



USER MANUAL

Gocator Snapshot Sensors

Gocator 3210 & 3506 Sensors

Firmware version: 5.1.x.xx

Document revision: F

Copyright

Copyright © 2018 by LMI Technologies, Inc. All rights reserved.

Proprietary

This document, submitted in confidence, contains proprietary information which shall not be reproduced or transferred to other documents or disclosed to others or used for manufacturing or any other purpose without prior written permission of LMI Technologies Inc.

No part of this publication may be copied, photocopied, reproduced, transmitted, transcribed, or reduced to any electronic medium or machine readable form without prior written consent of LMI Technologies, Inc.

Trademarks and Restrictions

Gocator™ is a registered trademark of LMI Technologies, Inc. Any other company or product names mentioned herein may be trademarks of their respective owners.

Information contained within this manual is subject to change.

Contact Information

LMI Technologies, Inc.
9200 Glenlyon Parkway
Burnaby BC V5J 5J8
Canada

Telephone: +1 604-636-1011
Fax: +1 604-516-8368

www.lmi3D.com

Table of Contents

Copyright	2
Table of Contents	3
Introduction	12
Gocator Overview	13
Safety and Maintenance	14
Electrical Safety	14
Handling, Cleaning, and Maintenance	14
Environment and Lighting	15
Getting Started	16
Hardware Overview	17
Gocator Sensor	17
Gocator 3x00 Cordsets	17
Master 100	18
Master 400 / 800 / 1200 / 2400	19
Master 810 / 2410	20
System Overview	22
Standalone System	22
Multi-Sensor System	22
Installation	24
Mounting	24
Grounding	25
Gocator	25
Recommended Practices for Cordsets	25
Master Network Controllers	26
Grounding When Using a DIN Rail (Master 810/2410)	26
Additional Grounding Schemes	27
Installing DIN Rail Clips: Master 810 or 2410	27
Configuring Master 810	29
Setting the Divider	29
Encoder Quadrature Frequency	30
Setting the Debounce Period	30
Network Setup	32
Client Setup	32
Gocator Setup	34
Running a Standalone Sensor System	34
Running a Multi-Sensor System	35
Next Steps	36
How Gocator Works	37
3D Acquisition	37

Clearance Distance, Field of View and Measurement Range	39
Stereo Correlation vs. Independent Triangulation	40
3D Data Output	41
Coordinate Systems	41
Sensor Coordinates	41
System Coordinates	42
Part and Section Coordinates	43
Switching between Coordinate Systems	43
Resampling	44
Data Generation and Processing	44
Part Detection	44
Sectioning	45
Part Matching	45
Measurement	45
Tool Chaining	46
Anchoring Measurements	46
Geometric Features	48
Tool Data	51
Output and Digital Tracking	55
Gocator Web Interface	57
Browser Compatibility	57
Internet Explorer 11 Issues	57
Internet Explorer Switches to Software Rendering	57
Internet Explorer Displays "Out of Memory"	57
User Interface Overview	58
Toolbar	60
Creating, Saving and Loading Jobs (Settings)	60
Recording, Playback, and Measurement Simulation	61
Recording Filtering	63
Downloading, Uploading, and Exporting Replay Data	65
Metrics Area	67
Data Viewer	68
Status Bar	68
Log	68
Frame Information	69
Quick Edit Mode	69
Interface Language	69
Management and Maintenance	71

Manage Page Overview	71
Sensor System	72
Sensor Autostart	72
Networking and Power	72
Motion and Alignment	73
Alignment Reference	74
Jobs	74
Security	76
Maintenance	77
Sensor Backups and Factory Reset	78
Firmware Upgrade	79
Support	80
Support Files	80
Manual Access	81
Software Development Kit	81
Scan Setup and Alignment	83
Scan Page Overview	83
Scan Modes	84
Triggers	86
Trigger Examples	87
Trigger Settings	87
Maximum Input Trigger Rate	88
Maximum Encoder Rate	89
Sensor	89
Reduce Occlusion	89
Active Area	90
Transformations	91
Exposure	92
Single Exposure	93
Multiple Exposure	96
Spacing	99
Spacing Interval	99
Advanced	99
Material	100
Camera Gain	101
Alignment	101
Alignment Types	102
Aligning Sensors	102
Clearing Alignment	103
Filters	104
Gap Filling	104
Median	105

Smoothing	105
Decimation	106
Part Detection	107
Edge Filtering	108
Data Viewer	110
Data Viewer Controls	110
Video Mode	111
Exposure Information	111
Exposures	111
Overexposure and Underexposure	112
Surface Mode	114
Height Map Color Scale	116
Sections	117
Region Definition	119
Intensity Output	119
Models	120
Model Page Overview	120
Part Matching	121
Using Edge Detection	122
Creating a Model	125
Modifying a Model's Edge Points	127
Adjusting Target Sensitivity	130
Setting the Match Acceptance Criteria	131
Running Part Matching	131
Using Bounding Box and Ellipse	131
Configuring a Bounding Box or an Ellipse	133
Running Part Matching	134
Using Part Matching to Accept or Reject a Part	135
Sections	135
Creating a Section	138
Deleting a Section	140
Measurement and Processing	141
Measure Page Overview	141
Data Viewer	142
Tools Panel	142
Adding and Configuring a Measurement Tool	142
Stream	143
Source	145
Regions	145
Feature Points	147
Geometric Features	149

Fit Lines	151
Decisions	151
Filters	152
Measurement Anchoring	154
Enabling and Disabling Measurements	159
Editing Tool, Input, or Output Names	160
Changing a Measurement ID	160
Duplicating a Tool	161
Removing a Tool	161
Reordering Tools	162
Profile Measurement	162
Advanced Height	162
Measurements, Data, and Settings	164
Master Comparison	165
X Correction	166
Reference Line	166
Anchoring	166
Area	167
Measurements, Features, and Settings	168
Bounding Box	171
Measurements, Features, and Settings	172
Circle	174
Measurements, Features, and Settings	174
Closed Area	177
Measurements and Settings	177
Dimension	181
Measurements and Settings	181
Groove	184
Measurements, Features, and Settings	185
Intersect	189
Measurements, Features, and Settings	189
Line	192
Measurements, Features, and Settings	193
Panel	196
Position	200
Measurements, Features, and Settings	200
Round Corner	202
Strip	206
Script	211
Surface Measurement	212
Bounding Box	213
Measurements, Features, and Settings	214

Countersunk Hole	217
Measurements, Features, and Settings	219
Dimension	226
Edge	230
Paths and Path Profiles	232
Measurements, Features, and Settings	233
Ellipse	244
Measurements, Features, and Settings	245
Extend	246
Data and Settings	248
Filter	249
Settings and Available Filters	250
Flatness	251
Measurements, Data, and Settings	253
Hole	258
Measurements, Features, and Settings	260
Measurement Region	262
Opening	264
Measurements, Features, and Settings	267
Measurement Region	271
Plane	272
Measurements, Features, and Settings	274
Position	276
Measurements, Features, and Settings	277
Segmentation	279
Measurements, Data, and Settings	280
Sphere	283
Measurements, Features, and Settings	284
Stitch	286
Measurements, Data, and Settings	287
Stud	289
Measurements, Features, and Settings	291
Measurement Region	292
Track	293
Key Concepts	295
Track Location	297
Peak Detection	298
Side Detection	298
Center Point Detection	299
Configuring the Track Tool	299
Measurements, Data, and Settings	300
Anchoring	304

Using the Track Editor	305	Remote Operation	360
Vibration Correction	308	Gocator Accelerator	362
Data and Settings	309	System Requirements and Recommendations ..	363
Volume	311	Benefits	363
Script	314	Installation	364
Feature Measurement	314	Gocator Accelerator Utility	364
Dimension	316	Dashboard and Health Indicators	366
Intersect	320	SDK Application Integration	367
Scripts	324	Gocator Device Files	368
Built-in Script Functions	324	Live Files	368
Output	330	Log File	368
Output Page Overview	330	Job File Structure	369
Ethernet Output	331	Job File Components	369
Digital Output	335	Accessing Files and Components	370
Analog Output	338	Configuration	370
Serial Output	340	Setup	371
Dashboard	343	Filters	372
Dashboard Page Overview	343	XSmoothing	372
State and Health Information	343	YSmoothing	373
Statistics	345	XGapFilling	373
Measurements	345	YGapFilling	373
Performance	345	XMedian	373
Gocator Emulator	347	YMedian	374
System Requirements	347	XDecimation	374
Limitations	348	YDecimation	374
Downloading a Support File from a Sensor	348	XSlope	374
Running the Emulator	349	YSlope	374
Adding a Scenario to the Emulator	350	Trigger	375
Running a Scenario	351	Layout	376
Removing a Scenario from the Emulator	351	Alignment	378
Using Replay Protection	352	Disk	378
Stopping and Restarting the Emulator	352	Bar	379
Running the Emulator in Default Browser	353	Plate	379
Working with Jobs and Data	353	Polygon	379
Creating, Saving, and Loading Jobs	353	Polygon/Corner	379
Playback and Measurement Simulation	354	Devices / Device	380
Downloading, Uploading, and Exporting		SurfaceGeneration	386
Replay Data	355	FixedLength	386
Downloading and Uploading Jobs	358	VariableLength	386
Scan, Model, and Measurement Settings	359	Rotational	386
Calculating Potential Maximum Frame Rate ..	360	SurfaceSections	387
Protocol Output	360	ProfileGeneration	387

FixedLength	388
VariableLength	388
Rotational	388
PartDetection	388
EdgeFiltering	390
PartMatching	390
Edge	390
BoundingBox	390
Ellipse	391
Replay	392
RecordingFiltering	392
Conditions/AnyMeasurement	392
Conditions/AnyData	393
Conditions/Measurement	393
Streams/Stream (Read-only)	393
ToolOptions	394
MeasurementOptions	395
FeatureOptions	395
StreamOptions	396
Tools	396
Profile Types	396
ProfileFeature	396
ProfileLine	397
ProfileRegion2d	397
Surface Types	397
Region3D	397
SurfaceFeature	397
SurfaceRegion2d	398
Geometric Feature Types	398
Parameter Types	398
ProfileArea	400
ProfileBoundingBox	402
ProfileCircle	404
ProfileDimension	405
ProfileGroove	407
ProfileIntersect	409
ProfileLine	411
ProfilePanel	413
ProfilePosition	416
ProfileRoundCorner	417
ProfileStrip	419
Script	421

SurfaceBoundingBox	422
SurfaceCsHole	424
SurfaceDimension	427
Tool (type SurfaceEdge)	429
SurfaceEllipse	432
SurfaceHole	434
SurfaceOpening	436
SurfacePlane	439
SurfacePosition	441
SurfaceStud	443
SurfaceVolume	445
Tool (type FeatureDimension)	447
Tool (type FeatureIntersect)	449
Custom	450
Output	451
Ethernet	451
Ascii	454
EIP	454
Modbus	454
Profinet	455
Digital0 and Digital1	455
Analog	456
Serial	456
Selcom	457
Ascii	457
Transform	458
Device	459
Part Models	459
Edge Points	460
Configuration	461
Protocols	462
Gocator Protocol	462
Data Types	463
Commands	463
Discovery Commands	464
Get Address	464
Set Address	465
Get Info	466
Control Commands	467
Protocol Version	468
Get Address	468
Set Address	469

Get System Info V2	469	Set Recording Enabled	490
Get System Info	471	Clear Replay Data	491
Get States	472	Get Playback Source	491
Log In/Out	473	Set Playback Source	491
Change Password	474	Simulate	492
Set Buddy	474	Seek Playback	492
List Files	475	Step Playback	493
Copy File	475	Playback Position	493
Read File	476	Clear Measurement Stats	494
Write File	476	Read Live Log	494
Delete File	477	Clear Log	495
User Storage Used	477	Simulate Unaligned	495
User Storage Free	478	Acquire	495
Get Default Job	478	Acquire Unaligned	496
Set Default Job	478	Create Model	496
Get Loaded Job	479	Detect Edges	496
Get Alignment Reference	479	Add Tool	497
Set Alignment Reference	480	Add Measurement	497
Clear Alignment	480	Read File (Progressive)	498
Get Timestamp	481	Export CSV (Progressive)	498
Get Encoder	481	Export Bitmap (Progressive)	499
Reset Encoder	481	Get Flag	500
Start	482	Set Flag	500
Scheduled Start	482	Get Runtime Variable Count	501
Stop	483	Set Runtime Variables	501
Get Auto Start Enabled	483	Get Runtime Variables	502
Set Auto Start Enabled	483	Upgrade Commands	502
Get Voltage Settings	484	Start Upgrade	502
Set Voltage Settings	484	Start Upgrade Extended	503
Get Quick Edit Enabled	484	Get Upgrade Status	503
Set Quick Edit Enabled	485	Get Upgrade Log	504
Start Alignment	485	Results	504
Start Exposure Auto-set	486	Data Results	504
Software Trigger	486	Stamp	505
Schedule Digital Output	487	Video	506
Schedule Analog Output	487	Uniform Surface	507
Ping	488	Surface Point Cloud	507
Reset	488	Surface Intensity	508
Backup	489	Surface Section	509
Restore	489	Surface Section Intensity	510
Restore Factory	489	Measurement	510
Get Recording Enabled	490	Alignment Result	511

Exposure Calibration Result	512
Edge Match Result	512
Bounding Box Match Result	512
Ellipse Match Result	513
Event	513
Feature Point	513
Feature Line	514
Feature Plane	514
Feature Circle	514
GenericMessage	515
Health Results	515
Modbus Protocol	521
Concepts	521
Messages	521
Registers	522
Control Registers	523
Output Registers	524
State	524
Stamp	525
Measurement Registers	526
EtherNet/IP Protocol	528
Explicit Messaging	528
Identity Object (Class 0x01)	529
TCP/IP Object (Class 0xF5)	529
Ethernet Link Object (Class 0xF6)	529
Assembly Object (Class 0x04)	530
Command Assembly	530
Runtime Variable Configuration Assembly	531
Sensor State Assembly	531
Sample State Assembly	533
Implicit Messaging	534
Assembly Object (Class 0x04)	534
Implicit Messaging Command Assembly	535
Implicit Messaging Output Assembly	536
PROFINET Protocol	538
Control Module	538
Runtime Variables Module	539
State Module	539
Stamp Module	540
Measurements Module	540
ASCII Protocol	541

Connection Settings	541
Ethernet Communication	541
Serial Communication	542
Polling Operation Commands (Ethernet Only)	542
Command and Reply Format	543
Special Characters	543
Command Channel	543
Start	544
Stop	544
Trigger	544
LoadJob	545
Stamp	545
Clear Alignment	546
Stationary Alignment	546
Set Runtime Variables	546
Get Runtime Variables	547
Data Channel	547
Result	547
Value	548
Decision	548
Health Channel	549
Health	549
Standard Result Format	550
Custom Result Format	550
Development Kits	552
GoSDK	552
Setup and Locations	553
Class Reference	553
Examples	553
Header Files	553
Functional Hierarchy of Classes	553
GoSystem	554
GoSensor	554
GoSetup	554
GoLayout	554
GoTools	555
GoTransform	555
GoOutput	555
Data Types	555
Value Types	555
Output Types	555
GoDataSet Type	556

Measurement Values and Decisions	557
Operation Workflow	557
Initialize GoSdk API Object	558
Discover Sensors	559
Connect Sensors	559
Configure Sensors	559
Enable Data Channels	559
Perform Operations	559
Limiting Flash Memory Write Operations	561
GDK	562
Benefits	562
Supported Sensors	562
Typical Workflow	563
Installation and Class Reference	563
Required Tools	563
Getting Started with the Example Code	563
Building the Sample Code	564
Tool Registration	564
Tool Definitions	565
Entry Functions	565
Parameter Configurations	566
Graphics Visualization	567
Debugging Your Tools	569
Debugging Entry Functions	570
Tips	570
Backward Compatibility with Older Versions of Tools	570
Define new parameters as optional	570
Configuration Versioning	570
Version	572
Common Programming Operations	572
Input Data Objects	572
Setup and Region Info during Tool Initialization	573
Computing Region Based on the Offset from an Anchor Source	573
Part Matching	573
Accessing Sensor Local Storage	573
Print Output	574
Tools and Native Drivers	575
Sensor Discovery Tool	575
GenTL Driver	576
16-bit RGB Image	580

16-bit Grey Scale Image	581
Registers	583
XML Settings File	584
Interfacing with Halcon	584
Setting Up Halcon	585
Halcon Procedures	588
Generating Halcon Acquisition Code	592
CSV Converter Tool	593
CSV File Format	595
Info	596
DeviceInfo	597
RecordingFilter	597
Ranges	598
Profile	599
RawProfile	600
Part	600
SurfacePointCloud	601
Surface Section	602
MountainsMap Transfer Tool	603
Configuring Gocator to Work with the Transfer Tool	603
Using the Mountains Map Transfer Tool	603
Universal Robots Integration	605
Mounting the Sensor	606
Connecting to the Sensor	606
Configuring the Gocator Sensor	607
Measurement Tool Settings	607
General Sensor Settings	609
Installing the Gocator URCap on the Robot	609
Performing the Hand-Eye Calibration	612
Using the Gocator URCap Program Nodes	617
Gocator Connect	617
Gocator Load Job	617
Gocator Scan	618
Fetch Measurements	618
Wait for Scan to Finish	618
Setting Variables	619
Measurement Types	620
Single Measurement	620
XYZRPY	620
Pose Matrix	620
XYZ	620

Acting on Retrieved Measurements	620
Troubleshooting	621
Specifications	622
Sensors	622
Gocator 3210 Sensor	623
Gocator 3210	625
Gocator 3500 Series	628
Gocator 3504	629
Gocator 3506	631
Estimated Scan Rates	633
Sensor Connectors	635
Gocator Power/LAN Connector	635
Grounding Shield	635
Power	636
Safety Input	636
Gocator I/O Connector	637
Grounding Shield	637
Digital Outputs	637
Inverting Outputs	638
Digital Input	638
Encoder Input	639
Serial Output	640
Analog Output	640
Master Network Controllers	641
Master 100	641
Master 100 Dimensions	642
Master 400/800	643
Master 400/800 Electrical Specifications ...	644
Master 400/800 Dimensions	645
Master 810/2410	646
Electrical Specifications	648
Encoder	649
Input	651
Master 810 Dimensions	653
Master 2410 Dimensions	654
Master 1200/2400	655
Master 1200/2400 Electrical Specifications .	656
Master 1200/2400 Dimensions	657
Accessories	658
Return Policy	660
Software Licenses	661
Support	666

Contact	667
----------------------	------------

Introduction

This documentation describes how to connect, configure, and use a Gocator. It also contains reference information on the device's protocols and job files, as well as an overview of the development kits you can use with Gocator. Finally, the documentation describes the Gocator emulator and accelerator applications.

The documentation applies to the following:

- Gocator 3210
- Gocator 3500 series

Notational Conventions

This documentation uses the following notational conventions:



Follow these safety guidelines to avoid potential injury or property damage.



Consider this information in order to make best use of the product.

Gocator Overview

Gocator snapshot LED projection sensors are designed for 3D measurement and control applications. Gocator sensors are configured using a web browser and can be connected to a variety of input and output devices. Gocator sensors can also be configured using the provided development kits.

Safety and Maintenance

The following sections describe the safe use and maintenance of Gocator sensors.

Electrical Safety



Failure to follow the guidelines described in this section may result in electrical shock or equipment damage.

Sensors should be connected to earth ground

All sensors should be connected to earth ground through their housing. All sensors should be mounted on an earth grounded frame using electrically conductive hardware to ensure the housing of the sensor is connected to earth ground. Use a multi-meter to check the continuity between the sensor connector and earth ground to ensure a proper connection.

Minimize voltage potential between system ground and sensor ground

Care should be taken to minimize the voltage potential between system ground (ground reference for I/O signals) and sensor ground. This voltage potential can be determined by measuring the voltage between Analog_out- and system ground. The maximum permissible voltage potential is 12 V but should be kept below 10 V to avoid damage to the serial and encoder connections.

For a description of the connector pins, see *Gocator I/O Connector* on page 637.

Use a suitable power supply

The +24 to +48 VDC power supply used with Gocator sensors should be an isolated supply with inrush current protection or be able to handle a high capacitive load.

Use care when handling powered devices

Wires connecting to the sensor should not be handled while the sensor is powered. Doing so may cause electrical shock to the user or damage to the equipment.

Handling, Cleaning, and Maintenance



Dirty or damaged sensor windows (emitter or camera) can affect accuracy. Use caution when handling the sensor or cleaning the sensor's windows.

Keep sensor windows clean

Use dry, clean air to remove dust or other dirt particles. If dirt remains, clean the windows carefully with a soft, lint-free cloth and non-streaking glass cleaner or isopropyl alcohol. Ensure that no residue is left on the windows after cleaning.

Avoid excessive modifications to files stored on the sensor

Settings for Gocator sensors are stored in flash memory inside the sensor. Flash memory has an expected lifetime of 100,000 writes. To maximize lifetime, avoid frequent or unnecessary file save

operations.

Environment and Lighting

Avoid strong ambient light sources

The imager used in this product is highly sensitive to ambient light hence stray light may have adverse effects on measurement. Do not operate this device near windows or lighting fixtures that could influence measurement. If the unit must be installed in an environment with high ambient light levels, a lighting shield or similar device may need to be installed to prevent light from affecting measurement.

Avoid installing sensors in hazardous environments

To ensure reliable operation and to prevent damage to Gocator sensors, avoid installing the sensor in locations

- that are humid, dusty, or poorly ventilated;
- with a high temperature, such as places exposed to direct sunlight;
- where there are flammable or corrosive gases;
- where the unit may be directly subjected to harsh vibration or impact;
- where water, oil, or chemicals may splash onto the unit;
- where static electricity is easily generated.

Ensure that ambient conditions are within specifications

Gocator sensors are suitable for operation between 0–50° C (0–40° C for Gocator 2500 sensors) and 25–85% relative humidity (non-condensing). The storage temperature is -30–70° C.

The Master network controllers are similarly rated for operation between 0–50° C.



The sensor must be heat-sunk through the frame it is mounted to. When a sensor is properly heat sunk, the difference between ambient temperature and the temperature reported in the sensor's health channel is less than 15° C.



Gocator sensors are high-accuracy devices, and the temperature of all of its components must therefore be in equilibrium. When the sensor is powered up, a warm-up time of at least one hour is required to reach a consistent spread of temperature in the sensor.


Getting Started

The following sections provide system and hardware overviews, in addition to installation and setup procedures.

Hardware Overview

The following sections describe Gocator and its associated hardware.

Gocator Sensor

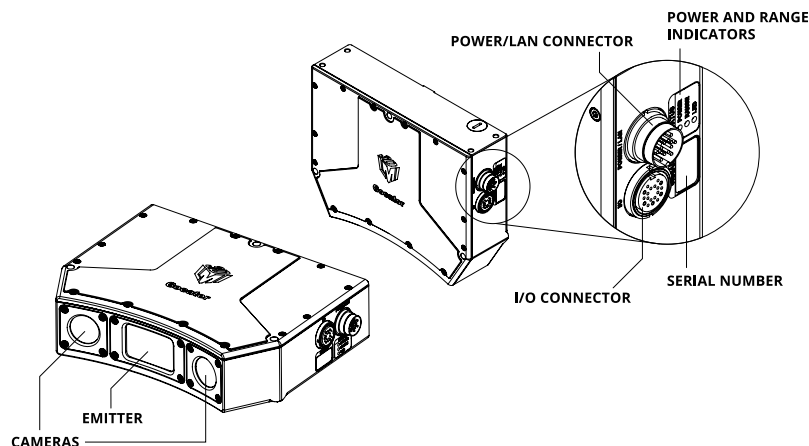

Gocator 3210

Item	Description
Camera	Observes light reflected from target surfaces.
Light Emitter	Emits structured light for 3D data acquisition.
I/O Connector	Accepts input/output signals.
Power/LAN Connector	Accepts power and connects to 1000 Mbit/s Ethernet network.
Power Indicator	Illuminates when power is applied (blue).
Range Indicator	Illuminates when the camera detects light that is within the sensor's measurement range (green).
LED Indicator	Illuminates when safety input is active (amber). Note that activating the safety input is <i>not</i> required to use Gocator snapshot sensors.
Serial Number	Unique sensor serial number.


Gocator 3x00 Cordsets

G3 sensors use two types of cordsets.

The Power & Ethernet cordset provides power and safety interlock to the sensor. It is also used for sensor communication via 1000 Mbit/s Ethernet with a standard RJ45 connector. The Master version of the Power & Ethernet cordset provides direct connection between the sensor and a [Master network controller](#) (excluding Master 100).

The G3 I/O cordset provides digital I/O connections, an encoder interface, RS-485 serial connection, and an analog output.


☐ If you use a Master 100 with a G3 sensor, you must use the latest version of the Master 100 with a metal-shielded Master Power Port and a Power & Ethernet cordset with a metal-shielded Power/Sync RJ45 plug.

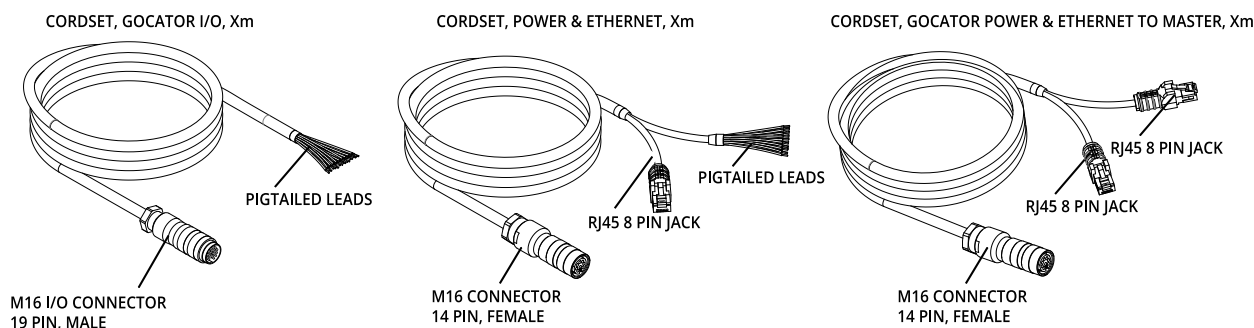

The maximum cordset length is 60 m. For pinout details, *Gocator I/O Connector* on page 637 and *Gocator Power/LAN Connector* on page 635.

See *Accessories* on page 658 for cordset lengths and part numbers. Contact LMI for information on creating cordsets with customized lengths and connector orientations.

Master 100

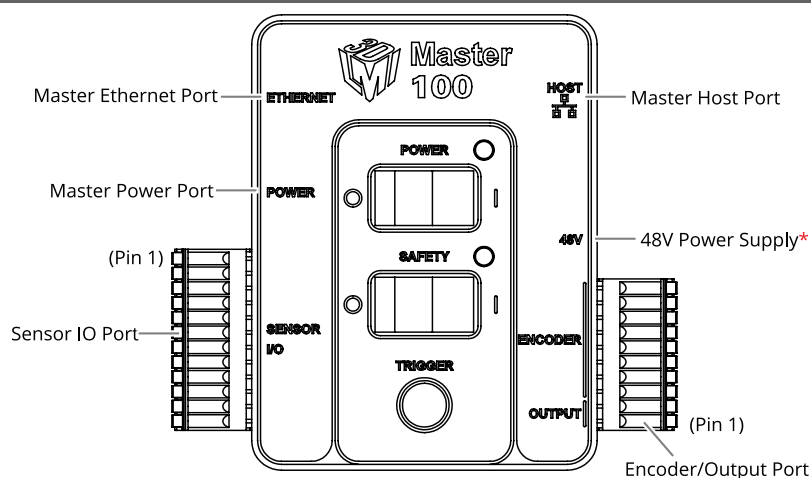


Item	Description
Master Ethernet Port	Connects to the RJ45 connector labeled Ethernet on the Power/LAN to Master cordset.
Master Power Port	Connects to the RJ45 connector labeled Power/Sync on the Power/LAN to Master cordset. Provides power to the Gocator.
Sensor I/O Port	Connects to the Gocator I/O cordset.
Master Host Port	Connects to the host PC's Ethernet port.
Power	Accepts power (+48 V).
Power Switch	Toggles sensor power.
Safety Switch	Toggles safety signal provided to the sensors [O= off, I= on]. Turning this switch on is <i>not</i> required with Gocator snapshot sensors.
Trigger	Signals a digital input trigger to the Gocator.
Encoder	Accepts encoder A, B and Z signals.
Digital Output	Provides digital output.


See *Master 100* on page 641 for pinout details.

Master 400 / 800 / 1200 / 2400

The Master 400, 800, 1200, and 2400 network controllers let you connect more than two sensors:

- Master 400: accepts four sensors
- Master 800 accepts eight sensors
- Master 1200: accepts twelve sensors
- Master 2400: accepts twenty-four sensors

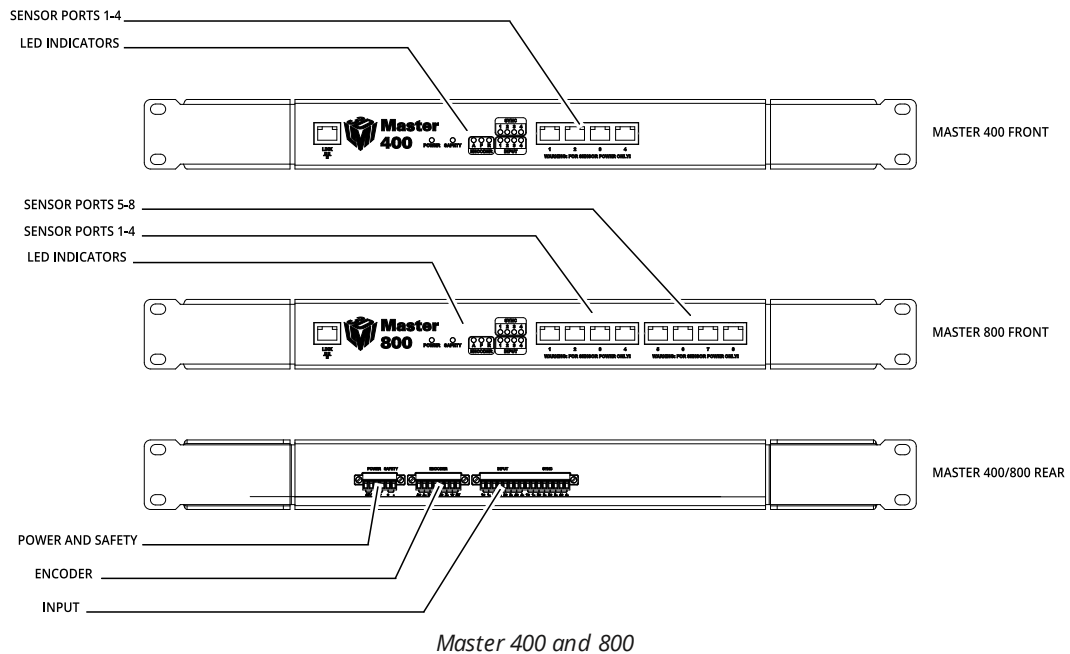

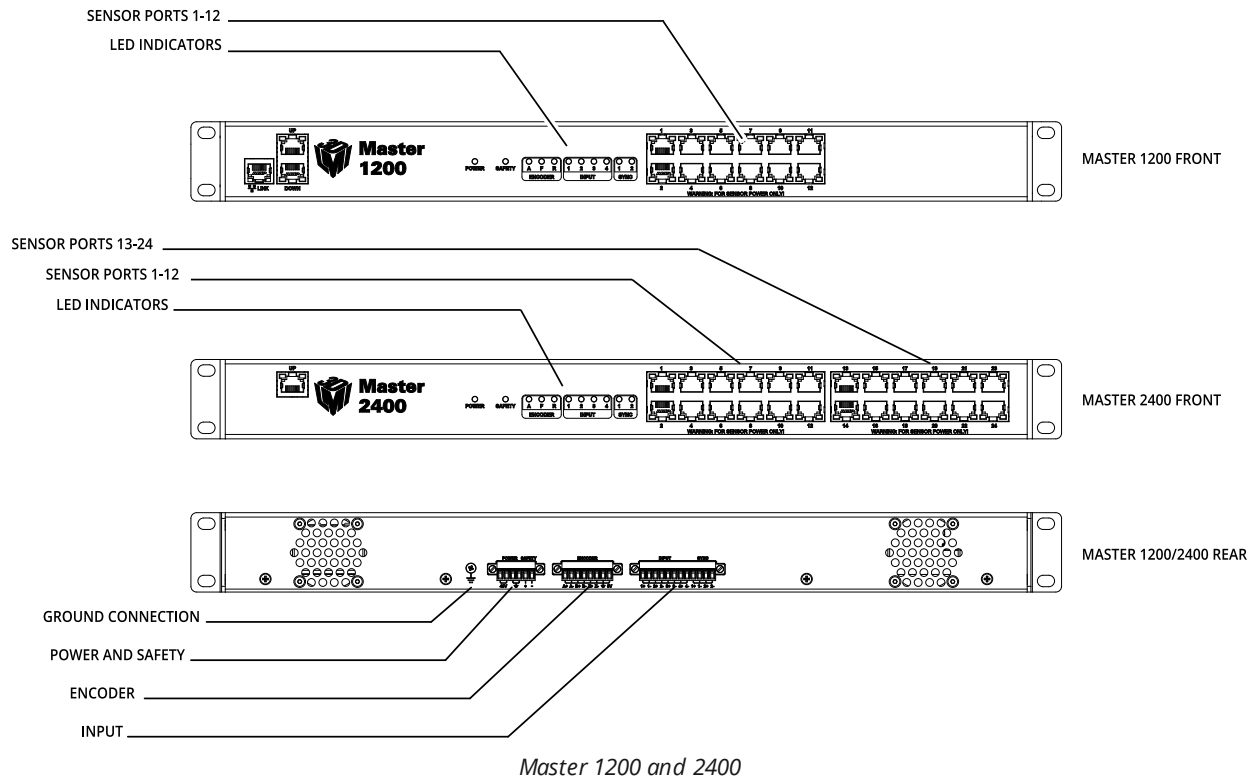

Item	Description
Sensor Ports	Master connection for Gocator sensors (no specific order required).
Ground Connection	Earth ground connection point.
Power and Safety	Power and safety connections. Safety input is <i>not</i> required with Gocator snapshot sensors.
Encoder	Accepts encoder signal.
Input	Accepts digital input.

For pinout details for Master 400 or 800, see *Master 400/800* on page 643.



For pinout details for Master 1200 or 2400, see *Master 1200/2400* on page 655.

Master 810 / 2410

The Master 810 and 2410 network controllers let you connect multiple sensors to create a multi-sensor system:

- Master 810 accepts up to eight sensors
- Master 2410 accepts up to twenty-four sensors

Both models let you divide the quadrature frequency of a connected encoder to make the frequency compatible with the Master, and also set the debounce period to accommodate faster encoders. For more information, see *Configuring Master 810* on page 29. (Earlier revisions of these models lack the DIP switches.)

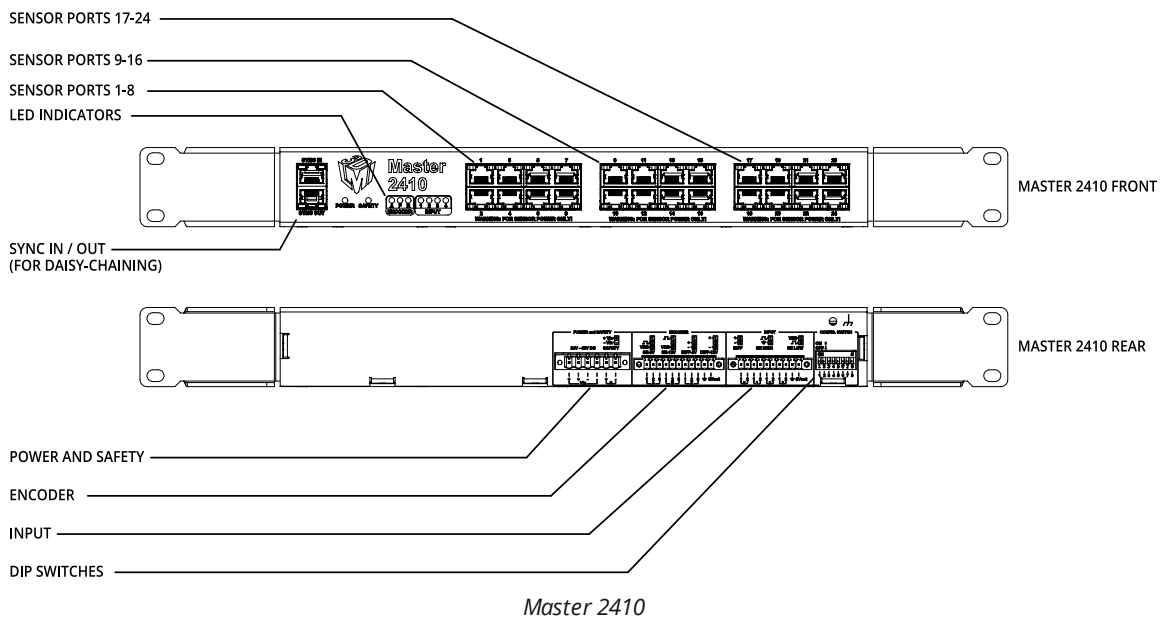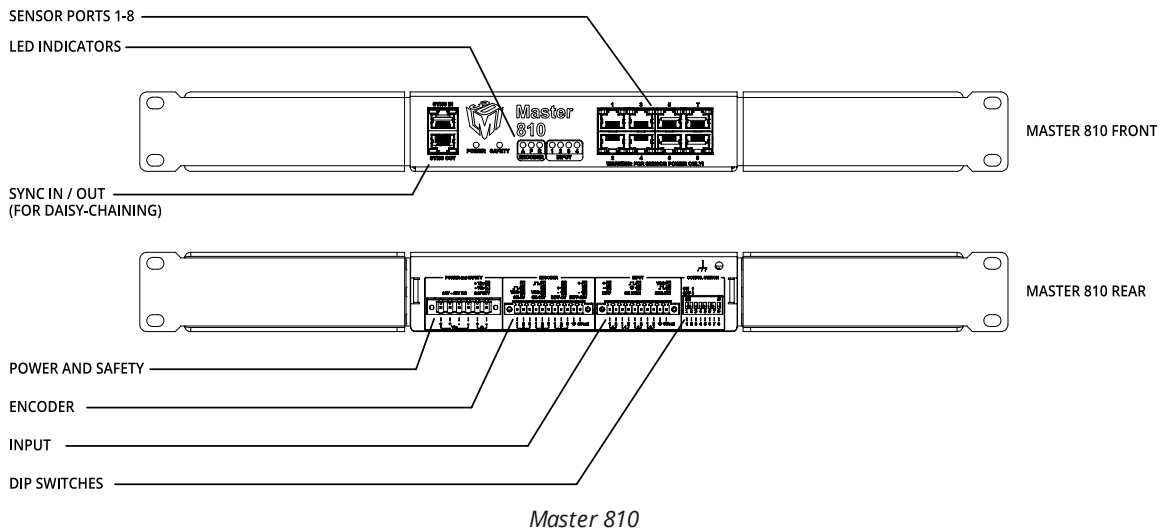

Item	Description
Sensor Ports	Master connection for Gocator sensors (no specific order required).
Power and Safety	Power and safety connections. Safety input is <i>not</i> required with Gocator snapshot sensors.
Encoder	Accepts encoder signal.
Input	Accepts digital input.
DIP Switches	Configures the Master (for example, allowing the device to work with faster encoders). For information on configuring Master 810 and 2410 using the DIP switches, see <i>Configuring Master 810</i> on page 29.


For pinout details, see *Master 810/2410* on page 646.

System Overview

Gocator sensors can be installed and used in scenarios where the target to be scanned is static in position relative to the sensor for the short duration of camera exposure. Sensors can be connected as standalone devices or in a multi-sensor system.


Standalone System

Standalone systems are typically used when only a single Gocator is required. The device can be connected to a computer's Ethernet port for setup and can also be connected to devices such as encoders, photocells, or PLCs.

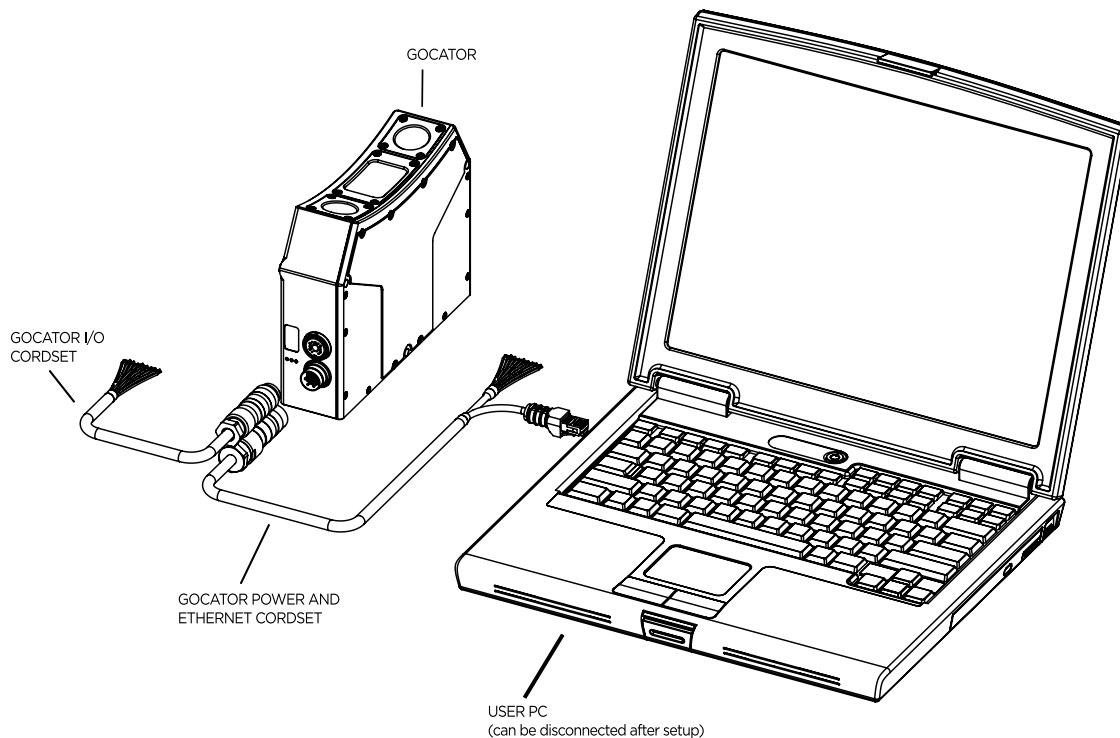

Multi-Sensor System

A [Master network controller](#) (excluding Master 100) can be used to connect two or more sensors into a multi-sensor system. Gocator Master cordsets are used to connect the sensors to a Master. The Master provides a single point of connection for power, safety, encoder, and digital inputs. A Master 400/800/810/1200/2400/2410 can be used to ensure that the scan timing is precisely synchronized across sensors. Sensors and client computers communicate via an Ethernet switch (1 Gigabit/s recommended).

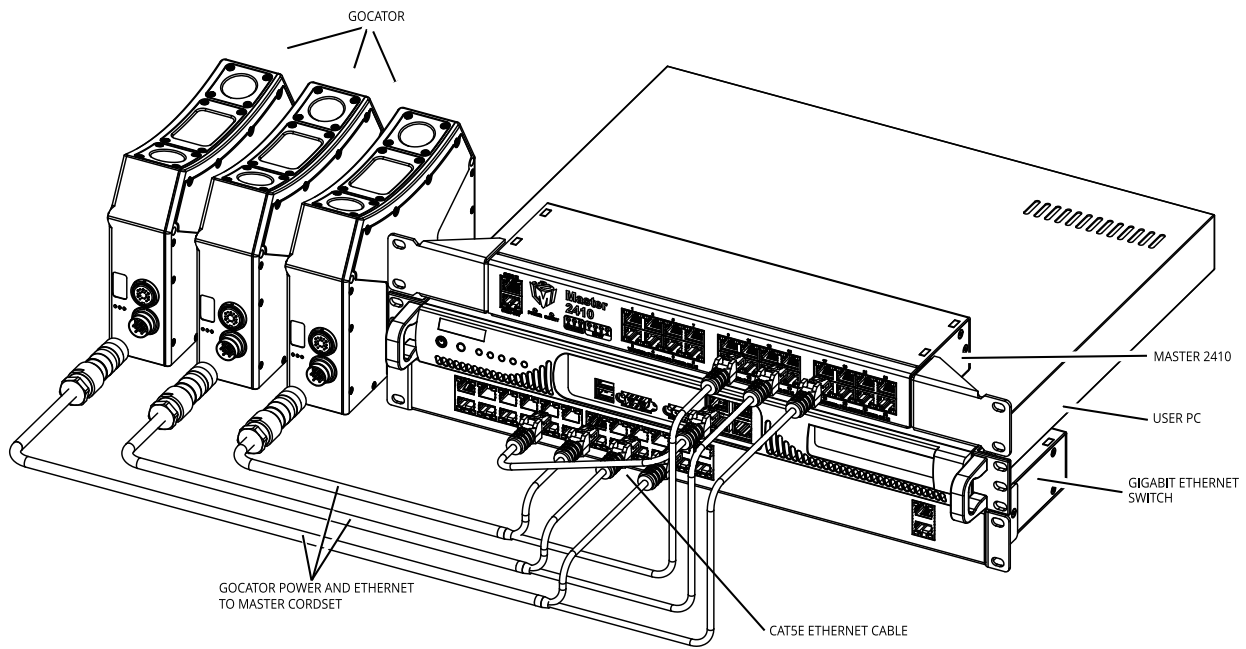

Installation


The following sections provide grounding, mounting, and orientation information.

Mounting


Sensors should be mounted using a model-dependent number of screws. Some models also provide the option to mount using bolts in through-body holes. Refer to the dimension drawings of the sensors in *Specifications* on page 622 for the appropriate screw diameter, pitch, and length, and bolt hole diameter.



Proper care should be taken in order to ensure that the internal threads are not damaged from cross-threading or improper insertion of screws.

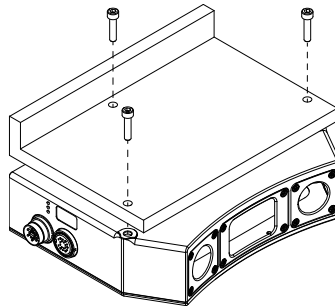

With the exception of Gocator 2880, sensors should not be installed near objects that might occlude a camera's view of the LED light pattern. (Gocator 2880 is specifically designed to compensate for occlusions.)

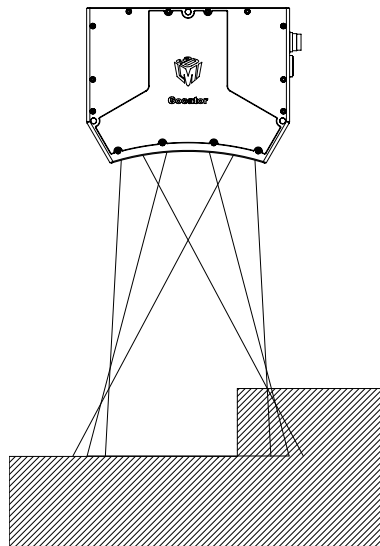

The sensor must be heat sunk through the frame it is mounted to. When a sensor is properly heat sunk, the difference between ambient temperature and the temperature reported in the sensor's health channel is less than 15° C.



Gocator sensors are high-accuracy devices. The temperature of all of its components must be in equilibrium. When the sensor is powered up, a warm-up time of at least one hour is required to reach a consistent spread of temperature within the sensor.

Grounding

Components of a Gocator system should be properly grounded.

Gocator

Gocators should be grounded to the earth/chassis through their housings and through the grounding shield of the Power I/O cordset. Gocator sensors have been designed to provide adequate grounding through the use of M5 x 0.8 pitch mounting screws. Always check grounding with a multi-meter to ensure electrical continuity between the mounting frame and the Gocator's connectors.




The frame or electrical cabinet that the Gocator is mounted to must be connected to earth ground.


Recommended Practices for Cordsets

If you need to minimize interference with other equipment, you can ground the Power & Ethernet or the Power & Ethernet to Master cordset (depending on which cordset you are using) by terminating the shield of the cordset before the split. The most effective grounding method is to use a 360-degree clamp.

CORDSET, POWER & ETHERNET, Xm

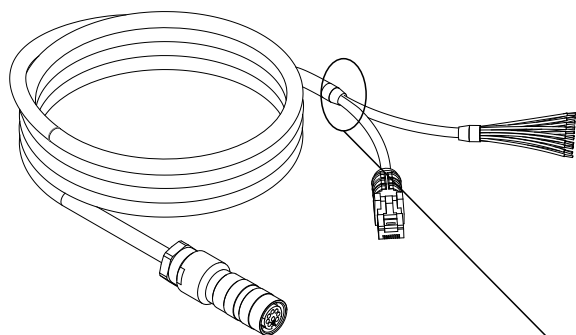

CORDSET, GOCATOR POWER & ETHERNET TO MASTER, Xm

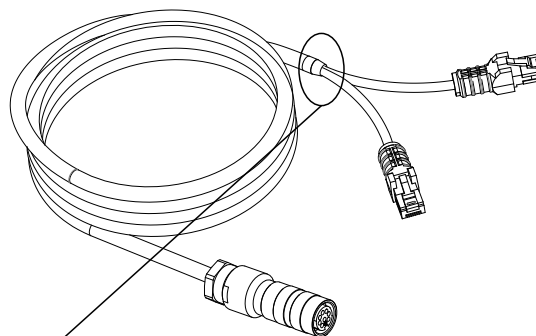

Attach the 360-degree clamp before the split

To terminate the cordset's shield:

1. Expose the cordset's braided shield by cutting the plastic jacket before the point where the cordset splits.
2. Install a 360-degree ground clamp.



Master Network Controllers

The rack mount brackets provided with all Masters are designed to provide adequate grounding through the use of star washers. Always check grounding with a multi-meter by ensuring electrical continuity between the mounting frame and RJ45 connectors on the front.



When using the rack mount brackets, you *must* connect the frame or electrical cabinet to which the Master is mounted to earth ground.



You *must* check electrical continuity between the mounting frame and RJ45 connectors on the front using a multi-meter.


If you are mounting Master 810 or 2410 using the provided DIN rail mount adapters, you must ground the Master directly; for more information, see *Grounding When Using a DIN Rail (Master 810/2410)* below.

Grounding When Using a DIN Rail (Master 810/2410)

If you are using DIN rail adapters instead of the rack mount brackets, you must ensure that the Master is properly grounded by connecting a ground cable to one of the holes indicated below. The holes accept M4x5 screws.



You can use any of the ground holes shown below. However, LMI recommends using the holes indicated on the housing by a ground symbol.

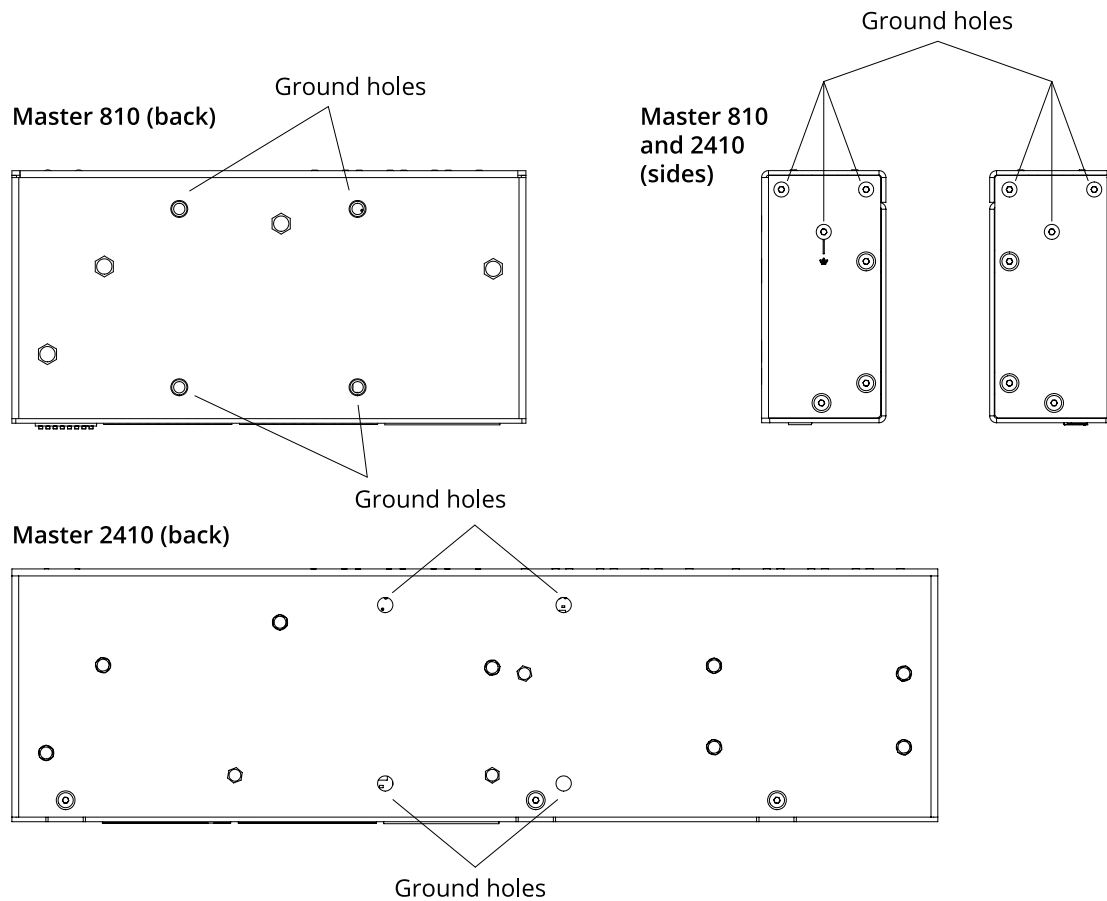

An additional ground hole is provided on the rear of Master 810 and 2410 network controllers, indicated by a ground symbol.

Additional Grounding Schemes

Potential differences and noise in a system caused by grounding issues can sometimes cause Gocator sensors to reset or otherwise behave erratically. If you experience such issues, see the *Gocator Grounding Guide* (<https://downloads.lmi3d.com/gocator-grounding-guide>) in the Download center for additional grounding schemes.

Installing DIN Rail Clips: Master 810 or 2410

You can mount the Master 810 and 2410 using the included DIN rail mounting clips with M4x8 flat socket cap screws. The following DIN rail clips ([DINM12-RC](#)) are included:




Older revisions of Master 810 and 2410 network controllers use a different configuration for the DIN rail clip holes.

To install the DIN rail clips:


1. Remove the 1U rack mount brackets.
2. Locate the DIN rail mounting holes on the back of the Master (see below).

Master 810:

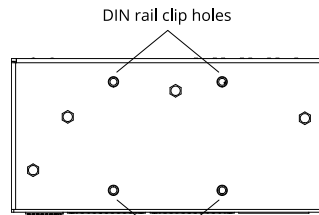

DIN rail clip holes


Current revision

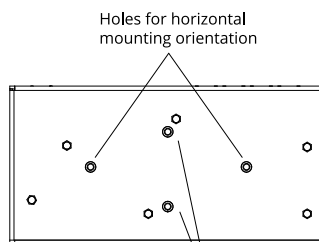

Holes for vertical mounting orientation


Older revision

Master 2410:

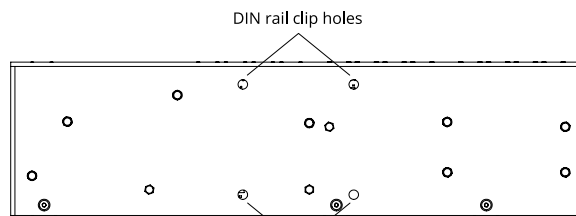

DIN rail clip holes

Current revision

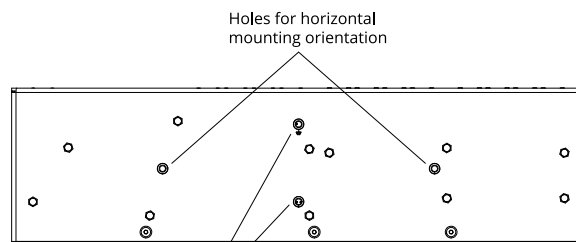


Holes for vertical mounting orientation

Older revision

3. Attach the two DIN rail mount clips to the back of the Master using two M4x8 flat socket cap screws for each one.

The following illustration shows the installation of clips on a Master 810 (current revision) for horizontal mounting:

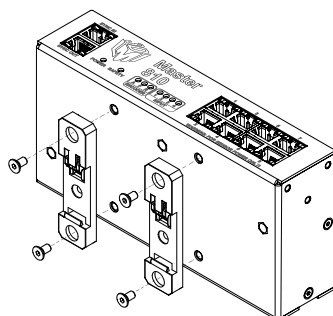


Ensure that there is enough clearance around the Master for cabling.

Configuring Master 810

If you are using Master 810 with an encoder that runs at a quadrature frequency higher than 300 kHz, you must use the device's divider DIP switches to limit the incoming frequency to 300 kHz.

Master 810 supports up to a maximum incoming encoder quadrature frequency of 6.5 MHz.

The DIP switches are located on the rear of the device.

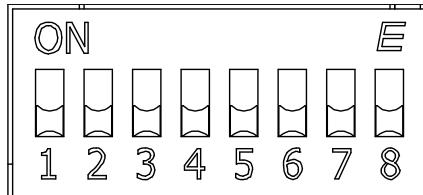

Switches 5 to 8 are reserved for future use.

This section describes how to set the DIP switches on Master 810 to do the following:

- Set the divider so that the quadrature frequency of the connected encoder is compatible with the Master.
- Set the debounce period to accommodate faster encoders.

Setting the Divider

To set the divider, you use switches 1 to 3. To determine which divider to use, use the following formula:

$$\text{Output Quadrature Frequency} = \text{Input Quadrature Frequency} / \text{Divider}$$

In the formula, use the *quadrature frequency* of the encoder (for more information, see *Encoder Quadrature Frequency* on the next page) and a divider from the following table so that the Output Quadrature Frequency is no more than 300 kHz.


Divider	Switch 1	Switch 2	Switch 3
1	OFF	OFF	OFF
2	ON	OFF	OFF
4	OFF	ON	OFF
8	ON	ON	OFF
16	OFF	OFF	ON
32	ON	OFF	ON
64	OFF	ON	ON
128	ON	ON	ON



The divider works on debounced encoder signals. For more information, see *Setting the Debounce Period* below.

Encoder Quadrature Frequency

Encoder quadrature frequency is defined as illustrated in the following diagram. It is the frequency of encoder ticks. This may also be referred as the native encoder rate.

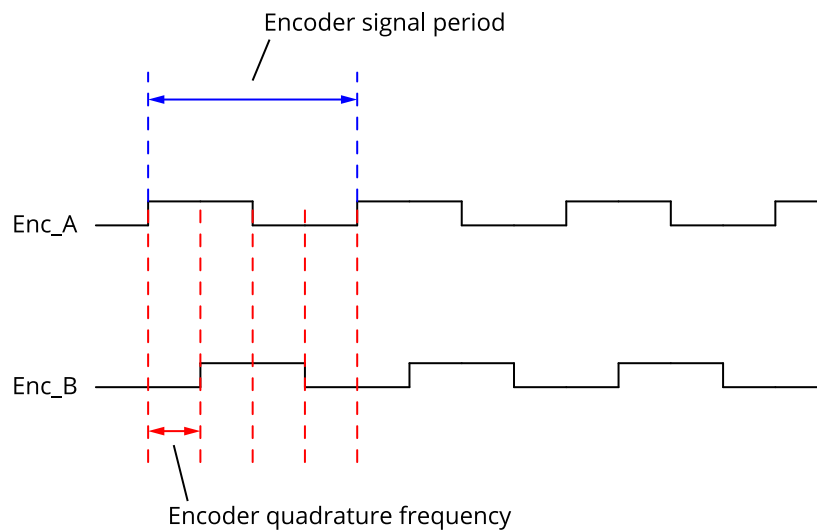

You must use a quadrature frequency when determining which divider to use (see *Setting the Divider* on the previous page). Consult the datasheet of the encoder you are using to determine its quadrature frequency.



Some encoders may be specified in terms of encoder signal frequency (or period). In this case, convert the signal frequency to quadrature frequency by multiplying the signal frequency by 4.

Setting the Debounce Period

If the quadrature frequency of the encoder you are using is greater than 3 MHz, you must set the debounce period to “short.” Otherwise, set the debounce period to “long.”

You use switch 4 to set the debounce period.

Debounce period	Switch 4
short debounce	ON
long debounce	OFF

Network Setup

The following sections provide procedures for client PC and Gocator network setup.



DHCP is not recommended for Gocator sensors. If you choose to use DHCP, the DHCP server should try to preserve IP addresses. Ideally, you should use static IP address assignment (by MAC address) to do this.

Client Setup


To connect to a sensor from a client PC, you must ensure the client's network card is properly configured.

Sensors are shipped with the following default network configuration:


Setting	Default
DHCP	Disabled
IP Address	192.168.1.10
Subnet Mask	255.255.255.0
Gateway	0.0.0.0

To connect to a sensor for the first time:

1. Connect cables and apply power.
Sensor cabling is illustrated in *System Overview* on page 22.

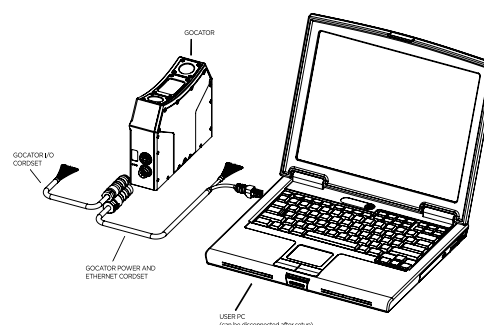


2. Change the client PC's network settings.
Windows 7
 - a. Open the Control Panel, select **Network and Sharing Center**, and then click **Change Adapter Settings**.
 - b. Right-click the network connection you want to modify, and then click **Properties**.
 - c. On the **Networking** tab, click **Internet Protocol Version 4 (TCP/IPv4)**, and then click **Properties**.
 - d. Select the **Use the following IP address** option.
 - e. Enter IP Address "192.168.1.5" and Subnet Mask

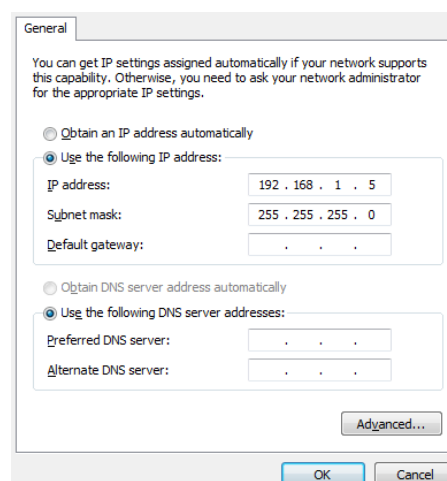

"255.255.255.0", then click **OK**.

Mac OS X v10.6

- a. Open the Network pane in **System Preferences** and select **Ethernet**.
- b. Set **Configure** to **Manually**.
- c. Enter IP Address "192.168.1.5" and Subnet Mask "255.255.255.0", then click **Apply**.

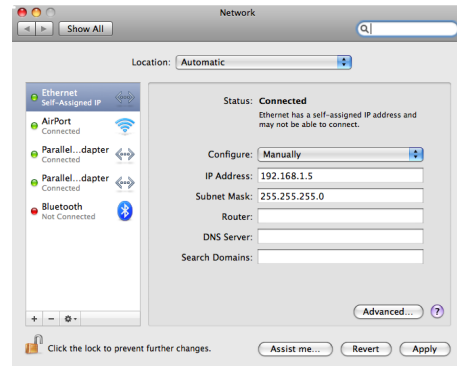

See *Troubleshooting* on page 621 if you experience any problems while attempting to establish a connection to the sensor.

Gocator Setup


The Gocator is shipped with a default configuration that will produce 3D data for most targets.

The following sections describe how to set up a standalone sensor system and a multi-sensor system for operations. After you have completed the setup, 3D data can be acquired to verify basic sensor operation.

Running a Standalone Sensor System

To configure a standalone sensor system:

1. Power up the sensor.
The power indicator (blue) should turn on immediately.

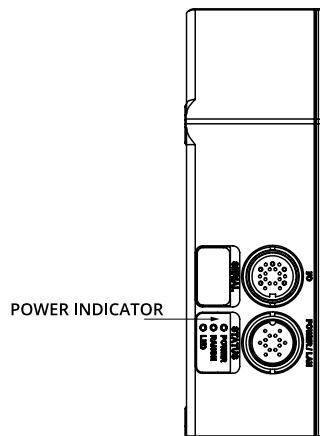


2. Enter the sensor's IP address (192.168.1.10) in a web browser.

The Gocator interface loads.


If a password has been set, you will be prompted to provide it and then log in.



 3. Go to the **Manage** page.




 4. Ensure that Replay mode is off (the slider is set to the left).



5. Go to the **Scan** page.
6. Observe the profile in the data viewer
7. Press the **Start** button or the **Snapshot** on the **Toolbar** to start the sensor.
The **Start** button is used to run sensors continuously.
The **Snapshot** button is used to trigger the capture of a single 3D point cloud.

8. Move a target into the LED light pattern.
If a target object is within the sensor's measurement range, the data viewer will display scan data, and the sensor's range indicator will illuminate.
If no scan data is displayed in the data viewer, see *Troubleshooting* on page 621.

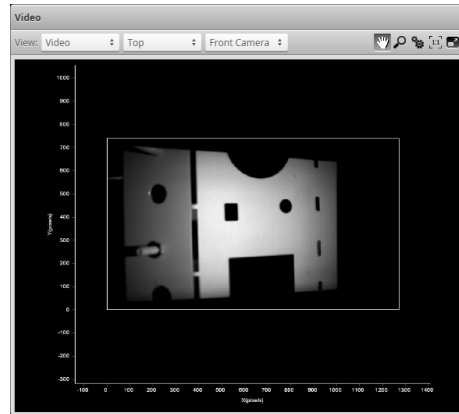

9. Press the **Stop** button.
The LED light projection should turn off.




Running a Multi-Sensor System


All sensors are shipped with a default IP address of 192.168.1.10. Ethernet networks require a unique IP address for each device, so you must set up a unique address for each sensor.

To configure a multi-sensor system:

1. Configure the first sensor in the system as described in *Running a Standalone Sensor System* on the previous page.
2. Unplug the Power/LAN connection of the configured sensor to power it down.

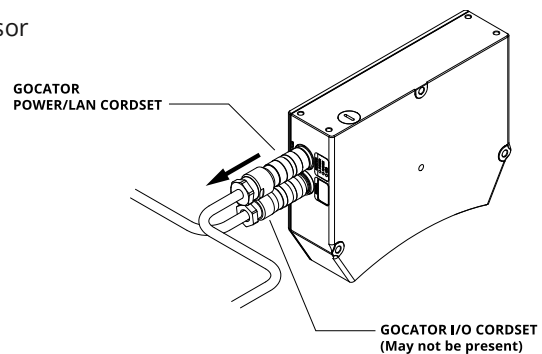

 
3. Connect the Power/LAN cordset to the new sensor.
The power LED (blue) of the new sensor should turn on immediately.
4. Enter the new sensor's default IP address (192.168.1.10) in a web browser.
The Gocator interface loads.
5. Go to the **Manage** page.



6. Modify the IP address in the **Networking** category and click the **Save** button.

You should increment the last octet of the IP address for each additional sensor you need to use. For example, if the IP address of the first sensor you configured is 192.168.1.10, use 192.168.1.11 for the second sensor; use 192.168.1.12 for the third; etc.

When you click the **Save** button, you will be prompted to confirm your selection.

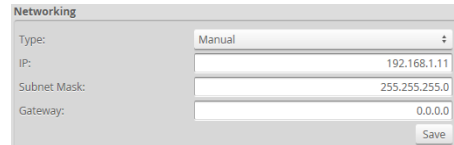

7. Power-cycle or reset the sensor.
After changing a sensor's network configuration, the sensor must be reset or power-cycled before the change will take effect.
8. Repeat steps 3 to 7 for each additional sensor.

Next Steps

After you complete the steps in this section, the Gocator measurement system is ready to be configured for an application using the software interface. The interface is explained in the following sections:

Management and Maintenance (page 71)

Contains settings for sensor system layout, network, motion and alignment, handling jobs, and sensor maintenance.

Scan Setup and Alignment (page 83)

Contains settings for scan mode, trigger source, detailed sensor configuration, and performing alignment.

Models (page 120)

Contains settings for creating part matching models and sections.

Measurement and Processing (page 141)

Contains built-in measurement tools and their settings.

Output (page 330)

Contains settings for configuring output protocols used to communicate measurements to external devices.

Dashboard (page 343)

Provides monitoring of measurement statistics and sensor health.

Toolbar (page 60)

Controls sensor operation, manages jobs, and replays recorded measurement data.

How Gocator Works

The following sections provide an overview of how Gocator acquires and produces data, detects and measures parts, and controls devices such as PLCs. Some of these concepts are important for understanding how you should mount sensors and configure settings such as active area.




You can use the Gocator Accelerator to speed up processing of data. For more information, see *Gocator Accelerator* on page 362.


3D Acquisition

After a Gocator system has been set up and is running, it is ready to start capturing 3D data.


Gocator 3x00 series sensors are 3D snapshot sensors, meaning they capture an entire surface in 3D in a single snapshot. These sensors project several structured light patterns in a rapid sequence onto the target. The reflection of the pattern off the target is captured by two cameras. The target must remain stationary during the camera exposure of the light patterns. The required exposure time depends on the shape, color, and reflectiveness of the target, but is often shorter than 1 second.

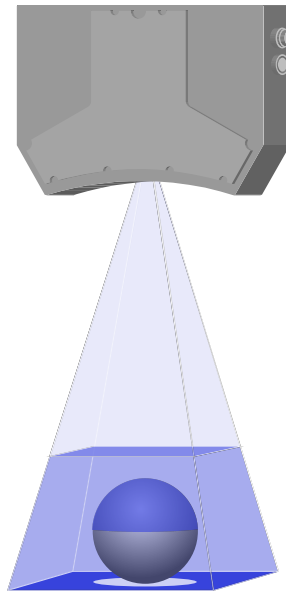


A Structured Light Modulator (SLM) produces a sequence of high resolution/high contrast light patterns using a blue LED. Two cameras capture the reflected light pattern from different viewing angles. The sensor can then use either stereo correlation or independent triangulation to generate 3D points from the light pattern.

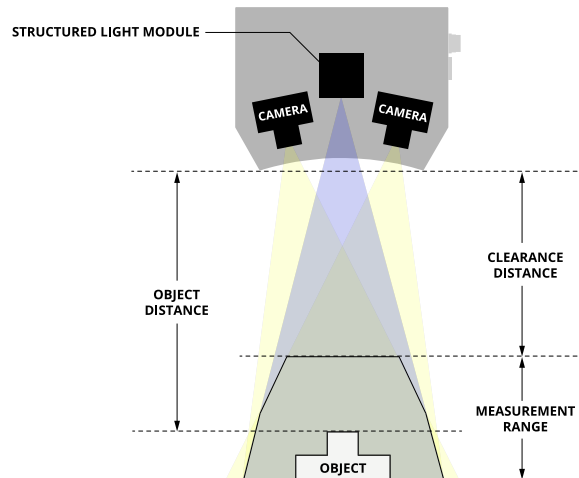


These are the steps of the acquisition of a 3D point cloud:

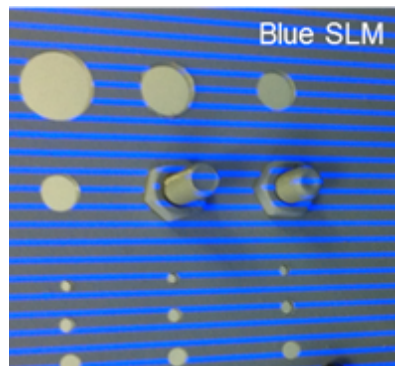

Step 1: Light pattern projected on target

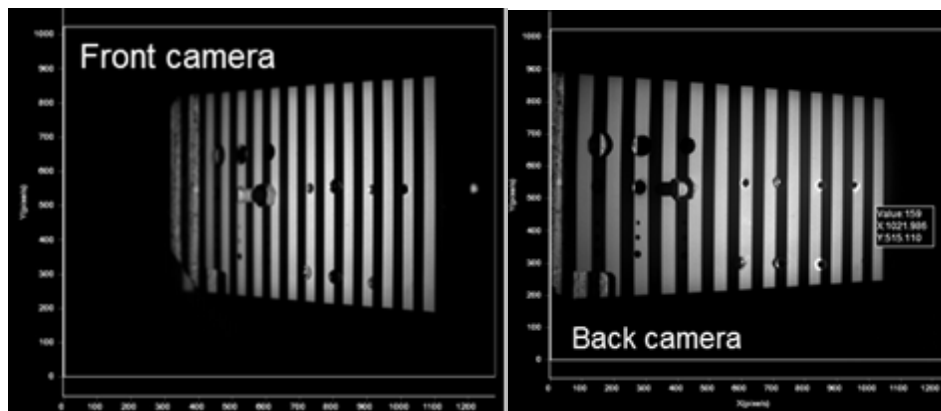

Step 2: Reflected light captured by two cameras

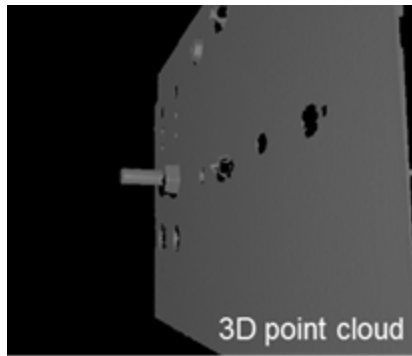

Step 3: Use stereo correlation or independent triangulation to generate 3D point cloud



Gocator sensors are always pre-calibrated to deliver 3D data in engineering units throughout their measurement range.


Clearance Distance, Field of View and Measurement Range

Clearance distance (CD), field of view (FOV), and measurement range (MR) are important concepts for understanding the setup of a Gocator sensor and for understanding results.

Clearance distance – The minimum distance from the sensor that a target can be scanned and measured. A target closer than this distance will result in invalid data.

Measurement range – The vertical distance, starting at the end of the clearance distance, in which targets can be scanned and measured. Targets beyond the measurement range will result in invalid data.

Field of view – The the area on the XY plane along the measurement range. At the far end of the measurement range, the field of view is larger, but the resolution is lower. At the near end, the field of view is smaller, but the resolution is higher. When resolution is critical, if possible, place the target closer to the near end.

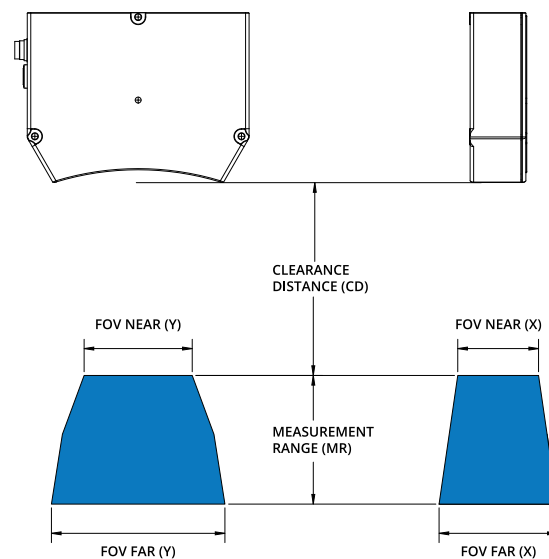

Gocator 3210: clearance distance, measurement range, and field of view

Stereo Correlation vs. Independent Triangulation

Stereo correlation means that the sensor locates the same point on the physical target in the two images captured at different viewing angles. Since the exact distance between the two cameras and the viewing angles are known, the distance to the point can be calculated. In order for stereo correlation to work and produce a 3D data point, the point on the target must be visible in both cameras. Stereo acquisition may produce more stable measurements on targets with a simple shape, but will be affected by occlusions on targets with complicated shapes and protruding features.

Independent triangulation means that each camera independently triangulates off the LED light pattern, based on the calibration process that takes place when the sensor is manufactured. Since the Gocator 3x00 sensor has two cameras, a point on the physical target only needs to be visible to one of the cameras in order to generate a 3D point. Independent triangulation may improve performance on targets with complicated shapes that can cause occlusion, but it relies on the sensor's internal components being fully stable.

The **Reduce Occlusion** setting determines whether 3D data is acquired by using stereo correlation or both stereo correlation and independent triangulation. See *Reduce Occlusion* on page 89 for more details.

3D Data Output

Gocator measures the shape of the object calculated from either dual triangulation or stereo correlation. The Gocator reports a series of 3D coordinates from the surface of the target in the sensor's field of view.


Coordinate Systems

Range data is reported in one of three coordinate systems, which generally depends on the alignment state of the sensor.

- **Sensor coordinates:** Used on unaligned sensors.
- **System coordinates:** Used on aligned sensors.
- **Part and section coordinates:** Data can optionally be reported using a coordinate system relative to the part itself.

These coordinate systems are described below.

Gocator 3x00 sensors use Cartesian left-hand notation for defining 3D coordinates.

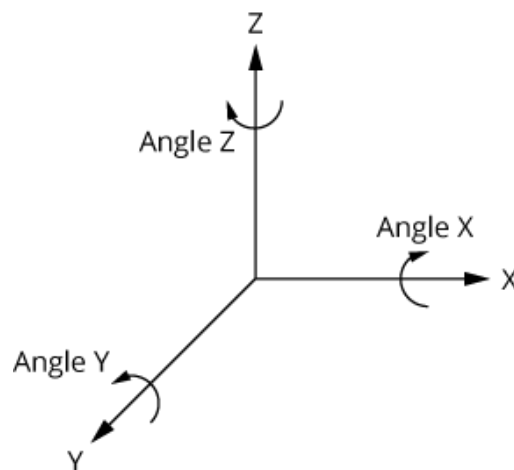

The Z axis represents the sensor's measurement range (MR), where the values increase toward the sensor. The X axis and Y axis represent the sensor's field of view (FOV).

X offset, Y offset, and Z offset define the translations from the origin.




 
Rotations are specified based on rotating the target around the X axis (Angle X), followed by rotating around the Y axis (Angle Y), followed by rotating around the Z axis.

3D point cloud data is reported in sensor coordinates or system coordinates depending on the alignment state of the sensor. These coordinate systems are described below.

Sensor Coordinates

Unaligned sensors use *sensor* coordinates: The measurement range (MR) is along the Z axis. Most importantly, the origin is at the *center* of the measurement range.

Before alignment, the origin of the sensor is at the center of the sensor's measurement range (MR) and field of view (FOV).

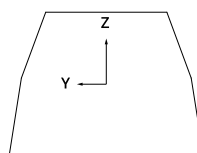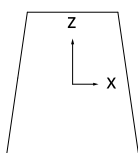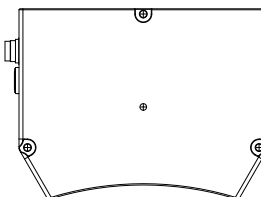

System Coordinates

Aligning sensors adjusts the coordinate system in relation to sensor coordinates, resulting in *system coordinates* (for more information on sensor coordinates, see *Sensor Coordinates* on the previous page). For more information on aligning sensors, see *Alignment* on page 101.

The adjustments resulting from alignment are called *transformations* (offsets along the axes and rotations around the axes). Transformations are displayed in the **Sensor** panel on the **Scan** page. For more information on transformations in the web interface, see *Transformations* on page 91.



Alignment is used with a single sensor to compensate for mounting misalignment and to set a zero reference, such as a conveyor belt surface.

Y angle is positive when rotating from positive X to positive Z axis.

X angle is positive when rotating from positive Y to positive Z. Z angle is positive when rotating from positive X to positive Y.

Alignment can be used to establish a transformed coordinate system according to the user's needs. Alignment determines the adjustments to X, Y, and Z, as well as rotation angle around each axis. Transformed coordinate systems can be associated with specific sensor jobs. For details, see *Alignment Types* on page 102.

Target	Alignment	Explanation
Flat surface	Z offset	System coordinates are aligned such that the system Z axis is perpendicular to the calibration plate surface. The system Z origin is set to the base of the calibration plate (using the Z Offset parameter).
	Angle X	
	Angle Y	
Plate (single reference hole)	X offset	The center of the hole defines the location of the X, Y and Z origins.
	Y offset	The orientation of the surface determines Angle X and Y.

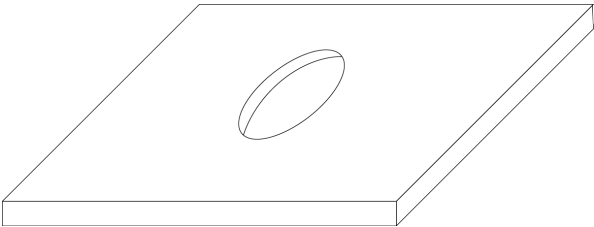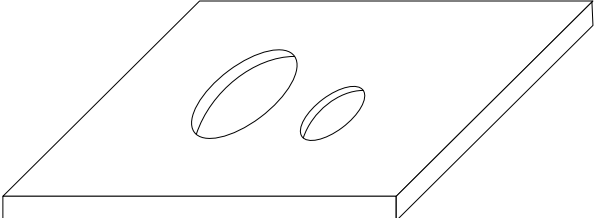Target	Alignment	Explanation
	Z offset Angle X Angle Y	
Plate (with two reference holes)	X offset Y offset Z offset Angle X Angle Y Angle Z	The sizes of the primary and the secondary holes must be different. The center of the primary hole defines the location of the X, Y, and Z origins. The orientation of the surface determines Angle X and Y. The direction of the primary and secondary holes determines Angle Z. 

When applying the transformations, the object is first rotated around X, then Y, and then Z, and then the offsets are applied.

Part and Section Coordinates

When you work with [parts](#) or [sections](#) extracted from scan data, a different coordinate system is available.

Part data can be expressed in aligned [system coordinates](#) or unaligned [sensor coordinates](#). But part data can also be represented in *part coordinates*: data and measurement results are in a coordinate system that places the X and Y origins at the center of the part. The Z origin is at the surface surrounding the alignment target (if the sensor or system has been aligned) or in the center of the center of the measurement range (if the sensor or system has not been aligned).



The **Frame of Reference** setting, in the **Part Detection** panel on the **Scan** page, controls whether part data is recorded using sensor/system coordinates or part coordinates.

Sections are *always* represented in a coordinate system similar to part coordinates: the X origin is always at the center of the extracted profile, and the Z origin is at the bottom of the alignment target (or in the center of the measurement range if the sensor is unaligned).

Switching between Coordinate Systems


In many situations, when working with part or section data that has been recorded with **Frame of Reference** set to **Part**, it is useful to have access to the "real-world" coordinates, rather than part- or section-relative coordinates. Gocator provides special "global" measurements, in the Bounding Box tools, that you can use in Gocator scripts to convert from part or section coordinates to sensor/system coordinates.

For more information, see the [Profile Bounding Box tool](#) or the [Surface Bounding Box tool](#), and the [Script tool](#).

Resampling

The internal acquisition engine in the sensor produces a random 3D point cloud, where each individual point is a coordinate triplet (X, Y, Z). When the sensor's **Uniform Spacing** setting is disabled, the sensor returns this point cloud. However, in this scenario, no built-in measurement tools are available for use with the data, so you must implement measurements yourself. (For more information on this setting, see *Scan Modes* on page 84.)

When the sensor's **Uniform Spacing** setting is enabled, the random 3D point cloud is resampled to an even grid in the XY plane. The resampling divides the XY plane into fixed-size square "bins." 3D points are projected along the Z axis, perpendicular to the XY plane, and points that fall into the same bin will be combined into a single Z value. The size of the resampling bins can be set with the **X/Y Spacing Interval** setting; for details, see *Spacing Interval* on page 99. The XY resampling plane is established through the Gocator's built-in alignment routine. That is, the resampling plane is set to match the plane described by the calibration plate; for more information, see *System Coordinates* on page 42.

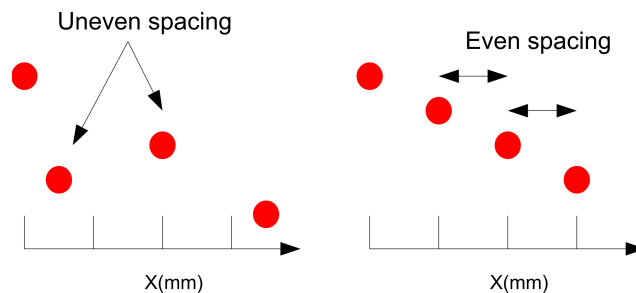

In the Ethernet data channel, only the Z values are reported, and the X and Y positions can be reconstructed through the 2D-array index at the receiving end (the client). Resampling reduces the complexity for the algorithms in the Gocator's built-in measurement tools, allowing them to run on the embedded processors. All built-in measurement tools in the Gocator operate on resampled data in Surface mode.

Data Generation and Processing

After scanning a target, Gocator can process the scan data to allow the use of more sophisticated measurement tools. This section describes the following concepts:

- Part detection
- Sectioning


Part Detection

Gocator can isolate discrete parts on a generated surface into separate scans representing parts. Gocator can then perform measurements on these isolated parts.

For more information on part detection, see *Part Detection* on page 107.

Sectioning

In Surface mode, Gocator can also extract a profile from a surface or part using a line you define on that surface or part. The resulting profile is called a “section.” A section can have any orientation on the surface, but its profile is parallel to the Z axis.

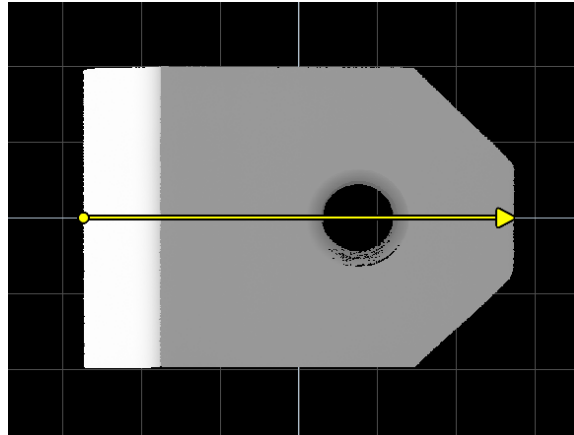

You can use most of Gocator's profile measurement tools on a section, letting you perform measurements that are not possible with surface measurement tools.

For more information on sections, see *Sections* on page 135.

Part Matching

Gocator can match scanned parts to the edges of a model based on a previously scanned part (see *Using Edge Detection* on page 122) or to the dimensions of a fitted bounding box or ellipse that encapsulate the model (see *Using Bounding Box and Ellipse* on page 131). When parts match, Gocator can rotate scans so that they are all oriented in the same way. This allows measurement tools to be applied consistently to parts, regardless of the orientation of the part you are trying to match.

Measurement

After Gocator scans a target and, optionally, [further processes](#) the data, the sensor is ready to take measurements on the scan data.

Gocator provides several measurement tools, each of which provides a set of individual measurements, giving you dozens of measurements ideal for a wide variety of applications to choose from. The configured measurements start returning pass/fail decisions, as well as the actual measured values, which are then sent over the enabled output channels to control devices such as PLCs, which can in turn control ejection or sorting mechanisms. (For more information on measurements and configuring measurements, see *Measurement and Processing* on page 141. For more information on output channels, see *Output and Digital Tracking* on page 55.)



You can create custom tools that run your own algorithms. For more information, see *GDK* on page 562.

A part's position can vary on a transport system. To compensate for this variation, Gocator can anchor a measurement to the positional measurement (X, Y, or Z) or Z angle of an easily detectable feature, such

as the edge of a part. The calculated offset between the two ensures that the anchored measurement will always be properly positioned on different parts.

Tool Chaining

Gocator's measurement and processing tools can be linked together: one tool uses another tool's output as input. This gives you a great deal of control and flexibility when it comes to implementing your application.

The following table lists the available outputs from Gocator's tools:

Gocator tool outputs


	Data Type	Supported Output Protocol	Visualization in Data Viewer	Input for Other Tools
Measurement	Single 64-bit value	SDK, PLC protocols	Rendered on tool's input data	Not supported as input, positional and Z angle measurements can be used by some tools for anchoring
Geometric Features	Structured data values: for example, point or line	Cannot be output via protocols	Rendered on tool's input data	Tools that accept the specific features
Tool Data	Binary data structure: Profile, Surface, or Generic	SDK	Rendered separately	Tools that accept the specific data type

The following sections describe these types of output and how you use them as input.

Anchoring Measurements


Tools can use the positional measurements (X, Y, or Z) of other tools as anchors to compensate for minor shifts of parts: anchored tools are "locked" to the positional measurements of the anchoring tool's measurements. Some tools can also use a Z Angle measurement as an anchor. Typically, you will use measurements from more easily found features on a target—such as an edge or a hole—as anchors to accurately place other positional and dimensional measurements. This can help improve repeatability and accuracy in the anchored tools. Note that anchoring measurements are used to calculate the offsets of the anchored tools: the results from these measurements are not used as part of the anchored tool's measurements.

Anchoring measurements are rendered as overlays on a tool's input data.

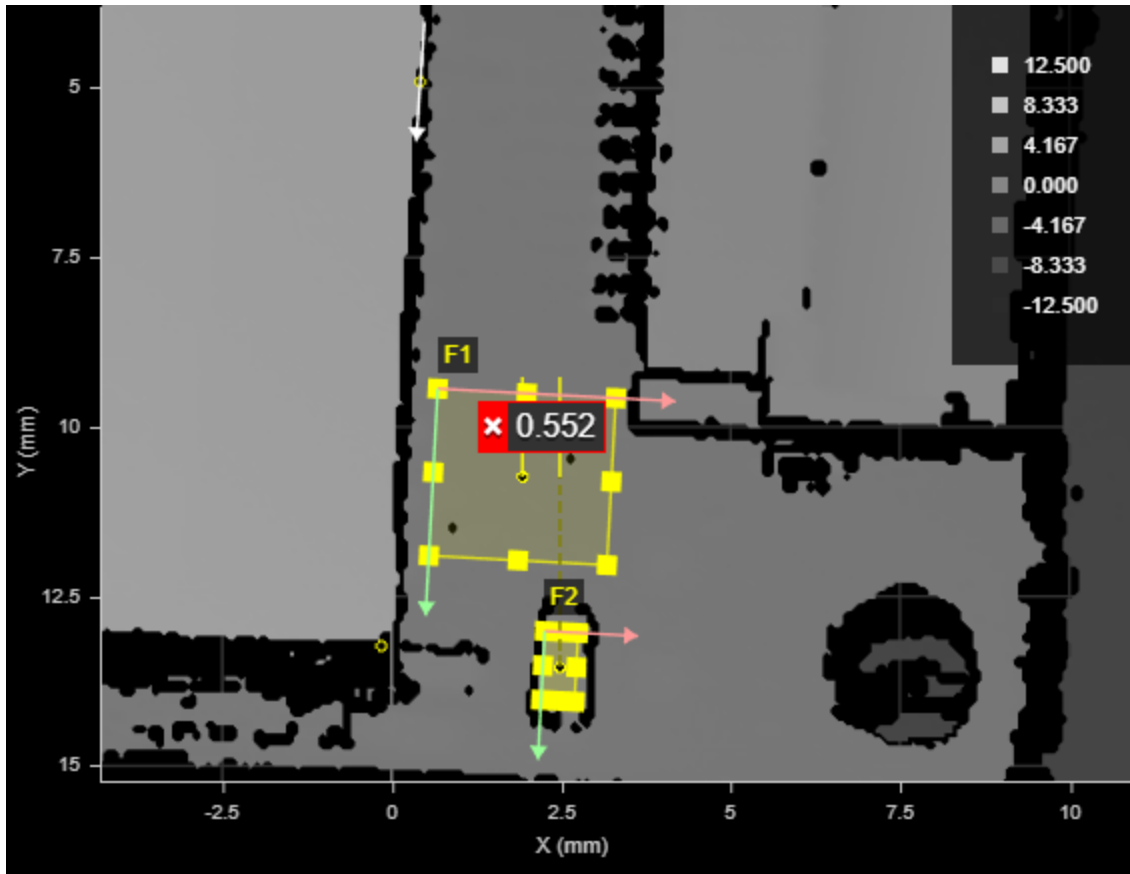

Height measurements rendered a tool's input: a small PCB component (F2) relative to nearby surface (F1), anchored to positional (X and Y) measurements of the hole (lower right) and to the Z angle of a larger component to the left (white arrow)

You enable anchoring on the **Anchoring** tab on the **Tools** panel:

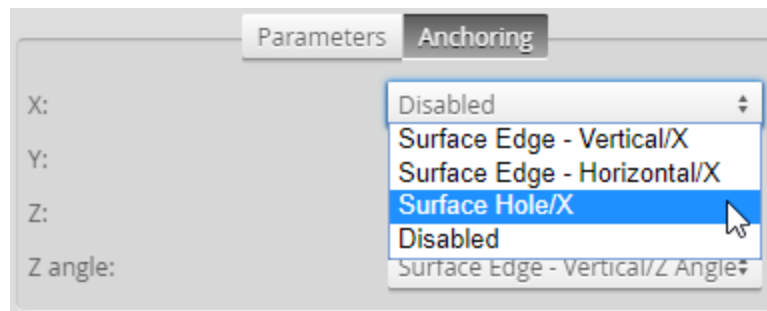


Note that anchoring is visualized on the *anchored* tool's input.

When combined with the matching and rotation capabilities of [part matching](#), anchoring accounts for most sources of variation in part position and orientation and, consequently, avoids many measurement errors. For more information on anchoring, see *Measurement Anchoring* on page 154.

Geometric Features

Many of Gocator's measurement tools can output data structures such as points, lines, planes, and circles. These structures are called geometric features and contain the components you would expect: a point geometric feature contains X, Y, and Z components (representing the location of the point in 3D space). Examples of point geometric features output by Gocator's measurement tools are hole center points, the tip and base of studs, or a position on a surface.

Geometric features are rendered as overlays on a tool's input data.

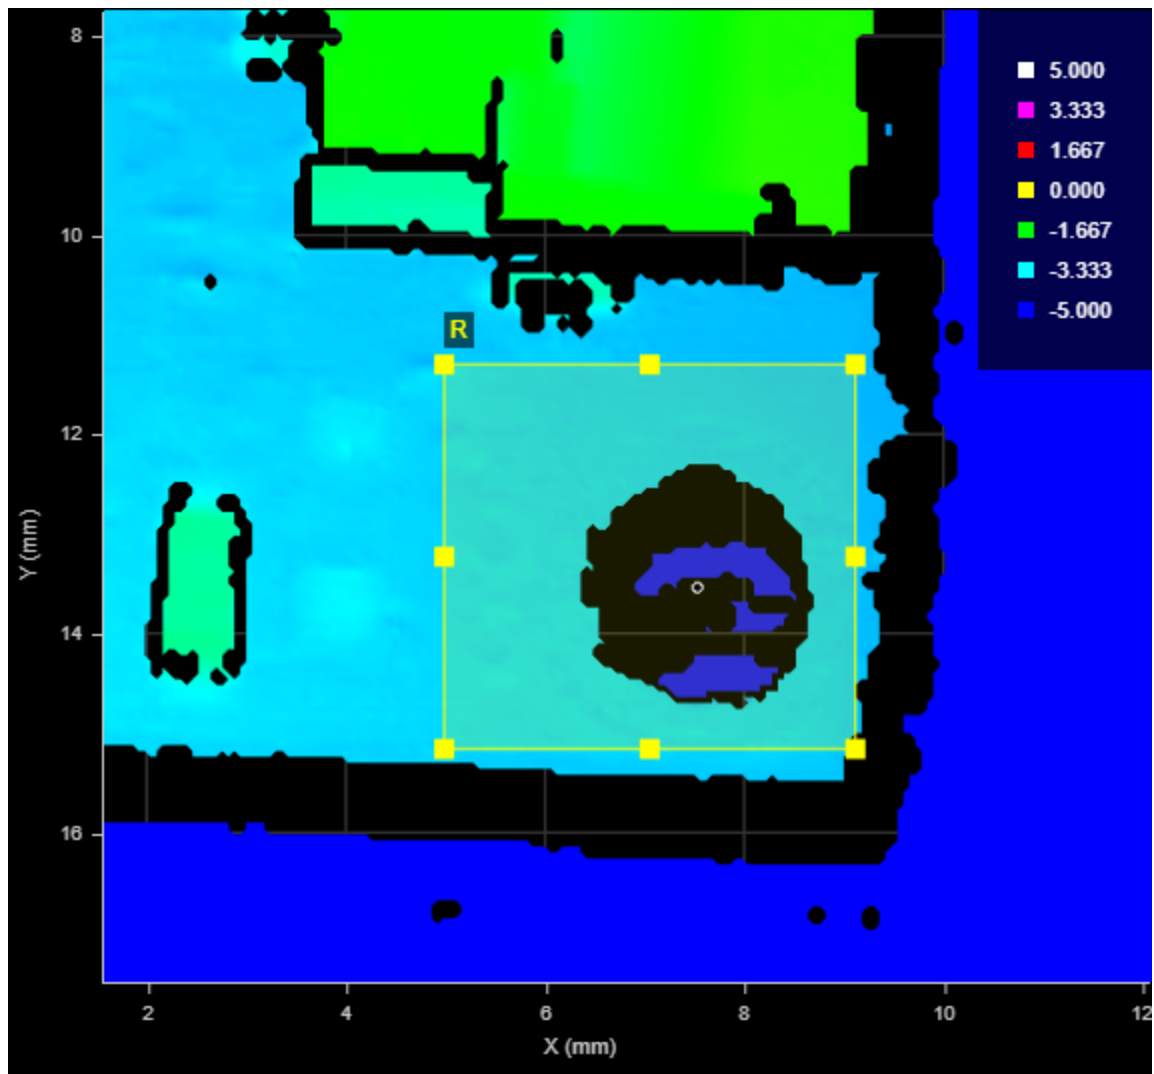

*Point geometric feature (a hole's Center Point) rendered
on a tool's input as a small white circle*

Gocator's "Feature" tools (Feature Dimension and Feature Intersect) use geometric features as inputs. For example, because the point geometric feature representing the center of a hole has X, Y, and Z components, you can perform dimensional measurements between it and another geometric feature, such as another hole or an edge. For more information on Feature tools, see *Feature Measurement* on page 314.

You enable geometric feature *output* on a tool's **Features** tab:

The screenshot shows the 'Surface Hole' tool configuration window. At the top is a blue header bar with the title 'Surface Hole' and navigation icons. Below the header is a large white rectangular area. The main configuration area has three tabs: 'Parameters' (selected), 'Advanced', and 'Anchoring'. Under the 'Parameters' tab, there are several settings: 'Source' is a dropdown menu set to 'Top'; 'Nominal Radius' is a text input field with '1.5 mm'; 'Radius Tolerance' is a text input field with '1 mm'; 'Partial Detection' is a small square checkbox that is unchecked; 'Depth Limit' is a text input field with '5 mm'; and 'Region' is a checkbox that is checked. To the right of the 'Region' checkbox are two icons: a circular arrow and a list icon. Below the 'Parameters' tab is a section with two sub-tabs: 'Measurements' and 'Features'. The 'Features' sub-tab is selected and contains a blue bar with the text 'Center Point' and a checked checkbox icon. At the bottom of the window, there is an 'ID' label and a text input field containing the number '3'.

Center Point geometric feature of a *Surface Hole* tool enabled on *Features* tab

You enable geometric feature *inputs* on a Feature tool's **Parameters** tab:

Surface Hole 1

Surface Hole 2

Feature Dimension

Parameters

Point

Surface Hole 1/Center Point

Reference Feature

Surface Hole 2/Center Point

Surface Hole 1/Center Point

Surface Hole 2/Center Point

Disabled

Measure

Width

Length

Height

Distance

Plane Distance

29.621

ID:

3

Output

Filters

Decision

Min:


0 mm

Max:

0 mm

*Setting the Point and Reference Feature to the Center Point
geometric features of two different holes*

Geometric features are distinct from the “feature points” used by certain tools to determine which data point in a region should be used in a measurement, for example, the maximum versus the minimum on the Z axis of a data point in a region of interest:

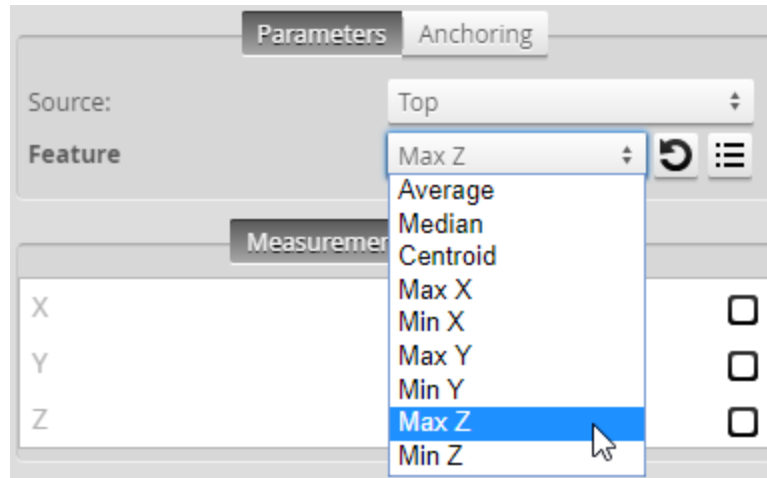


For more information on feature points, see *Feature Points* on page 147.

Tool Data


Some measurement and processing tools can output more complex data, which can be used as input by other tools or SDK applications. The following types of data are available: Profile, Surface, and Generic.

Profile and Surface tool data are identical in nature to the data produced by a sensor scan, except that they are the processed result from a tool. This kind of data can be used as input in compatible tools. Examples of this kind of data are the Stitched Surface output from the [Surface Stitch](#) tool, or the Corrected Surface output from the [Surface Vibration Correction](#) tool.


Both Profile and Surface tool data can be visualized in the data viewer, not as an overlay, however, but as independent data. The following is the output of the Surface Vibration Correction tool. Note that the first drop-down is set to Tool, to tell the sensor to display the tool data output, rather than the sensor output:

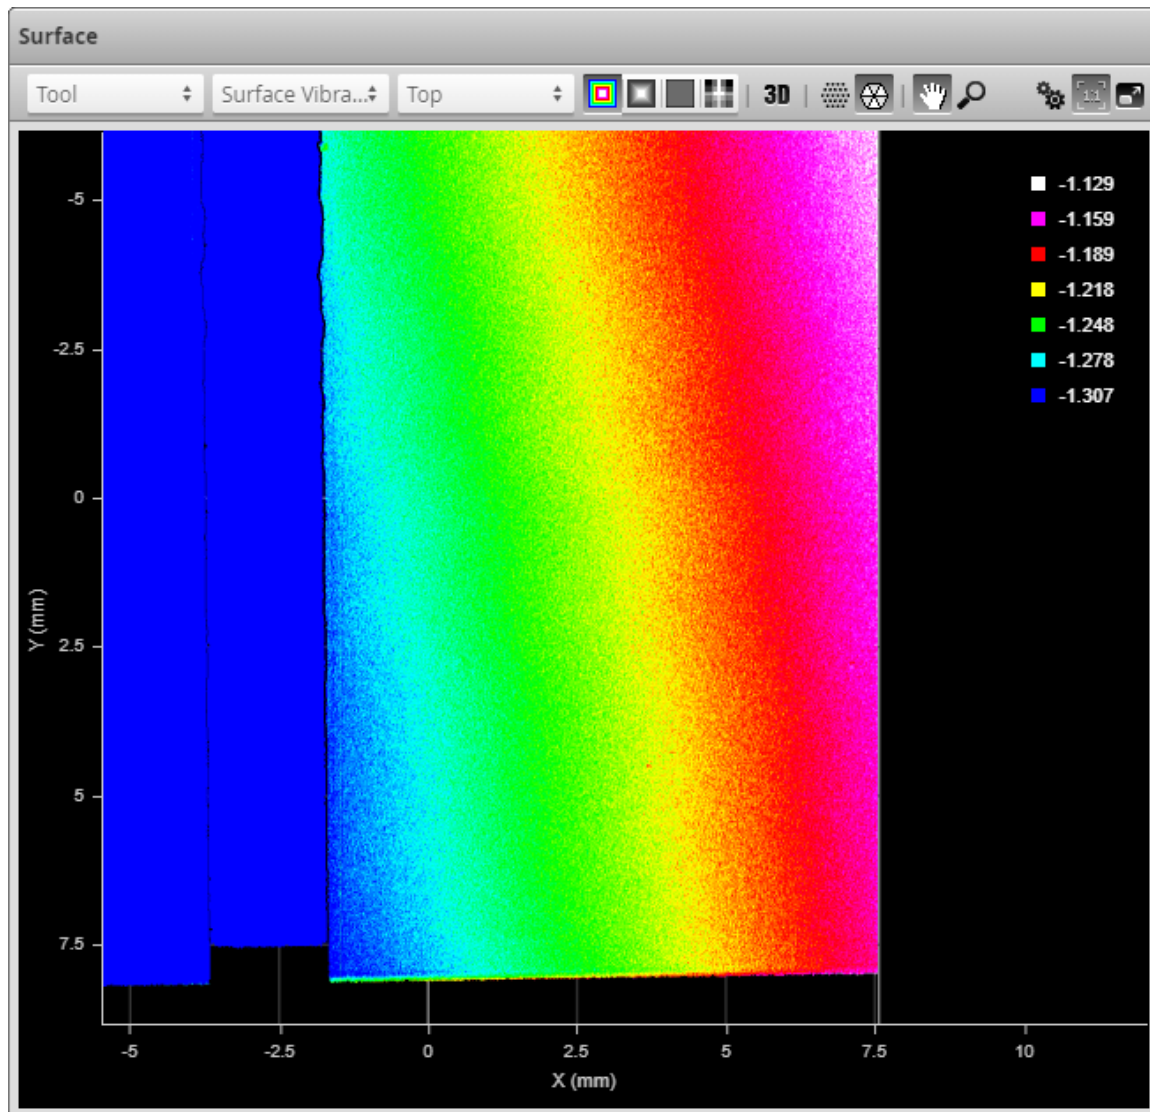

The following shows the scan data coming directly from the sensor's scan engine. Note that the first drop-down is set to **Surface**, rather than **Tool**.

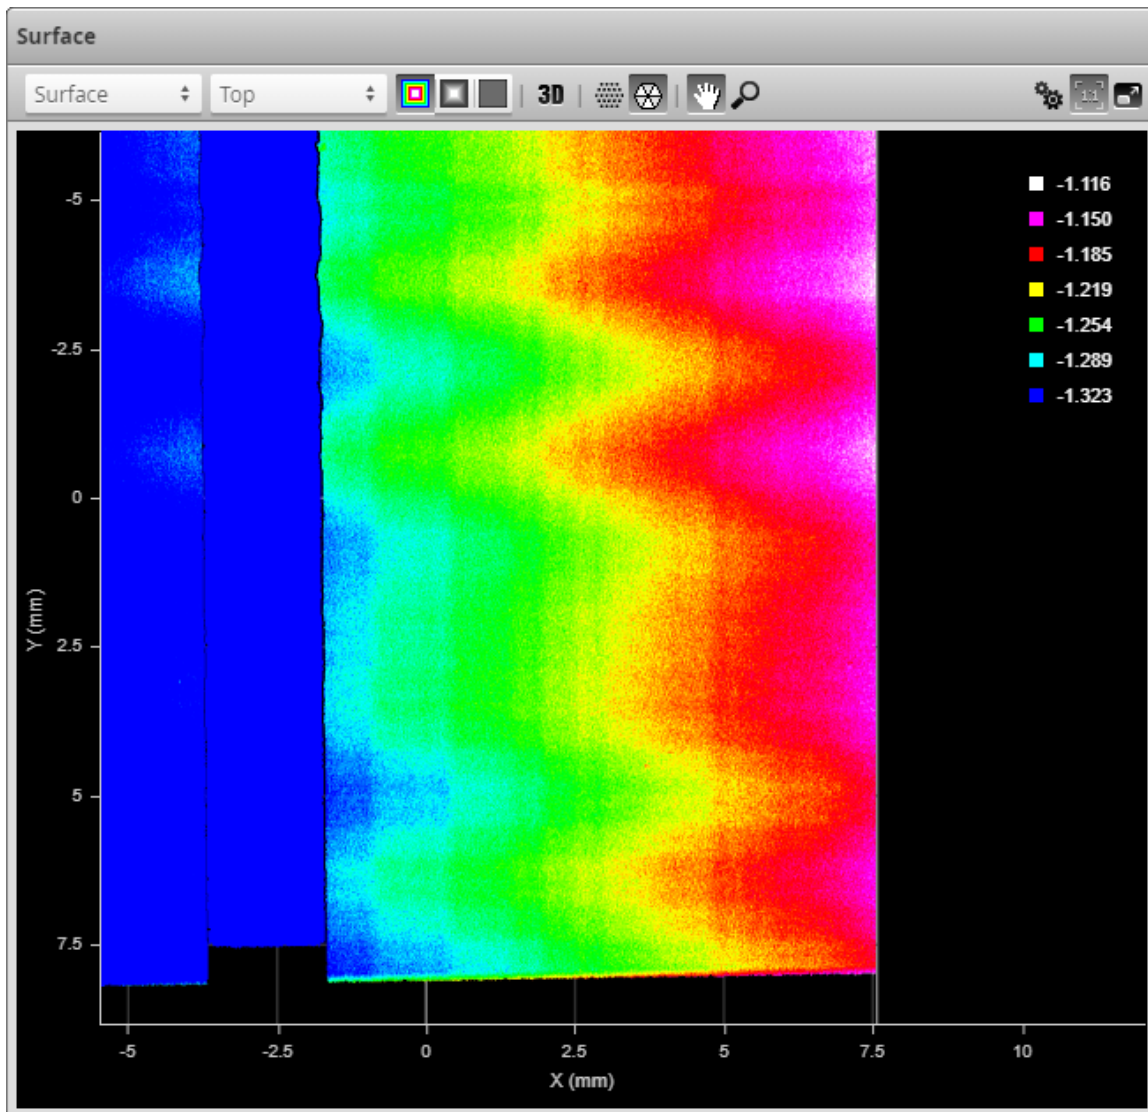


You enable this processed *output* in a tool's **Data** tab:

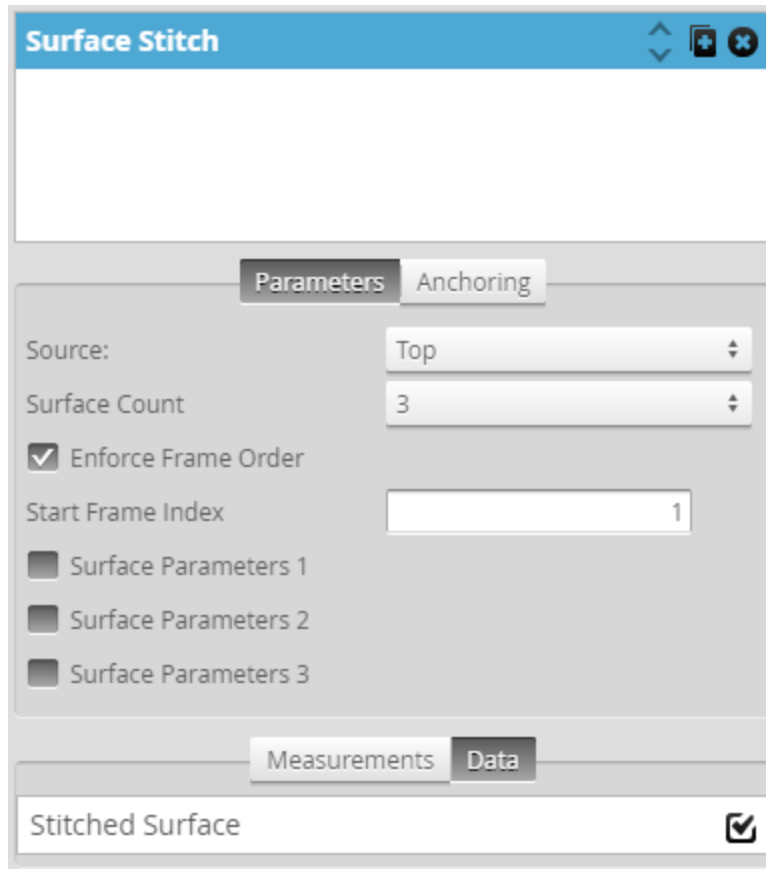

Stitched Surface tool enabled in Surface Stitch tool


You enable tool data *input* on a tool's **Parameters** tab, using the **Stream** drop-down:

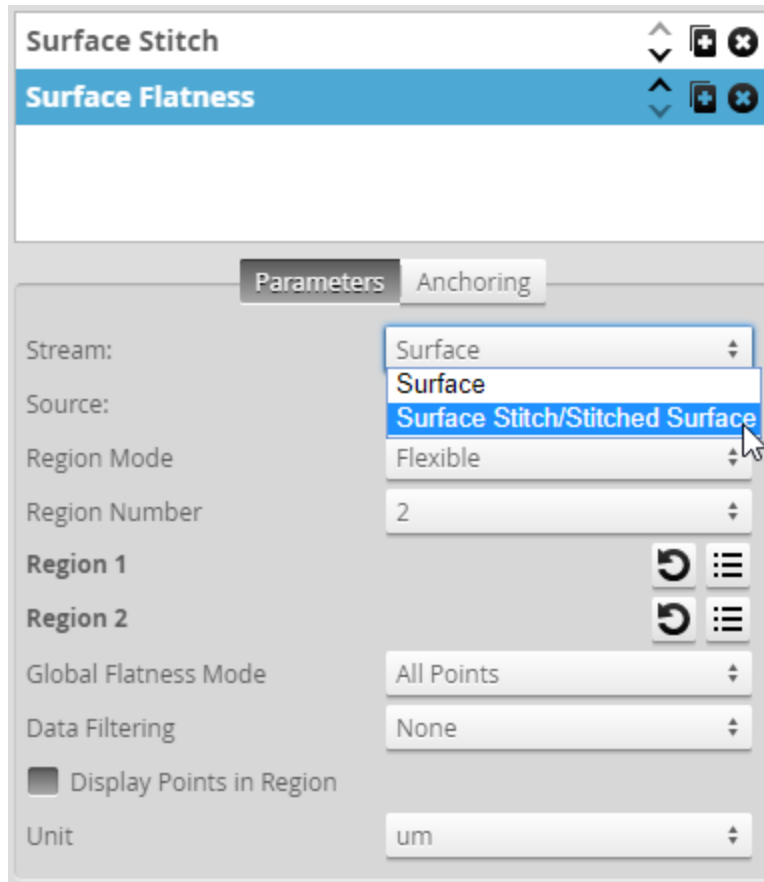

Setting a Surface Flatness tool's input to a Surface Stitch tool's data output

Generic tool data can't be visualized. It can however be accessed from GDK tools or SDK applications you create. Examples of Generic tool data are the Segments Array data produced by the Surface Segmentation tool, or the Output Measurement data produced by the Surface Flatness. For more information on the SDK, see *GoSDK* on page 552. Generic tool data is enabled in the same way as Profile and Surface tool data, from the tool's **Data** tab.

You may need to switch the first data viewer drop-down to "Tool" to view Profile or Surface tool data:

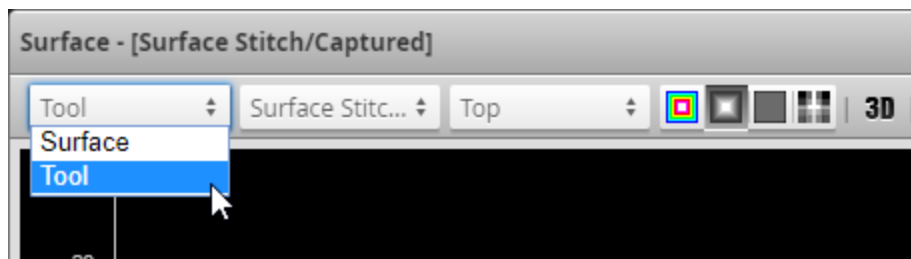

Output and Digital Tracking

After Gocator has scanned and measured parts, the last step in the operation flow is to output the results and/or measurements.

One of the main functions of Gocator sensors is to produce pass/fail decisions, and then control something based on that decision. Typically, this involves rejecting a part through an eject gate, but it can also involve making decisions on good, but different, parts. This is described as “output” in Gocator. Gocator supports the following output types:

- Ethernet (which provides industry-standard protocols such as Modbus, EtherNet/IP, and ASCII, in addition to the Gocator protocol)
- Digital
- Analog
- Serial interfaces

An important concept is digital output tracking. Production lines can place an ejection or sorting mechanism at different distances from where the sensor scans the target. For this reason, Gocator lets you schedule a delayed decision over the digital interfaces. Because the conveyor system on a typical production line will use an encoder or have a known, constant speed, targets can effectively be “tracked” or “tagged.” Gocator will know when a defective part has traveled far enough and trigger a PLC to activate an ejection/sorting mechanism at the correct moment. For more information on digital output tracking, see *Digital Output* on page 335.

Gocator Web Interface

The following sections describe the Gocator web interface.

Browser Compatibility

LMI recommends Chrome, Firefox, or Edge for use with the Gocator web interface.

Internet Explorer 11 is supported with limitations; for more information, see below.

Internet Explorer 11 Issues

If you use Gocator with large datasets on Internet Explorer 11, you may encounter the following issues.

Internet Explorer Switches to Software Rendering

If the PC connected to a Gocator sensor is busy, Internet Explorer may switch to software rendering after a specific amount of time. If this occurs, data is not displayed in the data viewer, and the only reliable way to recover from the situation is to restart the browser.


It is possible to remove the time limit that causes this issue, but you must modify the computer's registry. To do so, follow Microsoft's instructions at <https://support.microsoft.com/en-us/help/3099259/update-to-add-a-setting-to-disable-500-msec-time-limit-for-webgl-frame>.

Internet Explorer Displays "Out of Memory"


In some situations, you may encounter "Out of Memory" errors in the Gocator web interface. This issue can be resolved by checking two options in Internet Explorer.

To correct out of memory issues in Internet Explorer 11:


1. In upper right corner, click the settings icon (⚙️), and choose **Internet options**.

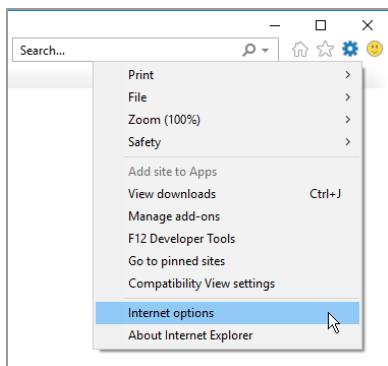

2. In the dialog that opens, click the **Advanced** tab, and scroll down to the **Security** section.

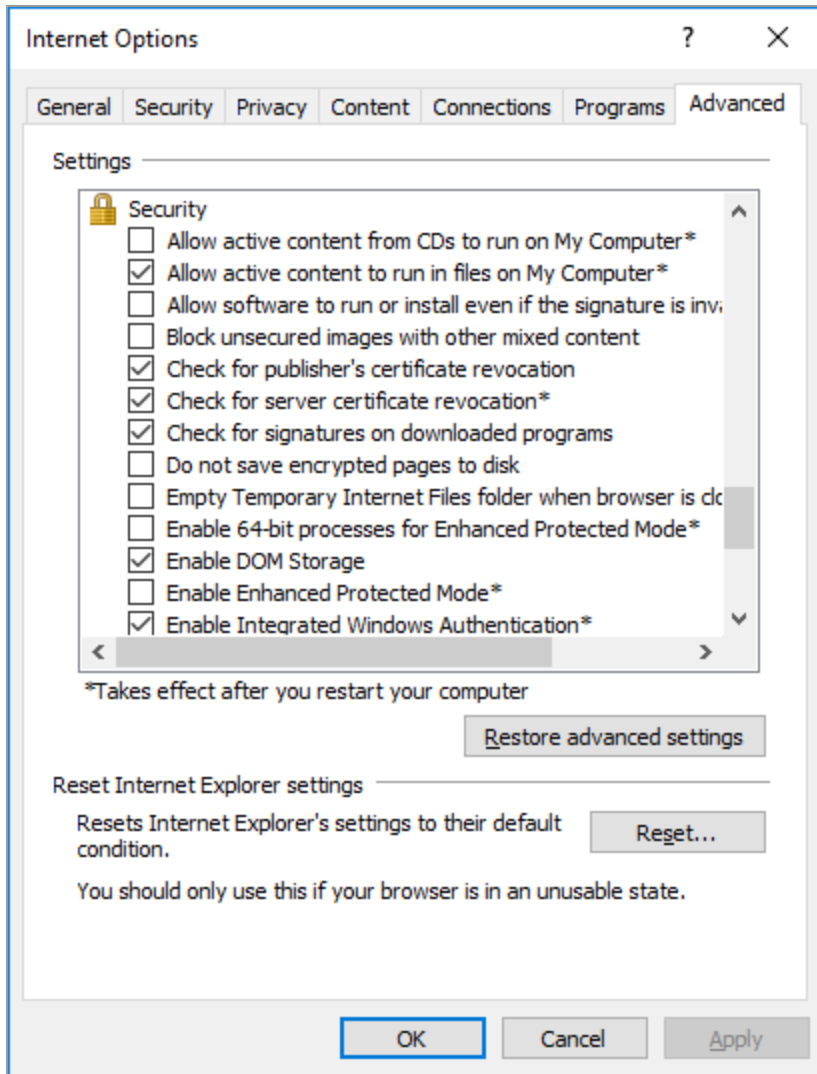

3. In the dialog, check *both* "Enable 64-bit processes for Enhanced Protected Mode" *and* "Enable Enhanced Protected Mode".

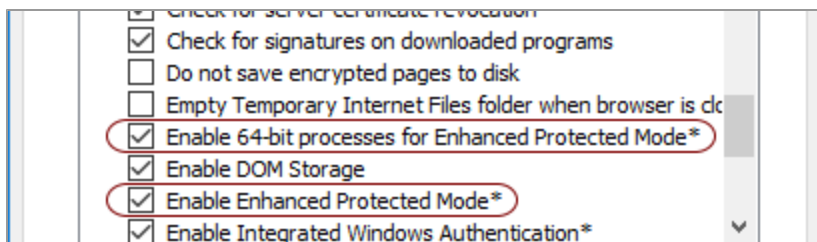


4. Click **OK** and then restart your computer for the changes to take effect.

User Interface Overview

Gocator sensors are configured by connecting to the IP address of a sensor with a web browser.

The Gocator web interface is shown below.

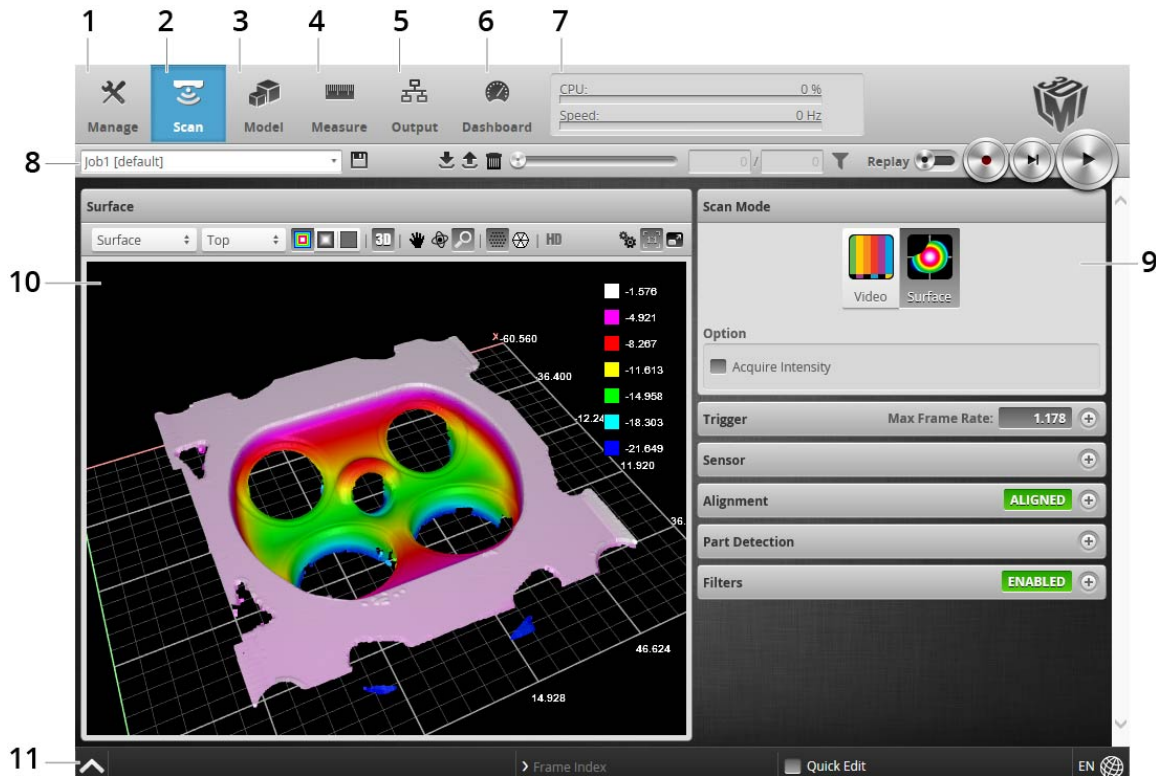


Element	Description
1	Manage page Contains settings for sensor system layout, network, motion and alignment, handling jobs, and sensor maintenance. See <i>Management and Maintenance</i> on page 71.
2	Scan page Contains settings for scan mode, trigger source, detailed sensor configuration, and performing alignment. See <i>Scan Setup and Alignment</i> on page 83.
3	Model page Lets you set up sections and part matching. See <i>Models</i> on page 120
4	Measure page Contains built-in measurement tools and their settings. See <i>Measurement and Processing</i> on page 141.
5	Output page Contains settings for configuring output protocols used to communicate measurements to external devices. See <i>Output</i> on page 330.
6	Dashboard page Provides monitoring of measurement statistics and sensor health. See <i>Dashboard</i> on page 343.
7	CPU Load and Speed Provides important sensor performance metrics. See <i>Metrics Area</i> on page 67.
8	Toolbar Controls sensor operation, manages jobs, and filters and replays recorded measurement data. See <i>Toolbar</i> on the next page.
9	Configuration area Provides controls to configure scan and measurement tool settings.

	Element	Description
10	Data viewer	Displays sensor data, tool setup controls, and measurements. See <i>Data Viewer</i> on page 110 for its use when the Scan page is active and on page 142 for its use when the Measure page is active.
11	Status bar	Displays log messages from the sensor (errors, warnings, and other information) and frame information , and lets you switch the interface language . For more information, see <i>Status Bar</i> on page 68.

Toolbar

The toolbar is used for performing operations such as managing jobs, working with replay data, and starting and stopping the sensor.

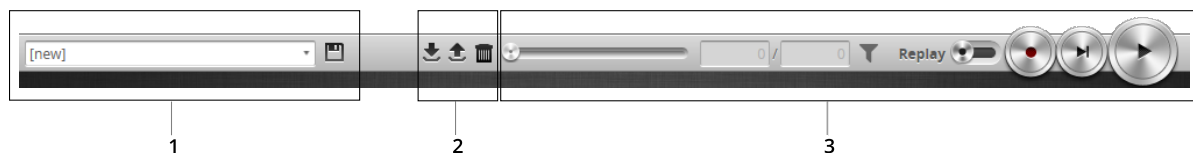

	Element	Description
1	Job controls	For saving and loading jobs.
2	Replay data controls	For downloading, uploading, and exporting recorded data.
3	Sensor operation / replay control	Use the sensor operation controls to start sensors, enable and filter recording, and control recorded data.

Creating, Saving and Loading Jobs (Settings)

A Gocator can store several hundred jobs. Being able to switch between jobs is useful when a Gocator is used with different constraints during separate production runs. For example, width decision minimum and maximum values might allow greater variation during one production run of a part, but might allow less variation during another production run, depending on the desired grade of the part.

Most of the settings that can be changed in the Gocator's web interface, such as the ones in the **Manage**, **Measure**, and **Output** pages, are temporary until saved in a job file. Each sensor can have multiple job files. If there is a job file that is designated as the default, it will be loaded automatically when the sensor is reset.

When you change sensor settings using the Gocator web interface in the emulator, some changes are saved automatically, while other changes are temporary until you save them manually. The following table lists the types of information that can be saved in a sensor.

Setting Type	Behavior
Job	Most of the settings that can be changed in the Gocator's web interface, such as the ones in the Manage , Measure , and Output pages, are temporary until saved in a job file. Each sensor can have multiple job files. If there is a job file that is designated as the default, it will be loaded automatically when the sensor is reset.
Alignment	Alignment can either be fixed or dynamic, as controlled by the Alignment Reference

Setting Type	Behavior
	setting in Motion and Alignment in the Manage page. Alignment is saved automatically at the end of the alignment procedure when Alignment Reference is set to Fixed . When Alignment Reference is set to Dynamic , however, you must manually save the job to save alignment.
Network Address	Network address changes are saved when you click the Save button in Networking on the Manage page. The sensor must be reset before changes take effect.

The job drop-down list in the toolbar shows the jobs stored in the sensor. The job that is currently active is listed at the top. The job name will be marked with "[unsaved]" to indicate any unsaved changes.



To create a job:

1. Choose **[New]** in the job drop-down list and type a name for the job.
2. Click the **Save** button  or press **Enter** to save the job.
The job is saved to sensor storage using the name you provided. Saving a job automatically sets it as the default, that is, the job loaded when the sensor is restarted.

To save a job:

- Click the **Save** button .
- The job is saved to sensor storage. Saving a job automatically sets it as the default, that is, the job loaded when the sensor is restarted.

To load (switch) jobs:

- Select an existing file name in the job drop-down list.
- The job is activated. If there are any unsaved changes in the current job, you will be asked whether you want to discard those changes.

You can perform other job management tasks—such as downloading job files from a sensor to a computer, uploading job files to a sensor from a computer, and so on—in the **Jobs** panel in the **Manage** page. See *Jobs* on page 74 for more information.

Recording, Playback, and Measurement Simulation

Gocator sensors can record and replay recorded scan data, and also simulate measurement tools on recorded data. This feature is most often used for troubleshooting and fine-tuning measurements, but can also be helpful during setup.

Recording and playback are controlled using the toolbar controls.



Recording and playback controls when replay is off

To record live data:

1. Toggle **Replay** mode off by setting the slider to the left in the **Toolbar**.

 Replay mode disables measurements.

2. (Optional) Configure recording filtering.
For more information on recording filtering, see *Recording Filtering* on the next page.
3. Click the **Record** button to enable recording.




The center of the Record button turns red.

When recording is enabled (and replay is off), the sensor will store the most recent data as it runs. Remember to disable recording if you no longer want to record live data. (Press the **Record** button again to disable recording).

4. Press the **Snapshot** button or **Start** button.
The **Snapshot** button records a single frame. The **Start** button will run the sensor continuously and all frames will be recorded, up to available memory. When the memory limit is reached, the oldest data will be discarded.

 Newly recorded data is appended to existing replay data unless the sensor job has been modified.

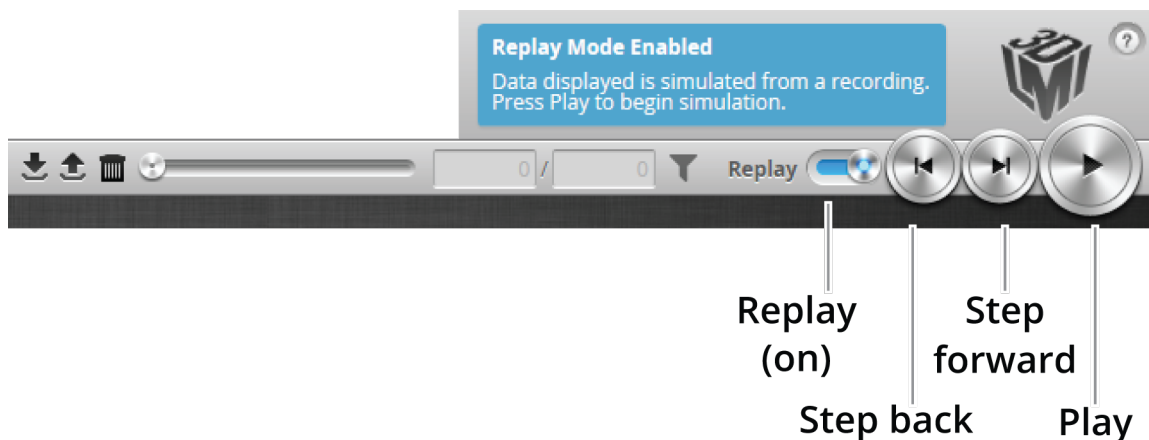

To replay data:

1. Toggle **Replay** mode on by setting the slider to the right in the **Toolbar**.
The slider's background turns blue and a Replay Mode Enabled message is displayed.
2. Use the **Replay** slider or the **Step Forward**, **Step Back**, or **Play** buttons to review data.
The **Step Forward** and **Step Back** buttons move the current replay location forward and backward by a single frame, respectively.
The **Play** button advances the replay location continuously, animating the playback until the end of the replay data.
The **Stop** button (replaces the **Play** button while playing) can be used to pause the replay at a particular location.
The **Replay** slider (or **Replay Position** box) can be used to go to a specific replay frame.

To simulate measurements on replay data:


1. Toggle **Replay** mode on by setting the slider to the right in the **Toolbar**.
The slider's background turns blue and a Replay Mode Enabled message is displayed.
To change the mode, **Replay Protection** must be unchecked.
2. Go to the **Measure** page.
Modify settings for existing measurements, add new measurement tools, or delete measurement tools as desired. For information on adding and configuring measurements, see *Measurement and Processing* on page 141.
3. Use the **Replay Slider**, **Step Forward**, **Step Back**, or **Play** button to simulate measurements.
Step or play through recorded data to execute the measurement tools on the recording.
Individual measurement values can be viewed directly in the data viewer. Statistics on the measurements that have been simulated can be viewed in the **Dashboard** page; for more information on the dashboard, see *Dashboard* on page 343.

To clear replay data:

1. Stop the sensor if it is running by clicking the **Stop** button.
2. Click the **Clear Replay Data** button .

Recording Filtering

Replay data is often used for troubleshooting. But replay data can contain thousands of frames, which makes finding a specific frame to troubleshoot difficult. Recording filtering lets you choose which frames Gocator records, based on one or more conditions, which makes it easier to find problems.

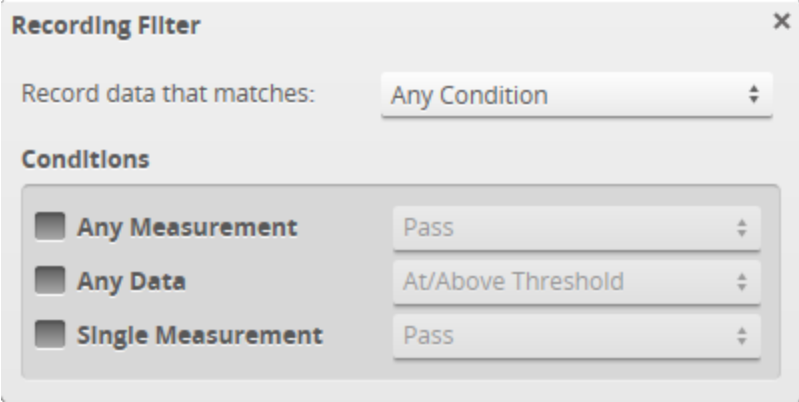

How Gocator treats conditions

Setting	Description
Any Condition	Gocator records a frame when any condition is true.
All Conditions	Gocator only records a frame if all conditions are true.

Conditions

Setting	Description
Any Measurement	Gocator records a frame when <i>any</i> measurement is in the state you select. The following states are supported: • pass • fail or invalid • fail and valid • valid • invalid
Single Measurement	Gocator records a frame if the measurement with the ID you specify in ID is in the state you select. This setting supports the same states as the Any Measurement setting (see above).
Any Data	At/Above Threshold: Gocator records a frame if the number of valid points in the frame is above the value you specify in Range Count Threshold. Below Threshold: Gocator records a frame if the number of valid points is below the threshold you specify. In Surface mode, the number of valid points in the surface is compared to the threshold, not any sections that may be defined.

To set recording filtering:

1. Make sure recording is enabled by clicking the Record button.



2. Click the Recording Filtering button .
3. In the Recording Filtering dialog, choose how Gocator treats conditions:
For information on the available settings, see *How Gocator treats conditions* above.

4. Configure the conditions that will cause Gocator to record a frame:

For information on the available settings, see *Conditions* on the previous page.

5. Click the "x" button or outside of the Recording Filtering dialog to close the dialog.

The recording filter icon turns green to show that recording filters have been set.


When you run the sensor, Gocator only records the frames that satisfy the conditions you have set.

Downloading, Uploading, and Exporting Replay Data

Replay data (recorded scan data) can be downloaded from a Gocator to a client computer, or uploaded from a client computer to a Gocator.

Data can also be exported from a Gocator to a client computer in order to process the data using third-party tools.

You can only upload replay data to the same sensor model that was used to create the data.

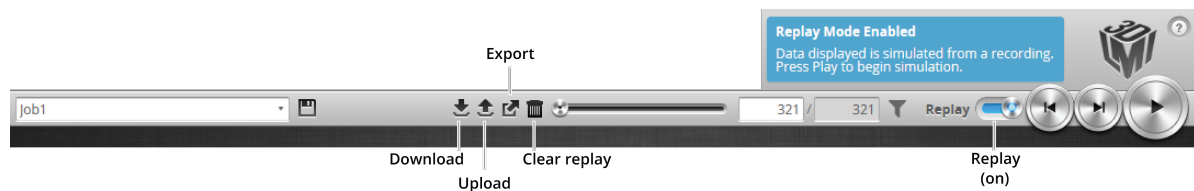


Replay data is not loaded or saved when you load or save jobs.

To download replay data:

1. Click the Download button .
2. In the **File Download** dialog, click **Save**.
3. In the **Save As...** dialog, choose a location, optionally change the name, and click **Save**.


To upload replay data:

1. Click the Upload button .
- The Upload menu appears.

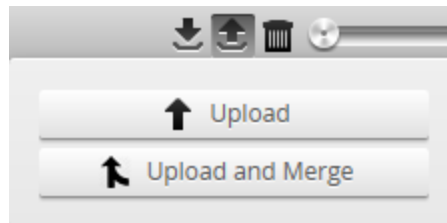

2. In the Upload menu, choose one of the following:
 - **Upload:** Unloads the current job and creates a new unsaved and untitled job from the content of the replay data file.
 - **Upload and merge:** Uploads the replay data and merges the data's associated job with the current job. Specifically, the settings on the **Scan** page are overwritten, but all other settings of the current job are preserved, including any measurements or models.


If you have unsaved changes in the current job, the firmware asks whether you want to discard the changes.

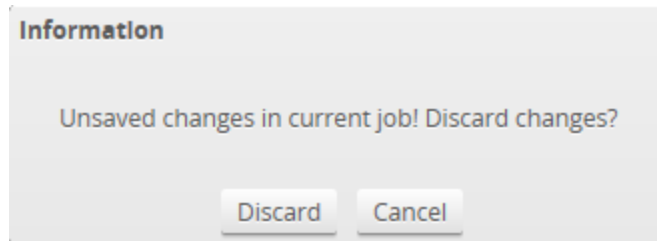

3. Do one of the following:
 - Click **Discard** to discard any unsaved changes.
 - Click **Cancel** to return to the main window to save your changes.
4. If you clicked **Discard**, navigate to the replay data to upload from the client computer and click **OK**. The replay data is loaded, and a new unsaved, untitled job is created.

Replay data can be exported using the CSV format.

 Surface intensity data cannot be exported to the CSV format. It can only be [exported separately as a bitmap](#).

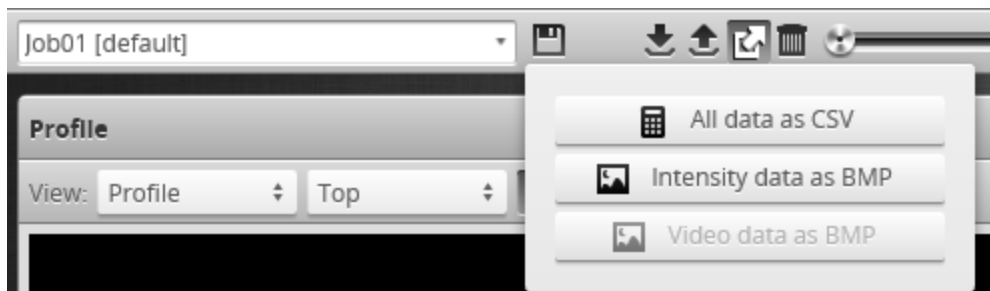

To export replay data in the CSV format:

1. In the **Scan Mode** panel, switch to Profile or Surface.
2. Switch to Replay mode.
3. Click the Export button  and select **All Data as CSV**.

Only data at the current replay location is exported.

Use the playback control buttons to move to a different replay location; for information on playback, see *To replay data in Recording, Playback, and Measurement Simulation* on page 61.
4. (Optional) Convert exported data to another format using the CSV Converter Tool. For information on this tool, see *CSV Converter Tool* on page 593.

 The decision values in the exported data depend on the *current* state of the job, not the state during recording. For example, if you record data when a measurement returns a *pass* decision, change the measurement's settings so that a *fail* decision is returned, and then export to CSV, you will see a *fail* decision in the exported data.


Recorded intensity data can be exported to a bitmap (.BMP format). **Acquire Intensity** must be checked in the **Scan Mode** panel while data was being recorded in order to export intensity data.

To export recorded intensity data to the BMP format:

- Switch to Replay mode and click the **Export** button  and select **Intensity data as BMP**.

Only the intensity data in the current replay location is exported.

Use the playback control buttons to move to a different replay location; for information on playback, see *To replay data in Recording, Playback, and Measurement Simulation* on page 61.

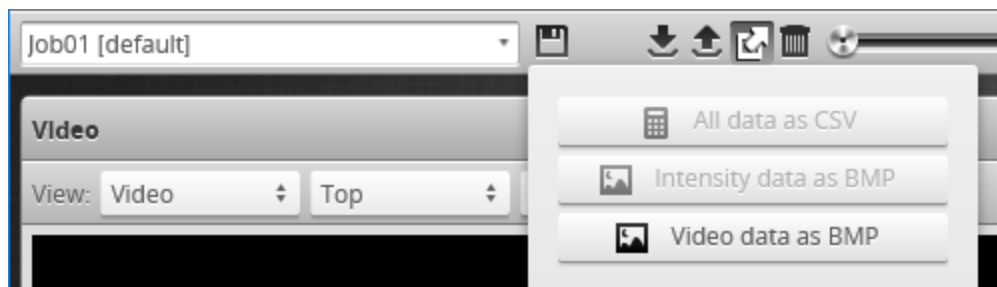


To export video data to a BMP file:

1. In the **Scan Mode** panel, switch to Video mode.
Use the playback control buttons to move to a different replay location; for information on playback, see *To replay data in Recording, Playback, and Measurement Simulation* on page 61.
2. Switch to Replay mode.
3. Click the Export button  and select **Video data as BMP**.

Metrics Area

The **Metrics** area displays two important sensor performance metrics: CPU load and speed (current frame rate).

 The **CPU** bar in the **Metrics** panel (at the top of the interface) displays how much of the CPU is being utilized.



CPU at 100%

The **Speed** bar displays the frame rate of the sensor. A warning symbol (⚠) will appear next to it if triggers (external input or encoder) are dropped because the external rate exceeds the maximum frame rate.

Open the log for details on the warning. For more information on logs, see *Log* on the next page.

When a sensor is [accelerated](#) a "rocket" icon appears in the metrics area.



Data Viewer

The data viewer is displayed in both the **Scan** and the **Measure** pages, but displays different information depending on which page is active.

When the **Scan** page is active, the data viewer displays sensor data and can be used to adjust the active area and other settings. Depending on the selected operation mode (page 84), the data viewer can display video images, sections, or surfaces. For details, see *Data Viewer* on page 110.

When the **Measure** page is active, the data viewer displays sensor data onto which representations of measurement tools and their measurements are superimposed. For details, see *Data Viewer* on page 142.


Status Bar

The status bar lets you do the following:

- See sensor messages in the [log](#).
- See [frame information](#).
- Change the [interface language](#).
- Switch to [Quick Edit mode](#).

Log

The log, located at the bottom of the web interface, is a centralized location for all messages that the Gocator displays, including warnings and errors.

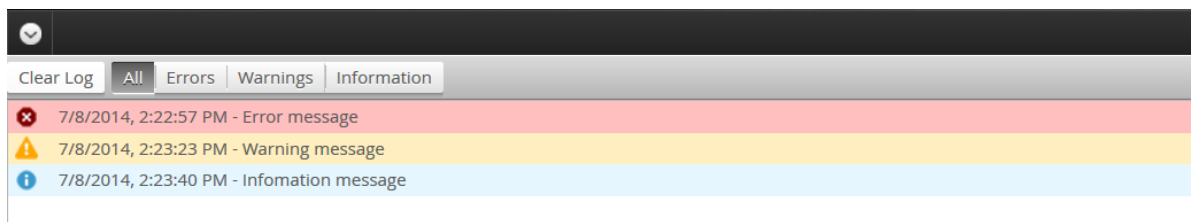

A number indicates the number of unread messages:



To use the log:

1. Click on the Log open button  at the bottom of the web interface.
2. Click on the appropriate tab for the information you need.

Frame Information

The area to the right of the status bar displays useful frame information, both when the sensor is running and when viewing recorded data.



This information is especially useful when you have enabled [recording filtering](#). If you look at a recording playback, when you have enabled recording filtering, some frames can be excluded, resulting in variable "gaps" in the data.

The following information is available:

Frame Index: Displays the index in the data buffer of the current frame. The value resets to 0 when the sensor is restarted or when recording is enabled.

Master Time: Displays the recording time of the current frame, with respect to when the sensor was started.

Encoder Index: Displays the encoder index of the current frame.

Timestamp: Displays the timestamp the current frame, in microseconds from when the sensor was started.

To switch between types of frame information:

- Click the frame information area to switch to the next available type of information.

Quick Edit Mode

When working with a very large number of [measurement tools](#) (for example, a few dozen) or a very complex user-created [GDK tool](#), you can switch to a "Quick Edit" mode to make configuration faster.



When this mode is enabled, the data viewer and measurement results are not refreshed after each setting change. Also, when Quick Edit is enabled, in Replay mode, [stepping through frames](#) or playing back scan data does not change the displayed frame.



When a sensor is running, Quick Edit mode is ignored: all changes to settings are reflected immediately in the data viewer.

Interface Language

The language button on the right side of the status bar at the bottom of the interface lets you change the language of the Gocator interface.




To change the language:

1. Click the language button at the bottom of the web interface.



2. Choose a language from the list.

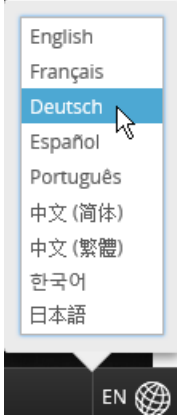


The Gocator interface reloads on the page you were working in, displaying the page using the language you chose. The sensor state is preserved.

Management and Maintenance

The following sections describe how to set up the sensor connections and networking, how to calibrate encoders and choose the alignment reference, and how to perform maintenance tasks.

Manage Page Overview


Gocator's system and maintenance tasks are performed on the **Manage** page.

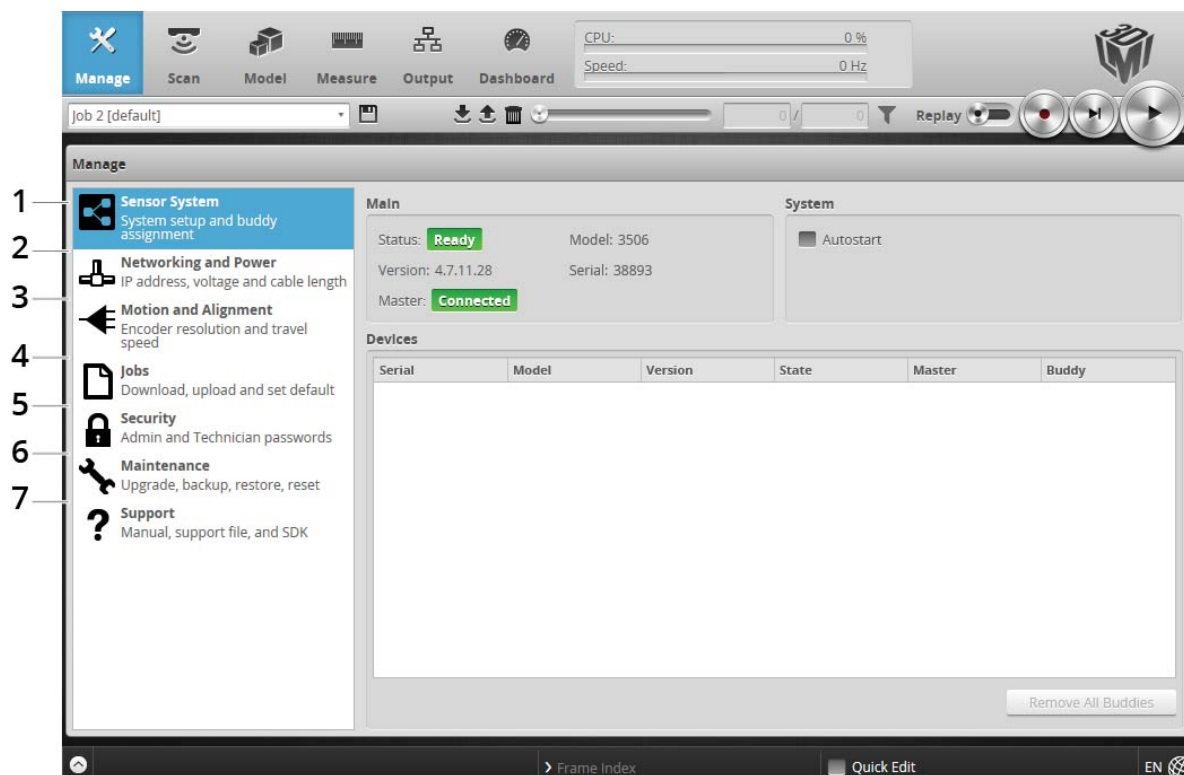

Element	Description
1 Sensor System	Contains sensor information and the autostart setting. See <i>Sensor System</i> on the next page.
2 Networking and Power	Contains settings for configuring the network, as well as power and cordset length. See <i>Networking and Power</i> on the next page.
3 Motion and Alignment	Contains settings to configure the encoder. See <i>Motion and Alignment</i> on page 73.
4 Jobs	Lets you manage jobs stored on the sensor. See <i>Jobs</i> on page 74.
5 Security	Lets you change passwords. See <i>Security</i> on page 76.
6 Maintenance	Lets you upgrade firmware, create/restore backups, and reset sensors. See <i>Maintenance</i> on page 77.
7 Support	Lets you open an HTML version or download a PDF version of the manual, download the SDK, or save a support file. Also provides device information. See <i>Support</i> on page 80


Sensor System

The following sections describe the **Sensor System** category on the **Manage** page. This category provides sensor information and the autostart setting.

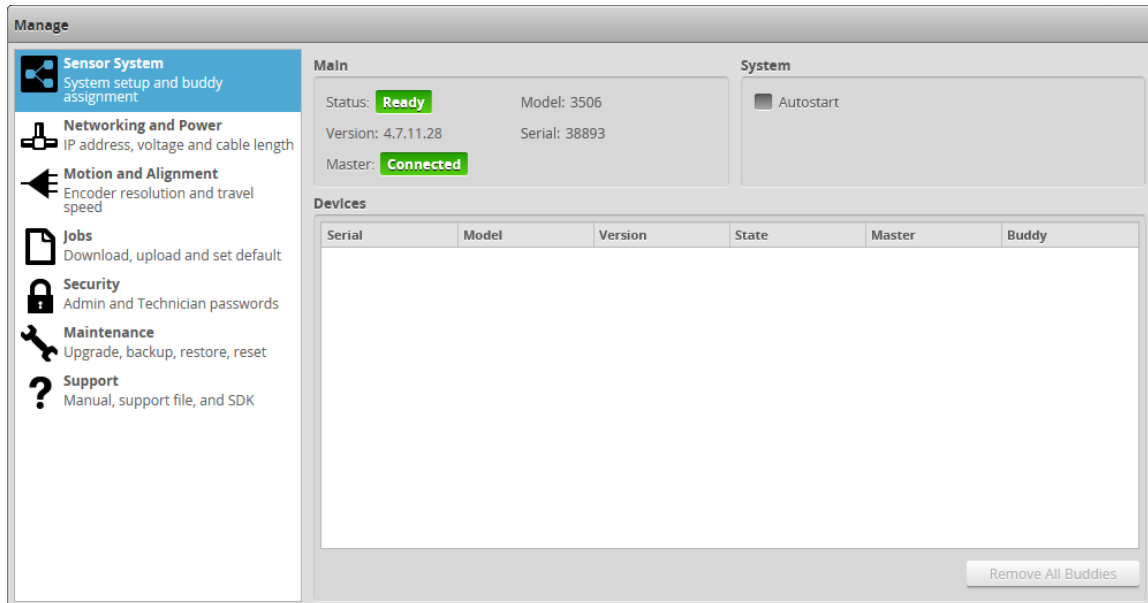

Sensor Autostart

With the **Autostart** setting enabled, scanning and measurements begin automatically when the sensor is powered on. Autostart must be enabled if the sensor will be used without being connected to a computer.

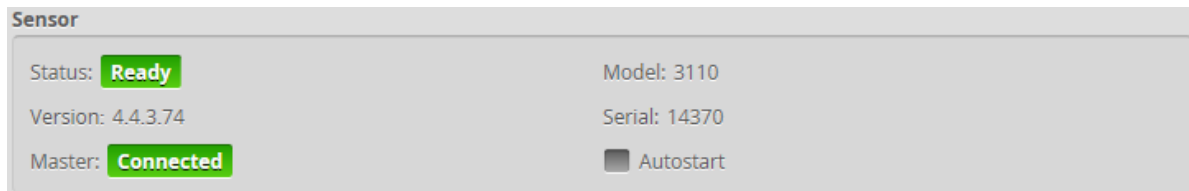


To enable/disable Autostart:

1. Go to the **Manage** page and click on the **Sensor System** category.
2. Check/uncheck the **Autostart** option in the **Main** section.

Networking and Power

The **Networking** category on the **Manage** page provides network settings. Settings must be configured to match the network to which the Gocator sensors are connected. The category also provides power and cordset length settings.

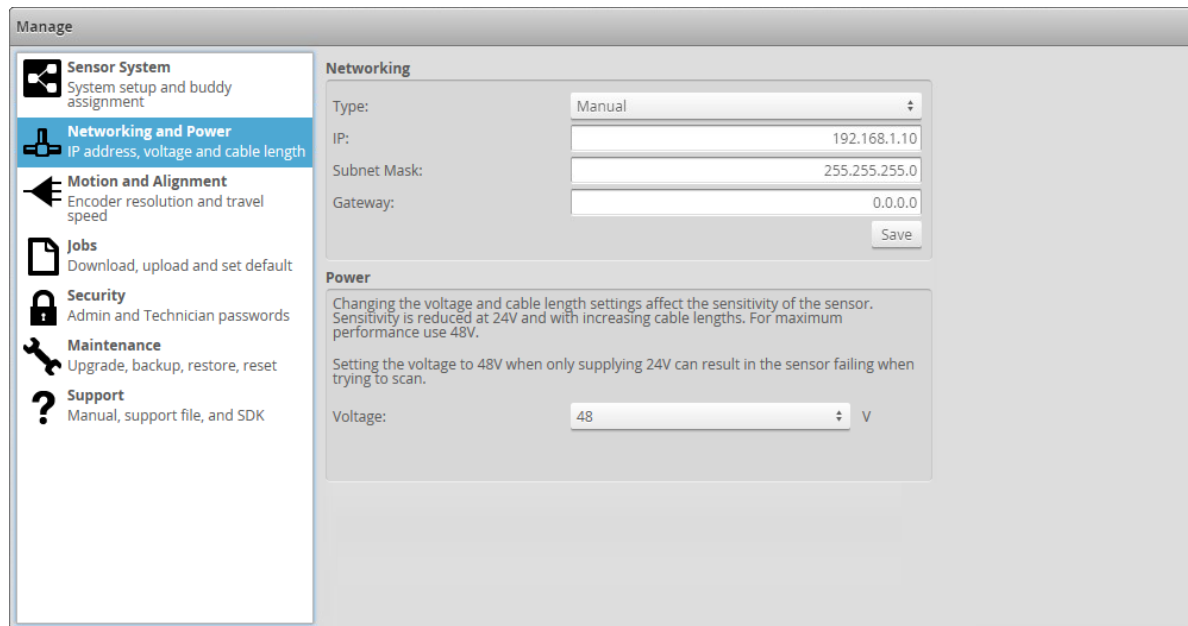

To configure the network settings:


1. Go to the **Manage** page.
2. In the **Networking** category, specify the Type, IP, Subnet Mask, and Gateway settings.
The Gocator sensor can be configured to use DHCP or assigned a static IP address by selecting the appropriate option in the **Type** drop-down.
3. For Gocator 3210, configure **Voltage** and **Cordset Length**.
When Gocator 3210 is run at 24 volts and with a longer cordset, the sensor must lower the projector's intensity to limit the current going to the sensor. As a result, you may need to increase the sensor's [exposure](#) to compensate for the lower projector intensity compared to running at 48 volts.

 If you run the sensor at 24 volts without properly configuring these settings, the sensor will fail to complete scans.

4. Click on the **Save** button.
You will be prompted to confirm your selection.


Motion and Alignment

The **Motion and Alignment** category on the **Manage** page lets you configure alignment reference, encoder resolution, and travel speed, and confirm that encoder signals are being received by the sensor.

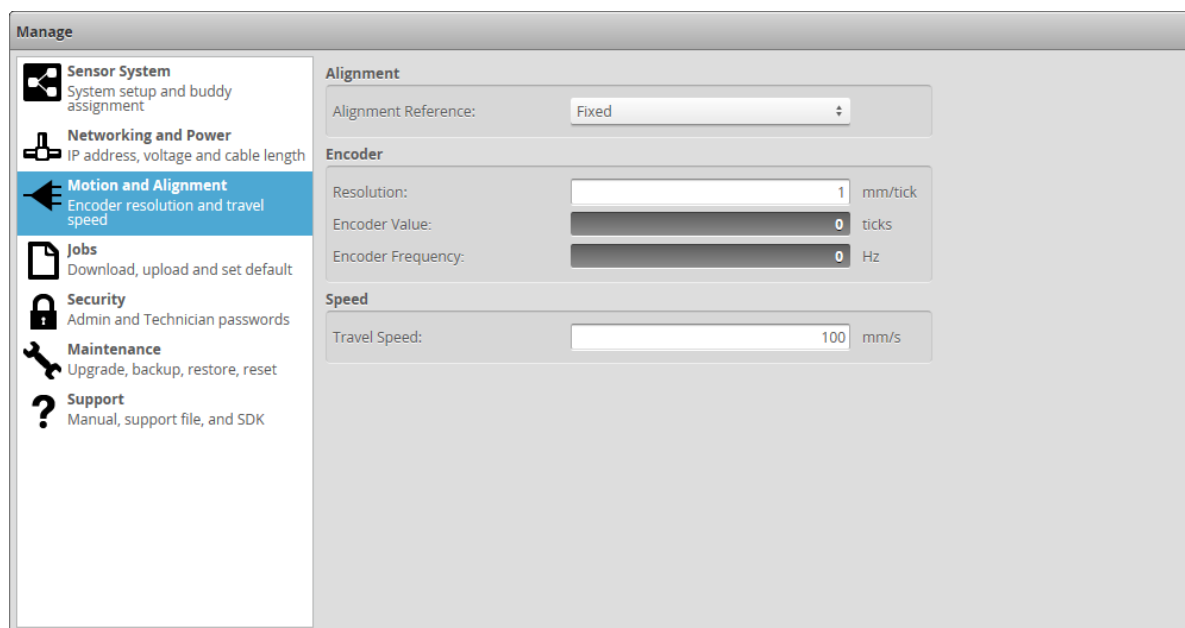

Alignment Reference

The **Alignment Reference** setting can have one of two values: **Fixed** or **Dynamic**.

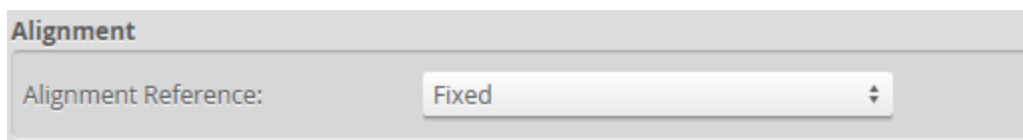


Setting	Description
Fixed	A single, global alignment is used for all jobs. This is typically used when the sensor mounting is constant over time and between scans, for example, when the sensor is mounted in a permanent position over a conveyor belt.
Dynamic	A separate alignment is used for each job. This is typically used when the sensor's position relative to the object scanned is always changing, for example, when the sensor is mounted on a robot arm moving to different scanning locations.

To configure alignment reference:

1. Go to the **Manage** page and click on the **Motion and Alignment** category.
2. In the Alignment section, choose **Fixed** or **Dynamic** in the **Alignment Reference** drop-down.


Jobs

The **Jobs** category on the **Manage** page lets you manage the jobs stored on a sensor.

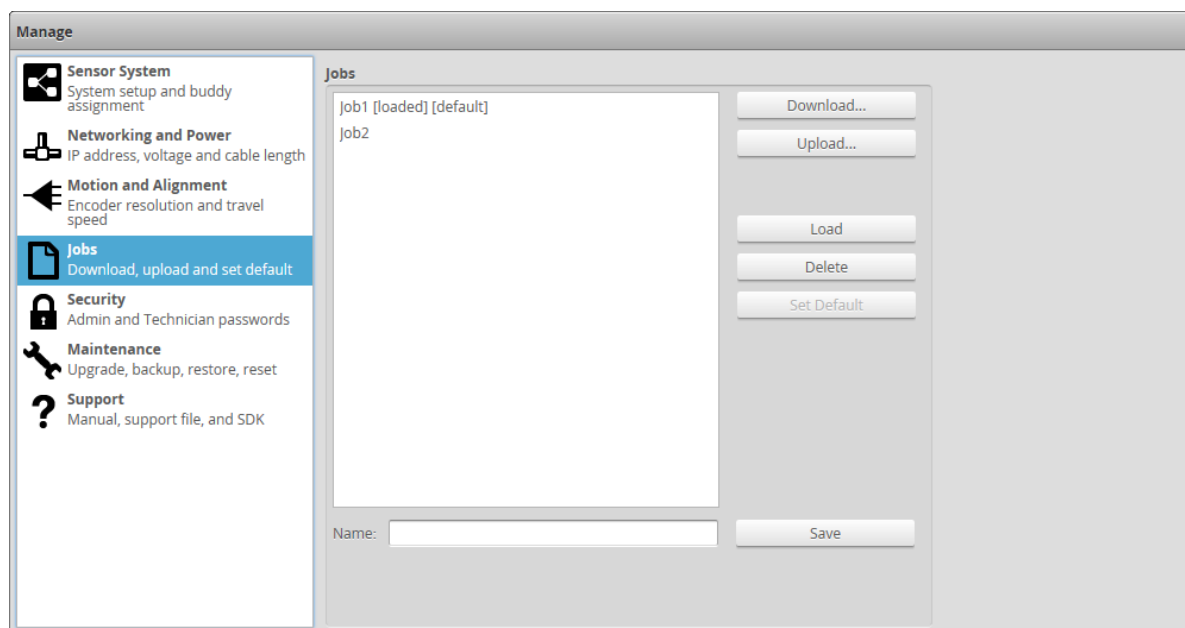


Element	Description
Name field	Used to provide a job name when saving files.
Jobs list	Displays the jobs that are currently saved in the sensor's flash storage.
Save button	Saves current settings to the job using the name in the Name field.
Load button	Loads the job that is selected in the job list. Reloading the current job discards any unsaved changes.
Delete button	Deletes the job that is selected in the job list.
Set as Default button	Sets the selected job as the default to be loaded when the sensor starts. When the default job is selected, this button is used to clear the default.
Download... button	Downloads the selected job to the client computer.
Upload... button	Uploads a job from the client computer.

Jobs can be loaded (currently activated in sensor memory) and set as default independently. For example, Job1 could be loaded, while Job2 is set as the default. Default jobs load automatically when a sensor is power cycled or reset.

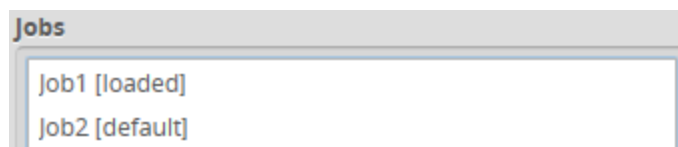

Unsaved jobs are indicated by "[unsaved]".

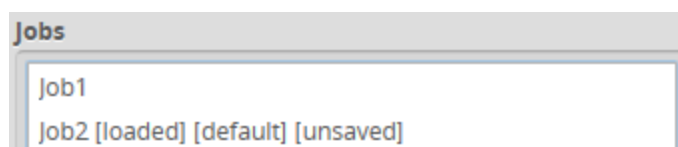

To save a job:

1. Go to the **Manage** page and click on the **Jobs** category.
2. Provide a name in the **Name** field.
To save an existing job under a different name, click on it in the **Jobs** list and then modify it in the **Name** field.
3. Click on the **Save** button or press **Enter**.
Saving a job automatically sets it as the default, that is, the job loaded when then sensor is restarted.

To download, load, or delete a job, or to set one as a default, or clear a default:

1. Go to the **Manage** page and click on the **Jobs** category.
2. Select a job in the **Jobs** list.
3. Click on the appropriate button for the operation.

Security

You can prevent unauthorized access to a Gocator sensor by setting passwords. Each sensor has two accounts: Administrator and Technician.

By default, no passwords are set. When you start a sensor, you are prompted for a password only if a password has been set.

The screenshot shows the 'Manage' page of the Gocator web interface. On the left is a sidebar with a tree view containing the following items: 'Sensor System' (System setup and buddy assignment), 'Networking and Power' (IP address, voltage and cable length), 'Motion and Alignment' (Encoder resolution and travel speed), 'Jobs' (Download, upload and set default), 'Security' (Admin and Technician passwords), 'Maintenance' (Upgrade, backup, restore, reset), and 'Support' (Manual, support file, and SDK). The 'Security' item is highlighted with a blue background. The main content area on the right is titled 'Administrator' and 'Technician'. Each section contains a 'Password:' label, a text input field, a 'Confirm Password:' label, another text input field, and a 'Change Password' button.

Gocator Account Types

Account	Description
Administrator	The Administrator account has privileges to use the toolbar (loading and saving jobs, recording and

Account	Description
	viewing replay data), to view all pages and edit all settings, and to perform setup procedures such as sensor alignment.
Technician	The Technician account has privileges to use the toolbar (loading and saving jobs, recording and viewing replay data), to view the Dashboard page, and to start or stop the sensor.

The Administrator and Technician accounts can be assigned unique passwords.

To set or change the password for the Administrator account:

1. Go to the **Manage** page and click on the **Security** category.
2. In the **Administrator** section, enter the Administrator account password and password confirmation.
3. Click **Change Password**.
The new password will be required the next time that an administrator logs in to the sensor.

To set or change the password for the Technician account:


1. Go to the **Manage** page and click on the **Security** category.
2. In the **Technician** section, enter the Technician account password and password confirmation.
3. Click **Change Password**.
The new password will be required the next time that a technician logs in to the sensor.

If the administrator or technician password is lost, the sensor can be recovered using a special software tool. See *Sensor Discovery Tool* on page 575 for more information.

Maintenance

The **Maintenance** category in the **Manage** page is used to do the following:

- upgrade the firmware and check for firmware updates;
- back up and restore all saved jobs and recorded data;
- restore the sensor to factory defaults;
- reset the sensor.

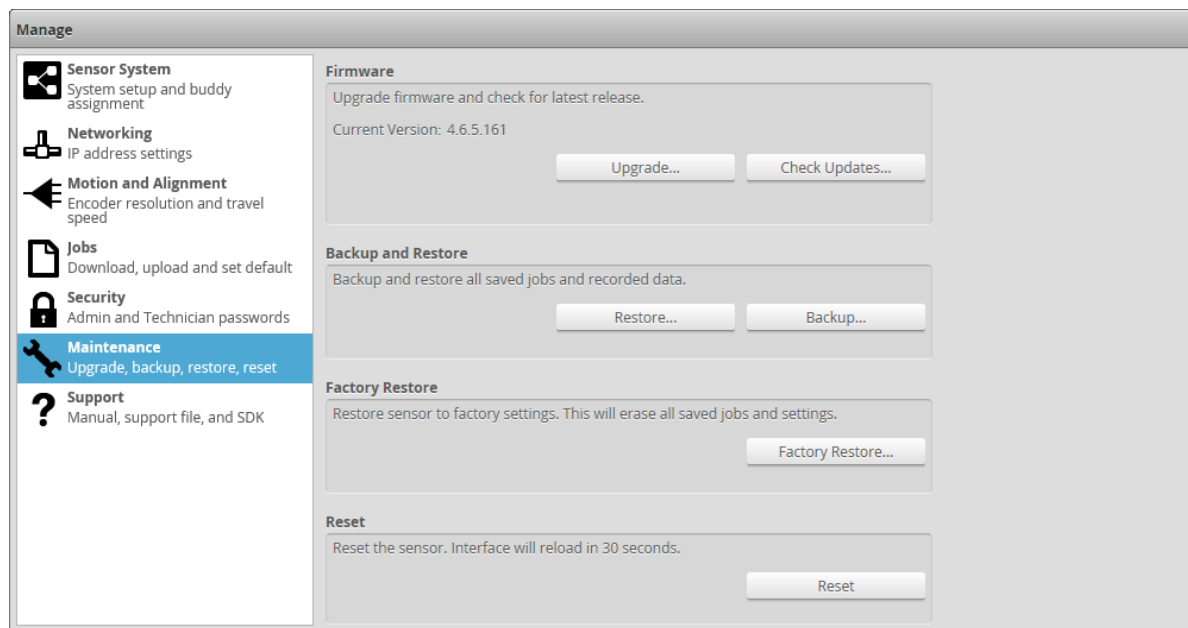


Sensor Backups and Factory Reset

You can create sensor backups, restore from a backup, and restore to factory defaults in the **Maintenance** category.

Backup files contain all of the information stored on a sensor, including jobs and alignment.




An Administrator should create a backup file in the unlikely event that a sensor fails and a replacement sensor is needed. If this happens, the new sensor can be restored with the backup file.

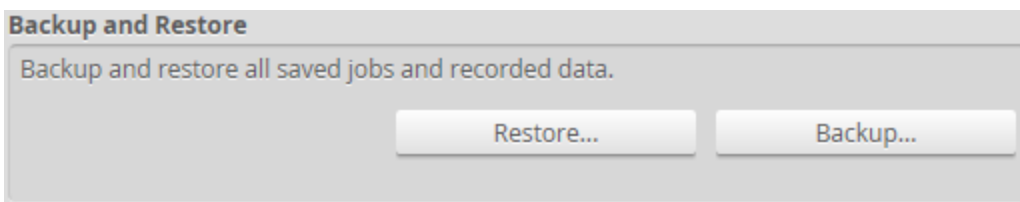

To create a backup:

1. Go to the **Manage** page and click on the **Maintenance** category.
2. Click the **Backup...** button under **Backup and Restore**.
3. When you are prompted, save the backup.
Backups are saved as a single archive that contains all of the files from the sensor.

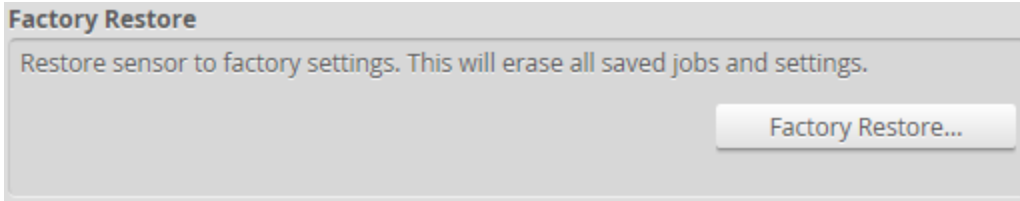

To restore from a backup:


1. Go to the **Manage** page and click on the **Maintenance** category.
2. Click the **Restore...** button under **Backup and Restore**.
3. When you are prompted, select a backup file to restore.
The backup file is uploaded and then used to restore the sensor. Any files that were on the sensor before the restore operation will be lost.

To restore a sensor to its factory default settings:

1. Go to the **Manage** page and click on **Maintenance**.
2. Consider making a backup.
Before proceeding, you should perform a backup. Restoring to factory defaults cannot be undone.
3. Click the **Factory Restore...** button under **Factory Restore**.
You will be prompted whether you want to proceed.

Firmware Upgrade

LMI recommends routinely updating firmware to ensure that Gocator sensors always have the latest features and fixes.

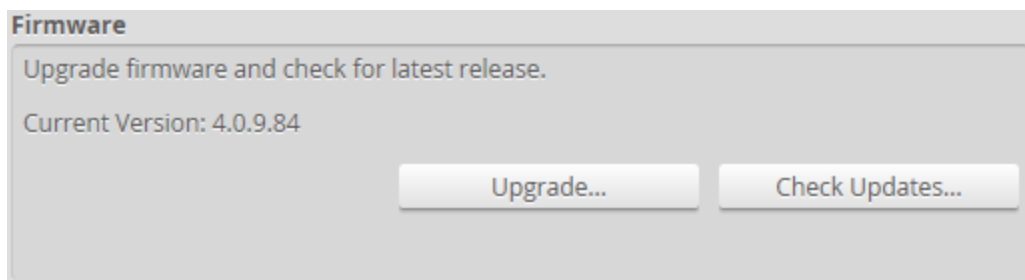

To download the latest firmware:

1. Go to the **Manage** page and click on the **Maintenance** category.
2. Click the **Check Updates...** button in the **Firmware** section.
3. Download the latest firmware.
If a new version of the firmware is available, follow the instructions to download it to the client computer.

If the client computer is not connected to the Internet, firmware can be downloaded and transferred to the client computer by using another computer to download the firmware from LMI's website:

<http://www.lmi3d.com/support/downloads>.

To upgrade the firmware:

1. Go to the **Manage** page and click on the **Maintenance** category.
2. Click the **Upgrade...** button in the **Firmware** section.
3. Locate the firmware file in the **File** dialog and then click open.
4. Wait for the upgrade to complete.

After the firmware upgrade is complete, the sensor will self-reset. If a buddy has been assigned, it will be upgraded and reset automatically.

Support

The **Support** category in the **Manage** page is used to do the following:

- Open an HTML version or download a PDF version of the manual.
- Download the SDK.
- Save a support file.
- Get device information.

The screenshot shows the 'Manage' web interface. On the left is a sidebar with a list of categories: Sensor System, Networking, Motion and Alignment, Jobs, Security, Maintenance, and Support. The 'Support' category is highlighted with a blue background and a question mark icon. The main content area is divided into sections. The 'Device Information' section displays 'Part Number: 313110-LED-B-01', 'Serial: 15093', and 'Version: 4.4.3.74'. Below this is the 'Support File' section, which includes a description, a 'Filename' input field containing 'support', and a 'Description' text area. A 'Download' button is located at the bottom right of this section. At the bottom of the main area, there are two rows of buttons: 'User Manual' with 'Open HTML' and 'Download PDF' buttons, and 'Software Development Kit (SDK)' with a 'Download' button.

Support Files

You can download a support file from a sensor and save it on your computer. You can then use the support file to create a scenario in the Gocator emulator (for more information on the emulator, see *Gocator Emulator* on page 347). LMI's support staff may also request a support file to help in troubleshooting.

Support File

Download a support file which contains all jobs, data and current state of the sensor.

Filename:

Description:

[Download](#)

To download a support file:

1. Go to the **Manage** page and click on the **Support** category.
2. In **Filename**, type the name you want to use for the support file.
When you create a scenario from a support file in the emulator, the filename you provide here is displayed in the emulator's scenario list.
Support files end with the .gs extension, but you do not need to type the extension in **Filename**.
3. (Optional) In **Description**, type a description of the support file.
When you create a scenario from a support file in the emulator, the description is displayed below the emulator's scenario list.
4. Click **Download**, and then when prompted, click **Save**.

 Downloading a support file stops the sensor.

Manual Access

You can access the Gocator manuals from within the Web interface.

User Manual: [Open HTML](#) [Download PDF](#)

 You may need to configure your browser to allow pop-ups to open or download the manual.

To access the manuals:

1. Go to the **Manage** page and click on the **Support** category
2. Next to **User Manual**, click one of the following:
 - **Open HTML**: Opens the HTML version of the manual in your default browser.
 - **Download PDF**: Downloads the PDF version of the manual to the client computer.

Software Development Kit

You can download the Gocator SDK from within the Web interface.

Software Development Kit (SDK):

Download

To download the SDK:

1. Go to the **Manage** page and click on the **Support** category
2. Next to **Software Development Kit (SDK)**, click **Download**
3. Choose the location for the SDK on the client computer.




For more information on the SDK, see *Development Kits* on page 552.

Scan Setup and Alignment

The following sections describe the steps to configure Gocator sensors for 3D data acquisition using the **Scan** page. Setup and alignment should be performed before adding and configuring measurements or outputs.

Scan Page Overview

The **Scan** page lets you configure sensors and perform alignment.

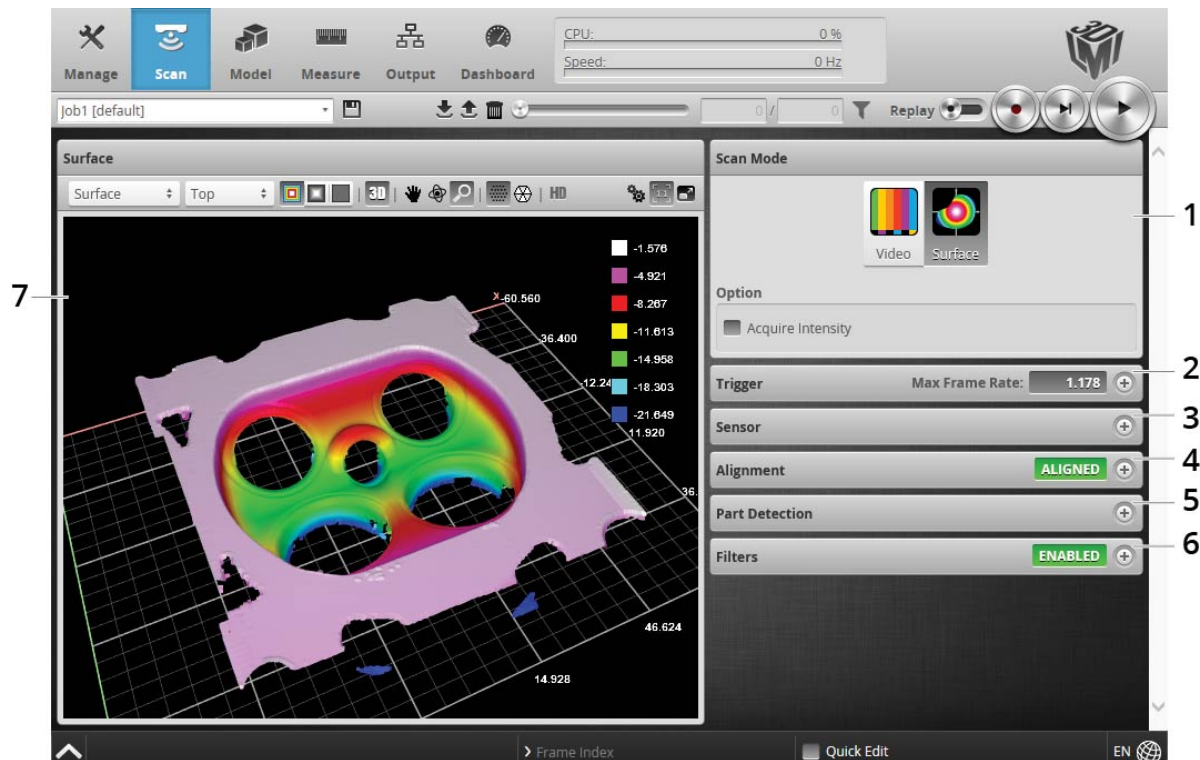


Element	Description
1 Scan Mode panel	Contains settings for the current scan mode and other options. See <i>Scan Modes</i> on the next page.
2 Trigger panel	Contains trigger source and trigger-related settings. See <i>Triggers</i> on page 86.
3 Sensor panel	Contains settings for an individual sensor, such as active area or exposure. See <i>Sensor</i> on page 89.
4 Alignment panel	Used to perform alignment. See <i>Alignment</i> on page 101.
5 Part Detection panel	Used to set the part detection logic for sorting data into discrete objects. See <i>Part Detection</i> on page 107.
6 Filters panel	Contains settings for post-processing of the profiles. See <i>Filters</i> on page 104.
7 Data Viewer	Displays sensor data and adjusts regions of interest. Depending on the current operation mode, the data viewer can display video images or scan data. See <i>Data Viewer</i> on page 110.

The following table provides quick references for specific goals that you can achieve from the panels in the **Scan** page.

Goal	Reference
Select a trigger source that is appropriate for the application.	Triggers (page 86)
Ensure that camera exposure is appropriate for scan data acquisition.	Exposure (page 92)
Find the right balance between data quality, speed, and CPU utilization.	Active Area (page 90) Exposure (page 92) Job File Structure (page 369)
Calibrate the system so that 3D data can be aligned to a reference plane.	
Set up the part detection logic to create discrete objects from scan data.	Part Detection (page 107)

Scan Modes

The Gocator web interface supports a video mode and one or more data acquisition modes. The scan mode can be selected in the **Scan Mode** panel.

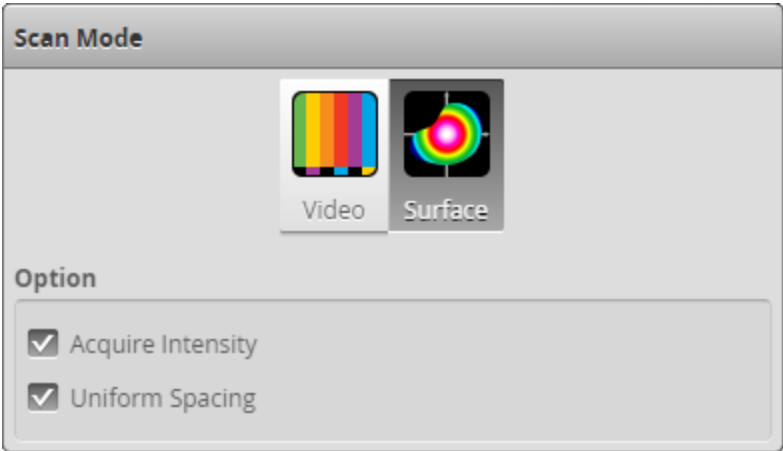

Mode and Option	Description
Video	Outputs video images from the Gocator. This mode is useful for configuring exposure time and troubleshooting stray light or ambient light problems.
Surface	Outputs 3D point clouds and performs surface measurements. Part detection can be enabled on a surface to identify discrete parts (<i>Part Detection</i> on page 107).
Uniform Spacing	When this option is enabled, data points are resampled to a uniform spacing . Set the size of the spacing in the Spacing tab (see <i>Spacing Interval</i> on page 99). When the option is disabled, the Gocator outputs unprocessed range data. The sensor reports data points in (x, y, z) coordinate tuples. No measurement tools are available when the option is disabled. Disable this option to extract ranges from the Gocator at the highest possible rate. The Y offset, X angle, and Z angle transformations cannot be non-zero when

Mode and Option	Description
	Uniform Spacing is unchecked. Therefore, when aligning a sensor using a bar alignment target with Uniform Spacing unchecked, set the Degrees of Freedom setting to X, Z, Y Angle, which prevents these transformations from being non-zero. If you are using a layout in which sensors are angled around the Y axis in order to capture "side" data, you must uncheck Uniform Spacing. However, currently, only a limited set of built-in measurement tools are able to perform measurements on the resulting data. If more complex measurements are required, data can be processed using an SDK-based application instead.
Acquire Intensity	When this option is enabled, an intensity value will be produced for each data point.

Triggers

A trigger is an event that causes a Gocator sensor to take a single 3D snapshot. Triggers are configured in the **Trigger** panel.

When a trigger is processed, the LED light pattern is strobed and the cameras expose to produce images. The resulting images are processed inside the sensor to yield a 3D point cloud, which can then be used for measurement.

The top-right of the **Trigger** panel displays the maximum speed at which an object could be captured at, calculated based on the exposure values, active area and the number of projection patterns required.

The sensor can be triggered by one of the sources described in the table below.

	If the sensor is connected to a Master 400 or higher, encoder and digital (external) input signals over the IO cordset are <i>ignored</i>. The sensor instead receives these signals from the Master; for encoder and digital input pinouts on Masters, see the section corresponding to your Master in <i>Master Network Controllers</i> on page 641. If the sensor is connected to a Master 100 (or no Master is used), the sensor receives signals over the IO cordset. For information on connecting encoder and digital input signals to a sensor in these cases, see <i>Encoder Input</i> on page 639 and <i>Digital Input</i> on page 638, respectively.
---	---

Trigger Source	Description
Time	Sensors have an internal clock that can be used to generate fixed-frequency triggers. The external input can be used to enable or disable the time triggers.
External Input	A digital input can provide triggers in response to external events (e.g., photocell). The external input triggers on the rising edge of the signal. When triggers are received at a frequency higher than the maximum frame rate, some triggers may not be accepted. The Trigger Drops Indicator in the Dashboard page can be used to check for this condition. For information on the maximum input trigger rate, see <i>Maximum Input Trigger Rate</i> on page 88.
Software	A network command can be used to send a software trigger. See <i>Protocols</i> on page 462 for more information.

Depending on the setup and measurement tools used, the CPU utilization may exceed 100%, which reduces the overall acquisition speed. If the **Clear Calibration** button is pressed, the calibration will be erased and the sensor will revert to using sensor coordinates. For the estimated acquisition speeds under different settings, see *Estimated Scan Rates* on page 633.

For examples of typical real-world scenarios, see *Trigger Examples* on the next page. For information on the settings used with each trigger source, see *Trigger Settings* on the next page.


Trigger Examples

Example: External Input + Conveyor

External input triggering can be used to produce a snapshot for 3D measurement.

For example, a photocell can be connected as an external input to generate a trigger pulse when a target object has moved into position.


An external input can also be used to gate the trigger signals when time or encoder triggering is used. For example, a photocell could generate a series of trigger pulses as long as there is a target in position.

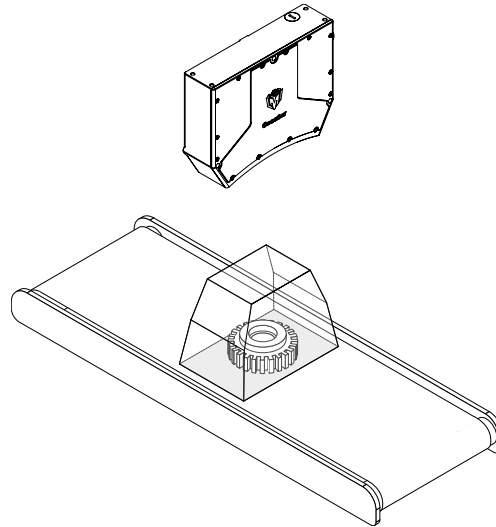

Example: Software Trigger + Robot Arm

Software triggering can be used to produce a snapshot for 3D measurement.

A software trigger can be used in systems that use external software to control the activities of system components.

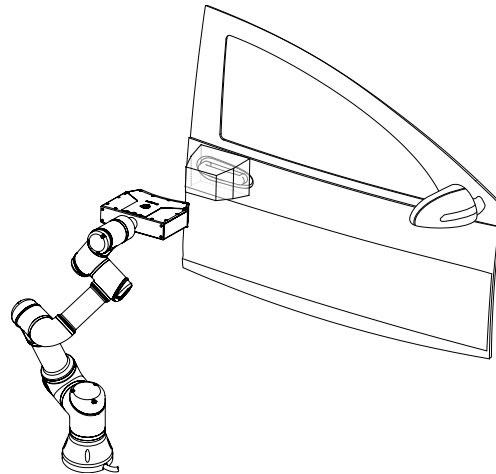

Trigger Settings

The trigger source is selected using the **Trigger** panel in the **Scan** page.

Trigger Max Frame Rate: 199.105

Source: Time

Frame Rate: Max Speed Hz

☐ Gate on External Input

Trigger Max Frame Rate: 199.105

Source: External Input

Units: μs (Time)

Trigger Delay: 0 μs

Trigger Max Frame Rate: 199.105

Source: Software

Units: μs (Time)

☐ Gate on External Input

After specifying a trigger source, the **Trigger** panel shows the parameters that can be configured.

Parameter	Trigger Source	Description
Source	All	Selects the trigger source (Time , Encoder , External Input , or Software).
Frame Rate	Time	Controls the frame rate. Select Max Speed from the drop-down to lock to the maximum frame rate. Fractional values are supported. For example, 0.1 can be entered to run at 1 frame every 10 seconds.
Gate on External Input	Time, Encoder	External input can be used to enable or disable data acquisition in a sensor. When this option is enabled, the sensor will respond to time or encoder triggers only when the external input is asserted. See <i>Digital Input</i> on page 638 for more information on connecting external input to Gocator sensors.
Units	External Input, Software	Specifies whether the trigger delay, output delay, and output scheduled command operate in the time. The unit is implicitly set to microseconds with Time trigger source. .
Trigger Delay	External Input	Controls the amount of time or the distance the sensor waits before producing a frame after the external input is activated. This is used to compensate for the positional difference between the source of the external input trigger (e.g., photocells) and the sensor. Trigger delay is only supported in single exposure mode; for details, see <i>Exposure</i> on page 92.

To configure the trigger source:

1. Go to the **Scan** page.
2. Expand the **Trigger** panel by clicking on the panel header.
3. Select the trigger source from the drop-down.
4. Configure the settings.
See the trigger parameters above for more information.
5. Save the job in the **Toolbar** by clicking the **Save** button .

Maximum Input Trigger Rate



The maximum external input trigger rate in a system including Master 400 or higher is 20 kHz.

When using a standalone sensor or a sensor connected to a Master 100, the maximum trigger rate is 32 kHz. This rate is limited by the fall time of the signal, which depends on the Vin and duty cycles. To achieve the maximum trigger rate, the Vin and duty cycles must be adjusted as follows:

Maximum Speed	Vin	Maximum Duty Cycle
32 kHz	3.3 V	88%
32 kHz	5 V	56%
32 kHz	7 V	44%
32 kHz	10 V	34%

At 50% duty cycle, the maximum trigger rates are as follows:

Vin	Maximum Speed
3.3 V	34 kHz
5 V	34 kHz
10 V	22 kHz

Maximum Encoder Rate

On a standalone sensor, with the encoder directly wired into the I/O port or through a Master 100, the maximum encoder rate is about 1 MHz.

For sensors connected through a Master 400 or higher, with the encoder signal supplied to the Master, the maximum rate is about 300 kHz.

Sensor


The following sections describe the settings that are configured in the **Sensor** panel on the **Scan** page.

Reduce Occlusion

When the **Reduce Occlusion** option is disabled, 3D data is acquired using *only* stereo correlation between the two cameras, meaning that a point on the target must be visible in both cameras to produce a 3D data point.

When this option is enabled (default), in addition to stereo correlation, each camera independently triangulates off the LED light pattern, which may improve performance on targets with complicated shapes that can cause occlusions.

For more information, see *Stereo Correlation vs. Independent Triangulation* on page 40.

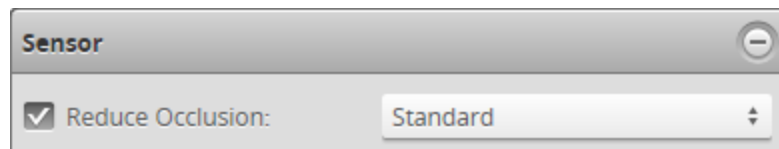

To enable or disable the Reduce Occlusion option:

1. Go to the **Scan** page.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, the **Sensor** panel will not be displayed.
3. Expand the **Sensor** panel by clicking on the panel header.
4. Check or uncheck the **Reduce Occlusion** checkbox.
5. In the dropdown next to **Reduce Occlusion**, choose one of the following:

Standard: The standard algorithm for merging images from each camera is used.

High Quality: An enhanced algorithm is used to merge images from each camera, which reduces the seam where images merge. Processing time may be increased.



6. Save the job in the **Toolbar** by clicking the **Save** button .

Active Area

Active area refers to the region within the sensor's maximum field of view that is used for data acquisition.

By default, the active area covers the sensor's entire field of view. By reducing the active area, the sensor can operate at higher speeds. You can also reduce the active area to exclude areas that are affected by ambient light.

Active area is set in the **Active Area** tab on the **Sensor** panel.

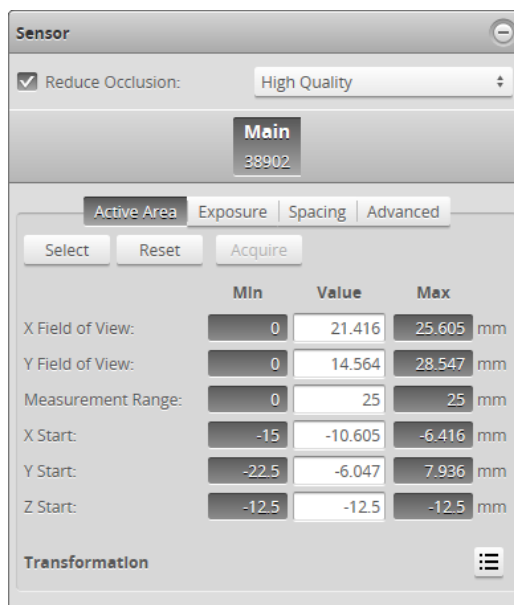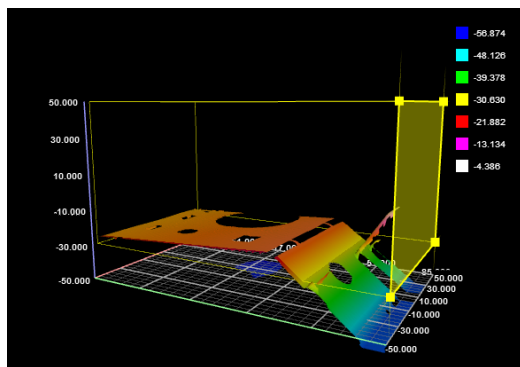

The screenshot shows the 'Sensor' panel with the 'Active Area' tab selected. The 'Reduce Occlusion' checkbox is checked, and the 'High Quality' dropdown is visible. Below the tabs, there are 'Select', 'Reset', and 'Acquire' buttons. A table displays the current settings for the active area, with columns for 'Min', 'Value', and 'Max'.

	Min	Value	Max
X Field of View:	0	21.416	25.605 mm
Y Field of View:	0	14.564	28.547 mm
Measurement Range:	0	25	25 mm
X Start:	-15	-10.605	-6.416 mm
Y Start:	-22.5	-6.047	7.936 mm
Z Start:	-12.5	-12.5	-12.5 mm

At the bottom, there is a 'Transformation' section with a menu icon.

To set the active area:

1. Go to the **Scan** page.
2. Choose a mode other than Video mode.
3. Expand the **Sensor** panel by clicking on the panel header or the  button.
4. Click on the **Active Area** tab.
5. Click **Select**.
6. Click **Acquire** to see a scan while setting the active area.
Acquiring a scan while setting the active area can help you determine where to size and place the

active area.

7. Set the active area.

Adjust the active area graphically in the data viewer or enter the values manually in the fields.

The 2D view lets you adjust the size and position of the active area on the X and Z axis. The 3D view lets you adjust the size and position in the X, Y, and Z axis. For more information, see *Regions* on page 145.

8. Click the **Save** button in the **Sensor** panel.

Click the **Cancel** button to cancel setting the active area.


9. Save the job in the **Toolbar** by clicking the **Save** button .



Scanning devices are usually more accurate at the near end of their measurement range. If your application requires a measurement range that is small compared to the maximum measurement range of the sensor, mount the sensor so that the active area can be defined at the near end of the measurement range.

Transformations

The transformation settings determine how data is converted from sensor coordinates to system coordinates (for an overview on coordinate systems, see *Coordinate Systems* on page 41). Typically, transformations are set when you [align a sensor](#). However, you can also manually set values using the **Transformations** section of the **Active Area** tab on the [Sensor](#) panel.

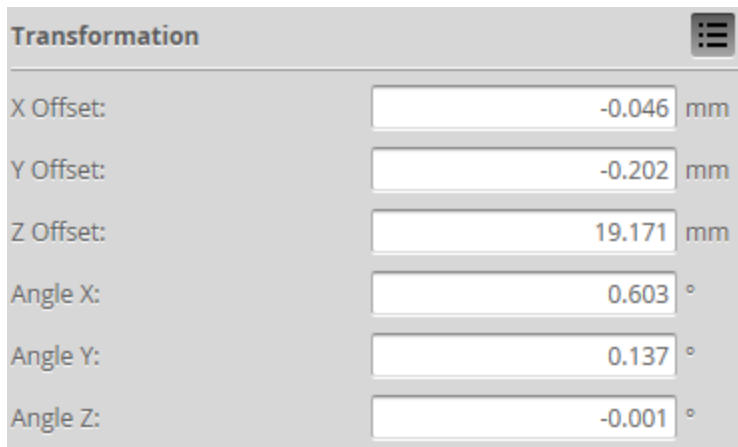

Transformation	
X Offset:	-0.046 mm
Y Offset:	-0.202 mm
Z Offset:	19.171 mm
Angle X:	0.603 °
Angle Y:	0.137 °
Angle Z:	-0.001 °

Parameter	Description
X Offset	Specifies the shift along the X axis. A positive value shifts the data to the right.
Y Offset	Specifies the shift along the Y axis.
Z Offset	Specifies the shift along the Z axis. A positive value shifts the data toward the sensor.
Angle X	Specifies the tilt around the X axis.
Angle Y	Specifies the tilt around the Y axis.
Angle Z	Specifies the tilt around the Z axis.

When applying the transformations, the object is first rotated around X, then Y, and then Z, and then the offsets are applied.

Setting **Angle X** or **Angle Z**, and to a lesser extent **Y Offset**, to a non-zero value increases CPU usage when scanning, which reduces the maximum scan speed.

Artifacts may appear in scan data when **Angle Z** or **Angle X** is set to a non-zero value if [encoder trigger spacing](#) is set too high (resulting in a low sampling rate).

To configure transformation settings:

1. Go to the **Scan** page.
2. Choose a mode other than Video mode in the **Scan Mode** panel.
If Video mode is selected, you will not be able to change the settings.
3. Expand the **Sensor** panel by clicking on the panel header.
4. Expand the Transformations area by clicking on the expand button ☰.
See the table above for more information.
5. Set the parameter values.
See the table above for more information.

The Y offset, X angle, and Z angle [transformations](#) cannot be non-zero when [Uniform Spacing](#) is unchecked. Therefore, when aligning a sensor using a bar alignment target with **Uniform Spacing** unchecked, set the **Degrees of Freedom** setting to **X, Z, Y Angle**, which prevents these transformations from being non-zero.


6. Save the job in the **Toolbar** by clicking the **Save** button .
7. Check that the transformation settings are applied correctly after the sensor is restarted.

Exposure


Exposure determines the duration of camera and light-source on-time. Longer exposures can be helpful to detect light on dark or distant surfaces, but increasing exposure time decreases the maximum speed. Different target surfaces may require different exposures for optimal results. Gocator sensors provide two exposure modes for the flexibility needed to scan different types of target surfaces.

Exposure Mode	Description
Single	Uses a single exposure for all objects. Used when the surface is uniform and is the same for all targets.
Multiple	Uses multiple exposures to create a single scan. Used when the target surface has a varying reflectance within a single scan (e.g., white and black).

Video mode lets you see how the light appears on the camera and identify any stray light or ambient light problems. When exposure is tuned correctly, the projected light should be clearly visible along the entire length of the viewer. If it is too dim, increase the exposure value; if it is too bright decrease exposure value.

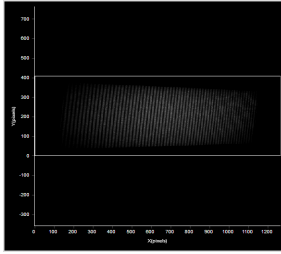


*Under-exposure:
Light pattern is not fully detected.
Increase the exposure value.*

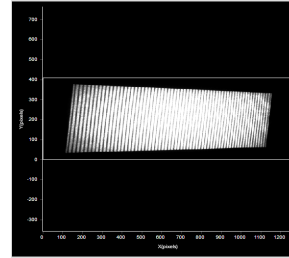


*Over-exposure:
Light pattern is saturated in the center.
Decrease the exposure value.*

When the Gocator is in Multiple exposure mode, select which exposure to view using the second drop-down box next to "View" in the data viewer. This drop-down is only visible in Video scan mode when the **Multiple** option is selected in the **Exposure** section in the **Sensor** panel.

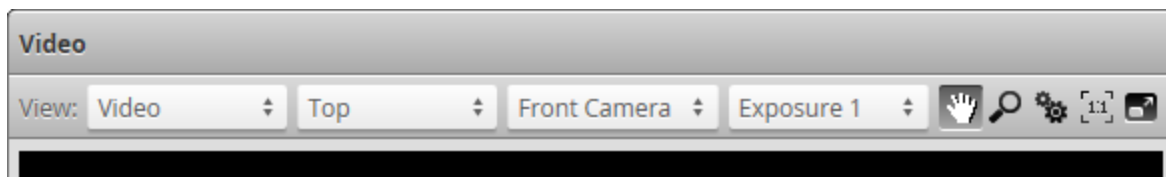

Single Exposure

The sensor uses a fixed exposure in every scan. Single exposure is used when the target surface is uniform and is the same for all targets.

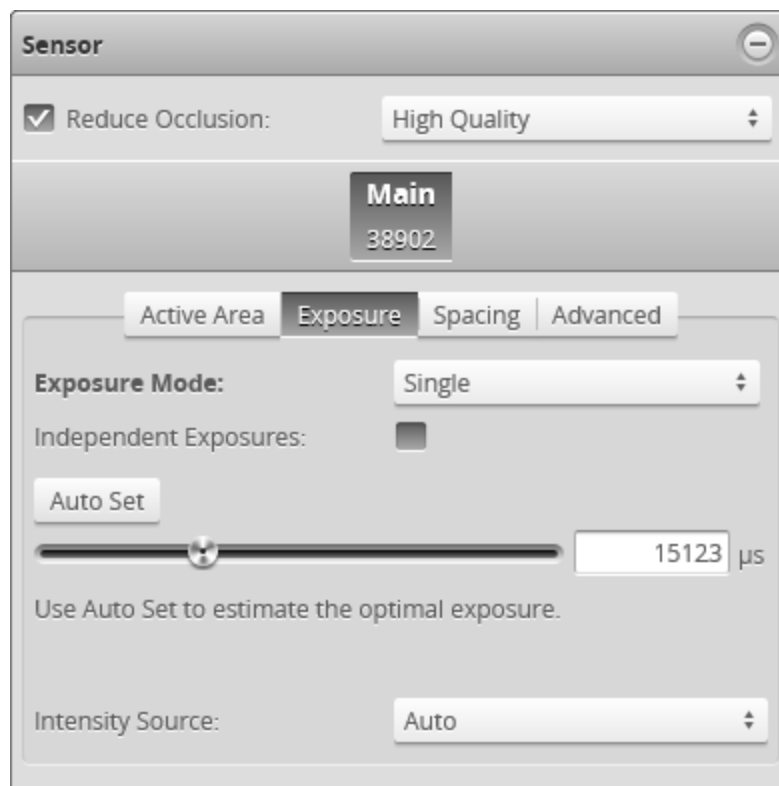

When the exposure mode is set to **Single**, you can optionally configure the sensor to allow setting exposure individually for each camera. This can be useful, for example, when reflections affect only camera: you could lower the exposure setting for that camera to improve scan data from that camera. (Automatic setting of exposure is not available when you this option is enabled.)

You can also choose which camera is used as the source for intensity data: if the front camera is typically affected by reflections off a part but not the back camera, you could choose the back camera as the source for intensity data.


To enable single exposure:

1. Place a representative target in view of the sensor.
The target surface should be similar to the material that will normally be measured.
2. Go to the **Scan** page.
3. Expand the **Sensor** panel by clicking on the panel header or the  button.
4. Click the **Exposure** tab.
5. Select **Single** from the **Exposure Mode** drop-down.
6. (Optional) Enable **Independent Exposure**.
7. Edit the exposure setting by using the slider or by manually entering a value.
You can automatically tune the exposure by pressing the **Auto Set** button, which causes the sensor to turn on and tune the exposure time. **Auto Set** is not available when **Independent Exposure** is enabled.
8. (Optional) Choose the source for intensity in **Intensity Source**.
Auto: The default value. Video from both cameras is used to create intensity data.
Front Camera: Video from the front camera is used to create intensity data.
Back Camera: Video from the back camera is used to create intensity data.
9. Run the sensor and check that 3D data acquisition is satisfactory.


When the sensor is set to [Video mode](#), you can use a special "line" focus pattern to aid in focusing the sensor. A focused sensor produces more accurate scans, which in turn results in more reliable measurements.

To use the focus pattern:

1. Place a representative target in view of the sensor.
The target surface should be similar to the material that will normally be measured.
2. Go to the **Scan** page and choose Video mode.
3. Expand the **Sensor** panel by clicking on the panel header or the  button.
4. Click the **Exposure** tab.
5. In **Pattern Sequence**, choose **Focus Pattern**.
A vertical line pattern is projected onto the surface (see next).
6. Move the sensor up and down until the dark lines are as sharp as possible.
In the following image, the vertical lines are blurry:

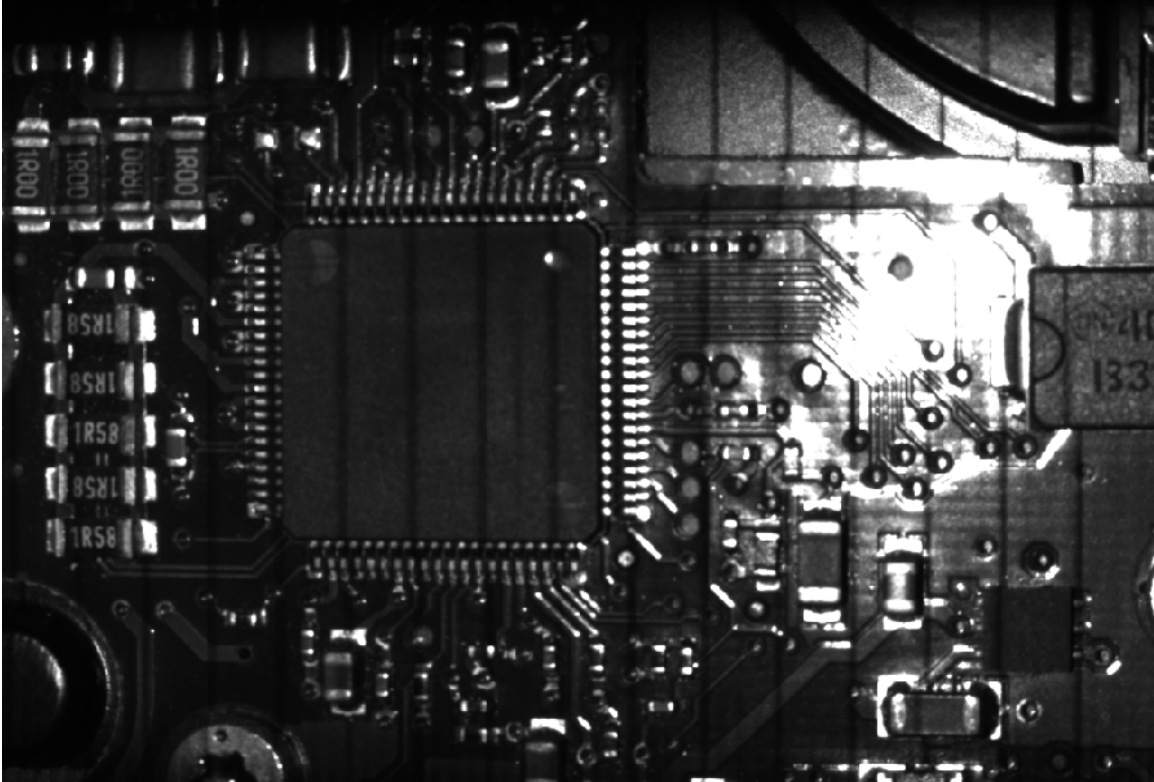

After focusing, the lines are more sharply defined:

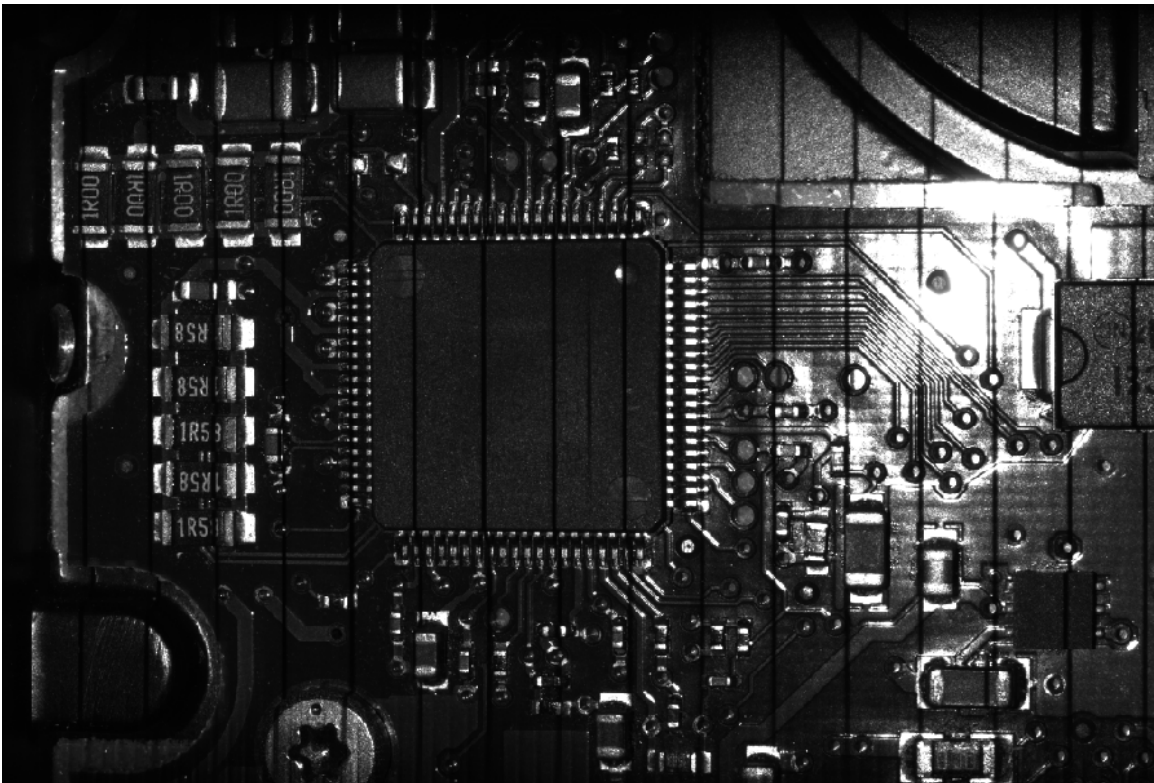


Multiple Exposure

The sensor combines data from multiple exposures to create a single 3D point cloud. Multiple exposures can be used to increase the ability to detect light and dark materials that are in the field of view simultaneously.

Up to three exposures can be defined with each set to a different exposure level. For each exposure, the sensor will perform a complete scan at the current frame rate making the effective frame rate slower. For example, if two exposures are selected, then the speed will be half of the single exposure frame rate. The sensor will perform a complete multi-exposure scan for each external input.

The resulting 3D point cloud is a composite created by combining data collected with different exposures.

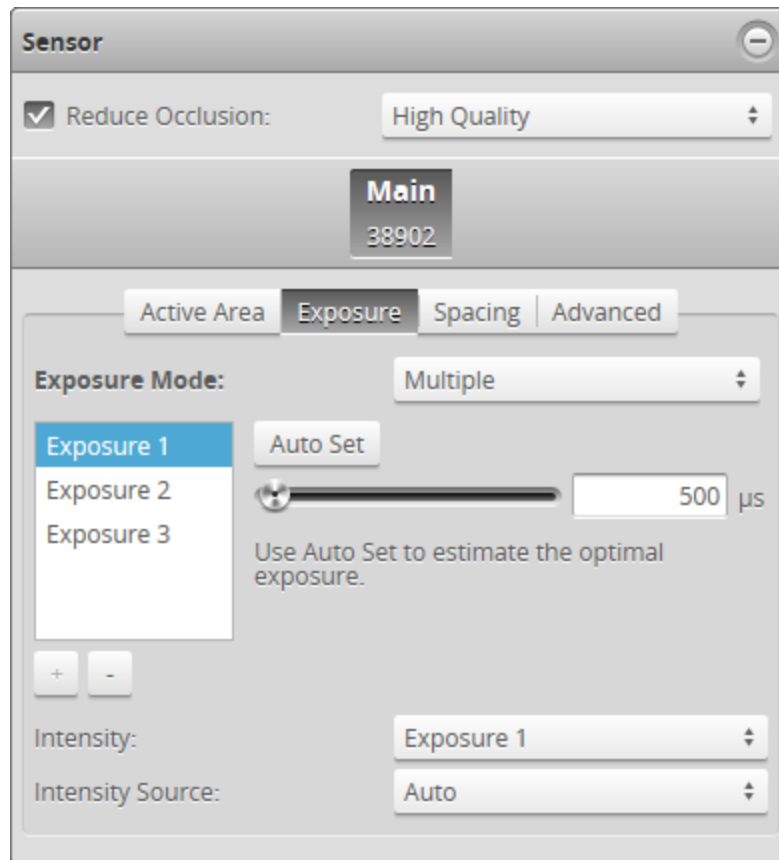

If you have enabled intensity in the **Scan Mode** tab, you can use the **Intensity** setting to choose which of the exposures Gocator uses for acquiring intensity data. This lets you choose the exposure that produces the best image for intensity data.

You can also choose which camera is used as the source for intensity data using the **Intensity Source** setting: if the front camera is typically affected by reflections off a part but not the back camera, you could choose the back camera as the source for intensity data.

To enable multiple exposure:


1. Go to the **Scan** page.
2. Expand the **Sensor** panel by clicking on the panel header or the  button.

3. Click the **Exposure** tab.
4. Select **Multiple** from the **Exposure Mode** drop-down.
5. Click the  button to add an exposure step.
Up to a maximum of three exposure settings can be added.
To remove an exposure, select it in the exposure list and click the  button
6. Set the exposure level for each exposure to make the Gocator's camera less or more sensitive, as required.
7. If **Acquire Intensity** is enabled in **Scan Mode**, select the exposure that is used to capture the intensity output.
8. Run the sensor and check that 3D data acquisition is satisfactory.
If 3D data acquisition is not satisfactory, adjust the exposure values manually. Switch to **Video** mode to use video to help tune the exposure; see *Exposure* on page 92 for details.


When the sensor is set to [Video mode](#), you can use a special "line" focus pattern to aid in focusing the sensor. A focused sensor produces more accurate scans, which in turn results in more reliable measurements.

To use the focus pattern:

1. Place a representative target in view of the sensor.
The target surface should be similar to the material that will normally be measured.
2. Go to the **Scan** page and choose Video mode.
3. Expand the **Sensor** panel by clicking on the panel header or the  button.
4. Click the **Exposure** tab.
5. In **Pattern Sequence**, choose **Focus Pattern**.
A vertical line pattern is projected onto the surface (see next).
6. Move the sensor up and down until the dark lines are as sharp as possible.
In the following image, the vertical lines are blurry:

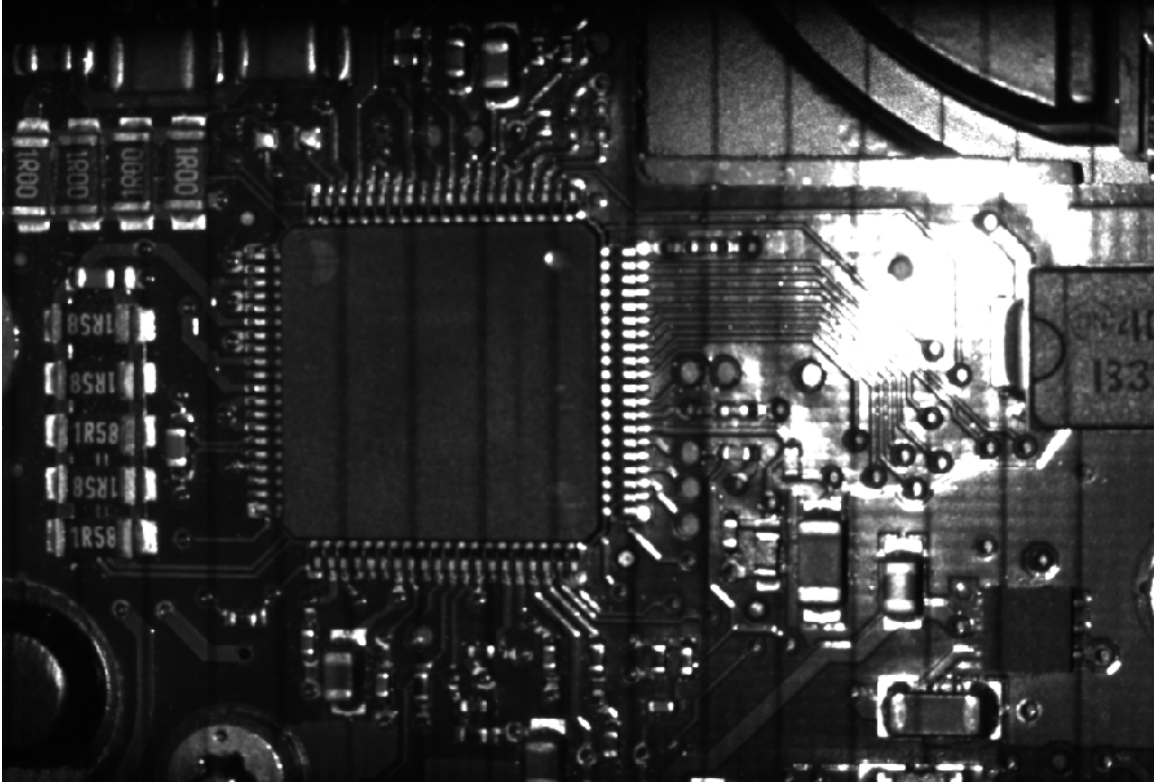


After focusing, the lines are more sharply defined:

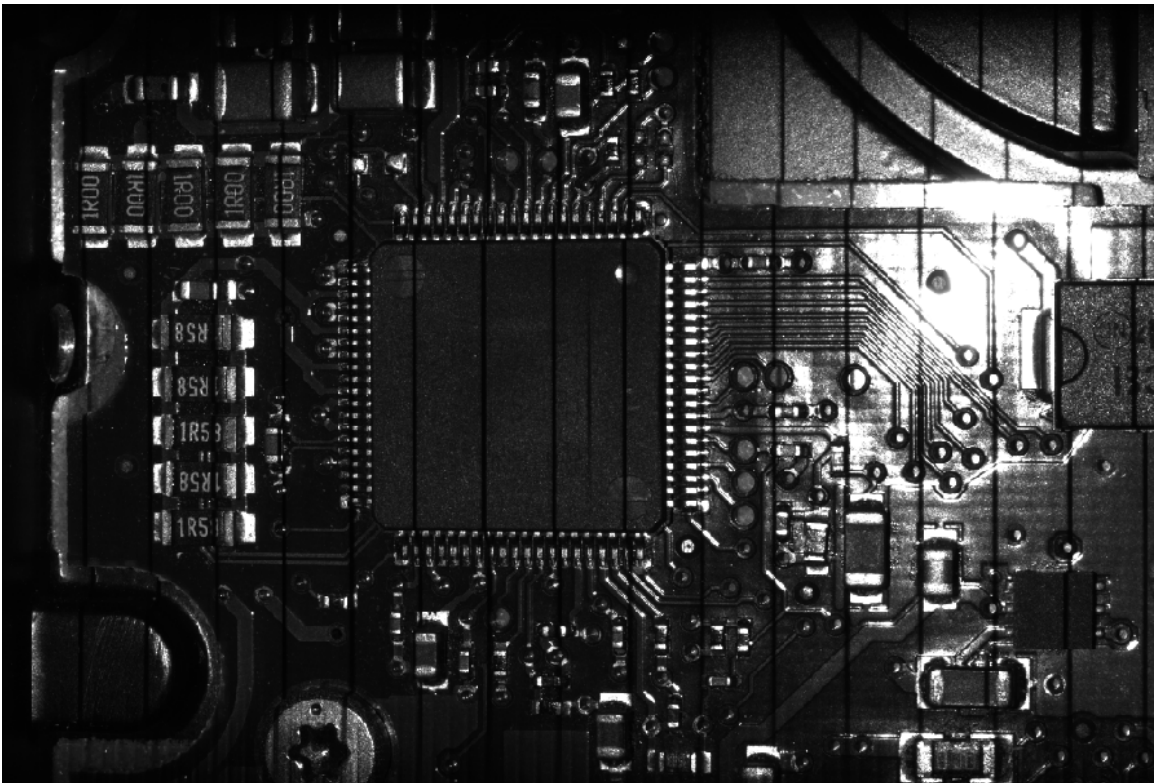

Spacing

The **Spacing** tab lets you configure the spacing interval.

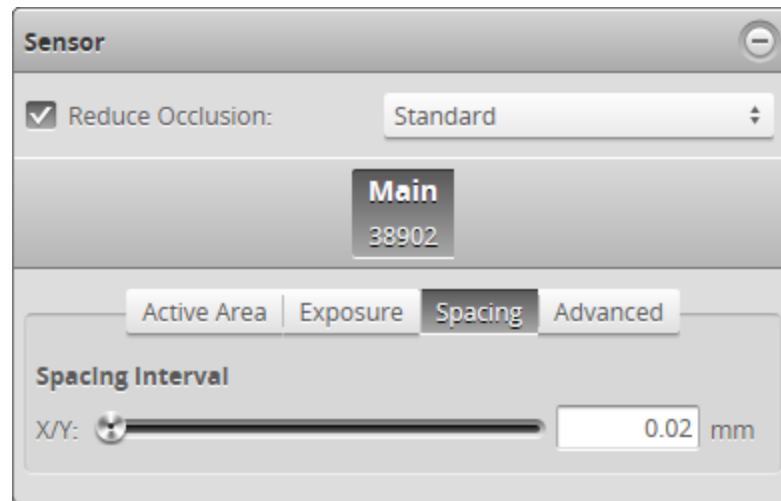

Spacing Interval


Spacing interval is the spacing between data points in resampled data. A larger interval creates scans with lower X/Y resolution, reduces CPU usage, and potentially increases the maximum frame rate. A larger interval also reduces the data output rate. For more information on resampled data, see *Resampling* on page 44.

To configure the spacing interval:

1. Go to the **Scan** page.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure the spacing interval.
3. Expand the **Sensor** panel by clicking on the panel header or the  button.
4. Click the button corresponding to the sensor you want to configure.
The button is labeled **Top**, **Bottom**, **Top-Left**, or **Top-Right**, depending on the system.
Spacing is configured separately for each sensor.
5. Click the **Spacing** tab.
6. Do one of the following:
7. Select a spacing interval level.
8. Save the job in the **Toolbar** by clicking the **Save** button .

Advanced

The **Advanced** tab contains settings to configure camera gain and material characteristics.

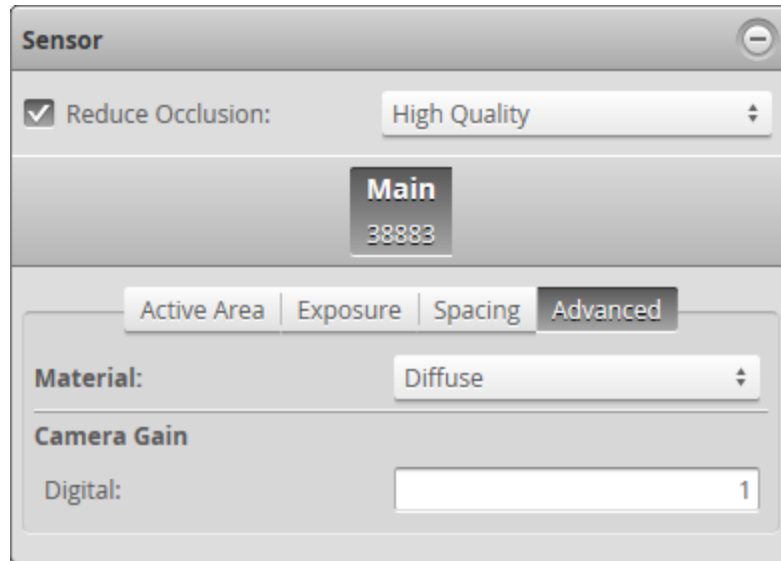


To configure advanced settings:

1. Go to the **Scan** page.
2. Switch to Video mode.
Using Video mode while configuring the settings lets you evaluate their impact.
3. Expand the **Sensor** panel by clicking on the panel header or the  button.
4. Click on the **Advanced** tab.
5. Configure material characteristics and camera gain.
For more information, see *Material* below and *Camera Gain* on the next page.
6. Save the job in the **Toolbar** by clicking the **Save** button .
7. Check that scan data is satisfactory.


Material

Data acquisition can be configured to suit different types of target materials. For many targets, changing the setting is not necessary, but it can make a great difference with others.

You can select preset material types in the **Materials** setting under the **Advanced** tab. The **Diffuse** material option is suitable for most materials. The **Interreflective** material option is useful with targets whose surface may show reflections from other surfaces in the scanned area, for example inside a countersunk hole or on surfaces with concave features.

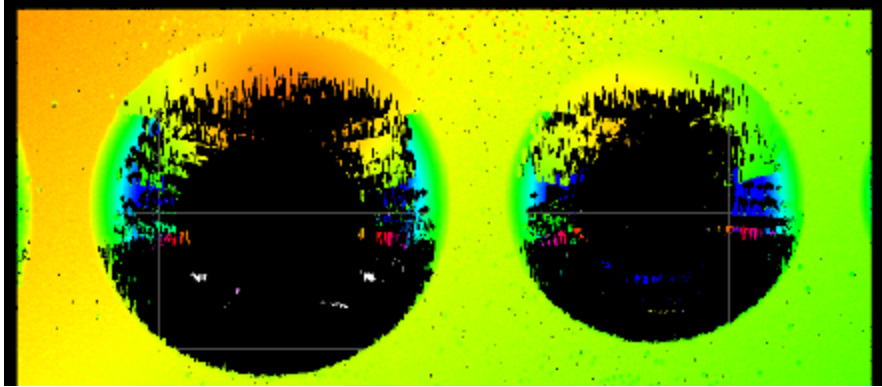

Countersunk holes with Material set to Diffuse

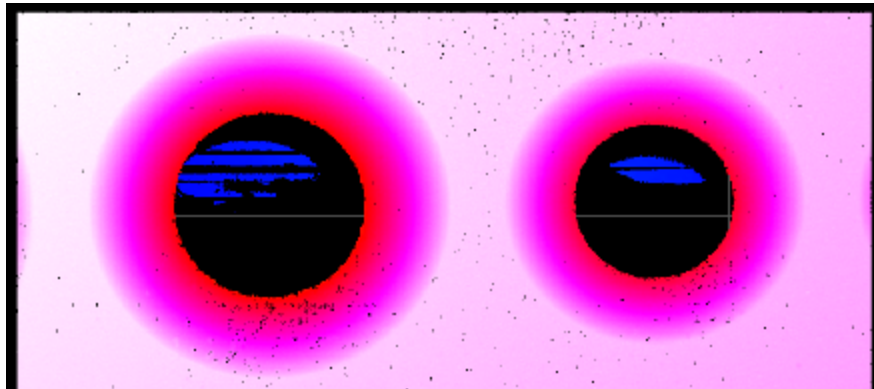

Countersunk holes with Material set to Interreflective



Currently, choosing **Custom** under the **Material** setting displays options identical to the **Interreflective** and **Diffuse** options under **Material**. Further customizations will be provided in the future.

Camera Gain

You can set camera gain to improve data acquisition.

Setting	Description
Camera Gain	Digital camera gain can be used when the application is severely exposure limited, yet dynamic range is not a critical factor.

Alignment

Alignment procedures are required to compensate for sensor mounting inaccuracies or to set a Z (height) reference plane.



Gocator sensors are pre-calibrated and ready to deliver data in engineering units (mm) out of the box. Alignment procedures do not affect sensor calibration.

A Gocator can be in one of two alignment states: Unaligned and Aligned. An indicator on the **Alignment** panel display UNALIGNED or ALIGNED, depending on the Gocator's state.

Alignment State

State	Explanation
Unaligned	The sensor or sensor system is not aligned. Data points are reported in sensor coordinates.
Aligned	The sensor is aligned using the alignment procedure (described below) or by manually modifying the values under Transformation in the Sensor tab on the Scan page (for more information, see <i>Transformations</i> on page 91). Data points are reported in system coordinates.

Once the alignment procedure has completed, the derived transformation values are displayed under **Transformations** in the **Sensor** panel.


Alignment Types

Gocator snapshot sensors only support Stationary alignment.

Type	Description
Stationary	Stationary is used when the alignment target does not move. This type of alignment compensates for Z offsets and X and Y angles, and optionally X and Y offsets and Z angle.

Aligning Sensors

Alignment is configured and performed using the **Alignment** panel.

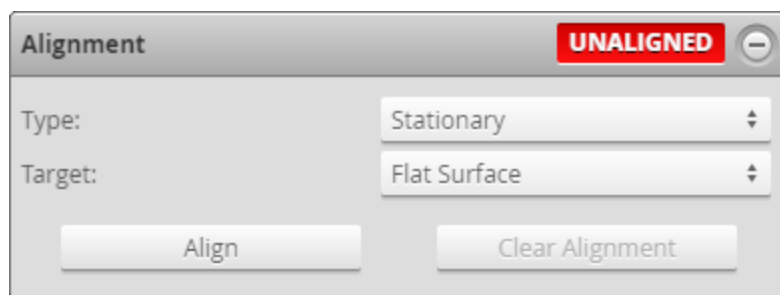

To prepare for alignment:

1. Choose an alignment reference in the **Manage** page if you have not already done so. For more information, see *Alignment Reference* on page 74.
2. Go to the **Scan** page.
3. Choose a mode other than Video mode in the **Scan Mode** panel.
4. Expand the **Alignment** panel by clicking on the panel header or the  button.
5. Ensure that all sensors have a clear view of the target surface. Remove any irregular objects from the sensor's field of view that might interfere with alignment.

To perform stationary alignment:

1. In the **Alignment** panel, select **Stationary** as the **Type**.
2. Clear the previous alignment if present.
Press the **Clear Alignment** button to remove an existing alignment.
3. Select an alignment **Target**.
4. Click the **Align** button.
The sensors will start, and the alignment process will take place. Alignment is performed simultaneously for all sensors. If the sensors do not align, check and adjust the exposure settings (page 92).



Alignment uses the exposure defined for single exposure mode, regardless of the current exposure mode.

5. Check the alignment results under **Transformation** in the **Active Area** tab in the **Sensor** panel.

Transformation	
X Offset:	-0.816 mm
Z Offset:	-11.702 mm
Angle:	-3.986 °

Clearing Alignment

Alignment can be cleared to revert the sensor to sensor coordinates.

Alignment ALIGNED ⊖

Type: Stationary

Target: Flat Surface

Align

Clear Alignment

To clear alignment:

1. Go to the **Scan** page.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, tools will not be available in the **Measure** panel.
3. Expand the **Alignment** panel by clicking on the panel header or the ⊕ button.
4. Click the **Clear Alignment** button.
The alignment will be erased and sensors will revert to using sensor coordinates.

Filters

Filters are used to post-process scan data along the X or Y axis to remove noise or clean it up *before* it is output or is used by measurement tools.

In some situations, such as when [Uniform Spacing](#) is disabled or when a sensor does not support filters, the filters panel is not displayed.

The following types of filters are supported:


Filter	Description
Gap Filling	Fills in missing data caused by occlusions using information from the nearest neighbors. Gap filling also fills gaps where no data is detected, which can be due to the surface reflectivity, for example dark or specular surface areas, or to actual gaps in the surface.
Median	Substitutes the value of a data point with the median within a specified window around the data point.
Smoothing	Applies moving window averaging to reduce random noise.
Decimation	Reduces the number of data points.

Filters are applied in the order displayed in the table above. The filters are configured in the **Filters** panel on the **Scan** page.

Gap Filling

Gap filling works by filling in missing data points using either the lowest values from the nearest neighbors or linear interpolation between neighboring values (depending on the Z difference between neighboring values), in a specified X or Y window. The sensor can fill gaps along both the X axis and the Y axis.

If both X and Y gap filling are enabled, missing data is filled along the X and Y axes at the same time, using the available neighboring data.

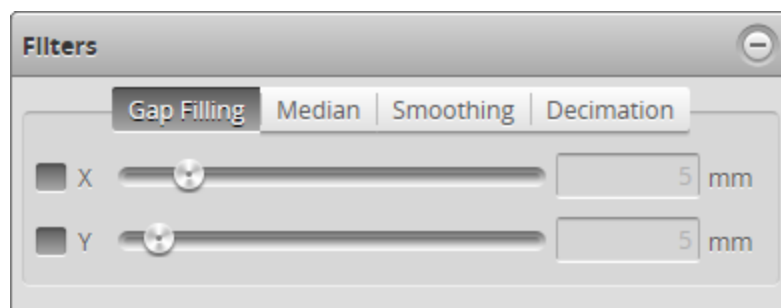

To configure X or Y gap filling:

1. Go to the **Scan** page.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure gap filling.
3. Expand the **Filters** panel by clicking on the panel header or the  button.


- Click on the **Gap Filling** tab.
- Enable the **X** or **Y** setting and select the maximum width value.
The value represents the maximum gap width that the Gocator will fill. Gaps wider than the maximum width will not be filled.
- Save the job in the **Toolbar** by clicking the **Save** button .
- Check that the scan data is satisfactory.

Median

The Median filter substitutes the value of a data point with the median calculated within a specified window around the data point.



Missing data points will not be filled with the median value calculated from data points in the neighbourhood.

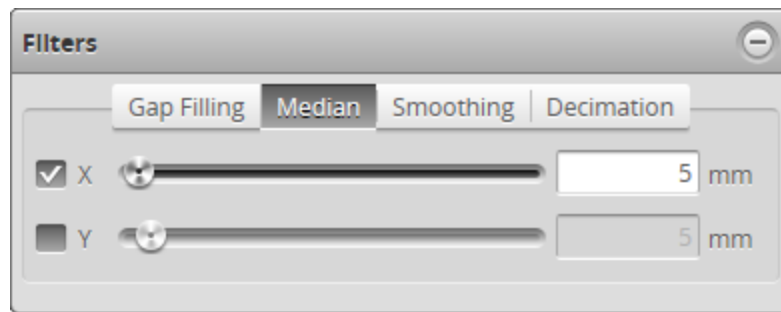

To configure X or Y median:

- Go to the **Scan** page.
- Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure the median filter.
- Expand the **Filters** panel by clicking on the panel header or the  button.
- Click on the **Median** tab.
- Enable the **X** or **Y** setting and select the maximum width value.
- Save the job in the **Toolbar** by clicking the **Save** button .
- Check that the scan data is satisfactory.


Smoothing

Smoothing works by substituting a data point value with the average value of that data point and its nearest neighbors within a specified window. Smoothing can be applied along the X axis or the Y axis. X smoothing works by calculating a moving average across samples along the X axis. Y smoothing works by calculating a moving average along the Y axis.

If both X and Y smoothing are enabled, the data is smoothed along X axis first, then along the Y axis.



Missing data points will not be filled with the mean value calculated from data points in the neighbourhood.

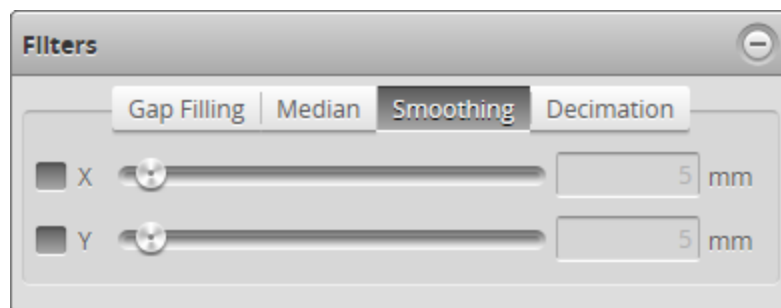


To configure X or Y smoothing:

1. Go to the **Scan** page.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure smoothing.
3. Expand the **Filters** panel by clicking on the panel header or the  button.
4. Click on the **Smoothing** tab.
5. Enable the **X** or **Y** setting and select the averaging window value.
6. Save the job in the **Toolbar** by clicking the **Save** button .
7. Check that the scan data is satisfactory.

Decimation

Decimation reduces the number of data points along the X or Y axis by choosing data points at the end of a specified window around the data point. For example, by setting X to .2, only points every .2 millimeters will be used.

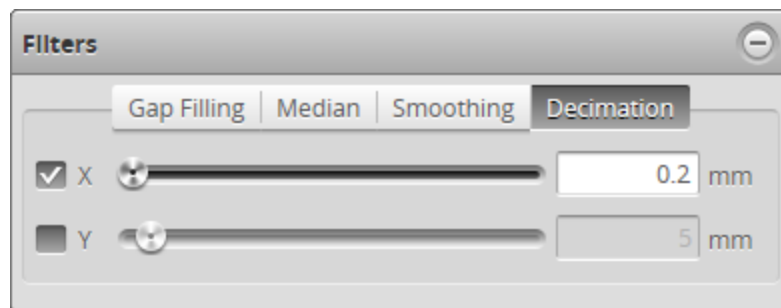


To configure X or Y decimation:

1. Go to the **Scan** page.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure the decimation filter.

3. Expand the **Filters** panel by clicking on the panel header or the  button.
4. Click on the **Decimation** tab.
5. Enable the **X** or **Y** setting and select the decimation window value.
6. Save the job in the **Toolbar** by clicking the **Save** button .
7. Check that the scan data is satisfactory.

Part Detection

Multiple parts can be detected from a single surface and will be individually tracked.

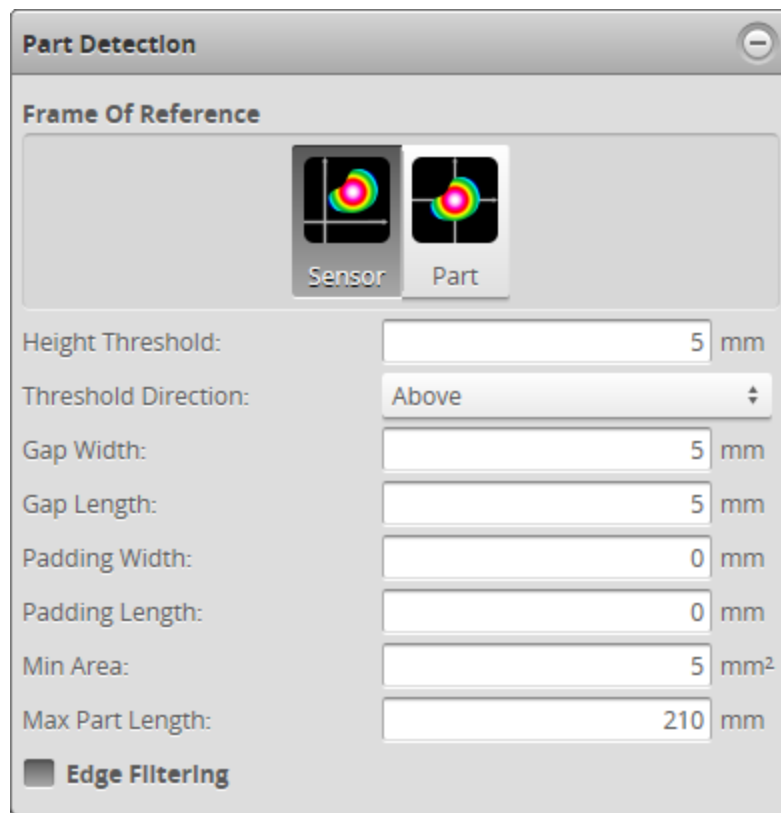

Part Detection

Frame Of Reference

Sensor Part

Height Threshold: 5 mm

Threshold Direction: Above

Gap Width: 5 mm

Gap Length: 5 mm

Padding Width: 0 mm

Padding Length: 0 mm

Min Area: 5 mm²

Max Part Length: 210 mm

☐ Edge Filtering

The following settings can be tuned to improve the accuracy and reliability of part detection.

Setting	Description
Height Threshold	Determines the height threshold for part detection. The setting for Threshold Direction determines if parts should be detected above or below the threshold. Above is typically used to prevent the belt surface from being detected as a part when scanning objects on a conveyor.
Threshold Direction	Determines if parts should be detected above or below the height threshold.
Gap Width	Determines the minimum separation between objects on the X axis. If parts are closer than the gap interval, they will be merged into a single part.

Setting	Description
Gap Length	Determines the minimum separation between objects on the Y axis. If parts are closer than the gap interval, they will be merged into a single part.
Padding Width	Determines the amount of extra data on the X axis from the surface surrounding the detected part that will be included. This is mostly useful when processing part data with third-party software such as HexSight, Halcon, etc.
Padding Length	Determines the amount of extra data on the Y axis from the surface surrounding the detected part that will be included. This is mostly useful when processing part data with third-party software such as HexSight, Halcon, etc.
Min Area	Determines the minimum area for a detected part. Set this value to a reasonable minimum in order to filter out small objects or noise.
Max Part Length	Determines the maximum length of the part object. When the object exceeds the maximum length, it is automatically separated into two parts. This is useful to break a long object into multiple sections and perform measurements on each section.
Frame of Reference	Determines the coordinate reference for surface measurements.

Sensor

When **Frame of Reference** is set to **Sensor**, the sensor's frame of reference is used.

When set to **Sensor**, all measurement values are relative to the sensor's field of view in X and relative to the encoder zero position in Y.

Part

When **Frame of Reference** is set to **Part**, all measurements except Bounding Box X and Y are relative to the center of the bounding box of the part. For Bounding Box X and Y, the measurement values are always relative to the sensor frame of reference (see *Bounding Box* on page 213).

Edge Filtering	See <i>Edge Filtering</i> below.
----------------	----------------------------------


To set up part detection:

1. Go to the **Scan** page and choose **Surface** in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure part detection.
2. Expand the **Part Detection** panel by clicking on the panel header or the  button.
3. If necessary, check the **Enabled** option.
When **Generation** is set to **Continuous**, part detection is always enabled.
4. Adjust the settings.
See the part detection parameters above for more information.


Edge Filtering

Part scans sometimes contain noise around the edges of the target. This noise is usually caused by the sensor's light being reflected off almost vertical sides, rounded corners, etc. Edge filtering helps reduce edge noise in order to produce more accurate and repeatable volume and area measurements, as well as


to improve positioning of relative measurement regions. Optionally, the **Preserve Interior Feature** setting can be used to limit filtering to the outside edges of the target.

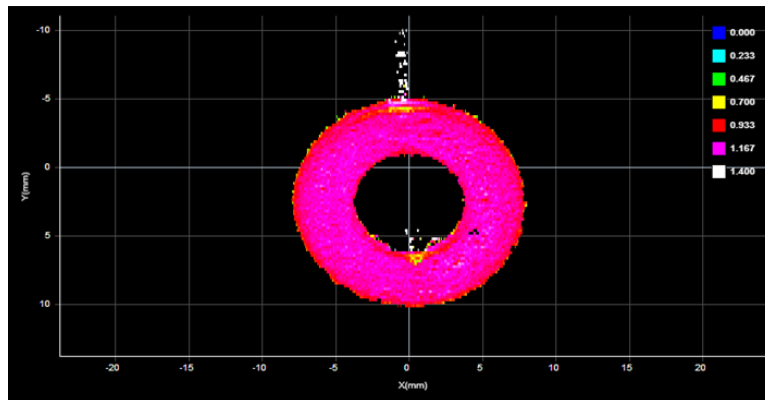


Edge Filtering disabled (scan shows reflection noise)

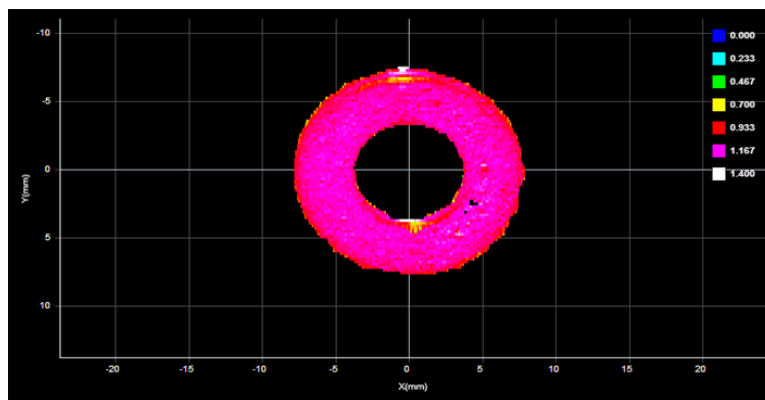

Edge Filtering enabled (reflection noise eliminated or reduced)

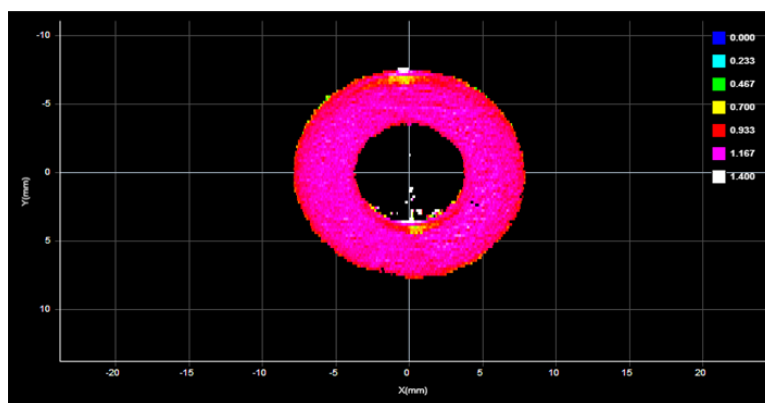

Edge Filtering enabled, Preserve Interior Feature enabled

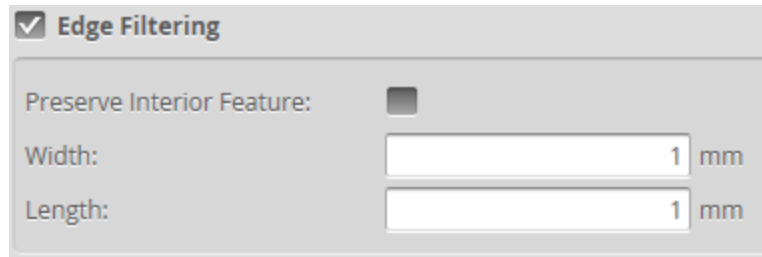The image shows a software configuration panel titled "Edge Filtering" with a checked checkbox. Below the title, there is a "Preserve Interior Feature:" label followed by an unchecked checkbox. Underneath, there are two input fields: "Width:" and "Length:", both containing the value "1" and followed by "mm".

☒ **Edge Filtering**

Preserve Interior Feature: ☐

Width: mm

Length: mm

To configure edge filtering:


1. Go to the **Scan** page and choose **Surface** in the **Scan Mode** panel.
If this mode is not selected, you will not be able to configure part detection.
2. Expand the Part Detection panel by clicking on the panel header or the  button and enable part detection if necessary.
3. Check the **Edge Filtering** checkbox to enable edge filtering.
4. Configure the **Width** and **Length** settings.
The **Width** and **Length** settings represent the size of the filter on the X axis and the Y axis, respectively.
5. Set the **Preserve Interior Feature** setting if necessary.
The **Preserve Interior Feature** setting limits filtering to the outside edges of the target.

Data Viewer

The data viewer can display images in a 2D view and height map (resampled point cloud) or intensity in 2D or 3D views, in addition to sections. The data viewer changes depending on the current operation mode and the panel that has been selected. Use the drop down list at the top-left corner to select the data source to view. The available data sources depend on the operation mode settings.

Data Viewer Controls

The data viewer is controlled by mouse clicks and by the buttons on the display toolbar. The mouse wheel can also be used for zooming in and out.

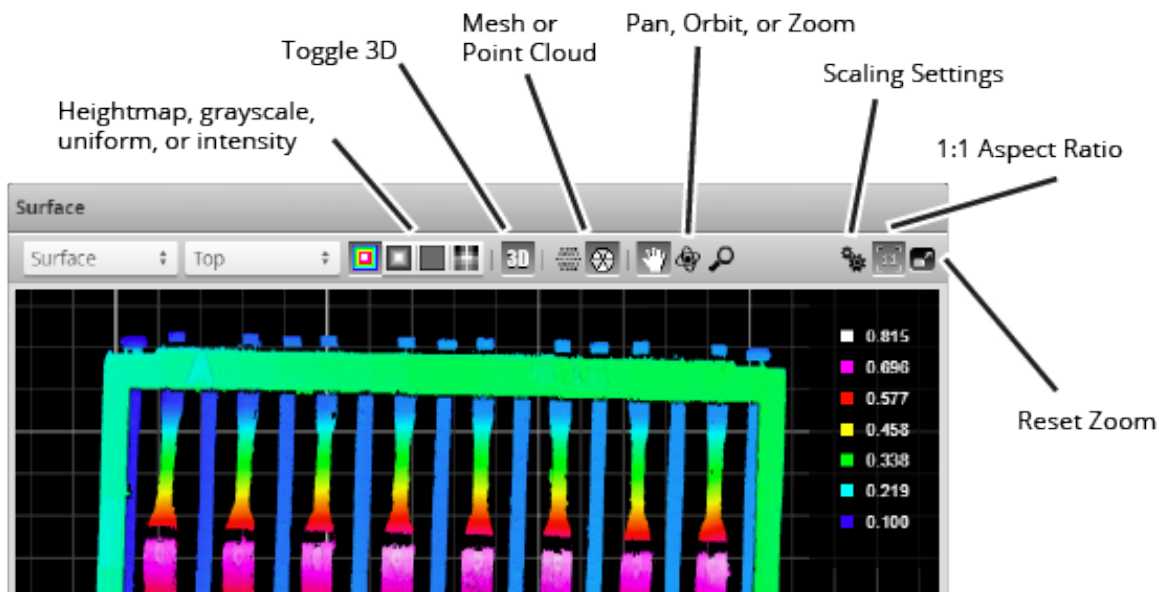

For more information on the kinds of data displayed in Surface mode, see *Surface Mode* on page 114.

Video Mode

In Video mode, the data viewer displays images directly from the sensor's camera or cameras.


In this mode, you can configure the data viewer to display exposure, spot, and dropout information that can be useful in properly setting up the system for scanning.

Exposure Information

In Video mode, you can display exposure-related information. This information can help you correctly adjust the [exposure settings](#).

Exposures

If you have set **Exposure Mode** to **Multiple**, and have set more than one exposure, a drop-down at the top of the data viewer lists the available exposures. Choosing an exposure changes the view of the data viewer to that exposure.

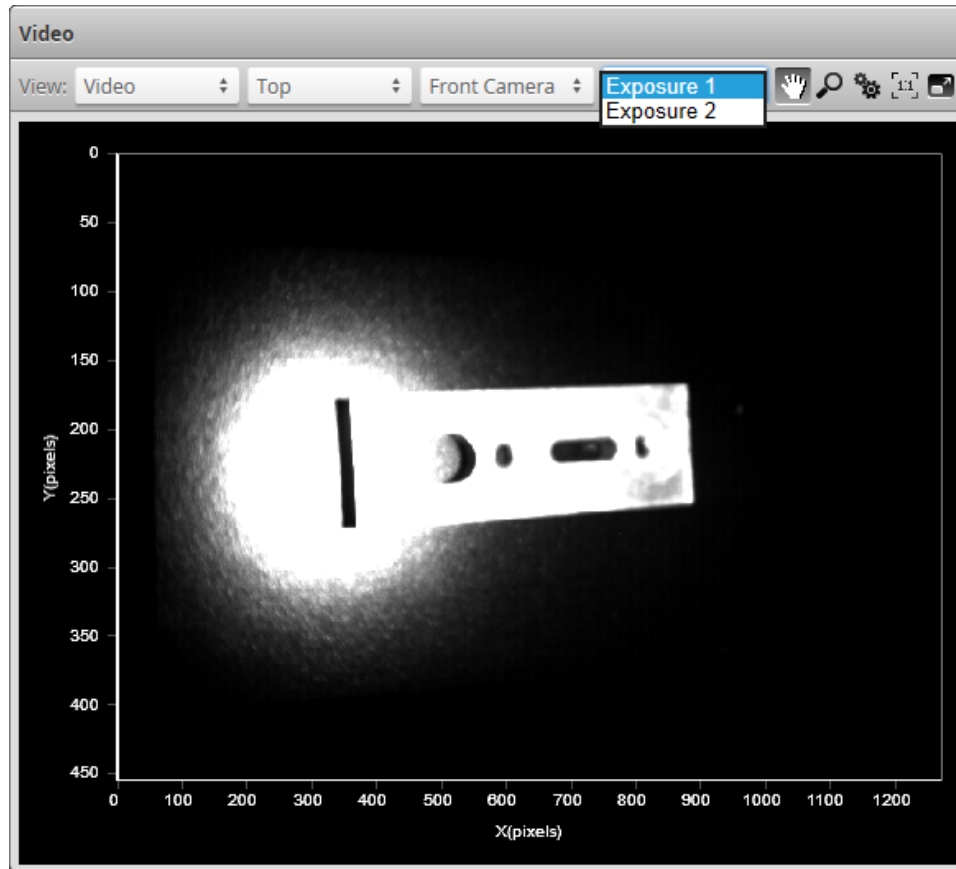


For details on setting exposure in the **Exposure** tab in the **Sensor** panel, see *Exposure* on page 92.

To select the exposure view of the display:

1. Go to the **Scan** page and choose **Video** mode in the **Scan Mode** panel.
2. Select the camera view in the data viewer.
Use the first drop-down list next to **View** at the top of the data viewer to select **Front Camera** or **Back Camera**.
3. Select the exposure.
Use the second drop-down list next to **View** at the top of the data viewer to select the exposure.

Overexposure and Underexposure

You can display a color exposure overlay on the video image to help set the correct exposure.

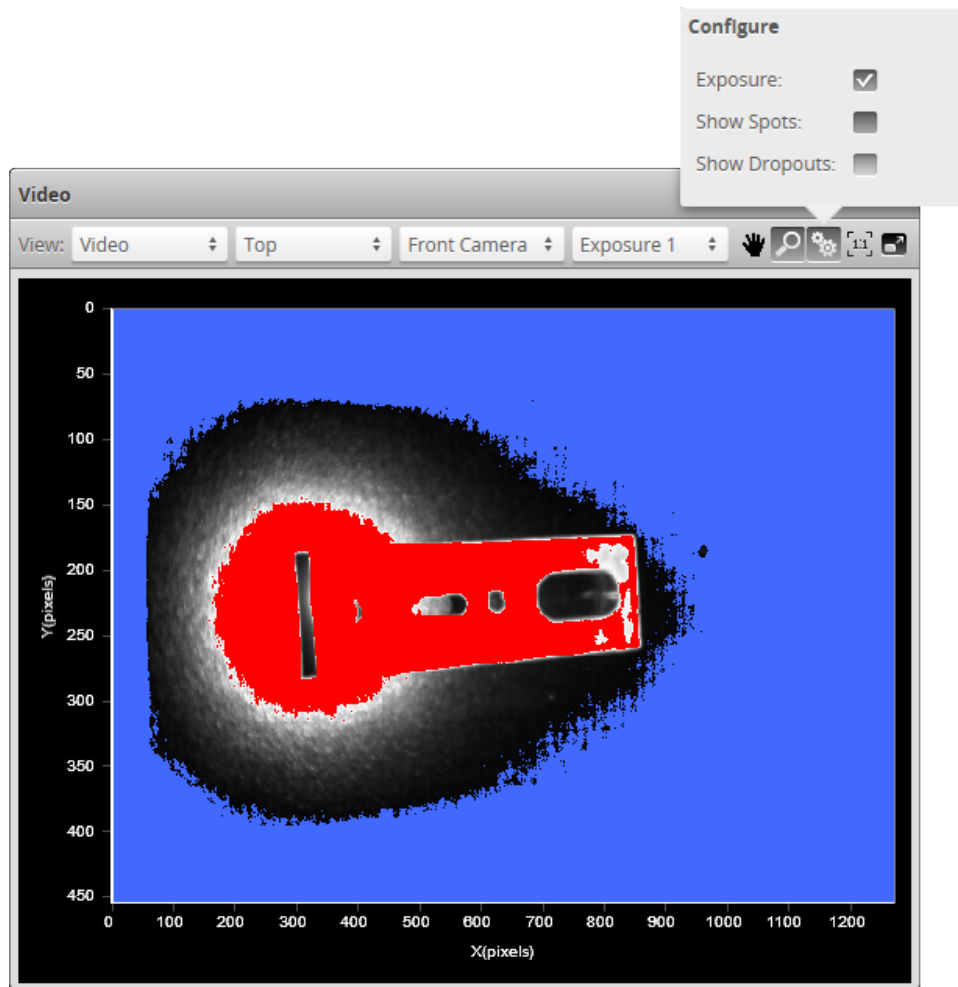

The **Exposure** setting uses the following colors:

- Blue: Indicates background pixels ignored by the sensor.
- Red: Indicates saturated pixels.

Correct tuning of exposure depends on the reflective properties of the target material and on the requirements of the application. Settings should be carefully evaluated for each application.


The Gocator 3x00 cannot generate 3D points in over-saturated (areas indicated with red) or in under-exposed areas (indicated with blue). If it's not possible to set a single exposure to capture the entire object target without red areas appearing in the image, the **Multiple** exposure feature should be enabled. Use the drop-down selection box to view each exposure and tune one high exposure for dark areas on the target and one low exposure for bright areas on the target. Note that multiple exposures reduce the maximum speed the sensor can run at.

To display an overlay:


1. Go to the **Scan** page and choose **Video** mode in the **Scan Mode** panel.
2. Check **Exposure** at the top of the data viewer.

Surface Mode

When the Gocator is in Surface [scan mode](#), the data viewer can display height maps, sections, and intensity images. You can select the data to display from the first drop-down.

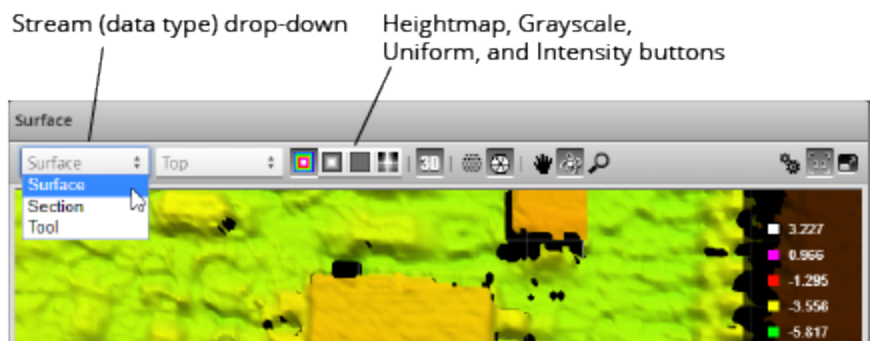

Data Type Option or Button	Description
Surface	Displays surface data received from the sensor's scan engine.
Section	If any sections have been defined, displays the section selected in the Sections drop-down. (Only available in 2D view.)
Tool	Displays data from tools capable of producing "tool data" output (such as Surface Stitch or Surface Track). When you select Tool , a second drop-down is displayed next to the first, which lets you choose among the available data.

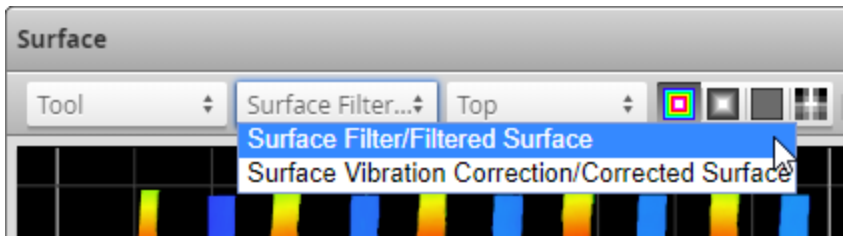


For more information on tool data output, see *Tool Data* on page 51.


Heightmap button 	In 2D view, displays the pseudo color height map. In 3D view, overlays the 2D pseudo color height map on the 3D model.
Grayscale button 	In 2D view, displays the grayscale height map. In 3D view, overlays the grayscale height map on the 3D model.
Uniform button 	Overlays a uniform shaded surface on the 3D model. (Only available in 3D view.)
Intensity button 	In 2D view, displays the intensity. In 3D view, overlays the intensity map on the 3D model. (Acquire Intensity must be checked in the Scan Mode panel for this button to be visible.)



2D viewer with height map overlay

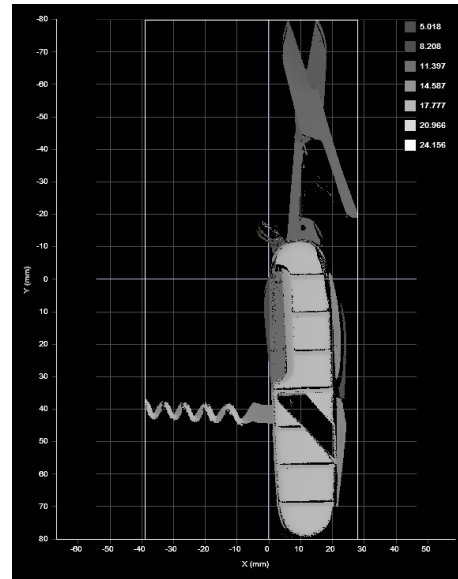


2D viewer with grayscale overlay

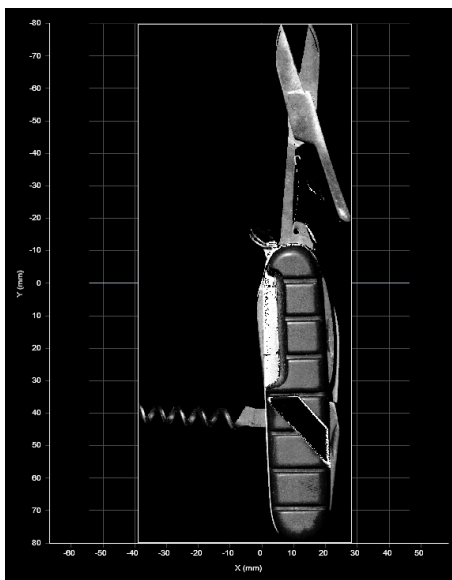


2D viewer with intensity overlay


Clicking the **3D** button toggles between the 2D and 3D viewer. The 3D model is overlaid with the information that corresponds to the selected **View** option.

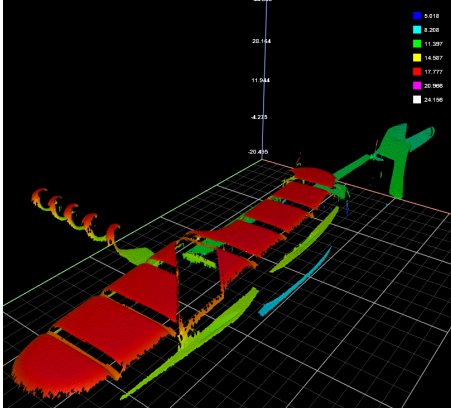


3D viewer with height map overlay

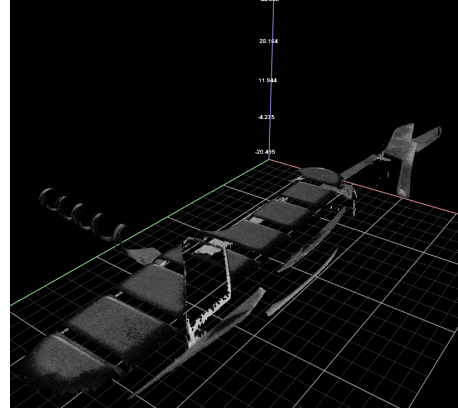

3D viewer with grayscale overlay

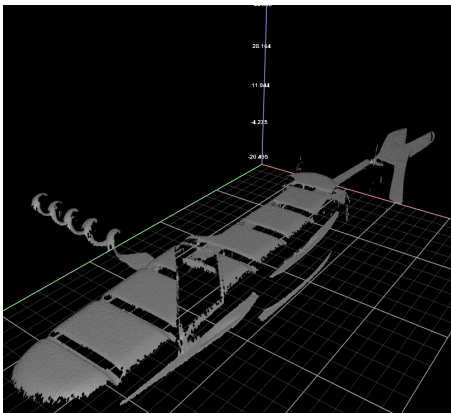

3D viewer with uniform overlay

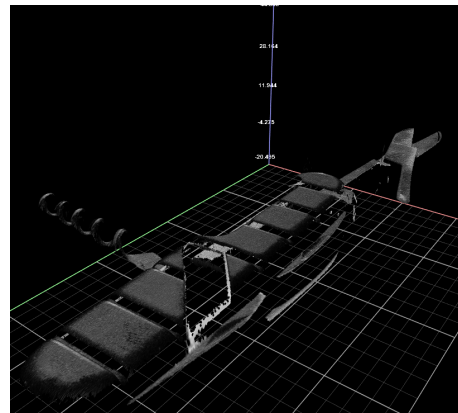

3D viewer with uniform overlay

In 3D mode, you can choose how the data viewer renders the model:


Rendering Mode	Description
Point Cloud (default) 	Renders 3D models using point clouds. Useful in scan data that contains noise around edges, and shows hidden structure.
Mesh 	Renders 3D models using "meshing," connecting 3D point clouds with polygons.

To manually select the display type and the display view in the Scan page:

1. Go to the **Scan** page.
2. Select the View options in the data viewer.
Heightmap, Grayscale, Uniform, or Intensity can be selected from the left drop-down list.

Height Map Color Scale

Height maps are displayed in pseudo-color. The height axis (Z) is color-coded. The scaling of the height map can be adjusted.

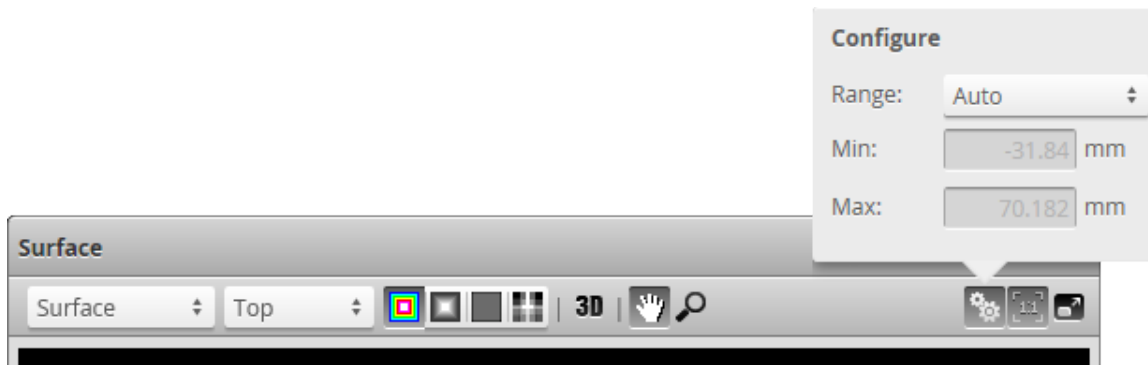


To change the scaling of the height map:


1. Select **Heightmap** from the **View** drop-down in the data viewer.
2. Click the **Scaling** button.
 - To automatically set the scale, choose **Auto** in the **Range** drop-down.
 - To automatically set the scale based on a user-selected sub-region of the heightmap, choose **Auto - Region** in the **Range** drop-down and adjust the yellow region box in the data viewer to the desired location and size.
 - To manually set the scale, choose the **Manual** in the **Range** drop-down and enter the minimum and maximum height to which the colors will be mapped.

Sections

When the Gocator is in Surface scan mode, the data viewer can display [sections](#) (profiles extracted from surfaces).

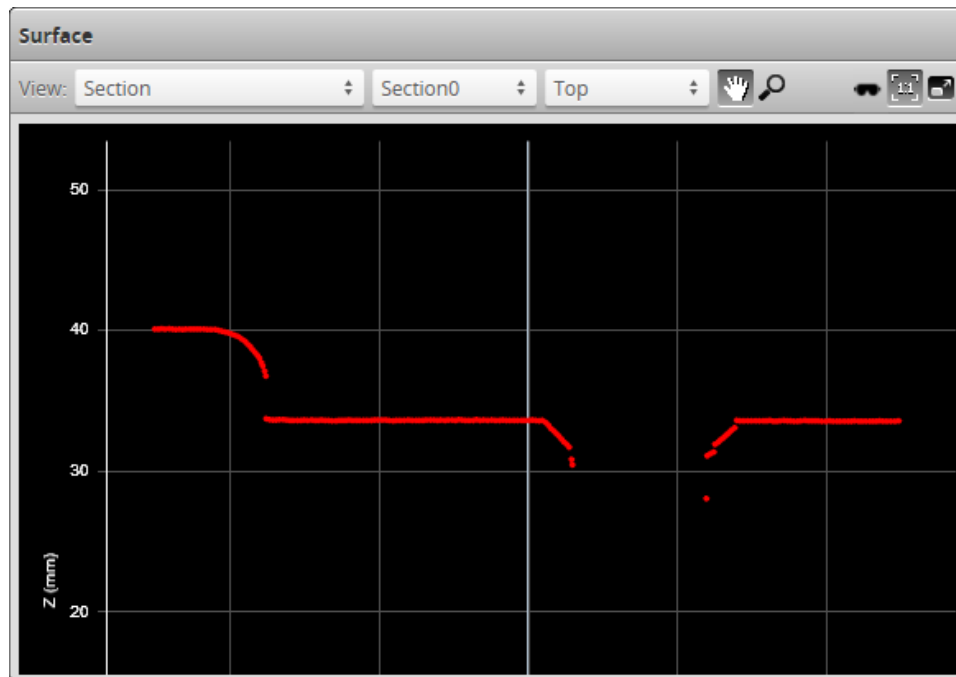

When in the **Scan** page, selecting a panel (e.g., **Sensor** or **Alignment** panel) automatically sets the display to the most appropriate display view.

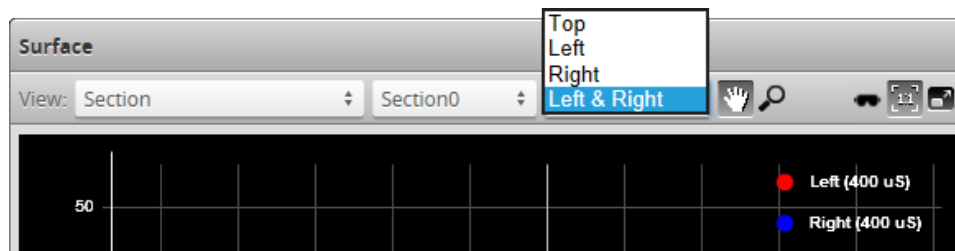

To manually select the display view in the Scan page:

1. Go to the **Scan** page.
2. Choose **Surface** mode in the **Scan Mode** panel.
3. Just above the data viewer, choose **Section** in the **View** drop-down.
The view from an individual sensor or the combined view of two sensors can be selected from the drop-down list at the top of the data viewer.
Top: View from a single sensor, from the top sensor in an opposite-layout dual-sensor system, or the combined view of sensors that have been aligned to use a common coordinate system.
Bottom: View from the bottom sensor in an opposite-layout dual-sensor system.
Left: View from the left sensor in a dual-sensor system.
Right: View from the right sensor in a dual-sensor system.
Left & Right: Views from both sensors, displayed at the same time in the data viewer, using the coordinate systems of each sensor.


1. Go to the **Scan** page.
2. Choose **Surface** mode in the **Scan Mode** panel.
3. Just above the data viewer, choose **Section** in the **View** drop-down.
The view from an individual sensor or the combined view of two sensors can be selected from the drop-down list at the top of the data viewer.
Top: View from a single sensor, from the top sensor in an opposite-layout dual-sensor system, or the combined view of sensors that have been aligned to use a common coordinate system.
Bottom: View from the bottom sensor in an opposite-layout dual-sensor system.
Left: View from the left sensor in a dual-sensor system.
Right: View from the right sensor in a dual-sensor system.
Left & Right: Views from both sensors, displayed at the same time in the data viewer, using the coordinate systems of each sensor.

In the **Measure** page, the view of the display is set to the profile source of the selected measurement tool.

Region Definition

Regions, such as an active area or a measurement region, can be graphically set up using the data viewer in the 2D or in the 3D view.

When the **Scan** page is active, the data viewer can be used to graphically configure the active area. The **Active Area** setting can also be configured manually by entering values into its fields and is found in the **Sensor** panel (see *Sensor* on page 89).

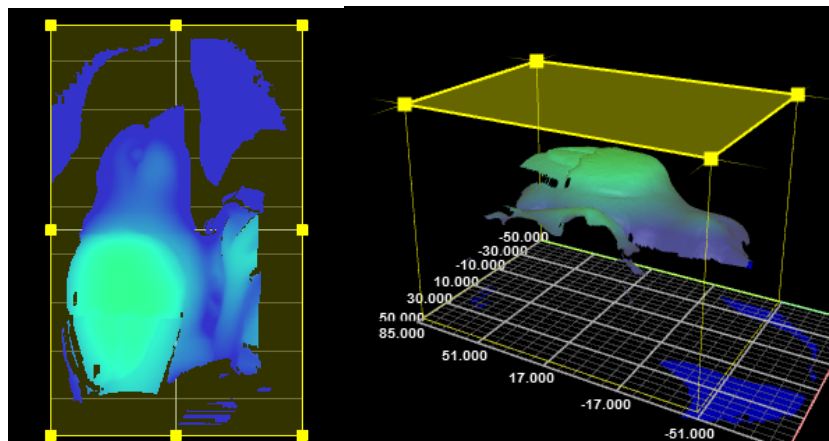

To set up a region of interest:

1. Move the mouse cursor to the rectangle. In the 3D viewer, you must first select which side of the 3D rectangle to adjust by clicking on it.
The rectangle is automatically displayed when a setup or measurement requires an area to be specified.
2. Drag the rectangle to move it, and use the handles on the rectangle's border to resize it.

Intensity Output

Gocator sensors can produce intensity images that measure the amount of light reflected by an object. An 8-bit intensity value is output for each point in the 3D point cloud.

To display intensity data, click the Intensity button ().



To be able to display intensity data, you must enable **Acquire Intensity** in the **Scan Mode** panel.




Models

The following sections describe how to set up part matching using a model, a bounding box, or an ellipse. It also describes how to configure sections.

Model Page Overview

The **Model** page lets you set up part matching and sections.

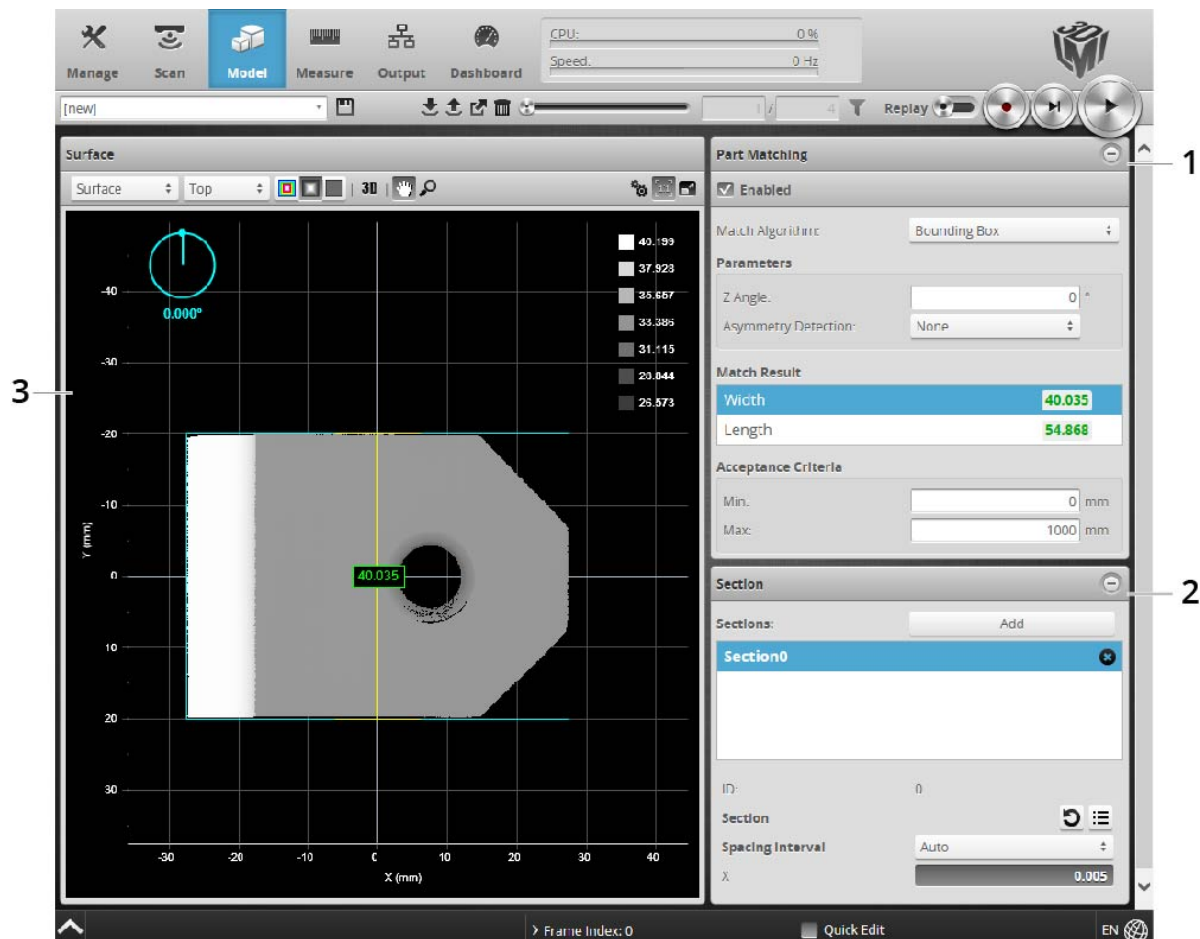

Element	Description
1	Part Matching panel Contains settings for configuring models and for part matching.
2	Sections panel Contains settings for configuring sections, which let you extract profiles from surfaces.
3	Data Viewer Displays sensor data and lets you add and remove model edge points.

Part Matching


Gocator can match scanned parts to the edges of a model based on a previously scanned part (see *Using Edge Detection* on page 122) or to the dimensions of a fitted bounding box or ellipse that encapsulate the model (see *Using Bounding Box and Ellipse* on page 131). When parts match, Gocator can rotate scans so that they are all oriented in the same way. This allows measurement tools to be applied consistently to parts, regardless of the orientation of the part you are trying to match.

When the match quality between a model and a part reaches a minimum value (a percentage), or the bounding box or ellipse that encapsulates the part is between minimum and maximum dimension values, the part is "accepted" and any measurements that are added in the **Measure** page will return valid values, as long as the target is in range, etc. If the part is "rejected," any measurements added in the **Measure** page will return an Invalid value. For more information on measurements and decision values, see *Measurement and Processing* on page 141.

Using Edge Detection

When using edge detection for part matching, the Gocator compares a model that you must create from a previous scan to a "target" (one of the parts you want to match to the model).

In the data viewer, a model is represented as a yellow outline. The target is represented as a blue outline. If the part match quality above a minimum user-defined level, any measurements configured on the **Measure** page are applied.

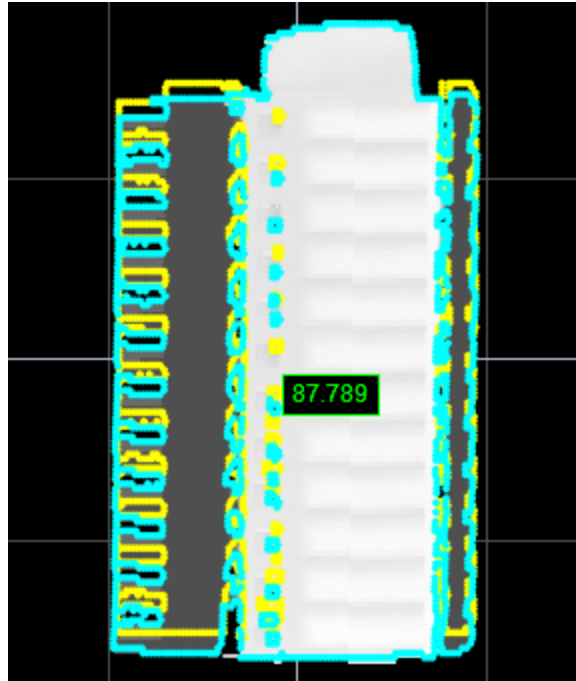

*Model (yellow outline) and target (blue outline).
Part match quality is 87.789%, which is greater
than the minimum set by the user, so the parts match.*

When you create a model, the Gocator runs an edge detection algorithm on either the heightmap or intensity image of a scanned part. The resulting model is made up of the detected edge points. The scan used to create the model should be of a reference (or "golden") part to which all other parts will be compared.

After the model has been created, you optionally modify the model by adjusting the sensitivity (how many edge points are detected), or selectively remove edge points from the model, to improve matching.



Models are saved as part of a job.

Once you have finished modifying the model, you can also modify target sensitivity, which controls how many edge points are detected on the subsequently scanned targets that will be compared to the model; the same edge detection algorithm used for creating models is used to compare a model to a part.

Typically, setting up edge detection to perform part matching involves the following steps:

1. Scan a reference part (you can also use replay data that you have previously saved).
2. Create a model based on the scan (using either heightmap or intensity data).
3. Adjust the model (edge detection algorithm sensitivity and selective removal of edge points).
4. Scan another part typical of the parts that would need to match the model.
5. Adjust the target sensitivity.
6. Set match acceptance level.

The screenshot shows the 'Part Matching' panel with the 'Target Matching' tab selected. The panel includes a checkbox for 'Enabled', a 'Match Algorithm' dropdown set to 'Edge', and a 'Models' section with an 'Add Current Scan' button and a list containing 'Model1'. Below this is a 'Parameters' section with 'Image Type' set to 'Heightmap' and 'Z Angle' set to '0°'. The 'Target Sensitivity' is shown as a slider between 'Low' and 'High' with a value of '5'. The 'Match Result' section shows a 'Quality' of '84.466'. The 'Acceptance Criteria' section has a 'Min' value of '80 %'.

Part Matching panel showing Target Matching tab

The screenshot shows the 'Part Matching' panel with the 'Model Editing' tab selected. It features a 'Model Sensitivity' slider between 'Low' and 'High' with a value of '5'. Below the slider are 'Edge Points' buttons for 'Edit' and 'Reset'. A note at the bottom states: '*Click to remove. Ctrl + Click to undo.'

Model Editing tab on Part Matching panel

The following settings are used to configure part matching using edge detection.

Setting	Description
Match Algorithm	Determines which algorithm the sensor will use to attempt a match. Set this to Edge for edge detection.
Image Type	Determines what kind of data the Gocator will use to detect edges and therefore for part matching. Choose this setting based on the kinds of features that will be used for part matching: Heightmap: Surface elevation information of the scanned part will be used to determine edges. This setting is most commonly used. Intensity: Intensity data (how light or dark areas of a scanned part are) will be used to determine edges. Use this setting if the main distinguishing marks are printed text or patterns on the parts. The Acquire Intensity option must be checked in the Scan Mode panel on the Scan page for this option to be available.
Z Angle	Corrects the orientation of the model to accurately match typical orientation and simplify measurements.
Target Sensitivity (Target Matching tab)	Controls the threshold at which an edge point is detected on the target's heightmap or intensity image. (The "target" is any part that is matched to the model and which will subsequently be measured if the match is accepted.) Setting Target Sensitivity higher results in more edge points. Setting it lower results in fewer edge points and results in higher performance. Use this setting to exclude noise from the detected edges and to make sure distinguishing features are properly detected. The level of this setting should generally be similar to the level of Model Sensitivity.
Model Sensitivity (Model Editing tab)	Controls the threshold at which an edge point is detected on the heightmap or intensity image used to create the model. Setting Model Sensitivity higher results in more edge points. Setting it lower results in fewer edge points and results in higher performance. Use this setting to exclude noise from the detected edges and to make sure distinguishing features are properly detected. The level of this setting should generally be similar to the level of Target Sensitivity. Changing this setting causes the edge detection algorithm to run again at the new threshold. If you have edited edge points manually (removing them selectively), those changes will be lost. See <i>Using Edge Detection</i> on page 122 for more information.
Edge Points (Model Editing tab)	The Edit button lets you selectively remove edge point that are detected by the edge detection algorithm at the current Model Sensitivity setting. See <i>Using Edge Detection</i> on page 122 for more information.
Acceptance Criteria	Determines the minimum quality level of the match as a percentage value. <i>Part rejected: Quality result is less than Min</i>

To run part matching, simply make sure that the **Enabled** option is checked on the **Part Matching** panel when the Gocator is running. Any measurements that are added and configured on the **Measure**


page will be applied to parts if a part match is accepted, regardless of the part's orientation (a successfully matched part is rotated to match orientation of the model), returning a value and decision (as long as the part is in range, etc.). If a part match is rejected, measurements will return an Invalid value.

Creating a Model

Gocator creates a model by running an edge detection algorithm on the heightmap or intensity image of a scan. The algorithm is run when a model is first created and whenever the **Model Sensitivity** setting is changed.


To create a model:

1. Go to the **Scan** page.
 - a. In the **Scan Mode** panel, choose **Surface**.

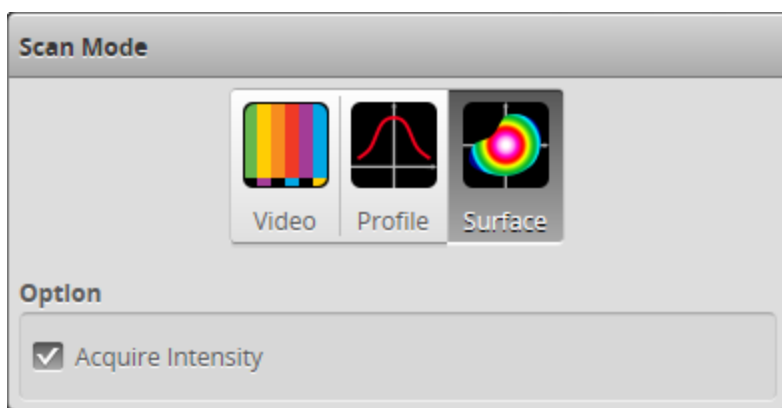

You must choose **Surface** in order to scan a part. Furthermore, the **Model** page is only displayed in Surface mode.

- b. If you want to use intensity data to create the model, make sure **Acquire Intensity** is checked.
 - c. In the **Part Detection** panel, choose **Part** for the **Frame of Reference**.

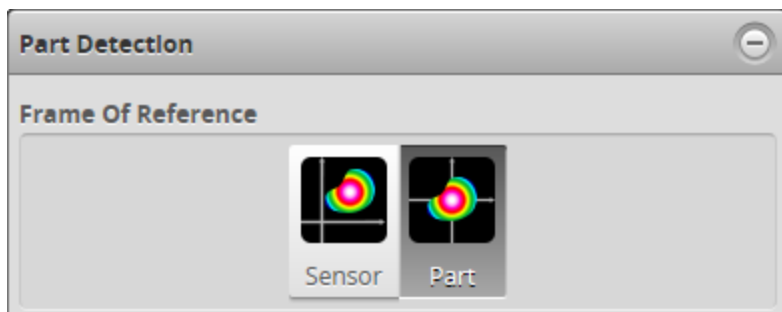


Part matching is only available when **Part** has been selected.

2. Do one of the following:
 - Scan a reference part. See *Scan Setup and Alignment* on page 83 for more information on setting up and aligning Gocator. See *Running a Standalone Sensor System* on page 34 for more information on running a system to scan a part.

- Locate some previously recorded replay data and load it. See *Recording, Playback, and Measurement Simulation* on page 61 and *Downloading, Uploading, and Exporting Replay Data* on page 65 for more information on replay data.

- Go to the **Model** page.
 - Make sure the **Enabled** option is checked in the **Part Matching** panel.
 - In the **Match Algorithm** drop-down, choose **Edge**.

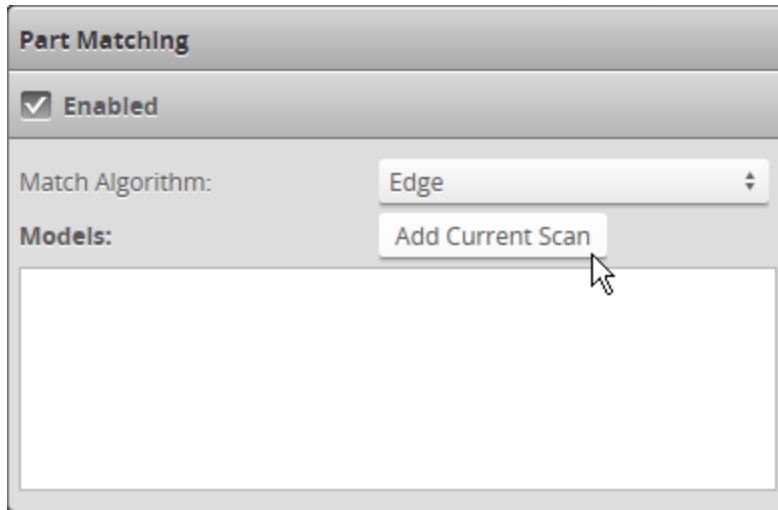


- Click **Stop** on the toolbar if the sensor is running.
- Click **Add Current Scan**.



After adding the model, the Gocator will show that the match quality is 100%, because it is in effect comparing the model to the scan that was used to create the model. This value can be ignored.

- In the **Image Type** drop-down, choose **Heightmap** or **Intensity**.

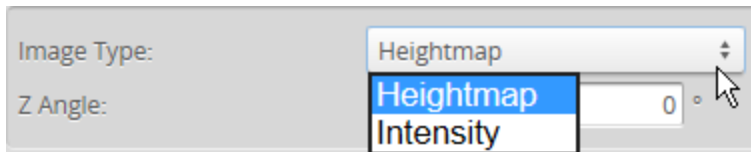

- If you need to correct the orientation of the model, provide a value in the **Z Angle** field.
Correcting the Z angle is useful if the orientation of the model is not close to the typical angle of target parts on the production line.
- Save the job by clicking the **Save** button .

Models are saved in job files.

See *Creating, Saving and Loading Jobs (Settings)* on page 60 for more information on saving jobs.

After you have created a model, you may wish to modify it to remove noise to improve its matching capabilities. You may also wish to modify a model to exclude certain areas. See *Creating a Model* on the previous page for more information.

Model names can be renamed.

To rename a model:

1. In the **Models** list, double-click on a model name.
2. Type a new name in the model name field.
3. Press Enter or click outside the model name field.
4. Save the job by clicking the **Save** button .


To delete a model, click the  button.

Modifying a Model's Edge Points


Modifying a model's edge points is useful to exclude noise in the detected edge points and to make sure distinguishing features are properly detected, which can improve matching. You can modify edge points in two ways.

First, you can control the overall number of edge points that are detected by the edge detection algorithm by raising and lowering the edge detection threshold (the **Model Sensitivity** setting). Modifying **Model Sensitivity** causes the edge detection algorithm to run again.

Second, you can fine-tune the model's edge points by selectively removing edge points that are detected by the edge detection algorithm. This could be useful, for example, if an edge on the target parts frequently presents minor variations such as flashing (excess material caused by leakage during molding): the edge points that make up the model can be edited to exclude that region. Editing the model can allow parts to match it more easily.

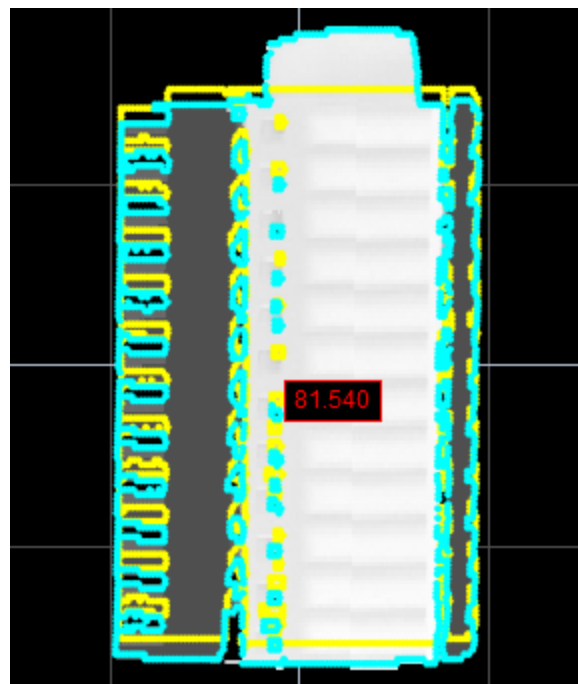

*Edge points along top of model not removed.
Part is rejected. (Min set to 85%.)*

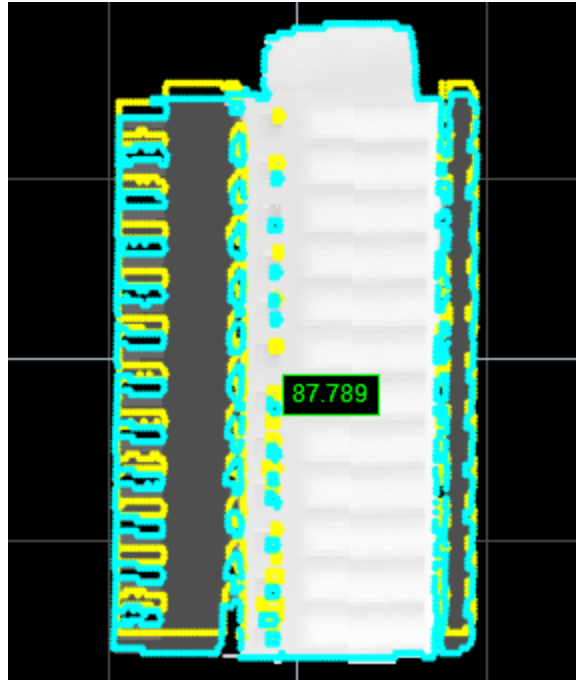

*Edge points along top of model removed.
Part is accepted. (Min set to 85%.)*


Removing edge points does not cause the edge detection algorithm to run again.

To change model sensitivity:

1. In the **Models** list, select the model you want to configure by clicking on its selection control.



2. Click the **Model Editing** tab.
3. Adjust the **Model Sensitivity** slider to exclude noise and to properly detect the distinguishing features that will match parts.

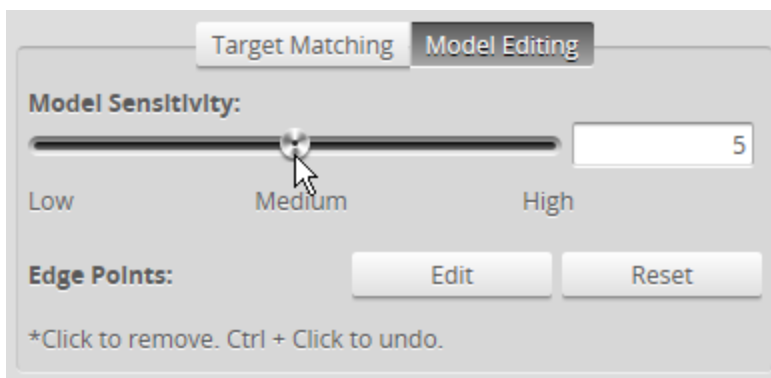

You can also set the sensitivity value manually in the provided text box.


4. Save the job by clicking the **Save** button .

To manually remove model edge points:

1. In the **Models** list, select the model you want to configure by clicking on its selection control.




2. In the **Model Editing** tab, click on the **Edit** button.

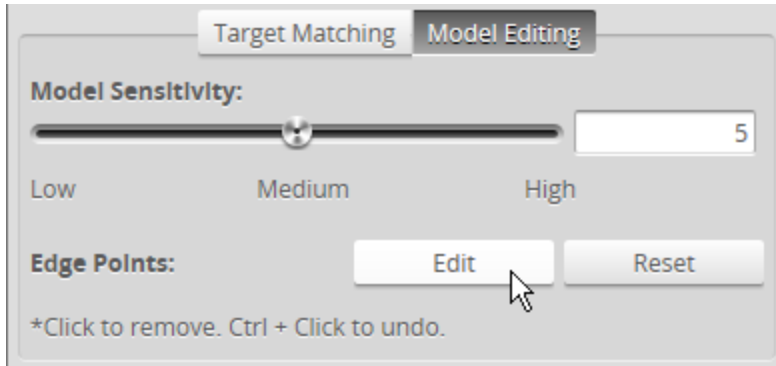

3. On the toolbar above the data viewer, make sure the **Select** tool is active.



4. Click in the data viewer and hold the mouse button while moving the pointer over the edge points you want to remove.

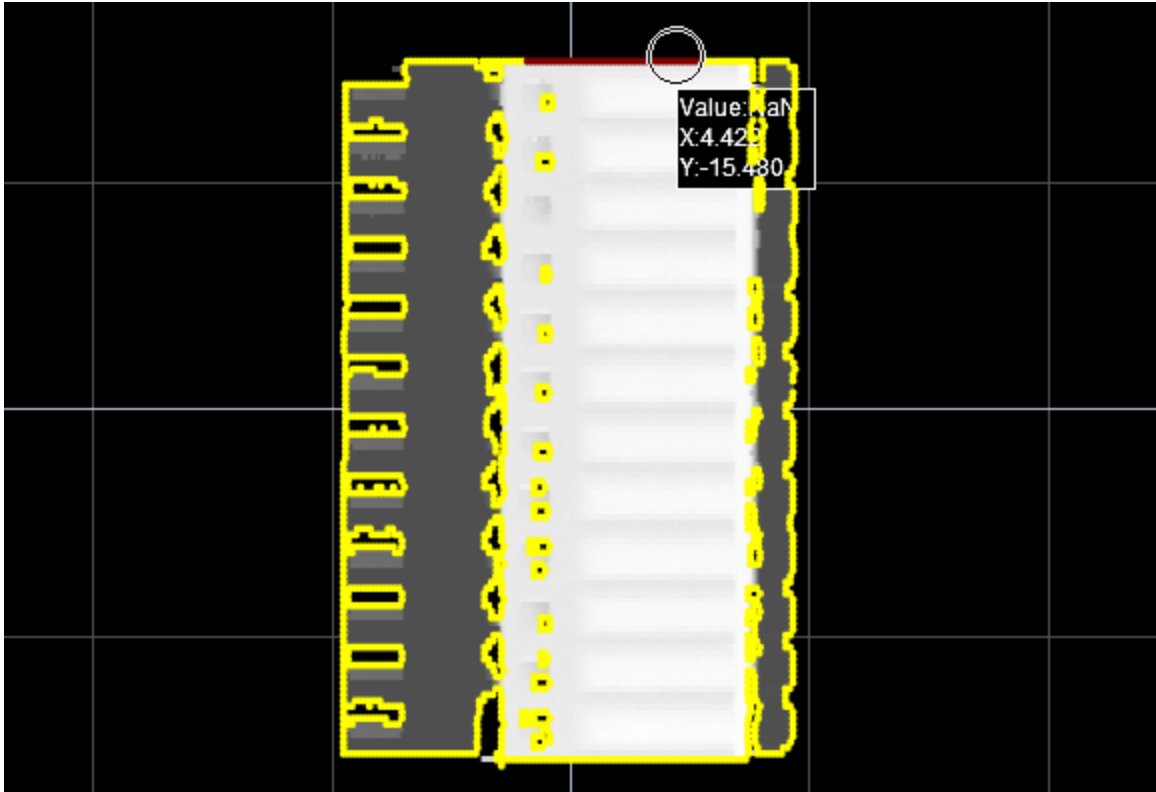

Points within the circular **Select** tool are removed from the model. Removed edge points turn red in the data viewer.

You can zoom in to see individual edge points by using the mouse wheel or by using the Zoom mode ().

5. If you have removed too many edge points, use Ctrl + Click in the data viewer to add the edge points back.
6. When you have finished editing the model, click **Save** in the **Model Editing** tab.
7. Save the job by clicking the **Save** button  on the toolbar.


Adjusting Target Sensitivity

After you have added a model and optionally adjusted it, you must scan a different part, one that is typical of parts that must match the model.

Much in the same way that you can adjust a model's sensitivity, you can adjust the target sensitivity, that is, the threshold at which edge points are detected on the heightmaps or intensity images of parts that you want to match to the model. Adjusting the target sensitivity is useful to exclude noise, improving part matching.

To change target sensitivity:

1. Click the **Target Matching** tab.
2. Adjust the **Target Sensitivity** setting to exclude noise in order to properly detect the distinguishing features that will allow parts to match.

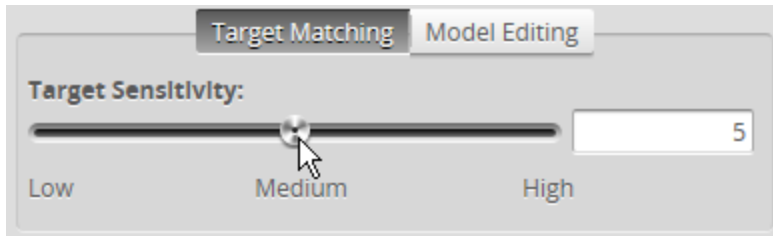

You can also set the sensitivity value manually in the provided text box.

Setting the Match Acceptance Criteria

In order for a part to match a model, the match quality must reach the minimum set in the **Min** field in **Acceptance Criteria** section of the **Part Matching** panel.

Match Result

Quality	87.789
---------	--------

Acceptance Criteria

Min:	85 %
------	------

Part accepted: Quality result is greater than Min

Match Result

Quality	87.789
---------	--------

Acceptance Criteria

Min:	90 %
------	------


Running Part Matching

To run part matching, simply make sure that the **Enabled** option is checked on the **Part Matching** panel when the Gocator is running. Any measurements that are added and configured on the **Measure** page will be applied to parts if a part match is accepted, regardless of the part's orientation (a successfully matched part is rotated to match orientation of the model), returning a value and decision (as long as the part is in range, etc.). If a part match is rejected, measurements will return an Invalid value.

Using Bounding Box and Ellipse

When using a bounding box or an ellipse to match parts, the Gocator tests whether a part fits into a bounding box or ellipse that you define. A match will occur regardless of orientation.


In the data viewer, a bounding box or ellipse is displayed with a blue outline. If a part fits in the bounding box or ellipse, any measurements configured on the **Measure** page are applied.

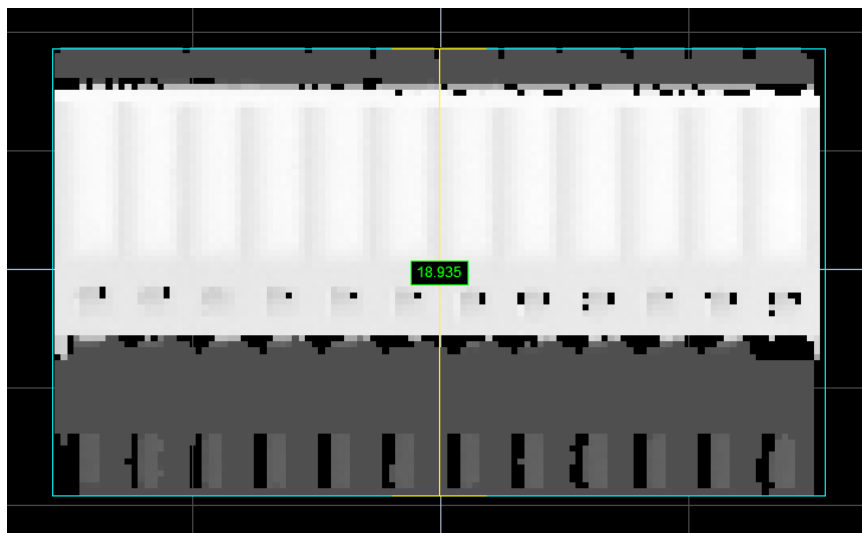

*Blue bounding box around a part.
(Yellow lines show currently selected
dimension in Part Matching panel.)*

Typically, setting up a bounding box or an ellipse to perform part matching involves the following steps:

1. Scan a reference part (you can also use replay data that you have previously saved).
2. Set the characteristics of the bounding box (width and length) or ellipse (major and minor axes).

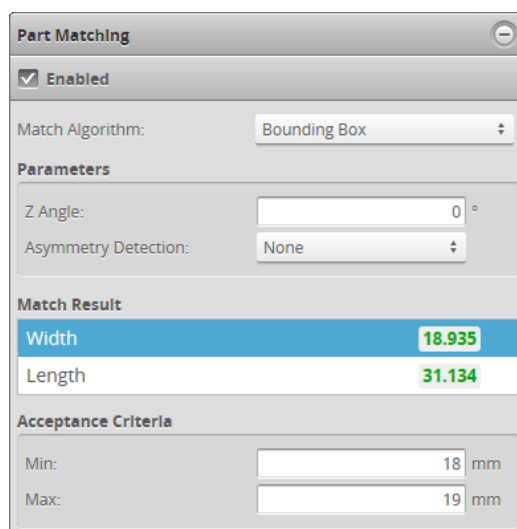

Part Matching panel (Bounding Box match algorithm)

The following settings are used to configure part matching using a bounding box or ellipse.

Setting	Description
Match Algorithm	Determines which algorithm the sensor will use to attempt a match. Set this to


Setting	Description
	Bounding Box or Ellipse.
Z Angle	Corrects the orientation of the bounding box or ellipse to accurately match typical orientation and simplify measurements.
Asymmetry Detection	Rotates scans based on the asymmetry of the scanned part. Gocator calculates the number of points on each side of the part's centroid in the bounding box or ellipse. Along Major Axis – The scan is flipped so that the greater number of points is to the left. Along Minor Axis – The scan is flipped so that the greater number of points is on the bottom. None – The scan is not flipped.
Acceptance Criteria	Determines the minimum and maximum acceptable values of the selected dimension (Width and Length for bounding box, Major and Minor for ellipse) in Match Result.

Configuring a Bounding Box or an Ellipse

To use a bounding box or an ellipse to match a part, you must set its dimensions, taking into account expected acceptable variations when compared to a reference (or "golden") part.

To configure a bounding box or ellipse for part matching:


1. Go to the **Scan** page.
 - a. In the **Scan Mode** panel, choose **Surface**.

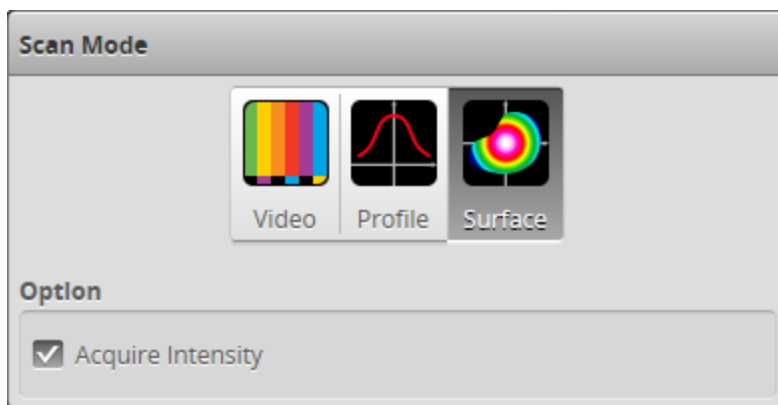

You must choose **Surface** in order to scan a part. Furthermore, the **Model** page is only displayed in Surface mode.


Intensity data is not used when part matching using a bounding box or an ellipse, but you can enable the **Acquire Intensity** option if you need intensity data for other reasons.

- b. In the **Part Detection** panel, choose **Part** for the **Frame of Reference**.

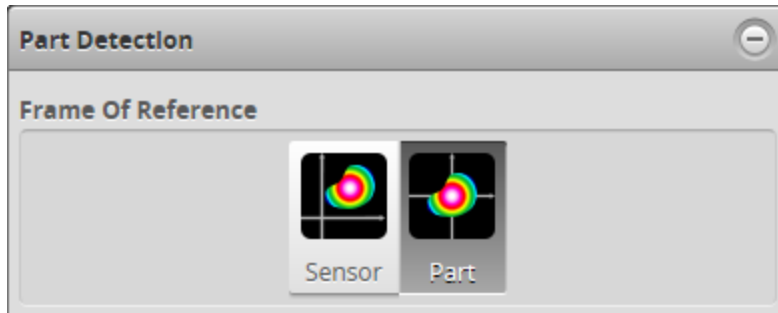

Part matching is only available when **Part** has been selected.

2. Do one of the following:
 - Scan a reference part. See *Scan Setup and Alignment* on page 83 for more information on setting up and aligning Gocator. See *Running a Standalone Sensor System* on page 34 for more information on running a system to scan a part.
 - Locate some previously recorded replay data and load it. See *Recording, Playback, and Measurement Simulation* on page 61 and *Downloading, Uploading, and Exporting Replay Data* on page 65 for more information on replay data.
3. Go to the **Model** page.
 - a. Make sure the **Enabled** option is checked in the **Part Matching** panel.
 - b. In the **Match Algorithm** drop-down, choose **Bounding Box** or **Ellipse**.

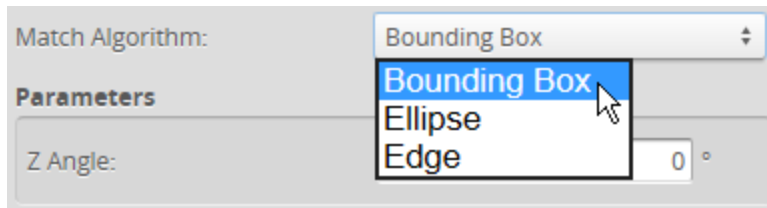

4. Set **Min** and **Max** of both of the dimensions of the selected match algorithm shape, taking into account expected acceptable variations.
 - If you chose **Bounding Box** for the match algorithm, select **Width** and then **Length** in **Match Result**, setting the minimum and maximum values acceptable for each dimension.
 - If you chose **Ellipse** for the match algorithm, select **Minor** and then **Major** in **Match Result**, setting the minimum and maximum values acceptable for each dimension.
 5. Save the job by clicking the **Save** button .
- See *Creating, Saving and Loading Jobs (Settings)* on page 60 for more information on saving jobs.

Running Part Matching

To run part matching, simply make sure that the **Enabled** option is checked on the **Part Matching** panel when the Gocator is running. Any measurements that are added and configured on the **Measure** page will be applied to parts if a part match is accepted, regardless of the part's orientation (a successfully matched part is rotated to match orientation of the bounding box or ellipse), returning a value and decision (as long as the part is in range, etc.). If a part match is rejected, measurements will return an Invalid value.

Using Part Matching to Accept or Reject a Part

Part matching results only determine whether a measurement is applied to a part. Whether the measurement returns a pass or fail value—its decision—depends on whether the measurement's value is between the **Min** and **Max** values set for the measurement. This decision, in addition to the actual value, can in turn be used to control a PLC for example. The part matching "decision" itself is not passed to the Gocator output, but you can simulate this by setting up a measurement that will always pass if it is applied.

For example, you could set up a Position Z measurement, choosing Max Z as the feature type, and setting the **Min** and **Max** values to the measurement range of the sensor. This way, as long as a part matches and the target is in range, etc., the measurement will pass. This measurement decision, which is passed to the Gocator's output, could in turn be used to control a PLC.

Sections

In Surface mode, Gocator can also extract a profile from a surface or part using a line you define on that surface or part. The resulting profile is called a "section." A section can have any orientation on the surface, but its profile is parallel to the Z axis.



Sections are not available on point cloud data, that is, when [Uniform Spacing](#) is disabled in the **Scan Mode** panel.




You can't create sections on surface data that is produced by other tools, such as Surface Stitch.

You can use most [profile measurement tools](#) on a section: you can't use tools that work with unresampled data. Using sections and the profile measurements, you can therefore use measurements that are not otherwise possible in Surface mode, for example:


- Gap and flush measurements
- Surface radius measurements (for example, rounded edges or corners)
- Intersections
- Point-to-point dimension measurements between profile features

Gocator supports multiple sections, letting you take multiple measurements on the same object.


On the **Output** page, in Surface mode, you can output both surface measurements and section-based profile measurements at the same time. Gocator can also output the surfaces and section profiles themselves at the same time.

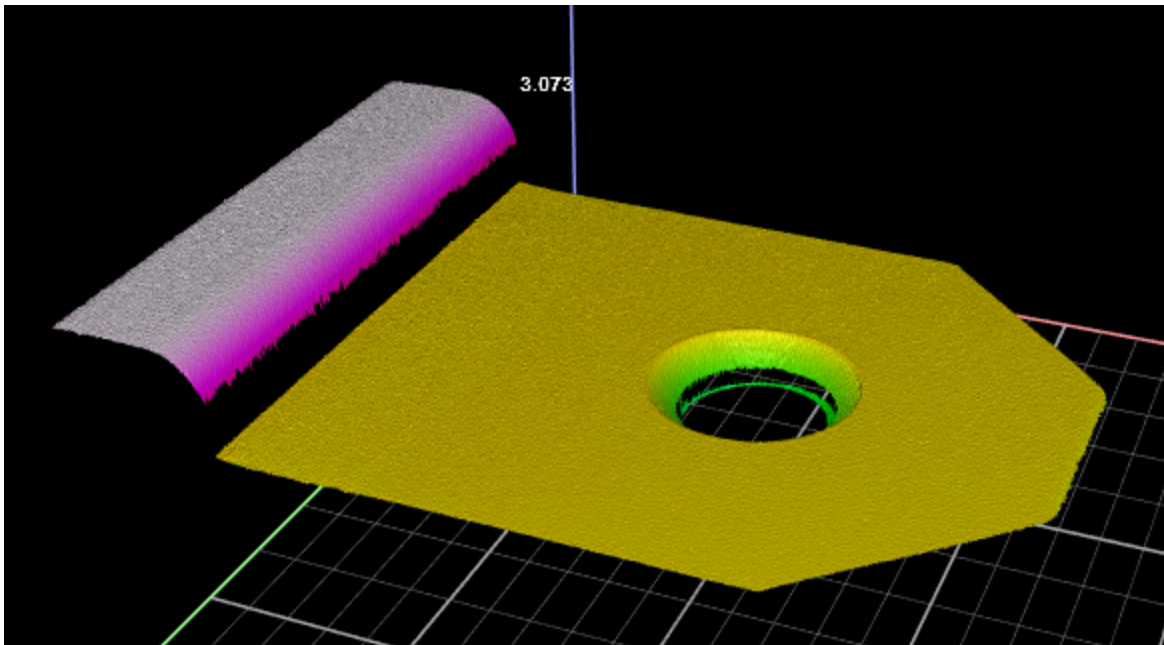

Part in data viewer (3D view)

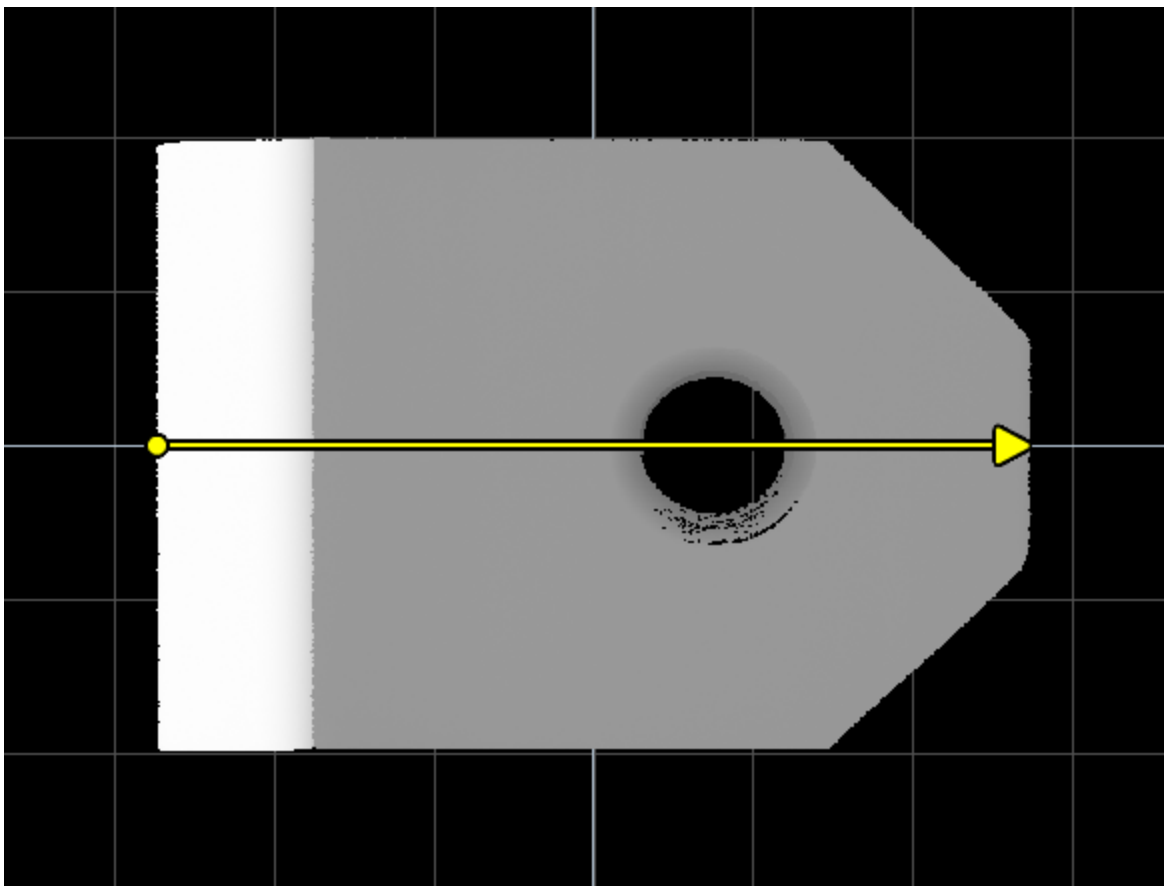


Section defined on top of part (2D view)

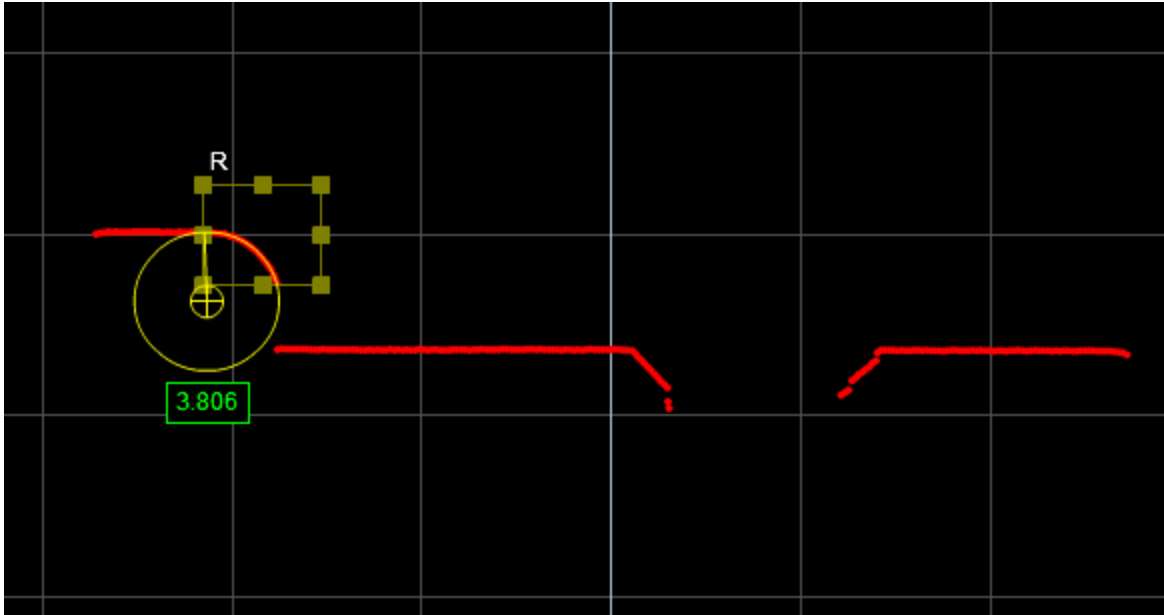


Circle Radius measurement running on profile extracted from surface using defined section

You can configure the sampling distance between points along the section. Reducing the sampling distance reduces the resolution of the profile, but increases the sensor's performance and results in less data being sent over the output.

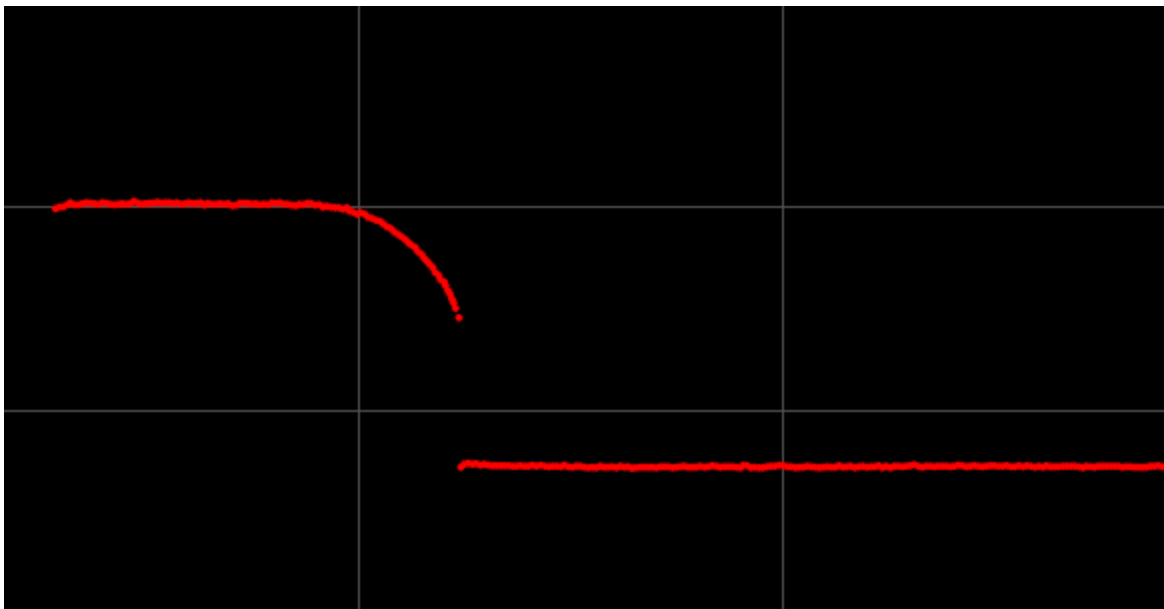

Minimum spacing interval: highest profile resolution, greater sensor CPU usage and data output

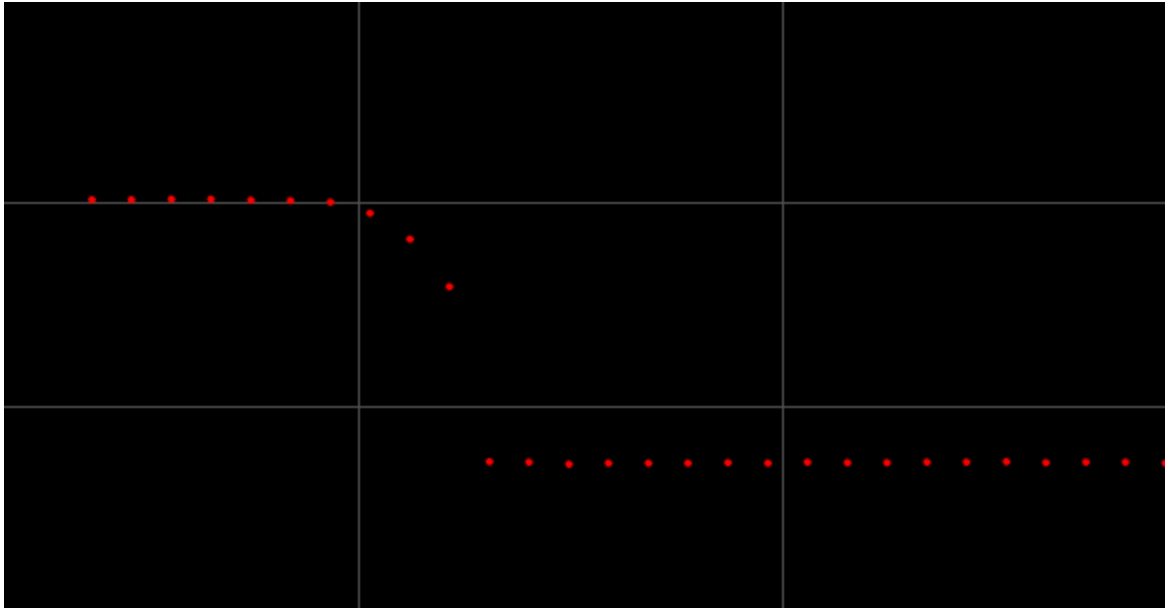

*Maximum spacing interval: lowest profile resolution,
lower sensor CPU usage and data output*




Using a higher spacing interval can produce different measurement results compared to using a smaller spacing interval. You should therefore compare results using different spacing intervals before using sections in production.

The sections you add to a surface are directional, and their start and end points are defined using X and Y coordinates. The start point always corresponds to the leftmost point on the extracted profile, whereas the end point always corresponds to the rightmost point on the extracted profile, no matter the orientation of the section on the surface.

For more information on profile tools, see *Profile Measurement* on page 162.

Creating a Section

Before you create a section, you should first scan a target in Surface mode to create a surface on which you can create the section. You can use either live data or recorded data.

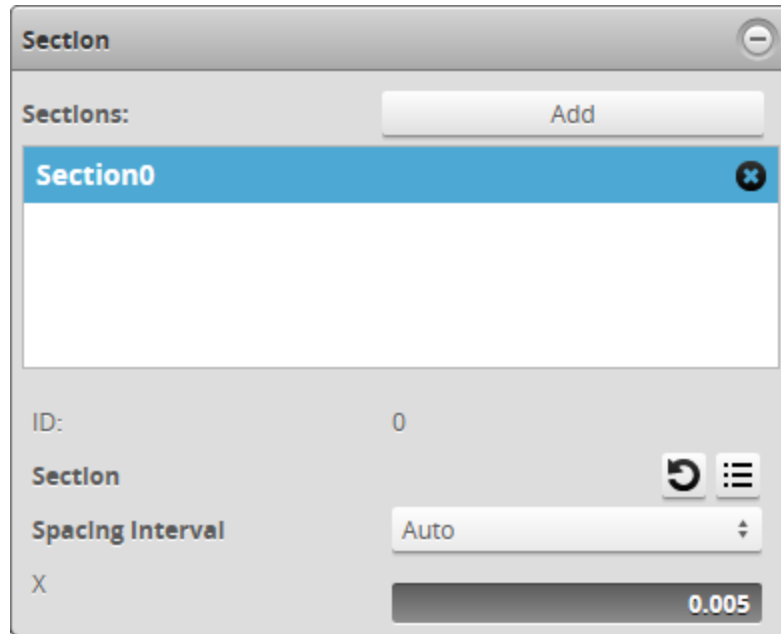

After creating a section, the following settings are available:


Setting	Description
Spacing Interval	Determines the space between the points of the extracted profile. Auto: The highest resolution, calculated using the X and Y resolution of the scan. Custom: Lets you set the spacing interval by using a slider or setting the value manually.
Section	Lets you manually set the X and Y coordinates of the start and end points of the section. Setting the coordinates manually is useful if you need to create a section that is perfectly horizontal or vertical. For example, to create a horizontal section, copy the Y value of either the start or end point to the other point's Y field. You can reverse the start and end points by clicking the  button. To reset the start and end points to their initial values, click the  button.

To create a section:

1. On the **Scan** page, in the **Scan Mode** panel, click **Surface**.
2. On the **Model** page, in the **Section** panel, click **Add**.
You may need to click the  button to expand the panel.
Gocator creates a section on the surface.
3. Rename the section if you want.
4. Move the section and adjust the start and end points of the section to extract the desired profile.
You can move or adjust the section graphically in the data viewer, or you can manually adjust the X and Y coordinates of the section.
5. (Optional) Adjust the **Spacing Interval**.

After you create a section, Gocator lists the profile measurement tools in the **Tools** panel on the **Measure** page. If you have created more than one section, you must select it in the tool. For more information on profile measurement tools, see *Profile Measurement* on page 162.

Gocator also adds a **Section** option to the **View** drop-down above the data viewer, which lets you view an extracted profile, as well as a section selector drop-down for cases where multiple sections are defined.

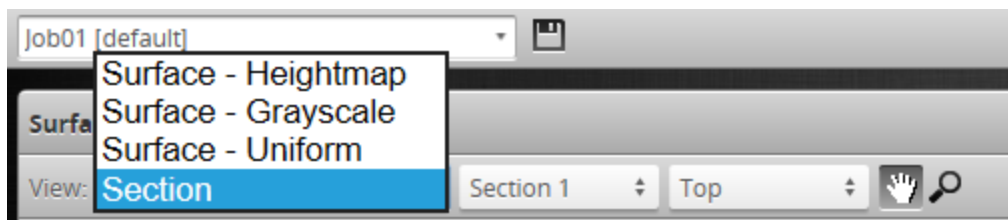

Sections are also added to the [Stream](#) drop-down in [Profile](#) and [Feature](#) tools.

If parts are not consistently oriented in the same way from scan to scan, you can use [part matching](#) to correct their rotation, if the entire part is visible in the scan. Parts will then be consistently oriented, and sections will fall on the same area on each part. You can also use [anchoring](#) to ensure that measurements are consistently placed on a part.

Deleting a Section

When you delete a section, Gocator removes any associated measurements. After you remove the last section, Gocator no longer displays profile measurement tools in the **Measure** page.

To delete a section:

1. On the **Scan** page, in the **Scan Mode** panel, click **Surface**.
2. On the **Model** page, in the **Section** panel, click the  button of the section you want to delete.

You may need to click the  button to expand the panel.

If you have associated a measurement tool to the section by setting the tool's **Stream** setting to the section, Gocator asks if you want to delete all of the associated measurement tools.

Gocator deletes the section on the surface.


Measurement and Processing

The following sections describe Gocator's measurement and processing tools.

Measure Page Overview

Measurement tools are added and configured in the **Measure** page.

The content of the **Tools** panel in the **Measure** page depends on the current scan mode. In Surface mode, the **Measure** page displays tools for surface measurement. If you have defined a section in Surface mode, profile tools are also displayed. In Video mode, tools are not available.

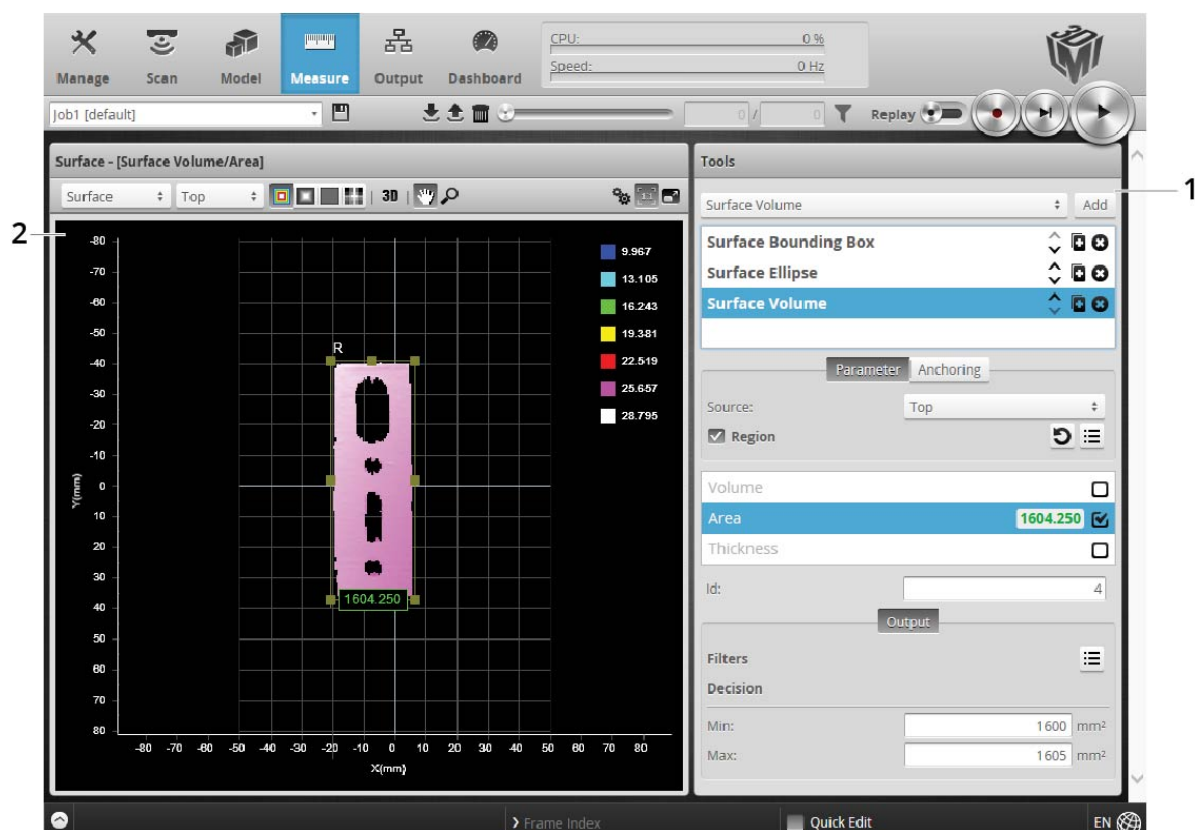

Element	Description
1 Tools panel	Used to add, manage, and configure tools and measurements (see <i>Tools Panel</i> on the next page) and to choose anchors (<i>Measurement Anchoring</i> on page 154).
2 Data Viewer	Displays video and scan data, sets up tools, and displays result calipers related to the selected measurement. Parts are displayed using a height map, which is a top-down view of the XY plane, where color represents height. See <i>Data Viewer</i> on the next page.
3 Feature Area	Configurable region of interest from which feature points are detected. These feature points are used to calculate the measurements. The number of feature areas displayed depends on which measurement tool is currently selected.

Data Viewer

When the **Measure** page is active, the data viewer can be used to graphically configure measurement regions. Measurement regions can also be configured manually in measurements by entering values into the provided fields (see *Regions* on page 145).

For information on controls in the data viewer, see *Data Viewer Controls* on page 110.

For instructions on how to set up measurement regions graphically, see *Region Definition* on page 119.

Tools Panel

The **Tools** panel lets you add, configure, and manage measurement tools. Tools contain related measurements. For example, the Position tool provides X, Y, and Z position measurements.

Some settings apply to tools, and therefore to all measurements; these settings are found in the **Parameters** tab below the list of tools. Other settings apply to specific measurements, and are found in a **Parameters** tab below the list of measurements; not all measurements have parameters.


See *Surface Measurement* on page 212 for information on the measurement tools and their settings.



Tool names in the user interface include the scan mode, but not in the manual. So for example, you will see "Surface Bounding Box" in the user interface, but simply "Bounding Box" in the manual.

Adding and Configuring a Measurement Tool

Adding a tool adds all of the tool's measurements to the **Tools** panel. You can then enable and configure the measurements selectively.

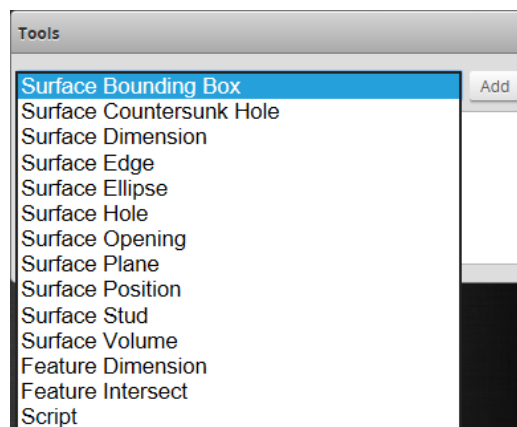


To add and configure a tool:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Profile or Surface mode in the **Scan Mode** panel.
If one of these modes is not selected, tools will not be available in the **Measure** panel.
3. Go to the **Measure** page by clicking on the **Measure** icon.

4. In the Tools panel, select the tool you want to add from the drop-down list of tools.
5. Click on the **Add** button in the Tools panel.
The tool and its available measurements are added to the tool list. The tool parameters are listed in the area below the tool list.
6. (Optional) If the measurement is a profile measurement running on a section, and you have created more than one section, choose the section that will provide data to the measurement in **Stream**.
For more information on streams, see *Stream* below.
7. Select a measurement at the bottom of the tool panel.
8. Set any tool- or measurement-specific settings.
For tool- and measurement-specific settings, see the topics for the individual [profile](#) or [surface](#) tools.
9. Set the **Min** and **Max** decision values.
For more information on decisions, see *Decisions* on page 151.
10. (Optional) Set one or more filters.
For more information on filters, see *Filters* on page 152.
11. (Optional) Set up anchoring.
For more information on anchoring, see *Measurement Anchoring* on page 154.


Stream

It's possible for more than one type of data to be available for a tool as input. You use the **Stream** drop-down in a tool to choose which type. If only one type of data is available for a tool, the **Stream** drop-down may not be displayed.

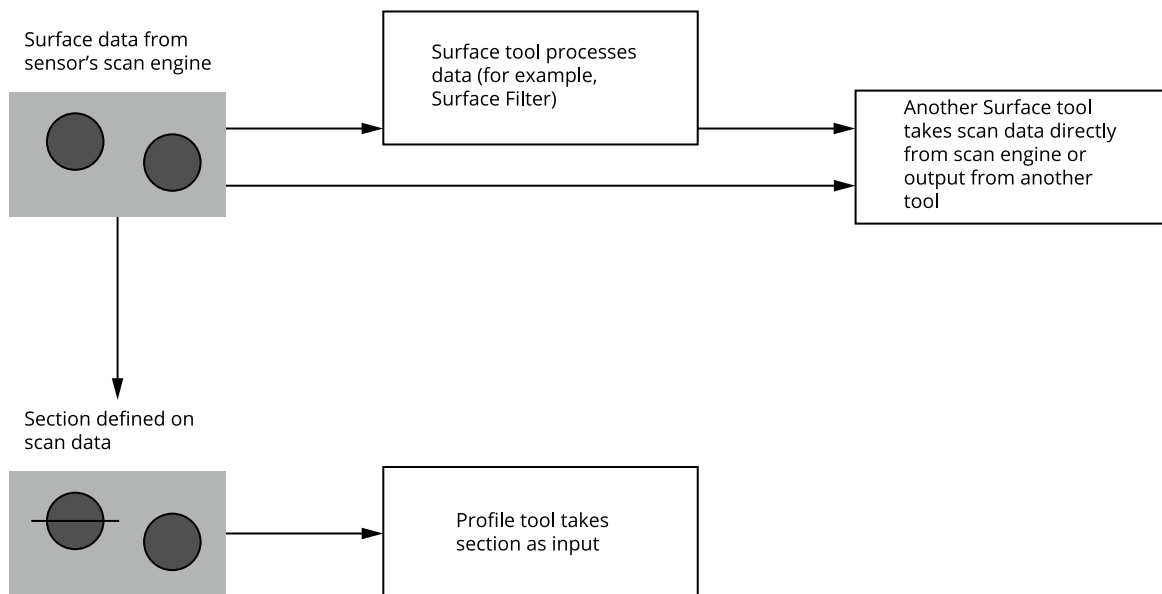


For example, many tools can produce processed surface data (such as the Stitched Surface output from the [Surface Stitch](#) tool, or the Corrected Surface output from the [Surface Vibration Correction](#) tool). When you have added one of these tools, the tool's data output is listed in the **Stream** drop-down, as

well as the data that comes directly from the sensor's scanning engine. Surface data coming directly from the sensor's scan engine is always called "Surface" in the **Stream** drop-down. For data that comes from another tool, the convention is {Tool name}/{Data output name}:

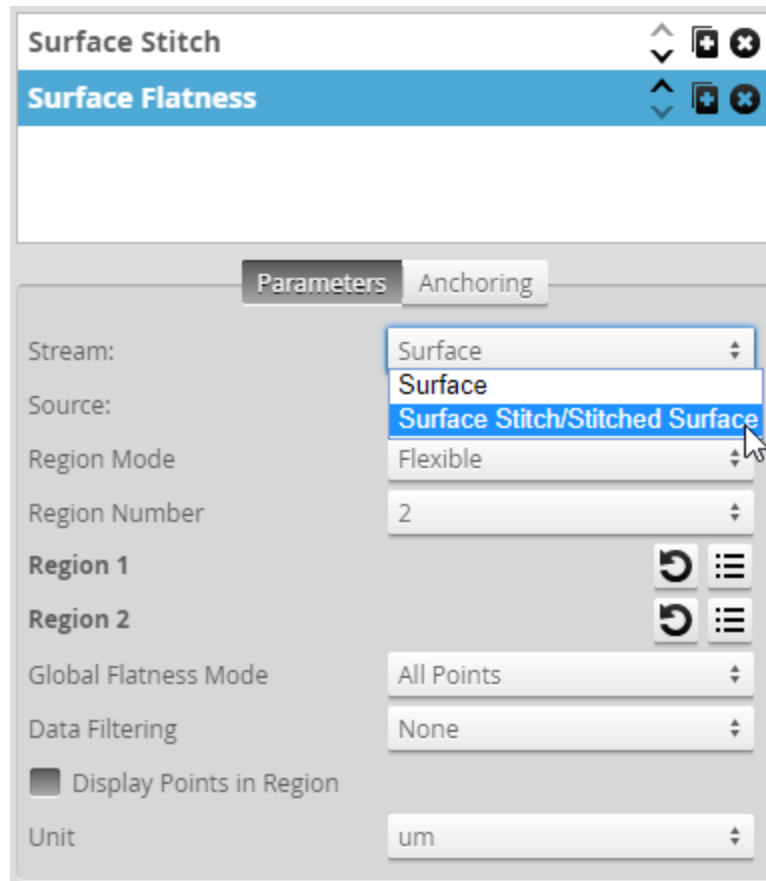

[Sections](#) are also listed in the **Stream** setting.

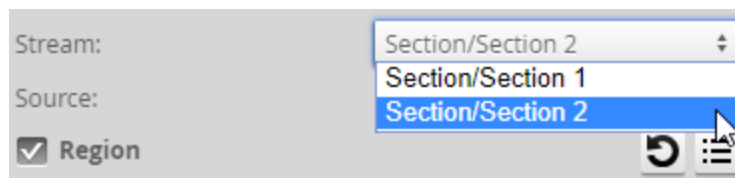

To choose a stream:

1. Go to the **Measure** page by clicking on the **Measure** icon.

 The [scan mode](#) must be set to the type of measurement you need to configure. Otherwise, the wrong tools, or no tools, will be listed on the **Measure** page.

2. In the **Tools** panel, click on a tool in the tool list.
3. If it is not already selected, click the **Parameter** tab in the tool configuration area.
4. Select the data in the **Stream** drop-down list.

Source

This setting is always **Top** with G3 sensors.

Regions

Many measurement tools use user-defined regions to limit the area in which measurements occur . Unlike reducing the [active area](#), reducing the measurement region does not increase the maximum frame rate of the sensor.



You can disable regions entirely and cause the measurement tool uses the entire [active area](#) by unchecking the checkbox next to the **Regions** setting.

All tools provide region settings under the upper **Parameters** tab. This region applies to all of a tool's measurements.

☒ Region	 
X:	-54.122 mm
Z:	-36.593 mm
Width:	109.67 mm
Height:	109.67 mm

Region settings are often found within expandable feature sections in the tool's panel.



In 2D mode, the tool region defaults to the center of the current data view, not the global field of view. In 3D mode, the region defaults to the global field of view.

Use the region reset button () to set the size of a region to its default. This is useful after zooming in or out in the data viewer.

To configure regions:


1. Go to the **Measure** page by clicking on the **Measure** icon.



The [scan mode](#) must be set to the type of measurement you need to configure. Otherwise, the wrong tools, or no tools, will be listed on the **Measure** page.


2. In the **Tools** panel, click on a tool in the tool list.
3. Configure the region using the mouse in the data viewer.
You can also configure regions manually by clicking the expand button () and entering values in the fields. This is useful if you need to set precise values.

The measurement region of some tools can be rotated by setting the region's **Z Angle** to better accommodate features that are on an angle on a target. By rotating the measurement region, data not related to the feature can often be excluded, improving accuracy of measurements.

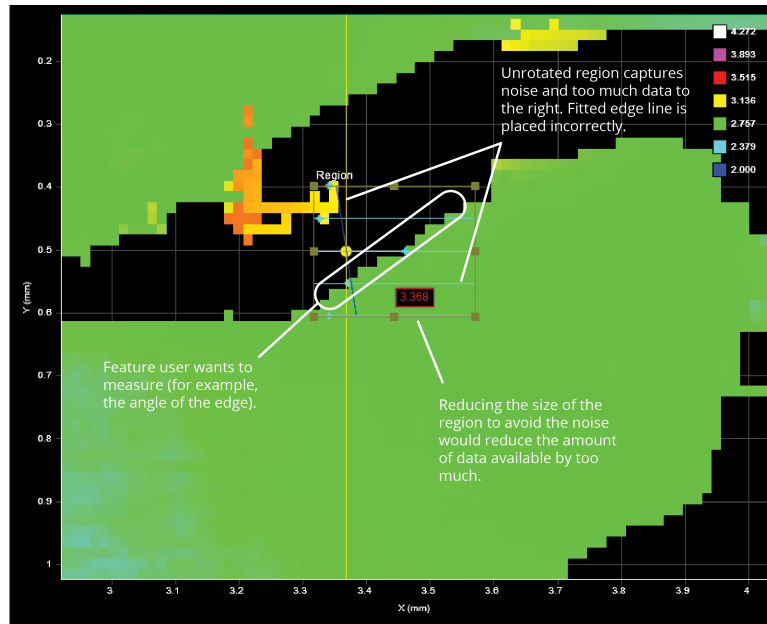

To rotate measurement regions:


1. Determine the length and width of the region that will be required once it is rotated.

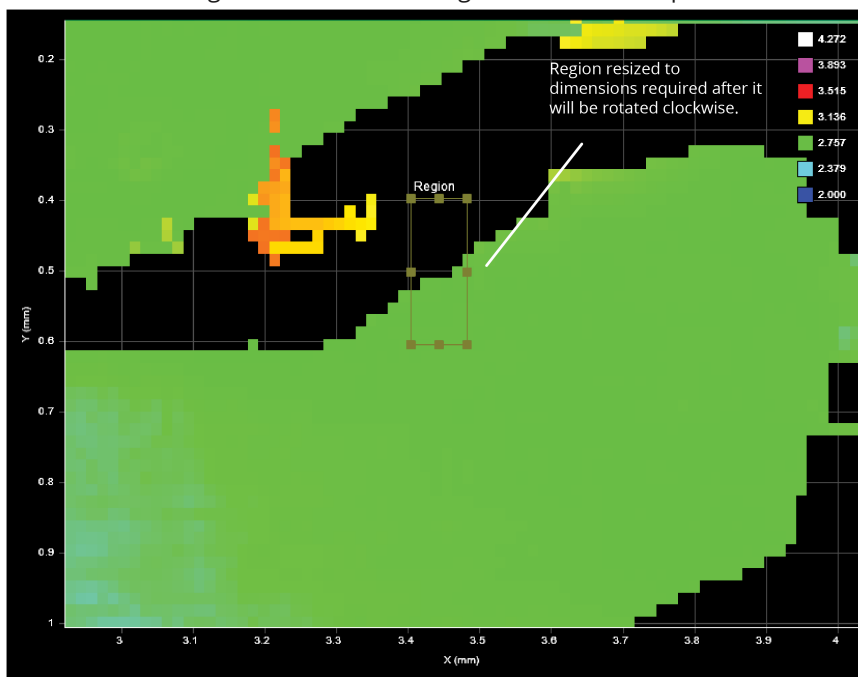

2. Expand the **Region** setting and then set a value in **Z Angle**.

Region	
X:	3.404 mm
Y:	0.397 mm
Z:	-16.725 mm
Width:	0.079 mm
Length:	0.207 mm
Height:	28.346 mm
Z angle:	55 °

The region rotates clockwise around the Z axis relative to the X axis.








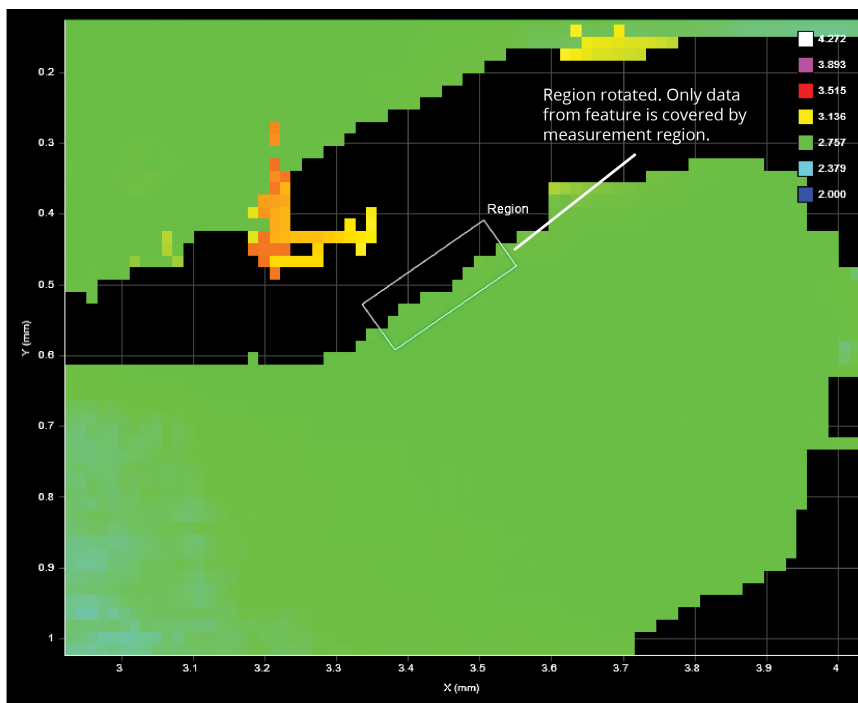








Once the region has been rotated, you cannot modify it in the data viewer using the mouse. You can however modify its dimensions and its location manually by changing the region's values in the **Region** setting.

Feature Points

Dimensional and positional measurements detect *feature points* found within the defined [measurement region](#) and then compare measurement values taken at the selected point with minimum and maximum thresholds to produce a *decision*. Feature points are selected in one or more **Feature** dropdowns in a tool and are used for all of the tool's measurements.

The following types of points can be identified in a measurement region.

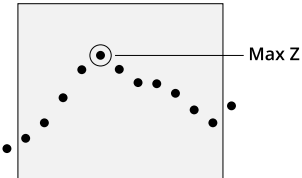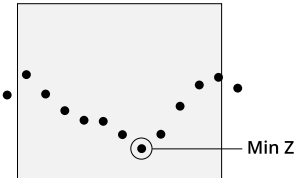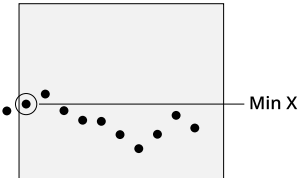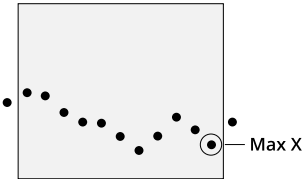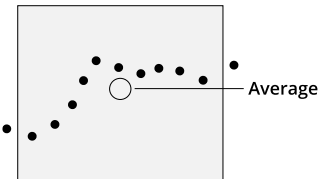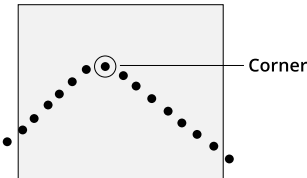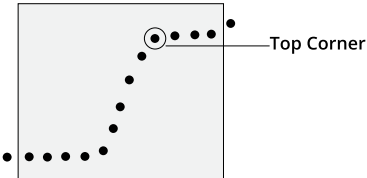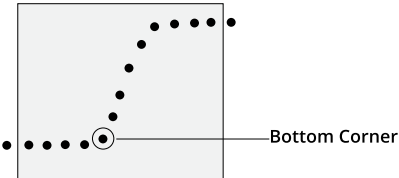Point Type	Examples
Max Z Finds the point with the maximum Z value in the region of interest.	
Min Z Finds the point with the minimum Z value in the region of interest.	
Min X Finds the point with the minimum X value in the region of interest.	
Max X Finds the point with the maximum X value in the region of interest.	
Average Determines the average location of points in the region of interest.	
Corner Finds a dominant corner in the region of interest, where corner is defined as a change in profile slope.	
Top Corner Finds the top-most corner in the region of interest, where corner is defined as a change in profile shape.	
Bottom Corner Finds the bottom-most corner in the region of interest, where corner is defined as a change in profile shape.	

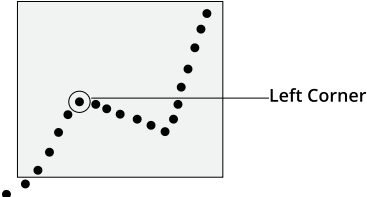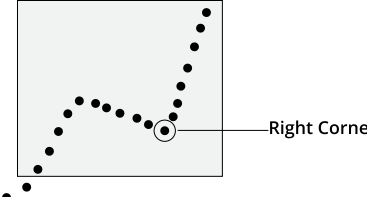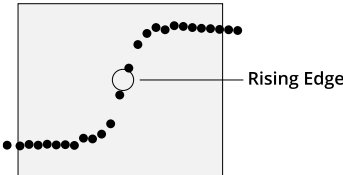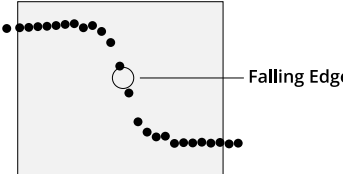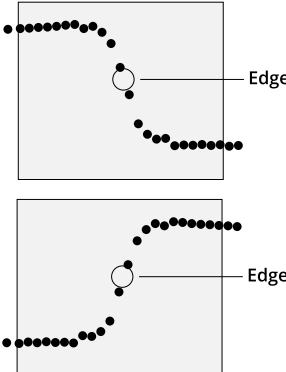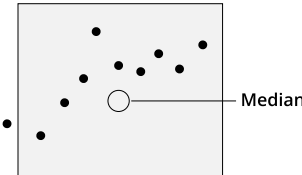Point Type	Examples
Left Corner Finds the left-most corner in the region of interest, where corner is defined as a change in profile shape.	
Right Corner Finds the right-most corner in the region of interest, where corner is defined as a change in profile shape.	
Rising Edge Finds a rising edge in the region of interest (moving from left to right).	
Falling Edge Finds a falling edge in the region of interest (moving from left to right).	
Any Edge Finds a rising or falling edge in the region of interest.	
Median Determines the median location of points in the region of interest.	

Geometric Features

Most [Surface tools](#), and many [Profile tools](#), can output features that [Feature tools](#) can take as input to produce measurements. These features are called *geometric features*. Feature tools use these entities to produce measurements based on more complex geometry. (For more information on Feature tools, see *Feature Measurement* on page 314.)

Gocator's measurement tools can currently generate the following kinds of geometric features:

Points: A 2D or 3D point. Can be used for point-to-point or point-to-line measurements.

Lines: A straight line that is infinitely long. Useful for locating the orientation of an enclosure or part, or to intersect with another line to form a reference point that can be consumed by a Feature tool.

Planes: A plane extracted from a surface. Can be used for point-to-plane distance or line-plane intersection measurements.

Circles: A circle extracted from a sphere.

The following tables list the tools that can generate geometric features. (Tools that can't generate geometric features are excluded.)

Geometric features generated by Surface tools

Tool	Point	Line	Plane	Circle
Bounding Box	X			
Countersunk Hole	X			
Edge	X			
Ellipse	X	X		
Hole	X	X		
Opening	X			
Plane			X	
Position	X			
Sphere	X			X
Stud	X			
Volume				

 The Circle geometric feature currently cannot be used by any of the built-in Feature tools.


Geometric features generated by Profile tools

Tool	Point	Line
Area	X	
Bounding Box	X	
Circle	X	
Intersect	X	X
Line	X	X
Position	X	

The [Feature Intersect](#) tool can also produce an intersect point. [Script tools](#) do not currently take geometric features as input.

Fit Lines

Some measurements involve estimating lines in order to measure angles or intersection points. A fit line can be calculated using data from either one or two fit areas.

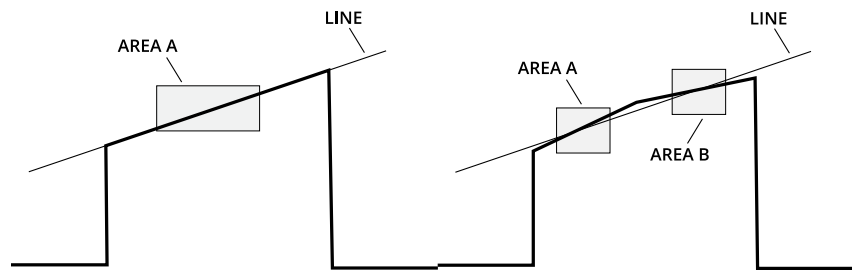


A line can be defined using one or two areas. Two areas can be used to bypass discontinuity in a line segment.


Decisions

Results from a measurement can be compared against minimum and maximum thresholds to generate *pass / fail* decisions. The decision state is *pass* if a measurement value is between the minimum and maximum threshold. In the data viewer and next to the measurement, these values are displayed in green. Otherwise, the decision state is *fail*. In the user interface, these values are displayed in red.

All measurements provide decision settings under the **Output** tab.

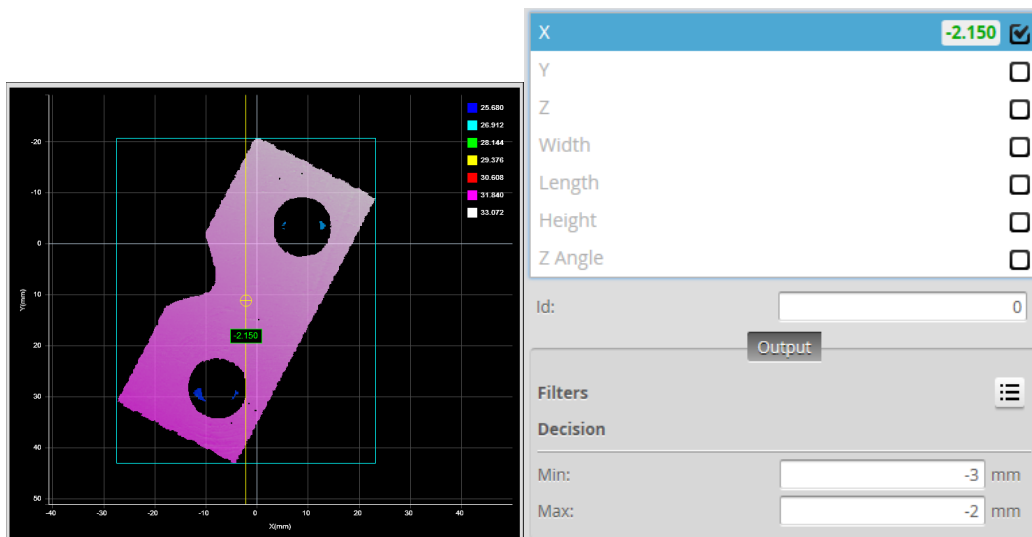

Value (-2.150) within decision thresholds (Min: -3, Max: -2). Decision: Pass

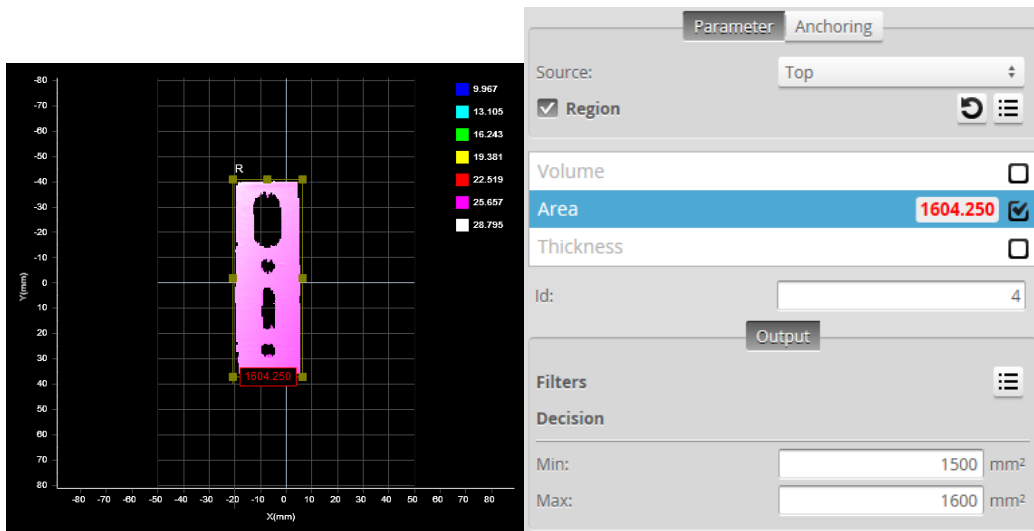

Value (1604.250) outside decision thresholds (Min: 1500, Max: 1600). Decision: Fail

Along with measurement values, decisions can be sent to external programs and devices. In particular, decisions are often used with digital outputs to trigger an external event in response to a measurement. See *Output* on page 330 for more information on transmitting values and decisions.

To configure decisions:

1. Go to the **Measure** page by clicking on the **Measure** icon.



The [scan mode](#) must be set to the type of measurement you need to configure. Otherwise, the wrong tools, or no tools, will be listed on the **Measure** page.

2. In the **Tools** panel, click on a tool in the tool list.
3. In the measurement list, select a measurement.
To select a measurement, it must be enabled. See *Enabling and Disabling Measurements* on page 159 for instructions on how to enable a measurement.
4. Click on the **Output** tab.
For some measurements, only the **Output** tab is displayed.
5. Enter values in the **Min** and **Max** fields.

Filters

Filters can be applied to measurement values before they are output from the Gocator sensors.

Filters

Scale:

Offset:

Hold Last Valid: ☐

☒ Smoothing: 1 Samples

Preserve Invalid: ☐

All measurements provide filter settings under the **Output** tab. The following settings are available.

Filter	Description
Scale and Offset	The Scale and Offset settings are applied to a measurement value according to the following formula: $\text{Scale} * \text{Value} + \text{Offset}$ Scale and Offset can be used to transform the output without the need to write a script. For example, to convert the measurement value from millimeters to thousands of an inch, set Scale to 39.37. To convert from radius to diameter, set Scale to 2. For more information on scripts, see <i>Scripts</i> on page 324.
Hold Last Valid	Holds the last valid value when the measurement is invalid.
Smoothing	Averages the <i>valid</i> measurements in the number of preceding frames specified in Samples. Use this to reduce the impact of random noise on a measurement's output. If Hold Last Valid is enabled, the smoothing filter uses the last valid measurement value until a valid value is encountered.
Preserve Invalid	When enabled, smoothing is only applied to valid measurements and not to invalid results: invalid results are not modified and are sent to output as is. When disabled, smoothing is applied to both valid and invalid results. (This setting is only visible when Smoothing is enabled.) If Hold Last Valid is enabled, results will always be valid, in which case this setting does nothing.

To configure the filters:

1. Go to the **Measure** page by clicking on the **Measure** icon.



The [scan mode](#) must be set to the type of measurement you need to configure. Otherwise, the wrong tools, or no tools, will be listed on the **Measure** page.

2. In the **Tools** panel, click on a tool in the tool list.
3. In the measurement list, select a measurement.

To select a measurement, it must be enabled. See *Enabling and Disabling Measurements* on page 159 for instructions on how to enable a measurement.

4. Click on the **Output** tab.
For some measurements, only the **Output** tab is displayed.
5. Expand the **Filters** panel by clicking on the panel header or the  button.
6. Configure the filters.
Refer to the table above for a list of the filters.

Measurement Anchoring

When parts that a sensor is scanning move on a transport mechanism such as a conveyor, their position typically changes from part to part in one or both of the following ways:


- along the X, Y, and Z axes (basically, horizontally and vertically)
- around the Z axis (orientation angle)

When the position and angle variation between parts is minor—for example, when scanning electronic parts in trays—you can anchor one tool to one or more measurements from another tool to compensate for these minor shifts. As a result, Gocator can correctly place the anchored tool's measurement regions on each part. This increases the repeatability and accuracy of measurements.




For cases where movement from part to part is more drastic, you can use part matching to compensate. However, in order for [part matching](#) to work properly, the entire part typically must be visible in the field of view.

For example, the following image shows a surface scan of a PCB. A [Surface Dimension](#) height measurement returns the height of a surface-mount capacitor relative to a nearby surface (the F1 region).

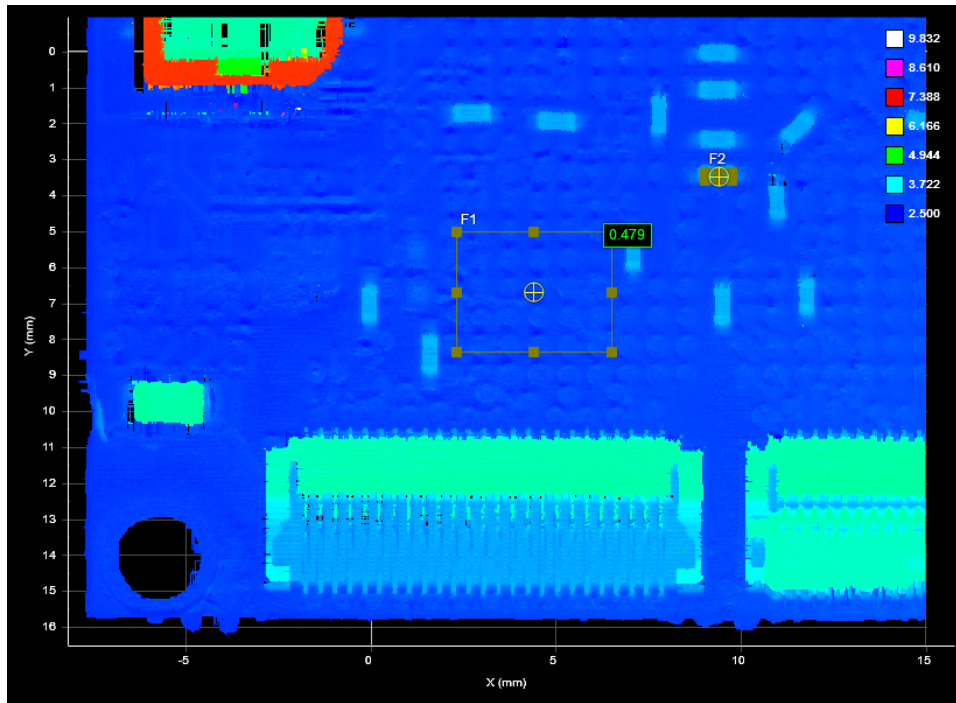


In the following scan, the part has shifted, but the measurement regions remain where they were originally configured, in relation to the sensor or system coordinate system, so the measurement returned is incorrect:

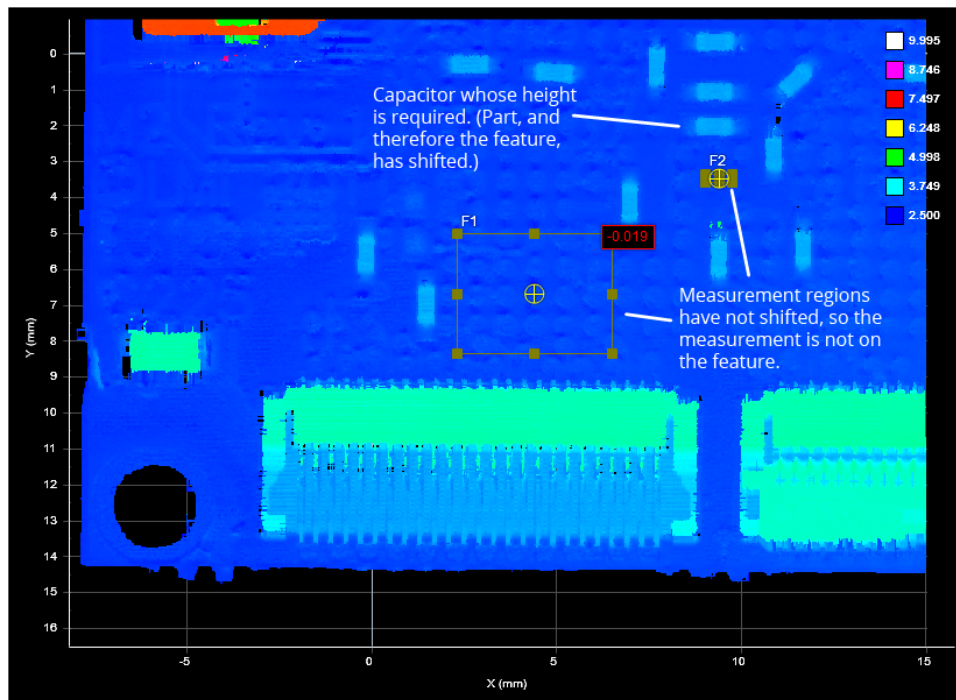


When you set a tool's anchor source, an offset is calculated between the anchored tool and the anchor source. This offset is used for each frame of scanned data: the anchored tool's [measurement region](#) is placed in relation to the anchor source, at the calculated offset.

In the following image, after the Surface Dimension tool is anchored to the X and Y measurements from a [Surface Hole tool](#) (placed over the hole to the lower left), Gocator compensates for the shift—mostly along the Y axis in this case—and returns a correct measurement, despite the shift.

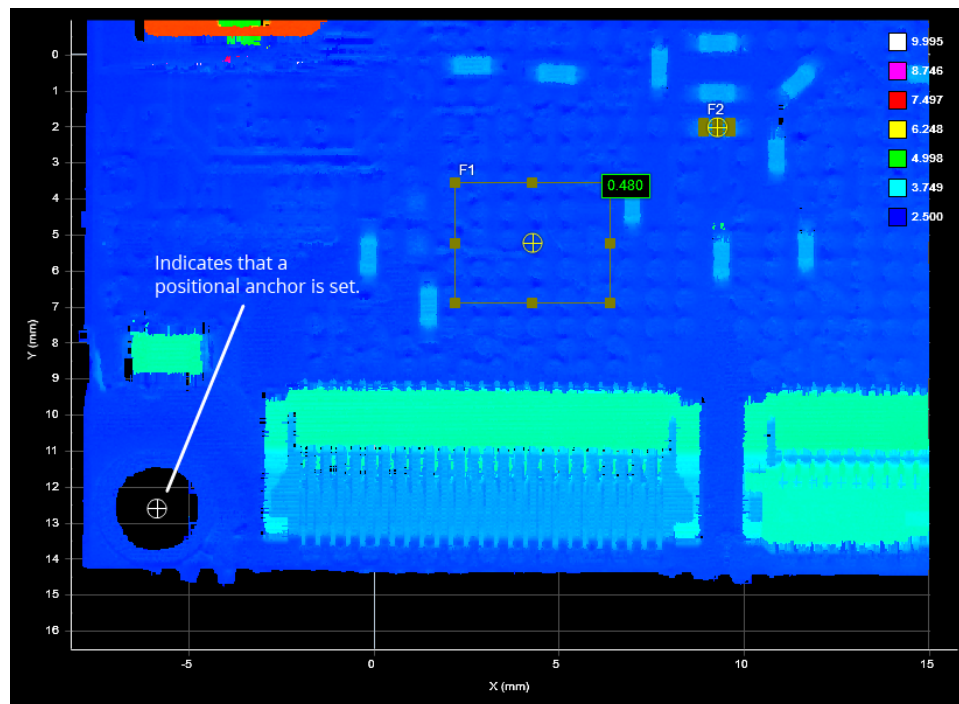

You can combine the positional anchors (X, Y, or Z measurements) with an angle anchor (a Z Angle measurement) for optimum measurement placement. For example, in the following scan, the part has not only shifted on the XY plane but also rotated around the Z axis. Anchoring the Surface Dimension tool to the Z Angle measurement of a [Surface Edge tool](#) (placed on the lower edge in this case) compensates for the rotation, and the anchored tool returns a correct measurement.

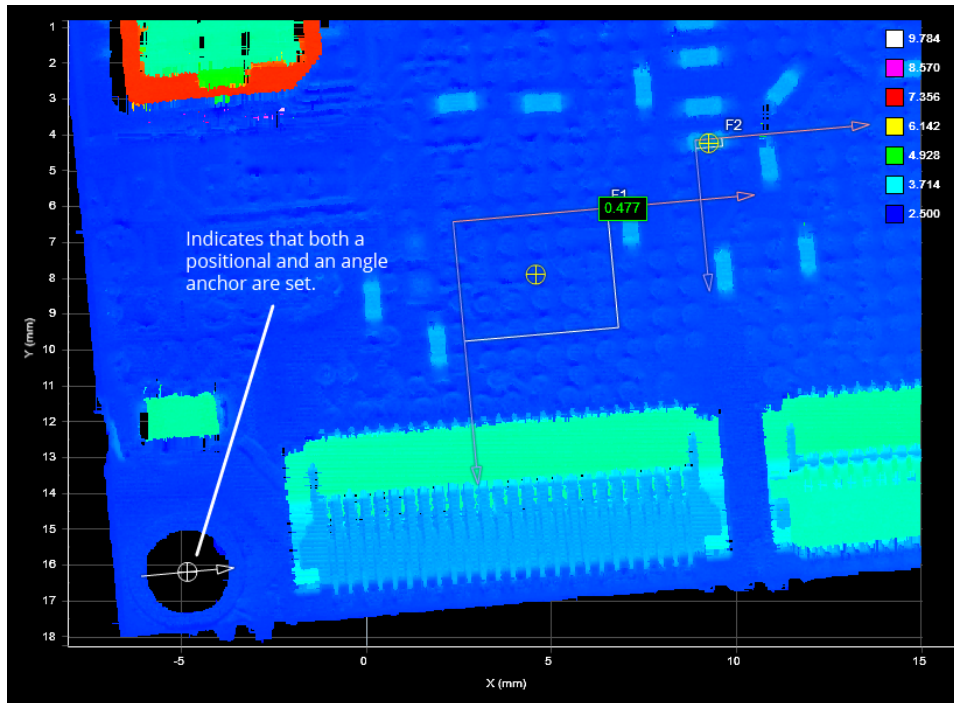

□ If Z Angle anchoring is used with both X and Y anchoring, the X and Y anchors should come from the same tool.

□ If Z Angle anchoring is used without X or Y anchoring, the tool's measurement region rotates around its *center*. If only one of X or Y is used, the region is rotated around its center and then shifted by the X or Y offset.

Several anchors can be created to run in parallel. For example, you could anchor the measurements of one tool relative to the left edge of a target, and anchor the measurements of another tool relative to the right edge of a target.

You can combine positional anchors (X, Y, or Z) with angle anchors (Z Angle) for optimum measurement placement.

To anchor a profile or surface tool to a measurement:


1. Place a representative target object in the field of view.
 - In Profile mode*
 - a. Use the **Start** or **Snapshot** button to view live profile data to help position the target.
 - In Surface mode*
 - a. Adjust Part Detection settings (see *Part Detection* on page 107) if applicable.
 - b. Start the sensor, scan the target, and then stop the sensor.
2. On the **Measure** page, add a suitable tool to act as an anchor.
 A suitable tool is one that returns an X, Y, or Z position or Z Angle as a measurement value.

- Adjust the anchoring tool's settings and measurement region, and choose a feature type (if applicable). You can adjust the measurement region graphically in the data viewer or manually by expanding the **Regions** area.

The position and size of the anchoring tool's measurement regions define the zone within which movement will be tracked.

 If you intend to use angle anchoring and the part in the initial scan is rotated too much, you may need to rotate the anchoring tool's region to accommodate this rotation. For more information on region rotation, see *Regions* on page 145.

- Add the tool that you want to anchor. Any tool can be anchored.
- Adjust the tool and measurement settings, as well as the measurement regions, on a scan of the representative target.
- Click on the tool's **Anchoring** tab.
- Choose an anchor from one of the drop-down boxes.

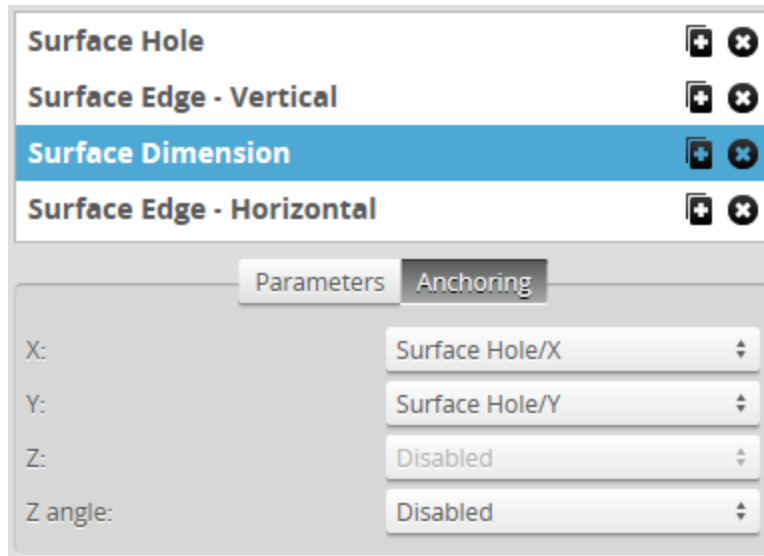

If the sensor is running, the anchored tool's measurement regions are shown in white to indicate the regions are locked to the anchor. The measurement regions of anchored tools cannot be adjusted. The anchored tool's measurement regions are now tracked and will move with the target's position and angle under the sensor, as long as the anchoring measurement produces a valid measurement value. If the anchoring measurement is invalid, for example, if part moves outside its measurement region, the anchored tool will not show the measurement regions at all and an "Invalid-Anchor" message will be displayed in the tool panel.


- Verify that the anchored tool works correctly on other scans of targets in which the part has moved slightly.

To remove an anchor from a tool:

- Click on the anchored tool's Anchoring tab. Select **Disabled** in the X, Y, or Z drop-down.

Enabling and Disabling Measurements

All of the measurements available in a tool are listed in the measurement list in the **Tools** panel after a tool has been added. To configure a measurement, you must enable it.

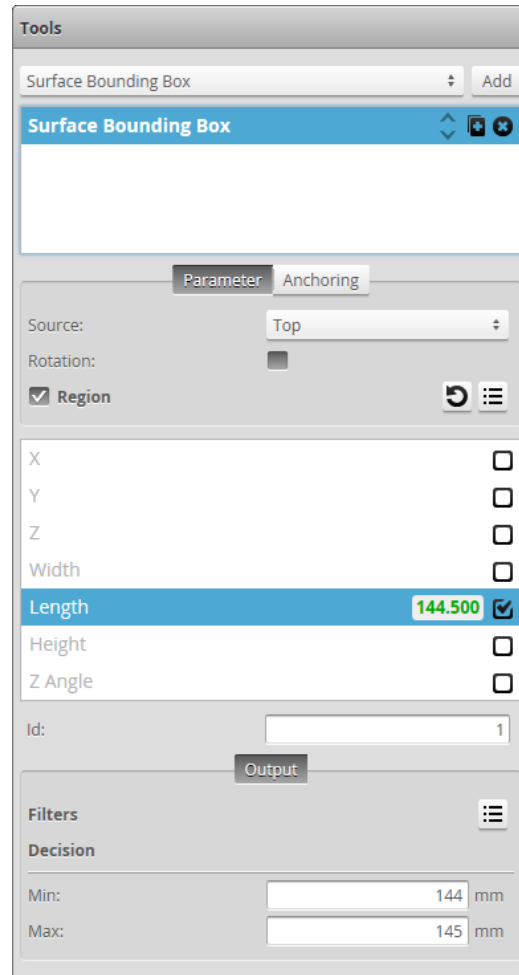

To enable a measurement:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, tools will not be available in the **Measure** panel.
3. Go to the **Measure** page by clicking on the **Measure** icon.
4. In the measurements list, check the box of the measurement you want to enable.
The measurement will be enabled and selected. The **Output** tab, which contains output settings will be displayed below the measurements list. For some measurements, a **Parameters** tab, which contains measurement-specific parameters, will also be displayed.

To disable a measurement:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Surface mode in the **Scan Mode** panel.
3. Go to the **Measure** page by clicking on the **Measure** icon.
4. In the measurement list, uncheck the box of the measurement you want to disable.
The measurement will be disabled and the **Output** tab (and the **Parameters** tab if it was available) will be hidden.

Editing Tool, Input, or Output Names

You can change the names of tools you add in Gocator. You can also change the names of their measurements. This allows multiple instances of tools and measurements of the same type to be more easily distinguished in the Gocator web interface. The measurement name is also referenced by the Script tool.

To change a tool or measurement name:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, tools will not be available in the **Measure** panel.
3. Go to the **Measure** page by clicking on the **Measure** icon.
4. Do one of the following:
 - **Tool:** In the tool list, double-click the tool name you want to change
 - **Measurement:** In a tool's measurement list, double-click the measurement name you want to change.
5. Type a new name.
6. Press the Tab or Enter key, or click outside the field.
The name will be changed.

Changing a Measurement ID

The measurement ID is used to uniquely identify a measurement in the Gocator protocol or in the SDK. The value **must** be unique among all measurements.

To edit a measurement ID:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Surface mode in the **Scan Mode** panel.
If this mode is not selected, tools will not be available in the **Measure** panel.
3. Go to the **Measure** page by clicking on the **Measure** icon.
4. In the measurement list, select a measurement.

To select a measurement, it must be enabled. See *Enabling and Disabling Measurements* on page 159 for instructions on how to enable a measurement.


5. Click in the ID field.
6. Type a new ID number.
The value must be unique among all measurements.
7. Press the Tab or Enter key, or click outside the ID field.
The measurement ID will be changed.

Duplicating a Tool

You can quickly create a copy of a previously added tool in Gocator. All settings of the original are copied. This is useful, for example, when you need almost identical tools with only minor variations, such as different Min and Max values.

To duplicate a tool:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Profile or Surface mode in the **Scan Mode** panel.
If one of these modes is not selected, tools will not be available in the **Measure** panel.
3. Go to the **Measure** page by clicking on the **Measure** icon.
4. In the tool list, click the Duplicate button (📄) of the tool you want to duplicate.
A copy of the tool appears below the original.

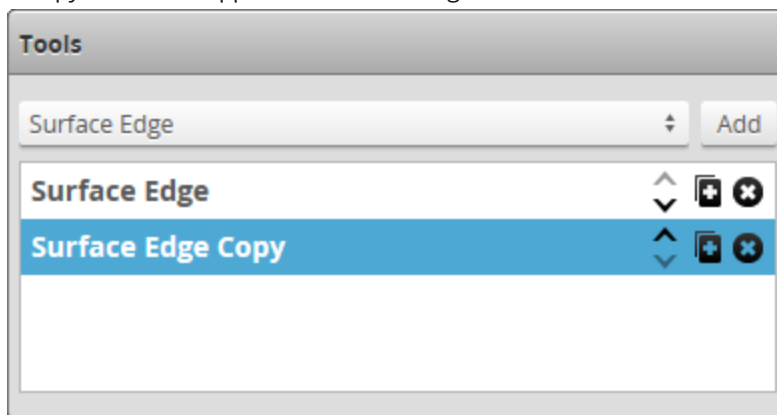

5. Configure the copy as desired and rename it if necessary.
For information on renaming a tool, see *Editing Tool, Input, or Output Names* on the previous page.

Removing a Tool

Removing a tool removes all of its associated measurements.


To remove a tool:

1. Go to the **Scan** page by clicking on the **Scan** icon.
2. Choose Profile or Surface mode in the **Scan Mode** panel.
If this mode is not selected, tools will not be available in the **Measure** panel.

3. Go to the **Measure** page by clicking on the **Measure** icon.
4. In the tool list, click on the Duplicate button (⊞) of the tool you want to duplicate.
A copy of the tool appears below the original.

Reordering Tools

When you [add](#) or [duplicate](#) a tool, the tool is added to the bottom of the list in the **Tools** panel. You can reorder tools in the web interface to organize tools more logically. For example, you could group tools that output [geometric features](#) with the tools that use them. Or you could group tools you use as anchors with the tools that use those anchors.

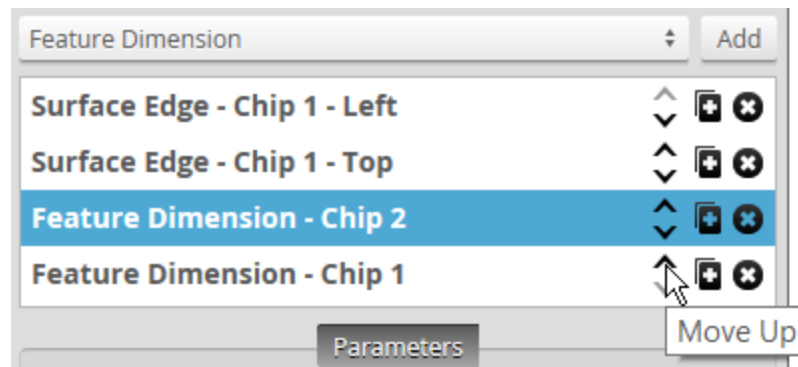

Profile Measurement

This section describes the profile measurement tools available in Gocator sensors.

When Gocator is in Surface [mode](#) and you have defined a [section](#), a **Stream** option displays in Profile tools. Choosing a section in the **Stream** option lets you apply profile measurements to the section.


Profile measurement tools can be used on sections. For more information on sections, see *Sections* on page 135.

Advanced Height

The Advanced Height tool provides highly accurate and repeatable master (template) comparison and step height measurements (up to 16 in a tool instance).

 All instances of the Advanced Height tool share the same template file set in **File**. For this reason, you must be careful when editing or removing template files shared by another instance of the tool.

Height measurements can be made relative to a reference line. Reference line sets the measurement direction (perpendicular to the reference line). A separate base line can also be set so that height measurements are between the base line and a profile feature, rather than the reference line (which in this case is used for angle correction).

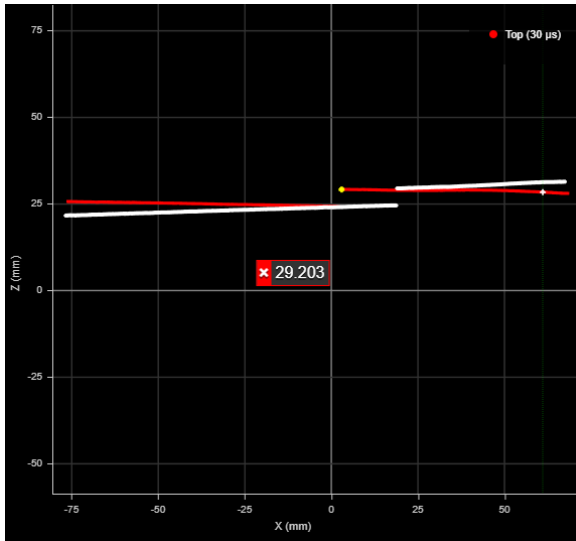

ParametersAnchoring

Source:Top

☒ Master

FileProfileAdvancedHeight-Mas...

OperationNormal

☒ Display Master

☐ X Correction

☐ Reference Line

Height Region0

☐ Base Height

MeasurementsData

Height 1	☐
Height 2	☐
Height 3	☐
Height 4	☐
Height 5	☐
Height 6	☐
Height 7	☐
Height 8	☐
Height 9	☐
Height 10	☐
Height 11	☐
Height 12	☐
Height 13	☐
Height 14	☐
Height 15	☐
Height 16	☐
Base Height	☐
Master Correction X	0.000 ☒
Master Correction Z	0.000 ☒
Master Correction Z Angle	0.000 ☒
Max Height Difference	5.097 ☒
Max Difference Position X	2.945 ☒
Max Difference Position Z	29.203 ☒

ID:

Output

Filters

Decision

Min: mm

Max: mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Data, and Settings

Measurements

Measurement

Height {n}

The height measured in height region {n}. Height is measured perpendicular

Will be Invalid if the appropriate number of height regions has not been set in **Height Region**.

Master Correction X

Master Correction Z

Master Correction Z Angle

The amount of correction applied to the profile with respect to the master.

Max Height Difference

The maximum height difference.

Max Difference Position X

Max Difference Position Z

The X and Z positions of the maximum height difference.

Data

Type

Difference Profile

Description

A profile representing the difference between the master and the current frame's profile, available for use as input in the **Stream** drop-down in other tools.

Parameters

Parameter

Source

Master

Reference Line

Height Region


Description

The sensor that provides data for the tool's measurements. For more information, see *Source* on page 145.

Toggles a set of settings related to master comparison. For more information, see *Master Comparison* on the next page.

Toggles a set of settings related to the reference line. For more information, see *Reference Line* on page 166.

Sets the number of height region measurements the tools returns. For each height region, the tool displays an **Edit Height Region** checkbox that you use to edit the height region's location and size. The tool also displays a Feature drop-down that lets you select the type of feature for that height region.

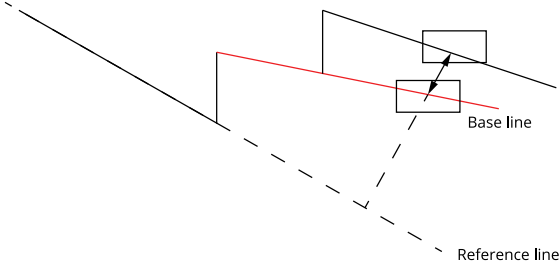Parameter	Description
Base Height	Use base height to "set" the Z axis: when enabled height values are offset from the base. This is useful if you need to measure between two features, rather than between a feature and the reference line.  When enabled, the tool displays settings related to the base height: size and position of the base height's region (Base Height section) and the base height's feature.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Master Comparison

When you check the **Master** option, the tool displays several additional settings and disables measurement anchoring from other tools.

Master Parameters

Parameter	Description
File	The file containing the master (template) profile, created by choosing Save from the Operation drop-down.
Operation	Contains operations related to the master file. One of the following: • Normal: Selected by the tool after you perform another file operation. • Create: Saves the <i>current profile</i> as the master. • Delete: Deletes the master file selected in File.
Display Master	Overlays the master profile, in white, on the current profile.
X Correction	Enables settings related to X correction (left or right movement) of the profile compared to the master profile. For more information, see <i>X Correction</i> on the next page.

X Correction

When you check the **Master** option and enable **X Correction**, the tool displays several additional settings.

X Correction Parameters

Parameter	Description
Edit Edge Region	Enables an edge region section letting you configure the region. You can also edit this region in the data viewer.
Edge Direction	Determines the direction of the edge. One of the following: Falling or Rising .
Count Direction	Indicates how edges are counted. One of the following: Left to Right or Right to Left .
Edge Index	Indicates which edge the tool uses.

Reference Line

When you check the **Master** option and enable **Reference Line**, the tool displays several additional settings. The reference line is use to set the measurement direction (perpendicular to the reference line).

Reference Line Parameters

Parameter	Description
Edit Edge Region	Enables an edge region section letting you configure the region. You can also edit this region in the data viewer.
Edge Direction	Determines the direction of the edge. One of the following: Falling or Rising .
Count Direction	Indicates how edges are counted. One of the following: Left to Right or Right to Left .
Edge Index	Indicates which edge the tool uses.

Anchoring

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Area

The Area tool determines the cross-sectional area within a region.

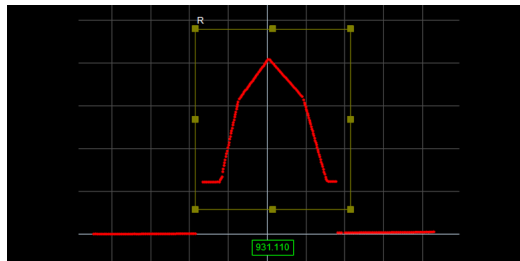

Parameters		Anchoring	
Source:	Top		
Type:	Object		
Baseline:	Line		
☒ Region			
Line	1 Region		

Measurements		Features	
Area	931.110	☒	
Centroid X		☐	
Centroid Z		☐	

Output	
ID:	0

Filters	
Decision	
Min:	930 mm ²
Max:	940 mm ²

Areas are positive in regions where the profile is above the X axis. In contrast, areas are negative in regions where the profile is below the X axis.

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.


Measurements, Features, and Settings

Measurements



Measurement	Illustration
-------------	--------------

Area

Measures the cross-sectional area within a region that is above or below a fitted baseline.

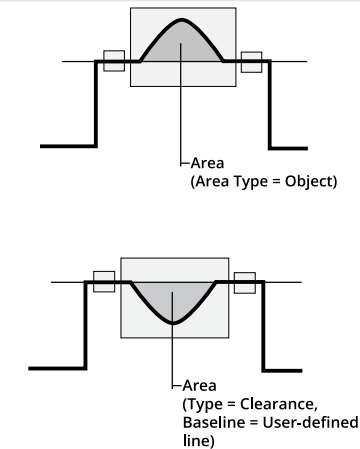

Standalone, or dual-sensor setup in Wide orientation

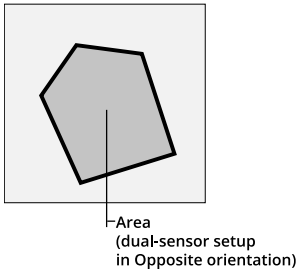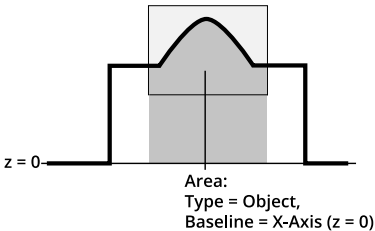


Centroid X

Determines the X position of the centroid of the area.

Centroid Z

Determines the Z position of the centroid of the area.

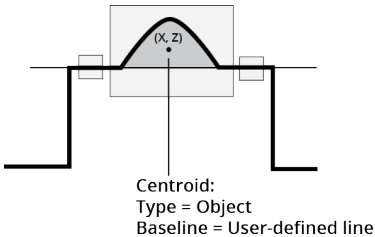

Features

Type	Description
------	-------------

Center Point	The center point of the area.
--------------	-------------------------------

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Type	Object area type is for convex shapes above the baseline. Regions below the baseline are ignored. Clearance area type is for concave shapes below the baseline. Regions above the baseline are ignored.
Baseline	Baseline is the fit line that represents the line above which (Object clearance type) or below which (Clearance area type) the cross-sectional area is measured. When this parameter is set to Line , you must define a line in the Line parameter. See <i>Fit Lines</i> on page 151 for more information on fit lines. When this parameter is set to X-Axis , the baseline is set to $z = 0$.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Line	When Baseline (see above) is set to Line , set this to one of the following: 1 Region or 2 Regions: Lets you set one or two regions whose data the tool will use to fit a line. All Data: The tool uses all of the data in the active area. For more information on regions, see <i>Regions</i> on page 145). For more information on fit lines, see <i>Fit Lines</i> on page 151.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.



Bounding Box

The Bounding Box tool provides measurements related to the smallest box that contains the profile (for example, X position, Z position, width, etc.).

The bounding box provides the absolute position from which the Position centroids tools are referenced.



When you use measurement tools on parts or sections, the coordinates returned are relative to the part or section. You can use the values returned by the Bounding Box tool's "Global" (see below) measurements as an offset in a Gocator script to convert the positional (X, Y, or Z) measurements of other measurement tools to [sensor](#) or [system](#) coordinates (depending on whether the sensor is aligned). For more information on Gocator scripts, see *Scripts* on page 324.


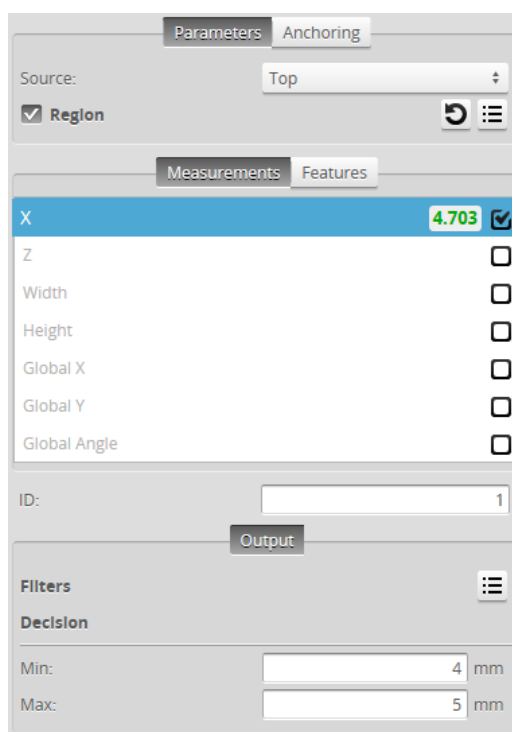
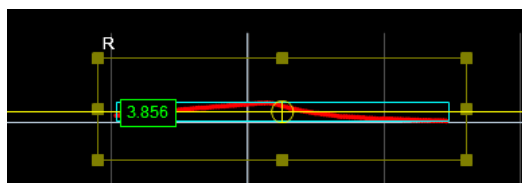


Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

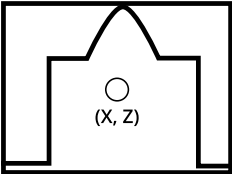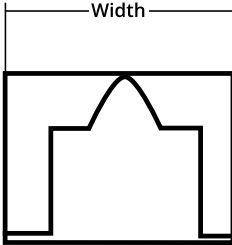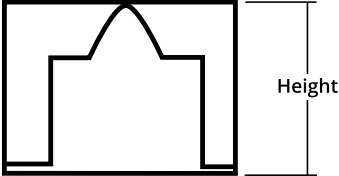Measurement	Illustration
X Determines the X position of the center of the bounding box that contains the profile. The value returned is relative to the profile.	
Z Determines the Z position of the center of the bounding box that contains the profile. The value returned is relative to the profile.	
Width Determines the width of the bounding box that contains the profile. The width reports the dimension of the box in the direction of the minor axis.	
Height Determines the height (thickness) of the bounding box that contains the profile.	
Global X* Determines the X position of the center of the bounding box that contains the profile relative to the surface from which the profile is extracted.	
Global Y* Determines the Y position of the center of the bounding box that contains the profile relative to the surface from which the profile is extracted.	
Global Angle* Determines the angle around Z of the section used to create the profile, relative to the surface from which it is extracted, where a line parallel to the X axis is 0 degrees. Angles of sections pointing to the bottom of the data viewer are positive. Angles of sections pointing to the top of the data viewer are negative.	
 *The Global X, Global Y, and Global Angle measurements are intended to be used with profiles extracted from a surface using a section.	

When used with profiles not generated from a section, the Global X measurement returns the same value as the X measurement, and the Global Y and Global Angle measurements return 0.000.

Features

Type	Description
Center Point	The center point of the bounding box.
Corner Point	The lower left corner of the bounding box.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.

 A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.


 For more information on anchoring, see *Measurement Anchoring* on page 154.

Circle

The Circle tool provides measurements that find the best-fitted circle to a profile and measure various characteristics of the circle.



The tool may be unable to fit a circle to the profile when attempting the fit on a small number of relatively collinear data points.

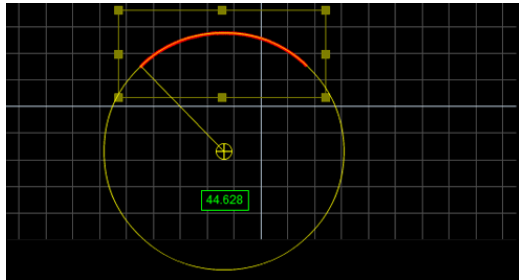

Parameters
Anchoring

Source: Top
☒ Region

Measurements
Features

X ☐
Z ☐
Radius 44.628 ☒

ID: 2

Output

Filters

Decision

Min: 44 mm
Max: 46 mm

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

Measurement	Illustration
Radius Measures the radius of the circle.	
X Finds the circle center position in the X axis.	
Z Finds the circle center position in the Z axis.	

Measurement	Illustration
Standard Deviation Returns the standard deviation of the data points with respect to the fitted circle.	
Min Error Max Error The minimum and maximum error among the data points with respect to the fitted circle.	
Min Error X Min Error Z The X and Z position of the minimum error.	
Max Error X Max Error Z The X and Z position of the maximum error.	

Features

Type	Description
Center Point	The center point of the fitted circle.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Closed Area

The Closed Area tool determines the cross-sectional area within a region using point cloud data from a dual- or multi-sensor system.

The tool is intended for use with roughly circular shaped profiles, or profiles that do not contain excessive concavity. The tool renders a polygon corresponding to the profile in the data viewer. Use this polygon to decide whether the tool can correctly calculate an acceptable representation of the profile. Minor gaps in the profile are permitted; the size of these gaps is configurable.

When the tool is used in conjunction with a script tool, you can calculate the volume of a target; for more information on the Script tool, see *Script* on page 211.

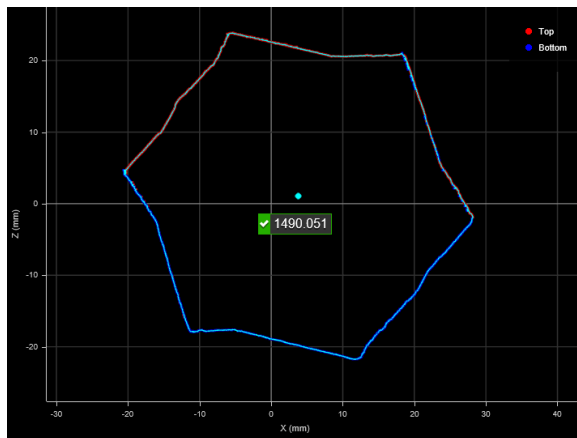

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements and Settings


Measurements

Measurement

Closed Area


Measures the cross-sectional area within a region using data from a dual- or multi-sensor system.



Illustration

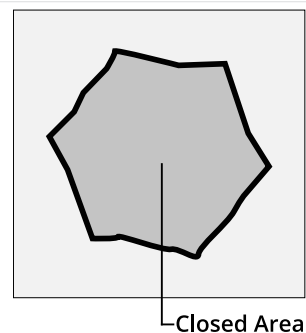

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145. For this tool, you should set this parameter to Top and Bottom.
Use Region	Indicates whether the tool uses a user-defined region. If this option is not checked, the tool uses data from the entire active area.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Use Max Gap	Indicates whether the tool uses the Max Gap setting (see below).
Max Gap	The maximum gap allowed between any two profile points on the contour of the target, in millimeters. In the following illustration of a profile, if the gap were greater than the value set in Max Gap, the tool would return an invalid value.

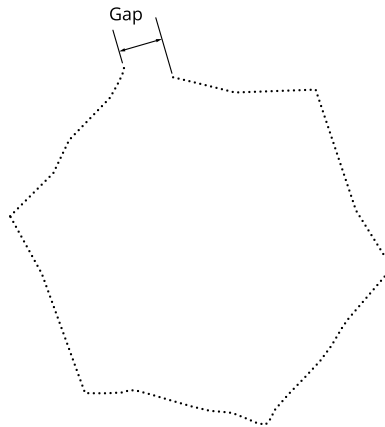

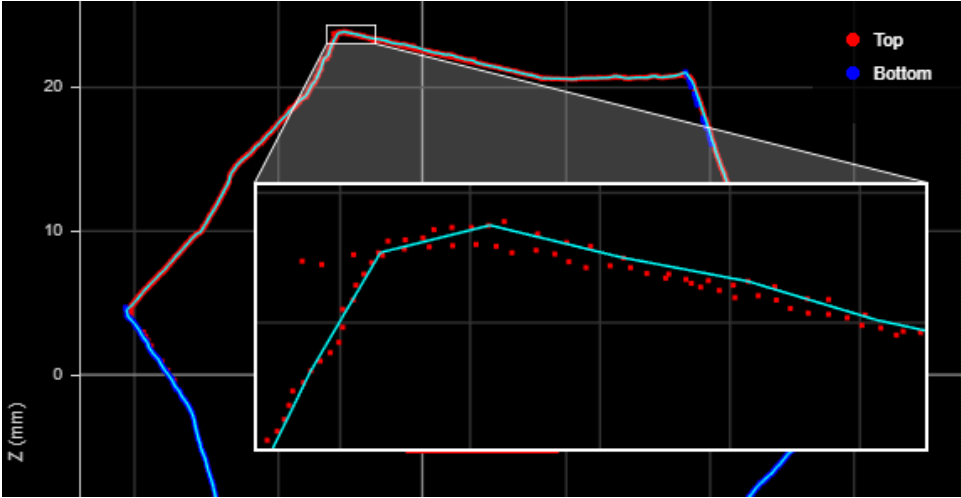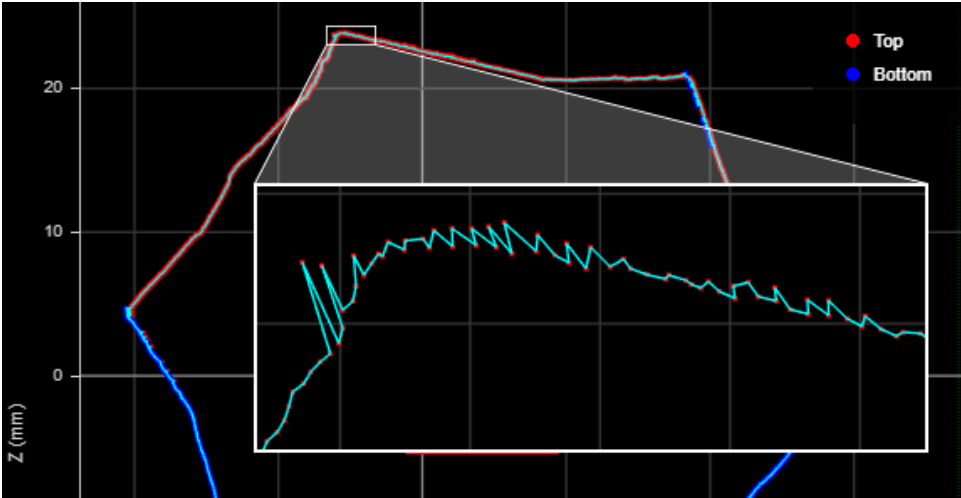Parameter	Description
Sample Spacing	The angle interval around the center of the profile the tool uses to calculate area. Enabling this setting and setting a value can increase the tool's performance. In the following image, the spacing is set to 1 degree. The polygon calculated from the profile points, which is then used to calculate the area, is simplified, increasing performance but reducing accuracy.  In the following image, Sampling Spacing is set to 0. Accuracy is increased, but performance is reduced.  If you set the value to 0, the tool uses the smallest angle permitted internally by the sampling engine.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Dimension

The Dimension tool provides Width, Height, Distance, Center X, and Center Z measurements.

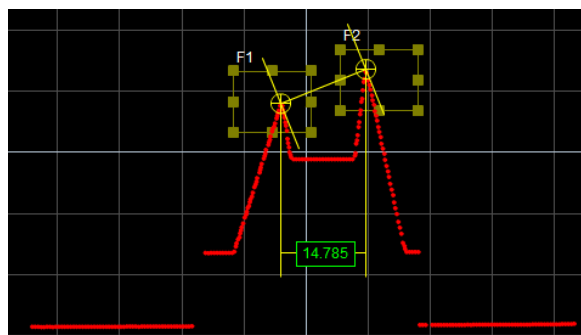

Parameters

Anchoring

Source:

Top

Feature 1

Max Z

Feature 2

Max Z

Width ☐

Height ☐

Distance

14.785

☒

Center X ☐

Center Z ☐

Id:

4

Output

Filters

Decision

Min:

14

 mm

Max:

15

 mm

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements and Settings

Measurements

Measurement


Illustration

Width

Determines the difference along the X axis between two feature points.

The difference can be calculated as an absolute or signed result. The difference is calculated by:

$$\text{Width} = \text{Feature 2}_{X \text{ position}} - \text{Feature 1}_{X \text{ position}}$$

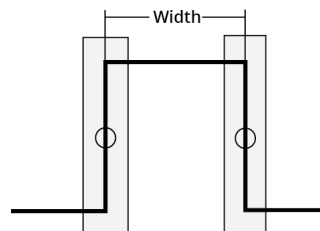





Height

Determines the difference along the Z axis between two feature points.

The difference can be expressed as an absolute or signed result. The difference is calculated by:

$$\text{Height} = \text{Feature 2}_{Z \text{ position}} - \text{Feature 1}_{Z \text{ position}}$$

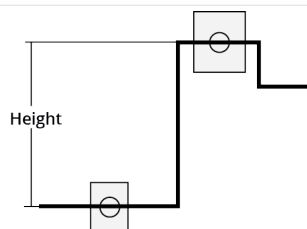

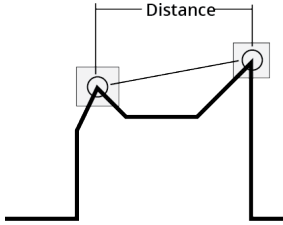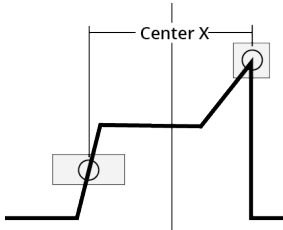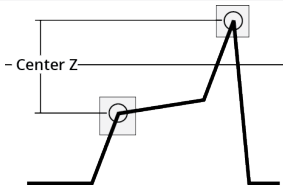Measurement	Illustration
Distance Determines the direct, Euclidean distance between two feature points.	
Center X Finds the average location of two features and measures the X axis position of the average location	
Center Z Finds the average location of two features and measures the Z axis position of the average location.	
Parameters	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.

Parameter	Description
Feature 1 Feature 2	The Feature 1 and Feature 2 settings represent the two features the tool uses to perform measurements. For each, one of the following: • Max Z • Min Z • Max X • Min X • Corner • Average • Rising Edge • Falling Edge • Any Edge • Top Corner • Bottom Corner • Left Corner • Right Corner • Median To set the region of a feature, adjust it graphically in the data viewer, or expand the feature using the expand button (⋮) and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145.
Absolute (Width and Height measurements only)	Determines if the result will be expressed as an absolute or a signed value.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Groove

The Groove tool provides measurements of V-shape, U-shape, or open-shape grooves.

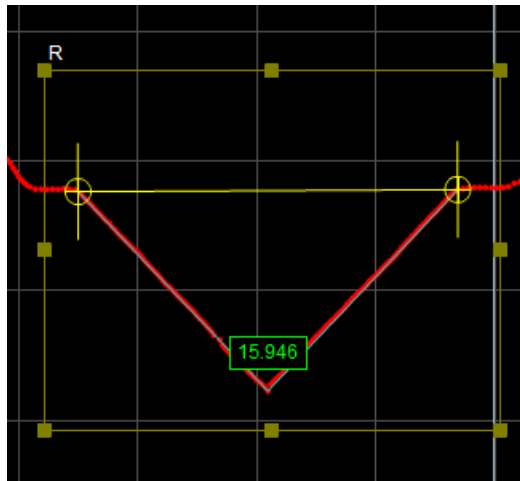

Parameter Anchoring

Source: Top

Shape: U-Shape

Min Depth: 0 mm

Min Width: 0 mm

Max Width: 0 mm

☒ Region

Width 15.946

X

Z

Width 15.946

Depth

Id: 6

Parameters Output

Select Type: Max Depth

Index: 0

The Groove tool uses a complex feature-locating algorithm to find a groove and then return measurements. See "Groove Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel.



The Groove tool lets you add multiple measurements of the same type to receive measurements and set decisions for multiple grooves. Multiple measurements are added by using the drop-down above the list of measurements and clicking on the **Add** button.



For example, if a target has three grooves, by adding two measurements, choosing **Index From The Left** in the **Select Type** setting of those measurements, and providing values of 0 and 2 in the **Index** setting of the measurements, respectively, the Groove tool will return measurements and decisions for the first and third grooves.



For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

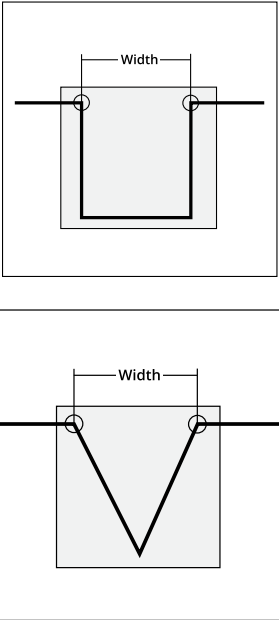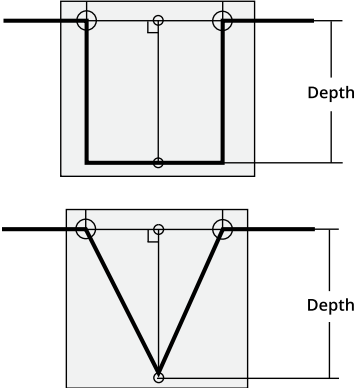Measurement	Illustration
Width Measures the width of a groove.	
Depth Measures the depth of a groove as the maximum perpendicular distance from a line connecting the edge points of the groove.	

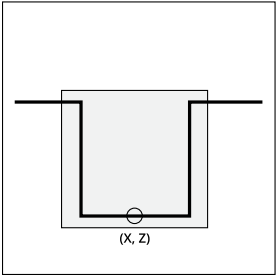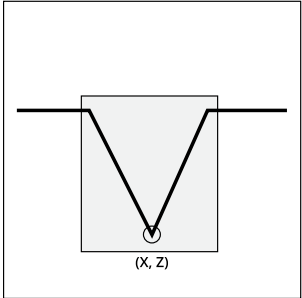Measurement	Illustration
X Measures the X position of the bottom of a groove.	
Z Measures the Z position of the bottom of a groove.	
Parameters	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.

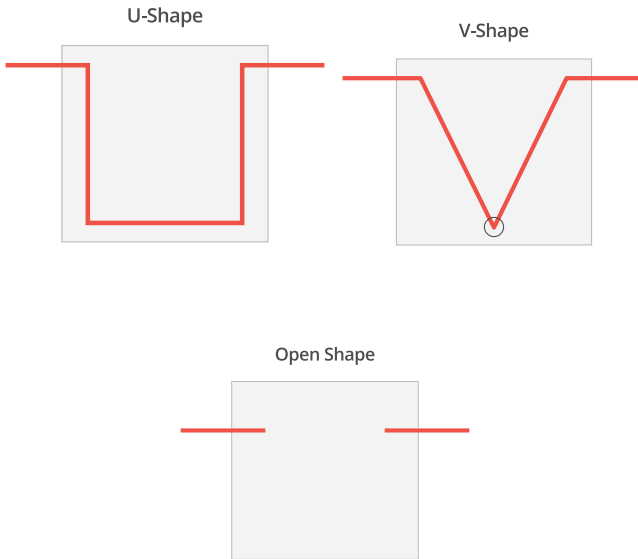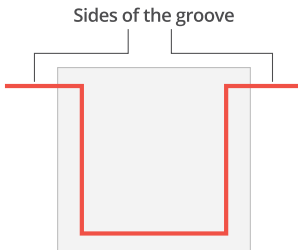Parameter	Description
Shape	Shape of the groove  The diagrams illustrate three types of groove shapes. The 'U-Shape' diagram shows a rectangular groove with a red outline. The 'V-Shape' diagram shows a V-shaped groove with a red outline and a small circle at the bottom vertex. The 'Open Shape' diagram shows a rectangular groove with a red outline, but the top edges are open to the left and right.
Min Depth	Minimum depth for a groove to be considered valid.
Min Width	Minimum width for a groove to be considered valid. The width is the distance between the groove corners.
Max Width	Maximum width of a groove to be considered valid. If set to 0, the maximum is set to the width of the measurement area.
Region	The measurement region defines the region in which to search for the groove. For a stable measurement, the measurement region should be large enough to cover some data on the left and right sides of the groove.  The diagram shows a rectangular groove with a red outline. Two horizontal lines extend from the left and right sides of the groove, indicating the measurement region. A bracket above the groove is labeled 'Sides of the groove'.
For more information on regions, see <i>Regions</i> on page 145.	

Parameter	Description
Location (Groove X and Groove Z measurements only)	Specifies the location type to return Bottom - Groove bottom. For a U-shape and open-shape groove, the X position is at the centroid of the groove. For a V-shape groove, the X position is at the intersection of lines fitted to the left and right sides of the groove. See algorithm section below for more details. Left - Groove's left corner. Right - Groove's right corner.
Select Type	Specifies how a groove is selected when there are multiple grooves within the measurement area. Maximum Depth - Groove with maximum depth. Index from The Left - 0-based groove index, counting from left to right Index from the Right - 0-based groove index, counting from right to left.
Index	0-based groove index.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Intersect

The Intersect tool determines intersect points and angles.

The Intersect tool's measurements require two fit lines, one of which is a reference line set to the X axis ($z = 0$), the Z axis ($x = 0$), or a user-defined line.



ParametersAnchoring

Source:Top

Reference Type:Line

Line (L)2 Regions

Ref Line (RL)2 Regions

MeasurementsFeatures

X-0.291

Z

Angle

ID:3

Output

Filters

Decision

Min:-3 mm

Max:-2 mm

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings


Measurements

Measurement

Illustration


X


Finds the intersection between two fitted lines and measures the X axis position of the intersection point.

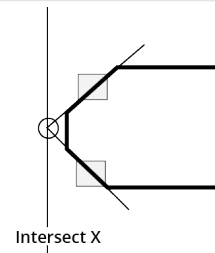

Z

Finds the intersection between two fitted lines and measures the Z axis position of the intersection point.

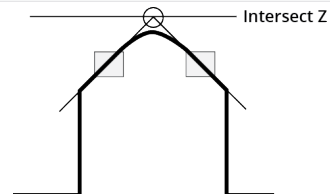

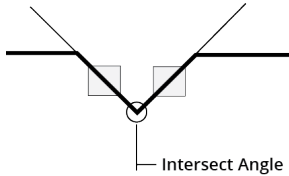Measurement	Illustration
Angle Finds the angle subtended by two fitted lines.	
Features	
Type	Description
Intersect Point	The point of intersection.
Line	The intersect line.
Base Line	The base line.
 For more information on geometric features, see <i>Geometric Features</i> on page 149.	
Parameters	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Reference Type	Determines the type of the reference line. X-Axis: The reference line is set to the X axis. Z-Axis: The reference line is set to the Z axis Line: The reference line is defined manually using the Ref Line parameter. One or two regions can be used to define the line.
Line	You can use one or two fit areas for the fit line. To set the region (or regions) of the fit line, adjust it graphically in the data viewer, or expand the feature using the expand button (⋮) and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145. For more information on fit lines, see <i>Fit Lines</i> on page 151.

Parameter	Description
Ref Line	Used to define the reference line when Line is selected in the Reference Type parameter. To set the region (or regions) of the reference line, adjust it graphically in the data viewer, or expand the feature using the expand button (⋮) and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145. For more information on fit lines, see <i>Fit Lines</i> on page 151.
Angle Range (Angle measurement only)	Determines the angle range. The options are: -90 – 90 0 – 180
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Line

The Line tool fits a line to the profile and measures the deviations from the best-fitted line. Gocator compares the measurement value with the values in **Min** and **Max** to yield a decision. For more information on decisions, see *Decisions* on page 151.

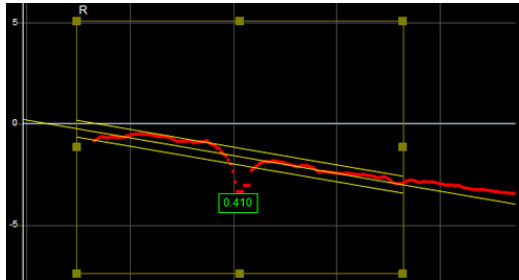

ParametersAnchoring

Source:Top

☒ Region

X:-25.63 mm

Z:-22.355 mm

Width:52.404 mm

Height:52.404 mm

☐ Fitting RegionsAll Data

MeasurementsFeatures

Standard Deviation0.410☒

Min Error☐

Max Error☐

Percentile☐

Offset☐

Angle☐

Min Error X☐

Min Error Z☐

Max Error X☐

Max Error Z☐

ID:4

Output

Filters

Decision

Min:0 mm

Max:1 mm

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings


Measurements

Measurement

Illustration


Standard Deviation

Finds the best-fitted line and measures the standard deviation of the data points from the line.

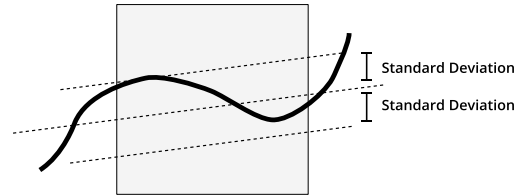


Min Error

Finds the best-fitted line and measures the minimum error from the line (the maximum distance below the line).

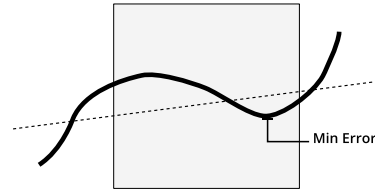


Max Error

Finds the best-fitted line and measures the maximum error from the line (the maximum distance above the line).

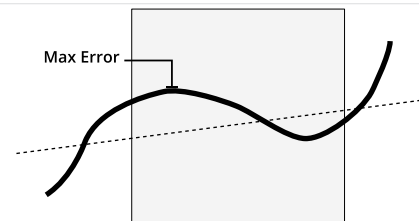


Percentile

 Finds the best-fitted line and measures the range (in Z) that covers a percentage of points around the line.




Offset

Finds the best-fitted line and returns the intersection point between that line and the Z axis.

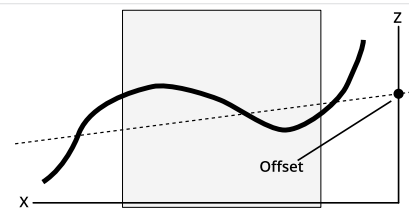

Angle


Finds the best-fitted line and returns the angle relative to the X axis.

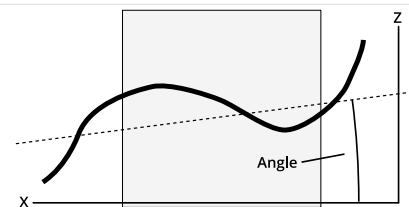


Min Error X

Min Error Z

Finds the best-fitted line and returns the X or Z position of the minimum error from the line (the maximum distance below the line).

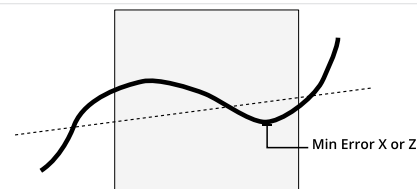

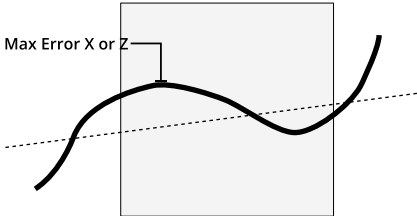Measurement	Illustration
Max Error X Max Error Z Finds the best-fitted line and returns the X or Z position of the maximum error from the line (the maximum distance above the line).	

Features

Type	Description
Line	The fitted line.
Error Min Point	The point of minimum error.
Error Max Point	The point of maximum error.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.

Parameter	Description
Fitting Regions	Determines which data Gocator uses to <i>fit the line</i> over the profile. When Fitting Regions is enabled, Gocator uses the data indicated by one of the following options: • All Data: All of the data in the profile is used to fit the line. • 1 Region: Data from a fitting region you define in the data viewer is used to fit the line. • 2 Regions: Data from two fitting regions you define is used to fit the line. When Fitting Regions is disabled, to fit the line, Gocator uses the measurement region if Region is enabled, or the entire profile if Region is disabled. When Fitting Regions is enabled and 1 Region or 2 Regions is selected, you can set the region (or regions) graphically in the data viewer, or you can expand the feature using the expand button (⋮) and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145.
Percent (Percentile measurement only)	The specified percentage of points around the best-fitted line.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Panel

The Panel tool provides Gap and Flush measurements.

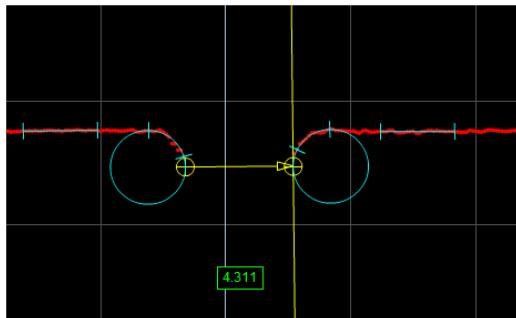

Parameters Anchoring

Source: Top

Reference Side: Left

Max Gap Width: 0 mm

Left

Right

Gap 4.311

Flush

Left Gap X

Left Gap Z

Left Flush X

Left Flush Z

Left Surface Angle

Right Gap X

Right Gap Z

Right Flush X

Right Flush Z

Right Surface Angle

ID: 0

Parameters Output

Measurement Axis Edge

The Panel tool uses a complex feature-locating algorithm to find the gap or calculate flushness and return measurements. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel. See "Gap and Flush Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm.



You must make sure that there are enough data points to define the edge in the profile, by properly setting up exposure, etc. If not, the algorithm will not function.

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurement	Illustration
Gap Measures the distance between two surfaces. The surface edges can be curved or sharp.	
Flush Measures the flushness between two surfaces. The surface edges can be curved or sharp.	
Left Gap X Returns the X position of the edge feature on the left side used to measure the gap.	
Left Gap Z Returns the Z position of the edge feature on the left side used to measure the gap.	
Left Flush X Returns the X position of the feature on the left side used to measure flushness.	
Left Flush Z Returns the Z position of the feature on the left side used to measure flushness.	
Left Surface Angle The angle of the left side surface relative to the X axis.	

Measurement	Illustration
Right Gap X Returns the X position of the edge feature on the right side used to measure the gap.	
Right Gap Z Returns the Z position of the edge feature on the right side used to measure the gap.	
Right Flush X Returns the X position of the feature on the right side used to measure flushness.	
Right Flush Z Returns the Z position of the feature on the right side used to measure flushness.	
Right Surface Angle The angle of the right side surface relative to the X axis.	
<i>Parameters</i>	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Reference SideDirection	Defines the side used to calculate the measurement axis (see below) rounded corner.
Max Gap Width	The maximum width of the gap. Allows the tool to filter gaps greater than the expected width. This can be used to single out the correct gap when there are multiple gaps in the field of view.
Measurement Axis <i>Gap measurement only</i>	Defines the direction that the gap is calculated, in relation to the reference side (see above). Surface: In the direction of the fitted surface line of the reference surface. Edge: In the direction perpendicular to the edge of the reference surface. Distance: The Cartesian distance between the two feature locations.
Absolute <i>Flush measurement only</i>	When enabled, returns an absolute value rather than a signed value.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Left/Right SideEdge Parameters

Parameter	Description
Max Void Width	The maximum allowed width of missing data caused by occlusion or data dropout.
Min Depth	Defines the minimum depth before an opening could be considered to have a potential edge. The depth is the perpendicular distance from the fitted surface line.
Surface Width	The width of the surface area in which data is used to form the fitted surface line. This value should be as large as the surface allows.
Surface Offset	The distance between the edge region and the surface region. Setting a small value allows the edge within a tighter region to be detected. However, the measurement repeatability could be affected if the data from the edge are considered as part of the surface region (or vice versa). A rule of thumb is to set Surface Offset equal to Nominal Radius.
Nominal Radius	The radius of the curve edge that the tool uses to locate the edge region.
Edge Angle	A point on the best fit circle to be used to calculate the feature point. The selected point is on the circumference at the specified angle from the start of the edge region. The angle is measured from the axis perpendicular to the fitted surface line.
Edge Type	Defines the type of feature point to use for the edge (Corner or Tangent). A tangent edge point is the point selected based on the defined Edge Angle. A corner edge point is the intersect point between the fitted surface line and a edge line formed by interpolating the points at and after the tangent within the edge region.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.



Position

The Position tool finds the X or Z axis position of a feature point. The feature type must be specified and is one of the following: Max Z, Min Z, Max X, Min X, Corner, Average (the mean X and Z of the data points), Rising Edge, Falling Edge, Any Edge, Top Corner, Bottom Corner, Left Corner, Right Corner, or Median (median X and Z of the data points).

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

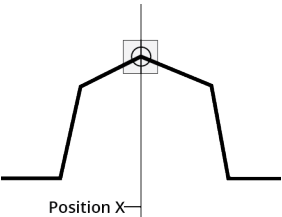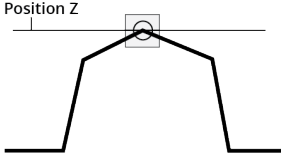Measurement	Illustration
X Finds the position of a feature on the X axis.	
Z Finds the position of a feature on the Z axis.	

Features

Type	Description
Point	The returned position.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.

Parameter	Description
Feature	The feature the tool uses for its measurements. One of the following: • Max Z • Min Z • Max X • Min X • Corner • Average • Rising Edge • Falling Edge • Any Edge • Top Corner • Bottom Corner • Left Corner • Right Corner • Median To set the region of a feature, adjust it graphically in the data viewer, or expand the feature using the expand button () and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Round Corner

The Round Corner tool measures corners with a radius, returning the position of the edge of the corner and the angle of adjacent surface with respect to the X axis.

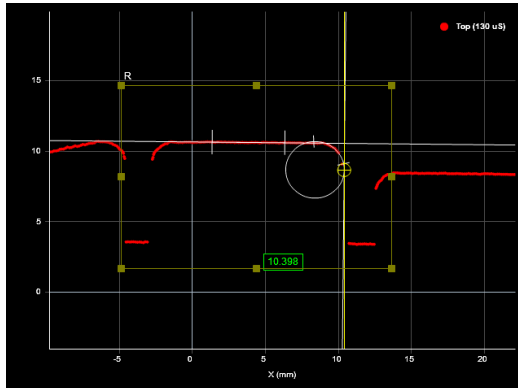

Parameters Anchoring

Source: Top

Reference Direction: From the Left

Edge

Max Void Width: 0 mm

Min Depth: 0 mm

Surface Width: 5 mm

Surface Offset: 2 mm

Nominal Radius: 2 mm

Edge Angle: 90°

Edge Type: Tangent

☒ Region

Measurements Features

X	10.398	☒
Z		☐
Angle		☐

ID: 0

Output

Filters

Decision

Min: 10 mm

Max: 11 mm




For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

The Round Corner tool uses a complex feature-locating algorithm to find the edge and return measurements. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel. See "Gap and Flush Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm.



You must make sure that there are enough data points to define the edge (proper exposure, etc.). If not, the algorithm will not function.

Measurements

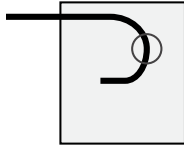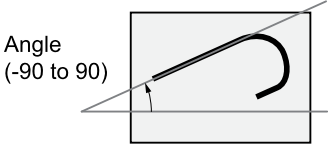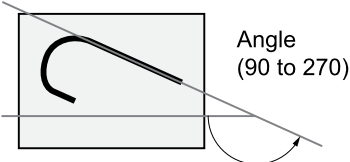Measurement	Illustration
X Measures the X position of the location where the tangent touches the edge, or intersect of the tangent and the line fitted to the surface used by the measurement (see Reference Side , below).	
Z Measures the Z position of the location where the tangent touches the edge, or intersect of the tangent and the line fitted to the surface used by the measurement (see Reference Side , below).	
Angle Measures the angle of the line fitted to the surface next to the corner (see Reference Side , below), with respect to the x-axis. Left edge angles are from -90 to 90. Right edge angles are from 90 to 270.	 

Features

Type	Description
Edge Point	The position of the edge.
Radius Center Point	The center of the radius.



For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.
Reference Direction	Defines the side used to calculate the rounded corner.
Max Gap Width	The maximum width of the gap. Allows the tool to filter gaps greater than the expected width. This can be used to single out the correct gap when there are multiple gaps in the field of view.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Edge Parameters

Parameter	Description
Max Void Width	The maximum allowed width of missing data caused by occlusion or data dropout.
Min Depth	Defines the minimum depth before an opening could be considered to have a potential edge. The depth is the perpendicular distance from the fitted surface line.
Surface Width	The width of the surface area in which data is used to form the fitted surface line. This value should be as large as the surface allows.
Surface Offset	The distance between the edge region and the surface region. Setting a small value allows the edge within a tighter region to be detected. However, the measurement repeatability could be affected if the data from the edge are considered as part of the surface region (or vice versa). A rule of thumb is to set Surface Offset equal to Nominal Radius.
Nominal Radius	The radius of the curve edge that the tool uses to locate the edge region.
Edge Angle	A point on the best fit circle to be used to calculate the feature point. The selected point is on the circumference at the specified angle from the start of the edge region. The angle is measured from the axis perpendicular to the fitted surface line.
Edge Type	Defines the type of feature point to use for the edge (Corner or Tangent). A tangent edge point is the point selected based on the defined Edge Angle. A corner edge point is the intersect point between the fitted surface line and a edge line formed by interpolating the points at and after the tangent within the edge region.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Strip

The Strip tool measures the width of a strip.

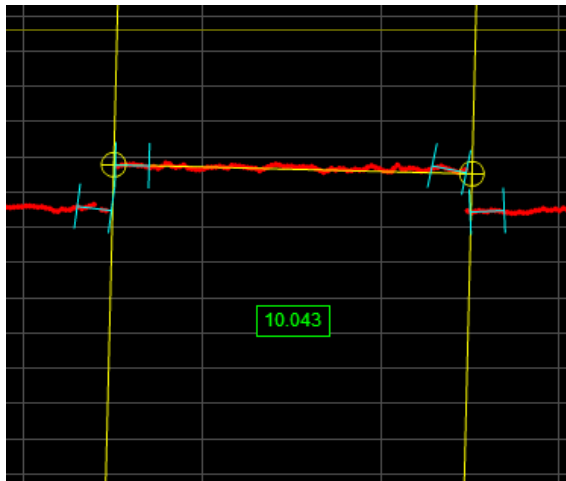

Parameters

Anchoring

Source:

Top

Base Type:

Flat

Left Edge

☒ Rising

☒ Data End

☒ Falling

☒ Void

Right Edge Tilt Enabled:

☒

Support Width:

5

 mmTransition Width:

0

 mmMin Width:

0

 mmMin Height:

2

 mmMax Void Width:

0

 mm☒ Region X Add

X

Z

Width

10.043

☒

Height

☐

Id:

12

Parameters

Output

Select Type:

Index Left

Index:

0






The Strip tool uses a complex feature-locating algorithm to find a strip and then return measurements. See "Strip Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel.

The Strip tool lets you add multiple measurements of the same type to receive measurements and set decisions for multiple strips. Multiple measurements are added by using the drop-down above the list of measurements and clicking on the **Add** button.

For example, if a target has three strips, by adding two measurements, choosing **Index From The Left** in the **Select Type** setting, and providing values of 1 and 3 in the **Index** of field of the measurements, respectively, the Strip tool will return measurements and decisions for the first and third strip.




For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements

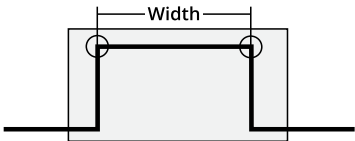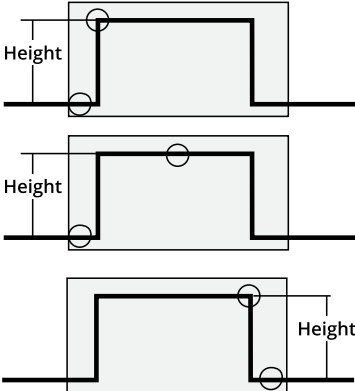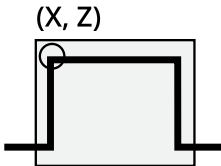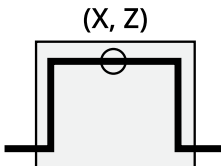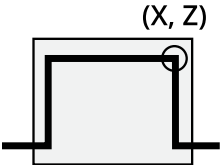Measurement	Illustration
Width Measures the width of a strip.	 A cross-sectional diagram of a rectangular strip. A horizontal double-headed arrow at the top indicates the width of the strip, labeled 'Width'. Two small circles are positioned on the top surface of the strip, one near each end.
Height Measures the height of a strip.	 Three cross-sectional diagrams of a rectangular strip, each showing a different height measurement point. In the first, a vertical double-headed arrow on the left indicates the height from the base to the top surface, labeled 'Height', with a circle on the left side. In the second, a vertical double-headed arrow on the left indicates the height from the base to the top surface, labeled 'Height', with a circle on the top surface. In the third, a vertical double-headed arrow on the right indicates the height from the base to the top surface, labeled 'Height', with a circle on the right side.
X Measures the X position of a strip.	 A cross-sectional diagram of a rectangular strip. A small circle is located on the top-left corner of the strip, with the label '(X, Z)' above it.
	 A cross-sectional diagram of a rectangular strip. A small circle is located on the top surface of the strip, with the label '(X, Z)' above it.
Z Measures the Z position of a strip.	 A cross-sectional diagram of a rectangular strip. A small circle is located on the top-right corner of the strip, with the label '(X, Z)' above it.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. For more information on sections, see <i>Sections</i> on page 135.

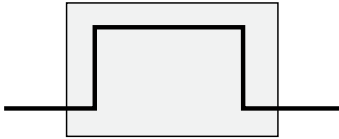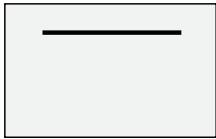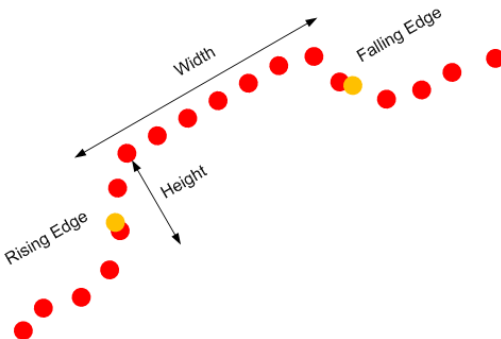Parameter	Description
Base Type	Affects detection of rising and falling edges. Base Type = Flat  Base Type = None  When Base Type is set to Flat, both strip (raised area) and base support regions are needed. When set to None, only a point that deviates from a smooth strip support region is needed to find a rising or falling edge.
Left Edge Right Edge	Specifies the features that will be considered as the strip's left and right edges. You can select more than one condition. Rising - Rising edge detected based on the strip edge parameters. Falling - Falling edge detected based on the strip edge parameters. Data end - First valid profile data point in the measurement region. Void - Gap in the data that is larger than the maximum void threshold. Gaps connected to the measurement region's boundary are not considered as a void. See "Strip Start and Terminate Conditions" in the <i>Gocator Measurement Tool Technical Manual</i> for the definitions of these conditions.
Tilt Enabled	Enables/disables tilt correction. The strip may be tilted with respect to the sensor's coordinate X axis. This can be caused by conveyor vibration. If the Tilt option is enabled, the tool will report the width and height measurements following the tilt angle of the strip. 
Support Width	Specifies the width of the region around the edges from which the data is used to calculate the step change. See "Strip Step Edge Definitions" in the <i>Gocator Measurement Tool Technical Manual</i> on how this parameter is used by different base types.

Parameter	Description
Transition Width	Specifies the nominal width needed to make the transition from the base to the strip. See "Strip Step Edge Definitions" in the <i>Gocator Measurement Tool Technical Manual</i> on how this parameter is used by different base types.
Min Width	Specifies the minimum width for a strip to be considered valid.
Min Height	Specifies the minimum deviation from the strip base. See "Strip Step Edge Definitions" in the <i>Gocator Measurement Tool Technical Manual</i> on how this parameter is used for different base types.
Max Void Width	The maximum width of missing data allowed for the data to be considered as part of a strip when Void is selected in the Left or Right parameter. This value must be smaller than the edge Support Width. The diagram shows a yellow rectangular box labeled 'Measurement region' at the bottom. Inside the box, there are two groups of red dots representing strips. The left group is labeled 'Strip 0' and the right group is labeled 'Strip 1'. Between the two groups, there is a gap. A horizontal double-headed arrow spans the width of this gap. Above the arrow, the text 'Gap > Maximum void' is written, with a downward-pointing arrow indicating the gap width. When occlusion and exposure causes data drops, users should use the gap filling function to fill the gaps. See <i>Gap Filling</i> on page 104 for information.
Region	The measurement region defines the region in which to search for the strip. If possible, the region should be made large enough to cover the base on the left and right sides of the strip. The diagram shows a gray rectangular area representing the measurement region. Inside this area, there is a white rectangular shape representing the strip. Two arrows point from the text 'Sides of the Strip' to the left and right edges of the white strip shape. For more information, see <i>Regions</i> on page 145.
Location <i>(Strip Height, Strip X, and Strip Z measurements only)</i>	Specifies the strip position from which the measurements are performed. Left - Left edge of the strip. Right - Right edge of the strip. Center - Center of the strip.
Select Type	Specifies how a strip is selected when there are multiple strips within the measurement area. Best - The widest strip. Index Left - 0-based strip index, counting from left to right. Index Right - 0-based strip index, counting from right to left.
Index	0-based strip index.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X or Z	Lets you choose the X or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Script

A Script measurement can be used to program a custom measurement using a simplified C-based syntax. A script measurement can produce multiple measurement values and decisions for the output.

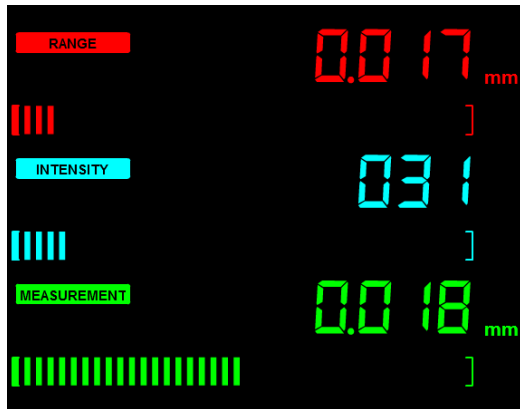


```
Code
1 double PositionZ = Measurement_Value(0);
2
3 if (Measurement_Valid(0))
4 {
5   Output_Set(PositionZ + 10000, 1);
6 }
7 else
8 {
9   Output_Set(0, 0);
10 }
11
```

*Press save button or 'Ctrl+S' to apply change.
Press 'Esc' to exit full screen.

Output: Add

Output 0 10000.018

Id: 1

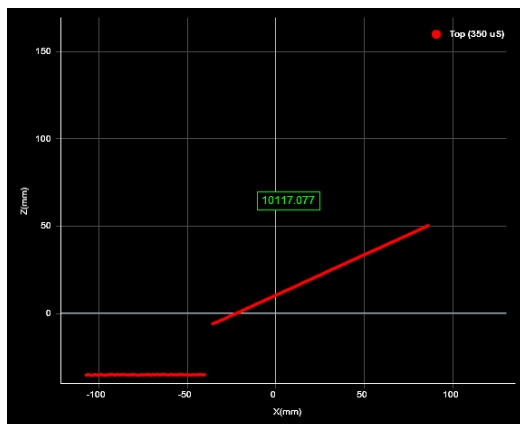

```
Code
1 double DimensionDistance = Measurement_Value(2);
2
3 if (Measurement_Valid(2))
4 {
5   Output_Set(DimensionDistance + 10000, 1);
6 }
7 else
8 {
9   Output_SetAt(0, 0);
10 }


```

*Press save button or 'Ctrl+S' to apply change.
Press 'Esc' to exit full screen.

Output: Add

Output 0 10117.077

Id: 0

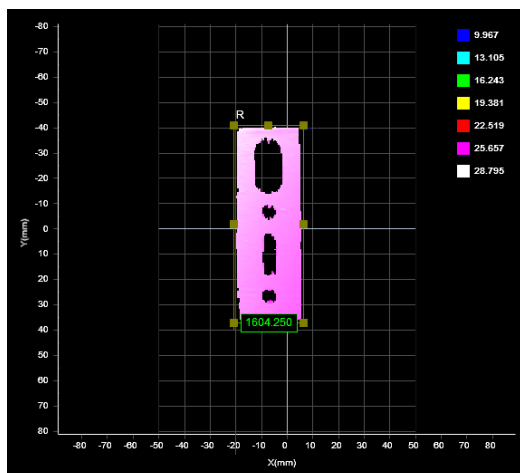

```
Code
1 double VolumeArea = Measurement_Value(4);
2
3 if (Measurement_Valid(4))
4 {
5   Output_Set(VolumeArea + 10000, 1);
6 }
7 else
8 {
9   Output_SetAt(0, 0);
10 }

```

*Press save button or 'Ctrl+S' to apply change.
Press 'Esc' to exit full screen.

Output: Add

Output 0 1604.250

Id: 0

See *Scripts* on page 324 for more information on the script syntax.

To create or edit a Script measurement:

1. Add a new Script tool or select an existing Script measurement.
2. Edit the script code.
3. Add script outputs using the **Add** button.
For each script output that is added, an index will be added to the **Output** drop-down and a unique ID will be generated.
To remove a script output, click on the  button next to it.
4. Click the **Save** button  to save the script code.
If there is a mistake in the script syntax, the result will be shown as a "Invalid" with a red border in the data viewer when you run the sensor.
Outputs from multiple measurement tools can be used as inputs to the script. A typical script would take results from other measurement tools using the value and decision function, and output the result using the output function. Stamp information, such as time and encoder stamps, are available in the script, whereas the actual profile3D point cloud data is not. (The script engine is not powerful enough to process the data itself.) Only one script can be created.

Surface Measurement


Surface measurement involves capturing 3D point cloud data, optionally identifying discrete objects, and measuring properties of the surface or the objects, such as the volume of the object or the height at a certain position of the object. All volumetric tools have the ability to operate either on the entire surface or the full object, or within a region of interest at a certain position in relation to the surface or an object.

Multiple measurements can be performed on the entire surface or each discrete object, limited only by the available CPU resources.


Bounding Box

The Bounding Box tool provides measurements related to the smallest box that contains the part (for example, X position, Y position, width, length, etc.).

A bounding box can be vertical or rotated. A vertical bounding box provides the absolute position from which the Position centroids tools are referenced.

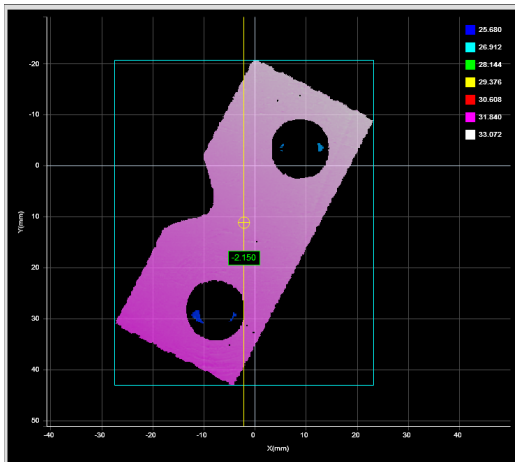

2D View

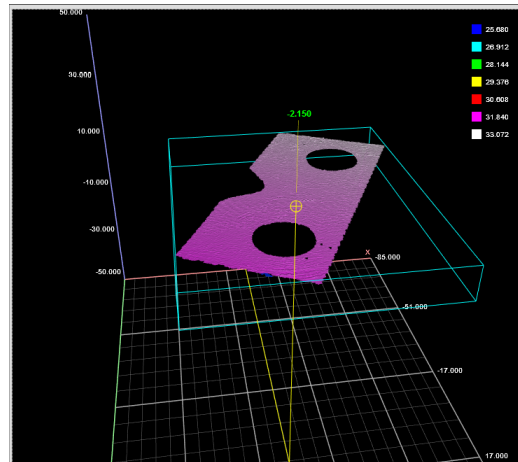

3D View

Parameters Anchoring

Source: Top

Rotation: ☐

☒ Region

Measurements Features

X	-2.150	☒
Y		☐
Z		☐
Width		☐
Length		☐
Height		☐
Z Angle		☐
Global X		☐
Global Y		☐
Global Z Angle		☐

ID: 0

Output

Filters

Decision

Min: -3 mm

Max: -2 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

Measurement

Illustration

X

Determines the X position of the center of the bounding box that contains the part.

The value returned is relative to the *part*.

Y



Determines the Y position of the center of the bounding box that contains the part.

The value returned is relative to the *part*.

Z

Determines the Z position of the center of the bounding box that contains the part.

The value returned is relative to the *part*.

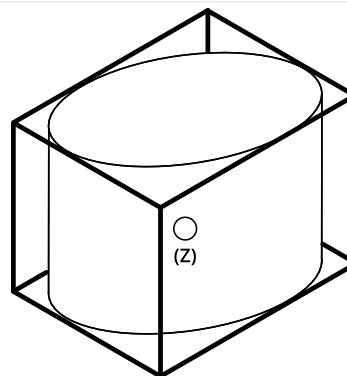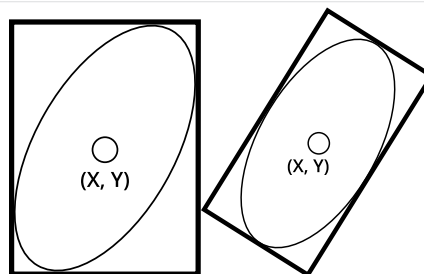


Width

Determines the width of the bounding box that contains the part.

When the **Rotation** setting is disabled, the bounding box is the smallest rectangle whose sides are parallel to the X and Y axes. Width is on the X axis.

When **Rotation** is enabled, the width is the smaller side dimension.

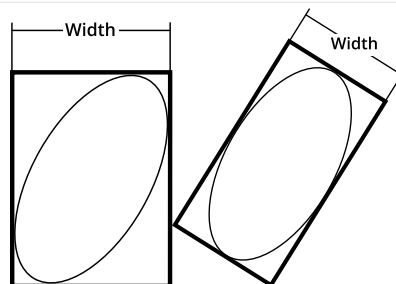






Length

Determines the length of the bounding box that contains the part.

When the **Rotation** setting is disabled, the bounding box is the smallest rectangle whose sides are parallel to the X and Y axes. Length is on the Y axis.

When **Rotation** is enabled, the length is the longer side dimension.

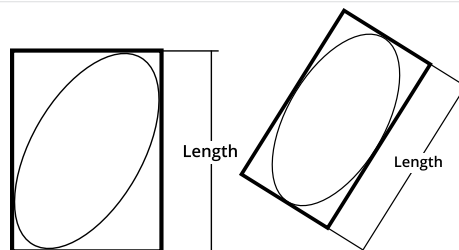

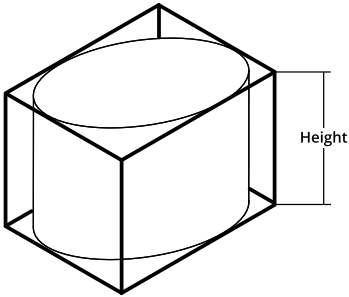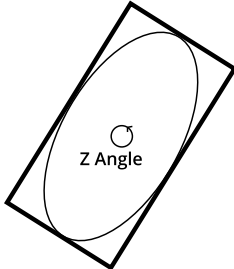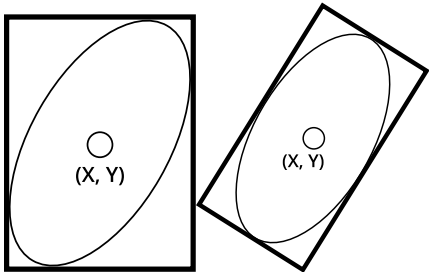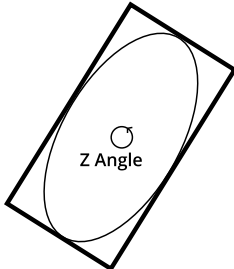Measurement	Illustration
Height Determines the height of the bounding box that contains the part.	
Z Angle Determines the rotation around the Z axis and the angle of the longer side of the bounding box relative to the X axis. If Rotation is not enabled, the measurement returns 90.000 degrees. In order to use this measurement for angle anchoring, you must enable Rotation; for more information on anchoring, see <i>Measurement Anchoring</i> on page 154.	
Global X* Determines the X position of the center of the bounding box that contains the part <i>on the surface from which the part was extracted</i>.	
Global Y* Determines the Y position of the center of the bounding box that contains the part <i>on the surface from which the part was extracted</i>.	
Global Z Angle* Determines the rotation of the longer side of the bounding box around the Z axis <i>on the surface from which the part was extracted</i>. If part matching is enabled, the returned value represents the rotation of the part <i>before</i> part matching rotates it. If Rotation is not enabled, the measurement returns 90.000 degrees.	
 *These measurements are mostly useful with parts extracted from a surface. For more information on parts, see <i>Part Detection</i> on page 107.	

Features

Type	Description
Center Point	The center point of the bounding box.
Box Axis Line	The axis of the bounding box.



For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Rotation	A bounding box can be vertical or rotated. A vertical bounding box provides the absolute position from which the part's Position centroid measurements are referenced. Check the Rotation setting to select rotated bounding box.
Asymmetry Detection	Resolves the orientation of an object over 360 degrees. The possible values are: 0 – None 1 – Along Major Axis 2 – Along Minor Axis This setting is only visible if Rotation is checked.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Countersunk Hole


The Countersunk Hole tool locates a countersunk circular opening within a region of interest on the surface and provides measurements to evaluate characteristics of countersunk holes, including the position (X, Y, and Z) of the center of the hole, outside radius of the hole, hole bevel angle, and the depth of the hole. The countersunk hole can be on a surface at an angle to the sensor. The tool also supports measuring holes drilled at an angle relative to the surrounding surface.



The Countersunk Hole tool does not search for or detect a hole. The tool expects that a hole conforming reasonably well to the defined parameters is present and that it is on a sufficiently uniform background.

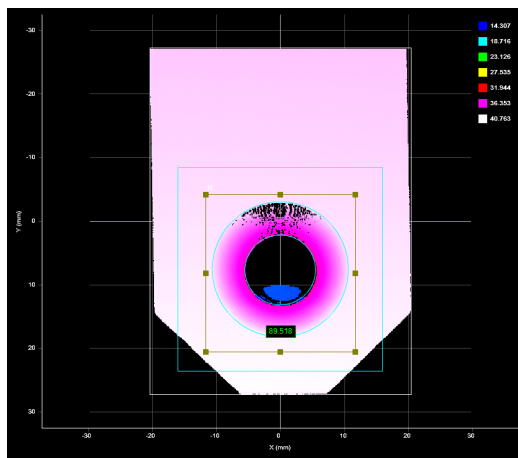

2D View

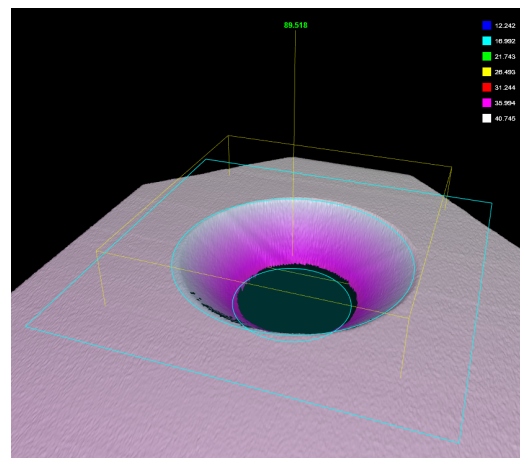

3D View

Parameters
Advanced
Anchoring

Source:
Top

Shape:
Cone

Nominal Bevel Angle:
100°

Nominal Outer Radius:
10 mm

Nominal Inner Radius:
4 mm

Bevel Radius Offset:
4 mm

Partial Detection:
☐

Plane Fit Range:
0 mm

☒ Region

Measurements
Features

X	89.518	☒
Y		☐
Z		☐
Outer Radius		☐
Depth		☐
Bevel Radius		☐
Bevel Angle		☐
X Angle		☐
Y Angle		☐
Counterbore Depth		☐
Axis Tilt		☐
Axis Orientation		☐

ID:
1


Output

Filters

Decision

Min:
89 mm

Max:
90 mm

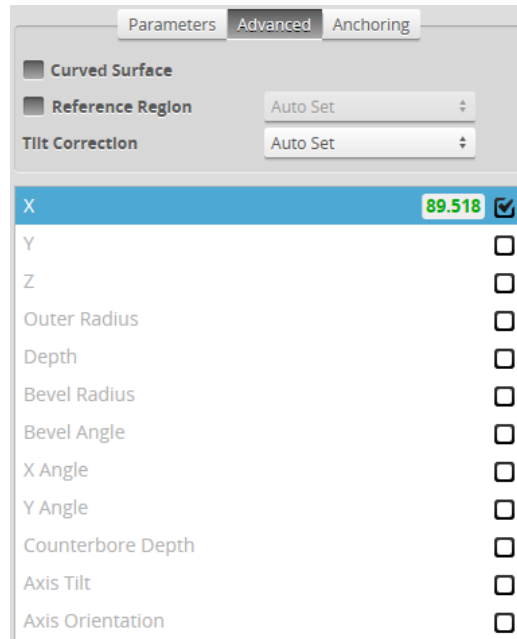

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

Measurement	Illustration
X Determines the X position of the center of the countersunk hole.	
Y Determines the Y position of the center of the countersunk hole.	
Z Determines the Z position of the center of the countersunk hole.	

Measurement

Illustration


Outer Radius

Determines the outer radius of the countersunk hole.

When a hole is cut at an angle relative to the surrounding surface, the outer radius is calculated as if the hole were not cut at an angle.




To convert the radius to a diameter, set the **Scale** setting in the **Output** panel (displayed after expanding the **Filters** section) to 2.

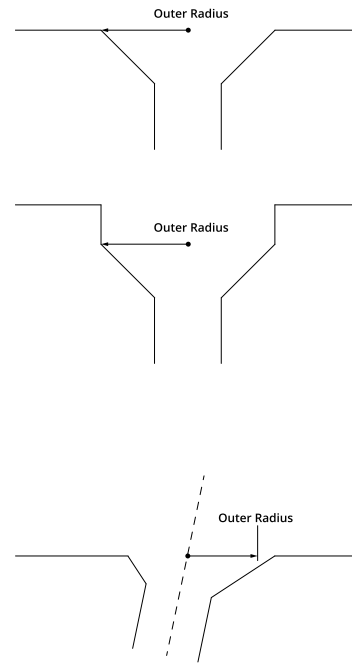

Depth

Determines the depth of the countersunk hole relative to the surface that the countersunk hole is on.

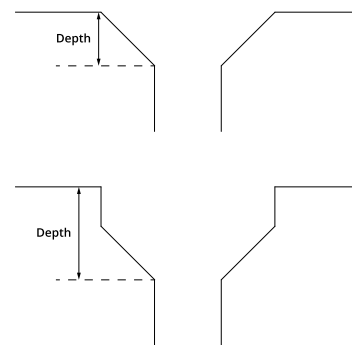

Measurement


Illustration

Bevel Radius

Determines the radius at a user-defined offset (**Offset** setting) relative to the surface that the countersunk hole is on.





To convert the radius to a diameter, set the **Scale** setting in the **Output** panel (displayed after expanding the **Filters** section) to 2.

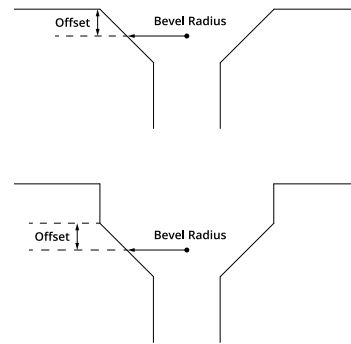

Bevel Angle

Determines the angle of the hole's bevel.

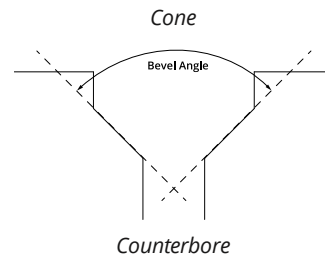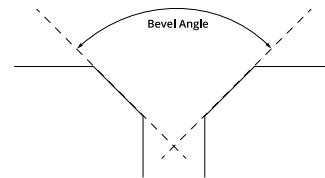


Measurement

Illustration


X Angle

Determines the angle the hole relative to the X axis.

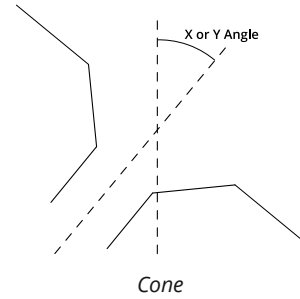


Y Angle

Determines the angle of the hole relative to the Y axis.

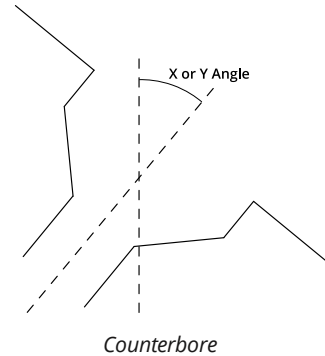

Counterbore Depth

Determines the depth of a counterbore.

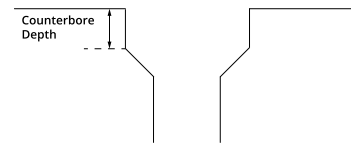


Axis Tilt

Measures the tilt of the axis of the hole relative to the surface surrounding the hole.



This measurement is not supported when **Shape** is set to **Counterbore**.

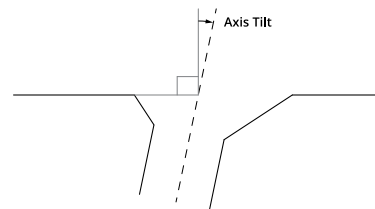


Axis Orientation

Measures the angle of the axis of the hole around the normal of the surface surrounding the hole, relative to the X axis.



This measurement is not supported when **Shape** is set to **Counterbore**.

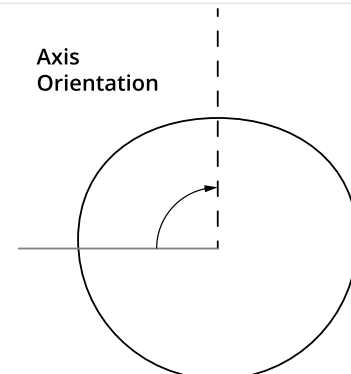

Features


Type	Description
Center Point	The center point of the countersunk hole. The Z position of the center point is at the Z position of the surrounding surface.



For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Shape	The shape of the countersunk hole. (See illustrations above.) 0 – Cone 1 – Counterbore
Nominal Bevel Angle	The expected bevel angle of the countersunk hole.
Nominal Outer Radius	The expected outer radius of the countersunk hole.
Nominal Inner Radius	The expected inner radius of the countersunk hole.
Bevel Radius Offset	The offset, relative to the surface that the countersunk hole is on, at which the bevel radius will be measured.
Partial Detection	Enable if only part of the hole is within the measurement region. If disabled, the hole must be completely in the region of interest for results to be valid.
Plane Fit Range	Excludes data beyond the specified distance from the plane surrounding the hole. You can use this setting to exclude surfaces close to the countersunk hole that step down from the plane surrounding the hole that could make measurement of the hole less reliable.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Curved Surface	Whether the surface that the countersunk hole is on is curved. When this setting is enabled, specify the orientation of the curvature in degrees in the Curve Orientation setting.
Curve Orientation	The orientation of the curvature in degrees. Only visible when Curved Surface is enabled.

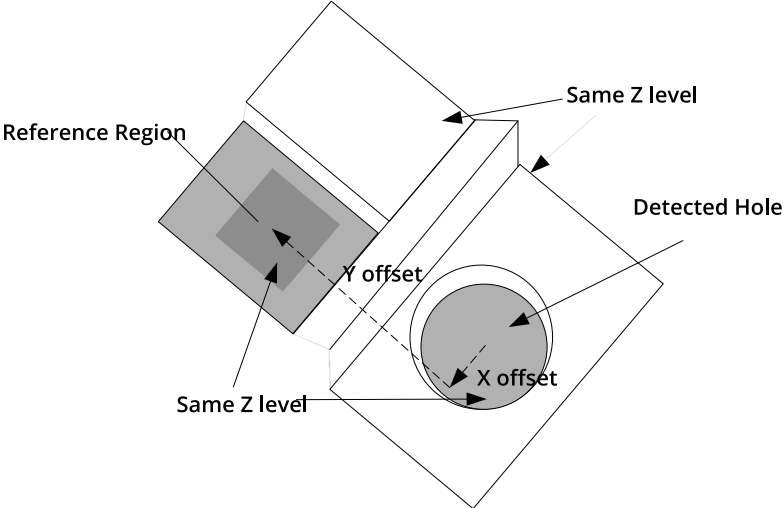Parameter	Description
Reference Regions	The tool uses the reference regions to calculate the Z position of the hole. It is typically used in cases where the surface around the hole is not flat.  When this option is set to Autoset, the algorithm automatically determines the reference region. When the option is not set to Autoset, you must manually specify one or two reference regions. The location of the reference region is relative to the detected center of the hole and positioned on the nominal surface plane. When Reference Region is disabled, the tool measures the hole's Z position using all the data in the measurement region, except for a bounding rectangular region around the hole.
Tilt Correction	Tilt of the target with respect to the alignment plane. Autoset: The tool automatically detects the tilt. The measurement region to cover more areas on the surface plane than other planes. Custom: You must enter the X and Y angles manually in the X Angle and Y Angle parameters (see below).
X Angle Y Angle	The X and Y angles you must specify when Tilt Correction is set to Custom. You can use the Surface Plane tool's X Angle and Y Angle measurements to get the angle of the surrounding surface, and then copy those measurement's values to the X Angle and Y Angle parameters of this tool.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Dimension

The Dimension tool returns various dimensional measurements of a part. You must specify two feature types (see below).

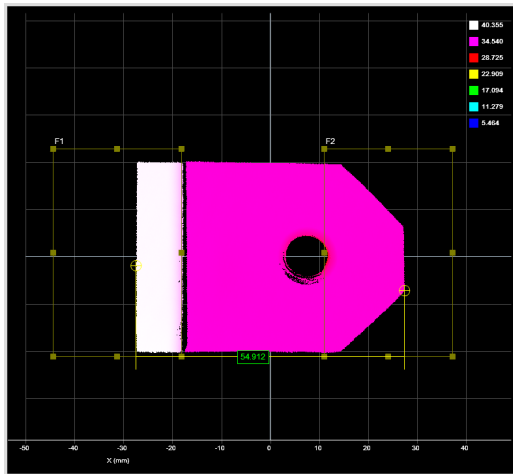

2D View

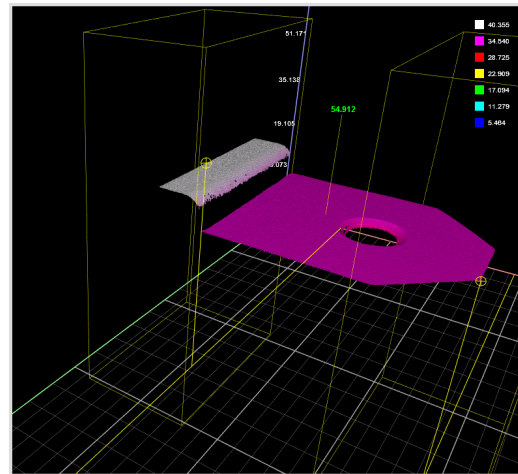

3D View

Parameters Anchoring

Source: Top

Feature 1 Min X

Feature 2 Max X

Width 54.912 ☒

Length ☐

Height ☐

Distance ☐

Plane Distance ☐

Center X ☐

Center Y ☐

Center Z ☐

ID: 0

Parameters Output

Filters

Decision

Min: 54.9 mm

Max: 55 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.


Measurements

Measurement

Illustration


Width

Determines the distance between the selected features along the X axis.

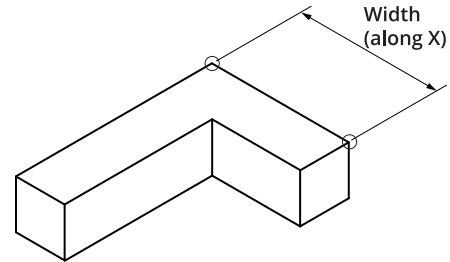


Length




Determines the distance between the selected features along the Y axis.

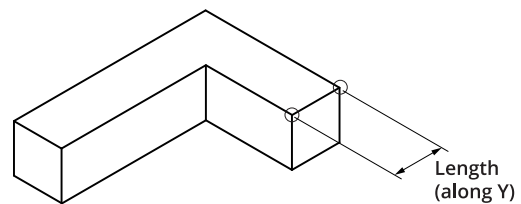

Height

Determines the distance between the selected features along the Z axis.

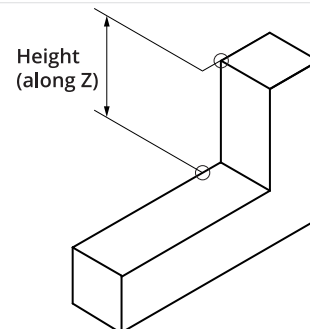

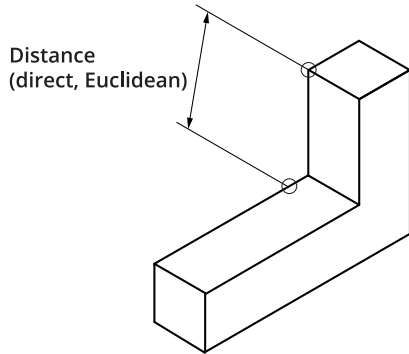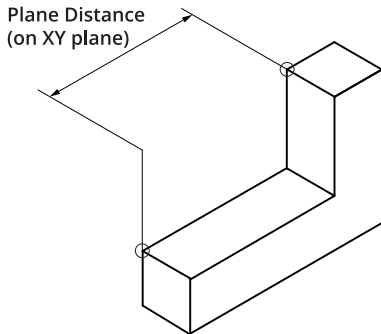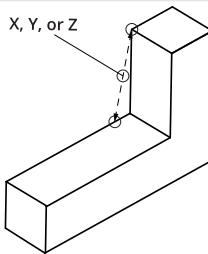Measurement	Illustration
Distance Determines the direct, Euclidean distance between the selected features.	
Plane Distance Determines the distance between the selected features. The position of the lowest feature point is projected onto the XY plane of the highest feature point.	
Center X Determines the X position of the center point between the selected features.	
Center Y Determines the Y position of the center point between the selected features.	
Center Z Determines the Z position of the center point between the selected features.	
Parameters	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.

Parameter	Description
Feature 1 Feature 2	The Feature 1 and Feature 2 settings represent the two features the tool uses to perform measurements. For each, one of the following: • Average • Median • Centroid • Max X • Min X • Max Y • Min Y • Max Z • Min Z To set the region of a feature, adjust it graphically in the data viewer, or expand the feature using the expand button (⊞) and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Edge


The Edge tool fits a line to a straight edge in the scan data, using either height map or intensity data. The tool's settings help fit the line when multiple potential edges are in the region of interest. After the tool locates an edge, the position (X, Y, and Z) of the center of the edge line in the region of interest, as well as its angle around the Z axis and the step height between the upper and lower surfaces adjacent to the edge, can be returned as measurements.

You can use the Z Angle measurement of the edge line with some tools to perform angle anchoring, compensating for minor part rotations around the Z axis, greatly increasing repeatability between part scans; for more information see *Measurement Anchoring* on page 154.

The tool can also generate edge line and center point geometric features that Feature tools can take as input for measurement. For more information on Feature tools, see *Feature Measurement* on page 314.

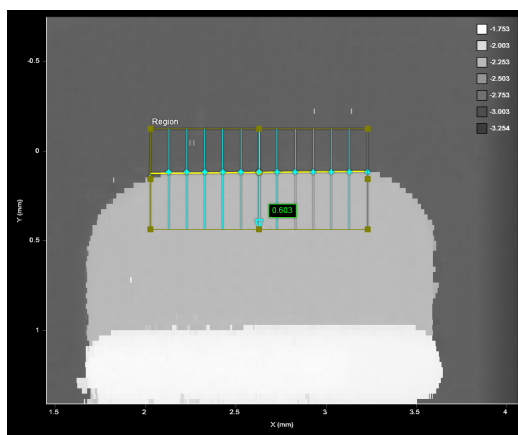

2D View

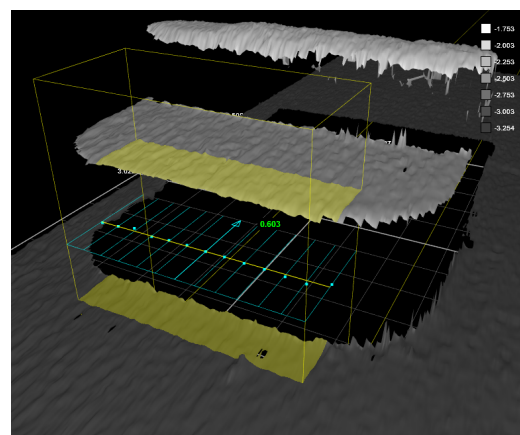

3D View

Parameters
Anchoring

Source:
Top

Number of Regions
1

Region 1

Search Direction
90 degrees

☐ Fixed Angle

Path Spacing
0.1 mm

Path Width
0 mm

Outlier Fraction
0 %

Selection Type
Best

Step Direction
Rising

Absolute Threshold
0 mm

☐ Use Relative Threshold

Step Smoothing
0 mm

Step Width
0 mm

Max Gap
0 mm

☒ Include Null Edges

Null Fill Value
0 mm

☒ Show Detail

Measurements
Features

X
☐

Y
☐

Z
☐

Z Angle
☐

Step Height
0.603
☒

ID:
1

Output

Filters

Decision

Min:
0 mm


Max:
1 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Paths and Path Profiles


To fit an edge line to the scan data, the Surface Edge tool overlays evenly spaced, parallel *paths* (light blue lines in the interface; see below) in the defined region of interest.

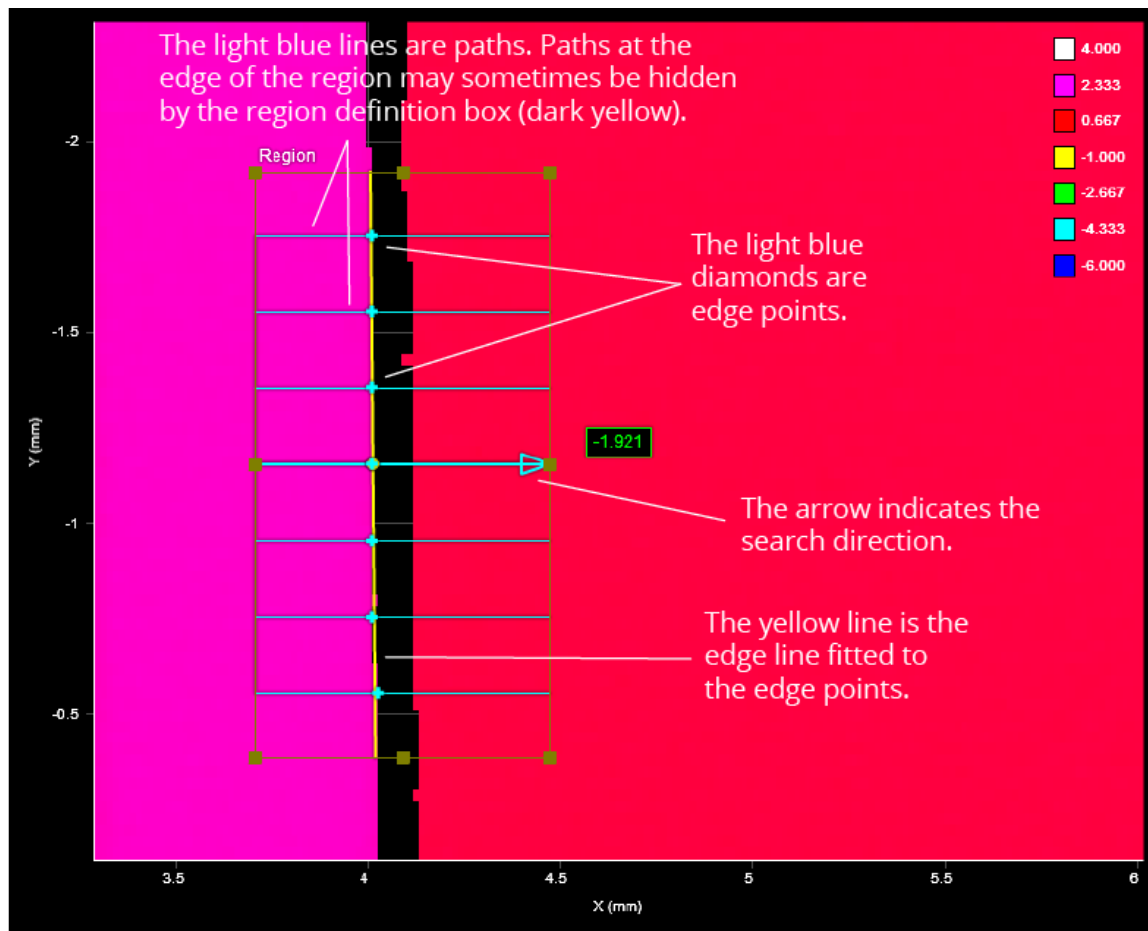

For each path, a profile is generated internally from the height map's data points that fall under or, optionally, near the path. The tool then examines each path profile for steps (changes in height) that meet the criteria set by the tool's settings, such as minimum height, direction (whether it is rising or falling), and so on.

Red dots are data points from the scan data that fall under paths (light blue lines).

A single path profile extracted from a path.

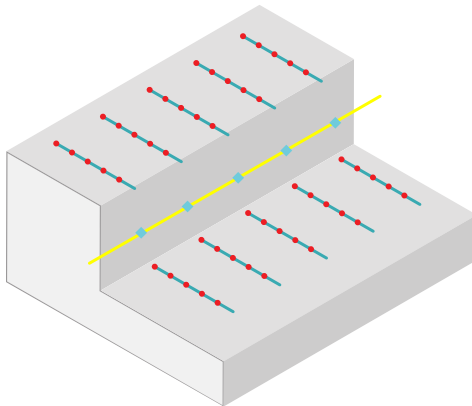

For the step on each path profile that matches the settings, the tool places an edge point between the upper and lower area (light blue diamonds in the interface). The tool then fits a line to those edge points (yellow line in the interface). You can choose the orientation of the paths around the Z axis to accommodate different edge orientations.

Measurements, Features, and Settings

Measurements

Measurement

X

Returns the X position of the center point of the fitted edge line.


Y

Returns the Y position of the center point of the fitted edge line.

Z

Returns the Z position of the center point of the fitted edge line.

Illustration

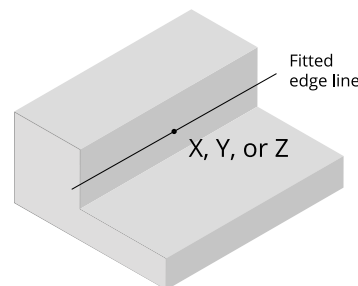


Measurement	Illustration
-------------	--------------

Z Angle

Returns the rotation, around the Z axis, of the fitted edge line. Rotating the measurement region has no impact on the angle that is returned unless a different edge is detected.


Useful for using minor variations in the rotation of an edge on target as an anchor for other measurements. For more information, see *Measurement Anchoring* on page 154.

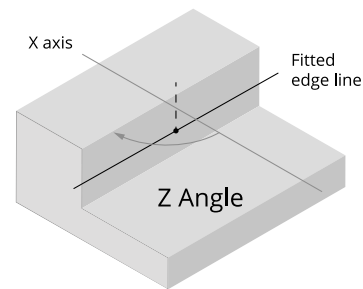

Step Height

Returns the height of the step, calculated by averaging the step heights of all of the path profiles.

(When **Use Intensity** is enabled, the value returned is the difference in intensity.)

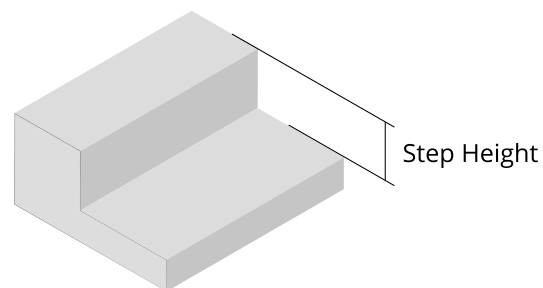

Features


Type	Description
Edge line	The fitted edge line.
Center Point	The intersection point of the fitted edge line and a line through the center of the region at the path angle.

 For more information on geometric features, see *Geometric Features* on page 149.


Parameters


Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.


Parameter	Description
Use Intensity	(This setting is only available when Acquire Intensity is enabled in the Scan Mode panel; for more information, see <i>Scan Modes</i> on page 84.) Uses intensity data rather than height data to find an edge. Useful when color differences on a flat area of a target, which would not be detected using height map data, are distinct, letting you use the detected "line" as an anchor source or perform geometric feature measurements.

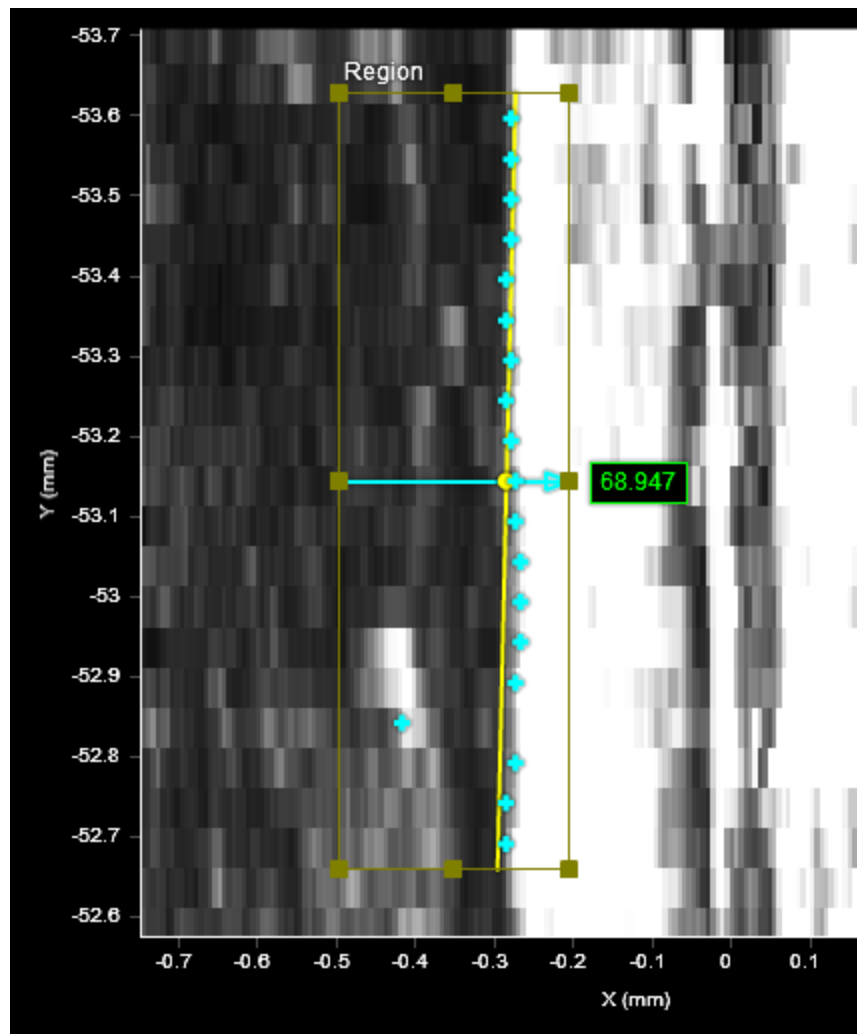


Use Intensity enabled (intensity view): Surface Edge tool finds the edge using intensity data.

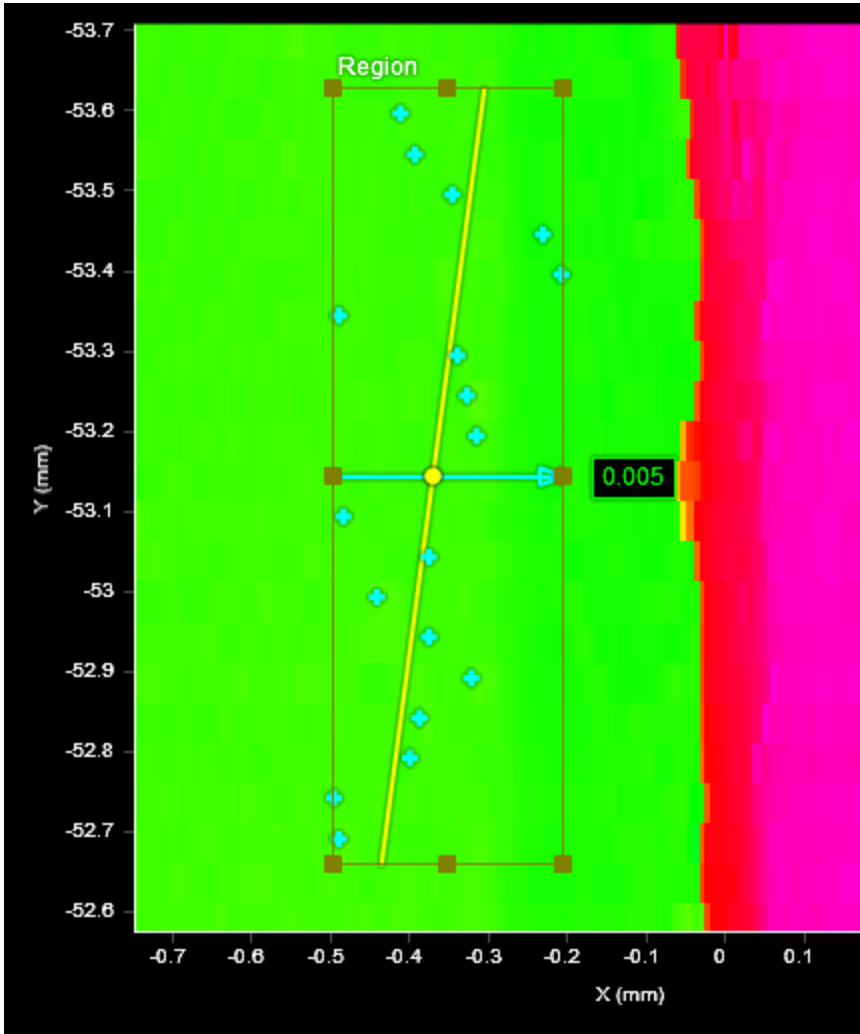Parameter	Description
	 <i>Use Intensity disabled (heightmap view of the same area): Surface Edge tool unable to find edge using height data.</i>
Number of Regions	The number of regions the tool will use to fit the line. You must configure each region (see <i>Region {n}</i> below). Using multiple regions allows you to fit a line to an edge that is not straight along its entire length or that is not continuous.
Region {n}	The region or regions the tool uses to fit a line. For more information, see <i>Regions</i> on page 145. The Search Direction setting applies to all of the regions. You can configure the Z Angle of each region independently to accommodate the particularities of the feature or target (for example, to exclude unwanted scan data next to one of the regions in the fitting of the line to the edge).

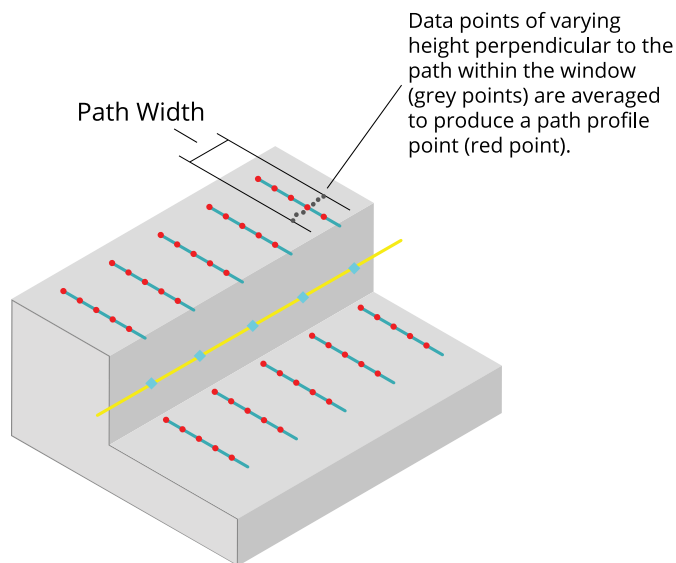
Parameter	Description
Search Direction	The search direction for steps, specified as an orientation around the Z axis, relative to the X axis. Can be 0, 90, 180, or 270 degrees. Choose a value that is roughly perpendicular to the edge on the target. The direction is indicated by a light blue arrow in the data viewer.
Fixed Angle	When this option is enabled, the value in Fixed Angle Value replaces the value the Z Angle measurement returns. Useful when the angle of the feature is known and noise in the scan data could otherwise cause the measurement to return an incorrect angle.
Fixed Angle Value	The value the tool uses to locate the edge and returns for the Z Angle measurement. You must enable Fixed Angle to set this value.
Path Spacing	Sets the spacing between paths in the measurement region used to extract the profiles that determine the edge. A higher number of paths results in a higher number of edge points, which makes the fitting of the edge line more accurate. However, a higher number of edge points results in a greater tool execution time. When Path Spacing is set to 0, the resolution of the scan data is used as the basis for spacing. No paths are displayed in the data viewer in this case.
Path Width	The size of the windows perpendicular to the path used to calculate an average for each data point on a path profile. Useful to average out noise along the path caused by reflections, and so on.  If Path Width is set to 0, no averaging is performed (only the data point under the path is used). For averaging along the path, use Step Smoothing (see below).

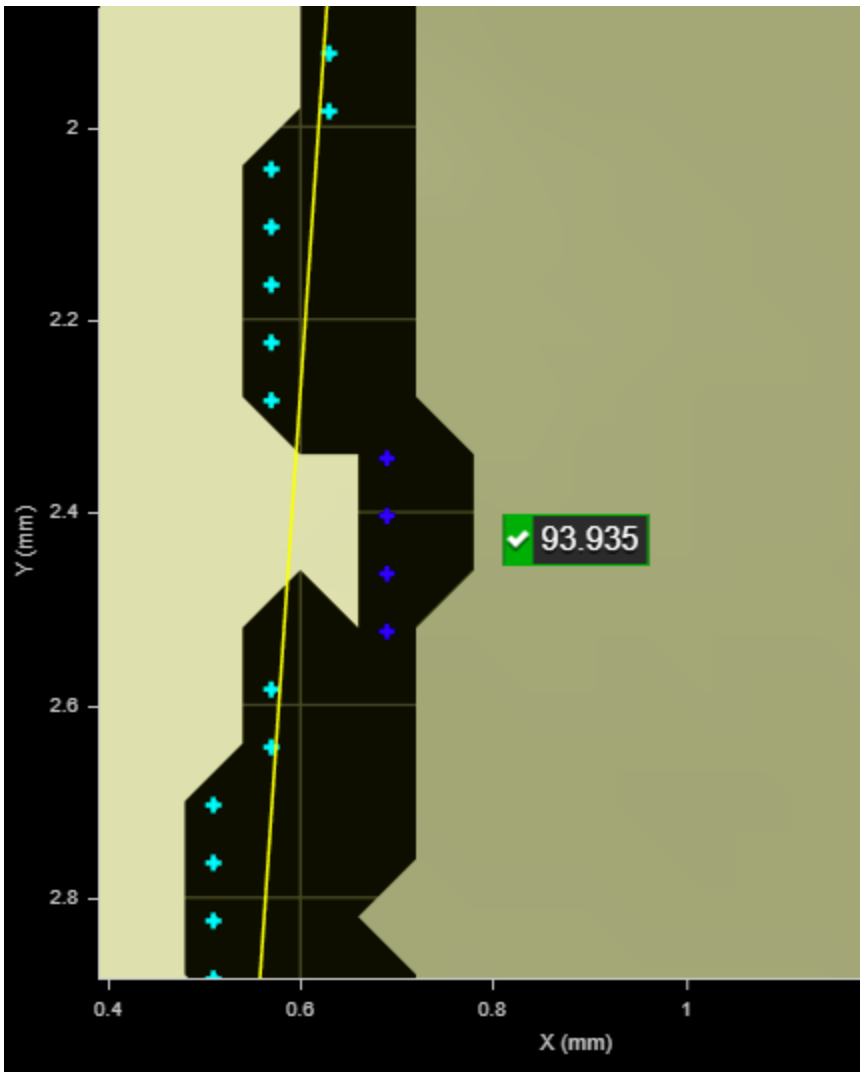Parameter	Description
Outlier Fraction	The percentage of outlier points to exclude. Setting this to a small value can help the tool fit the line better to the edge.  <i>Outlier Fraction set to a low value: rejected outlier edge points are dark blue.</i>
Selection Type	Determines which step the tool uses on each path profile when there are multiple steps in the profile. An edge point is placed on each chosen step. Steps must pass the criteria of the tool's Step Threshold and Step Direction settings. Best: Selects the greatest step on each path profile. First: Selects the first step on each path profile. Last: Selects the last step on each path profile.
Step Direction	Determines whether the expected step rises or falls along the path. Either Rising, Falling, or Rising or Falling.


Parameter	Description
Absolute Threshold	When Use Intensity is disabled, the setting specifies the minimum <i>height</i> difference between points on a path profile for that step to be considered for an edge point. The setting can be used to exclude smaller steps on a part that should not be considered for an edge, or to exclude height differences caused by noise. When used in conjunction with Relative Threshold, Absolute Threshold is typically set to a small value, greater than the general surface roughness.

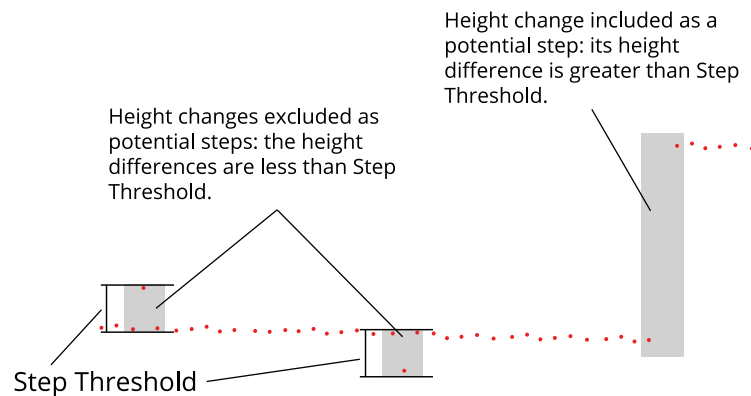




In the image below, when **Step Threshold** is left at the default of 0, all steps are included as possible candidates for an edge, and will be used to fit an edge line. The resulting edge line is angled upward to the left.

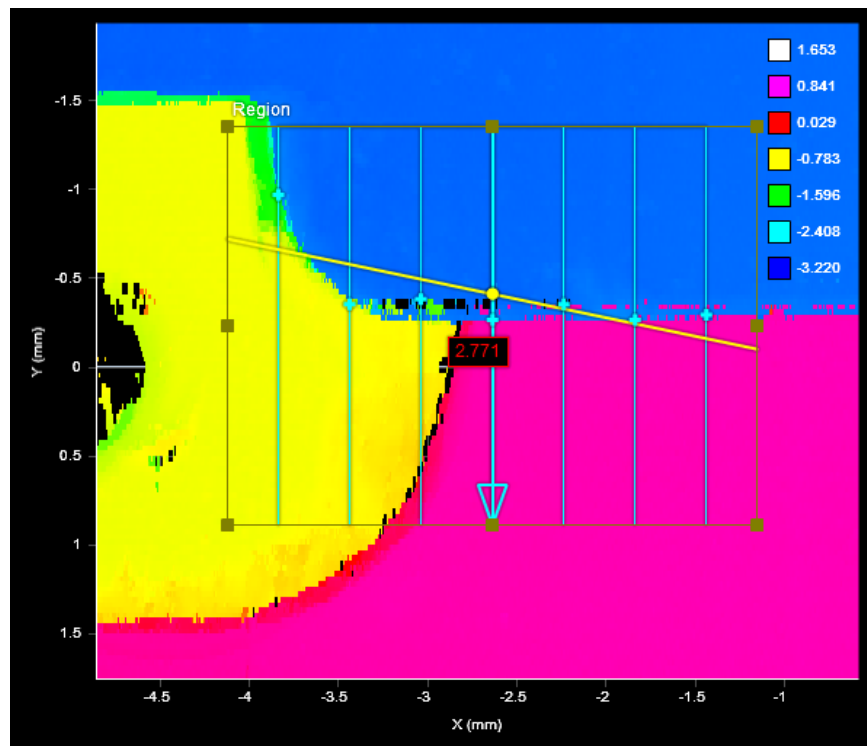

When **Step Threshold** is set to 3 with the same data (see image below), steps going from the yellow to pink regions (roughly 1.37 mm) and from the blue to yellow regions (roughly

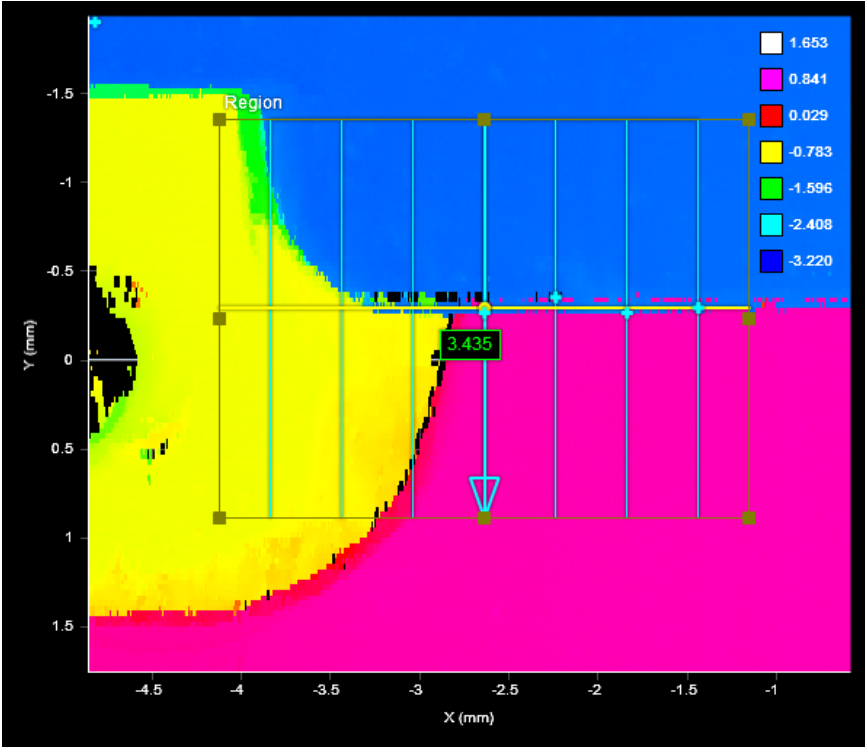Parameter	Description
	2 mm) are excluded. Only steps from the blue to pink regions (roughly 3 mm) are included.  When Use Intensity is enabled, the setting specifies the minimum difference in intensity. (Acquire Intensity must be enabled in the Scan Mode panel.)
Use Relative Threshold	When this option is enabled, the Relative Threshold field is displayed.
Relative Threshold	The value for the relative threshold. The tool calculates a relative threshold by scaling the greatest height or intensity difference found on the path profiles by the percentage in Relative Threshold. This lets you configure the tool without knowing the actual step height in advance, and is useful for edges with varying step height. For a height or intensity difference to be considered a valid step, both Absolute Threshold and Relative Threshold must pass.

Parameter	Description
Step Smoothing	The size of the windows along the path used to calculate an average for each data point on a path profile. The setting is useful for averaging out noise. Step Smoothing Data points of varying height along the path within the window (grey points) are averaged to produce a path profile point (red point). If Step Smoothing is set to 0, no averaging is performed (only the data point under the path is used). For averaging perpendicular to the path, use Path Width (see above).
Step Width	The distance, along a path profile, separating the points used to find steps on a path profile. Step Width The setting is useful when you must detect a slope as an edge, rather than a sharply defined edge: setting Step Width to a value greater than the width of the edge ensures that the tool measures the height difference between the flat regions on either side of the edge. As a result, the height of the step is accurately measured, and the edge is correctly located.  Setting Step Width wider than necessary can reduce the precision of edge location.

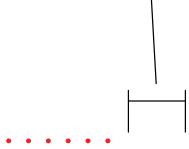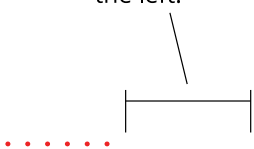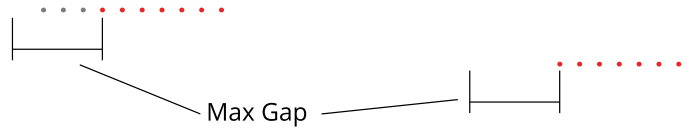Parameter	Description
Max Gap	Fills in regions of missing data caused by an occlusion near the desired edge. Use this setting when continuity on the target is expected. When Max Gap is set to a non-zero value, the tool holds and extends the last data point on the low side next to an edge across a gap of null points, up to the distance specified in Max Gap. Gap caused by occlusion is <i>less than</i> Max Gap: last data point from lower side is extended to the left.  Gap caused by occlusion is <i>greater than</i> Max Gap: last data point from lower side is <i>not</i> extended to the left.   Max Gap
Include Null Edges	Indicates whether null points (points where no height or intensity value is available, due to dropouts or regions outside of the measurement range) are filled with the value in Null Fill Value as a general “background level.” If Use Intensity (see above) is enabled, the intensity value in Intensity Null Fill Value is also used. A typical example is a discrete part produced by part detection of an object sitting on a flat background. The background is not visible in the part, so the tool assumes that any null region are at the background level. To find edges along a region of null points, you must use either this option and an appropriate value in Null Fill Value (and Intensity Null Fill Value if Use Intensity is enabled) or Max Gap. Otherwise, only edges within areas of contiguous data will be detected.
Null Fill Value	The height value (in mm) used to replace null points not filled by Max Gap when Include Null Edges is enabled.
Intensity Null Fill Value	The intensity value (0-255) used to replace null points when Include Null Edges and Use Intensity are enabled.
Show Detail	When disabled, hides the light blue path lines and edge points.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Ellipse

The Ellipse tool provides measurements for the major and minor axis lengths of an ellipse fitted to the part's shape in the XY plane, and also for the ratio of the major and minor axis lengths and for the orientation angle of the ellipse.

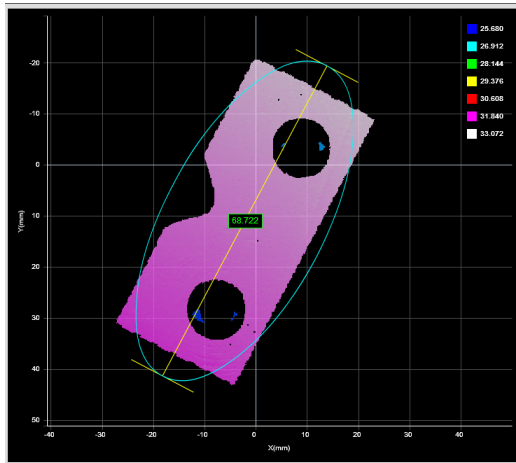

2D View

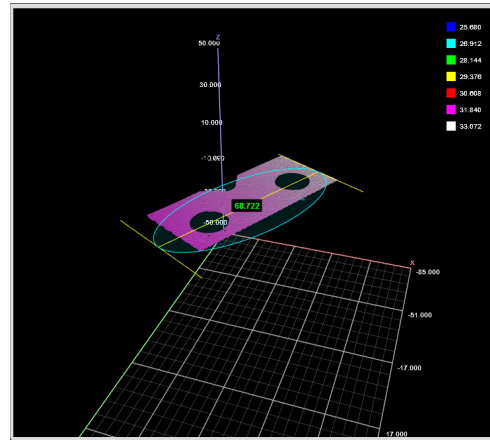

3D View

Parameters Anchoring

Source: Top

Asymmetry Detection: None

☒ Region

Measurements Features

Major	68.722	☒
Minor		☐
Ratio		☐
Z Angle		☐

ID: 2

Output

Filters

Decision

Min: 68 mm





Max: 69 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

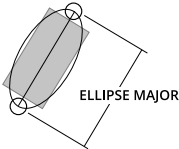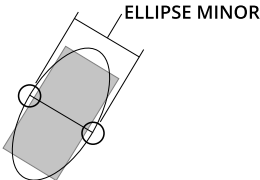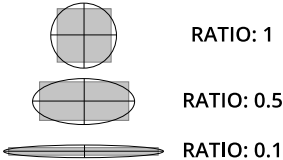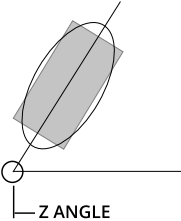Measurement	Illustration
Major Determines the major axis length of an ellipse fitted to the part's area in the XY plane.	
Minor Determines the minor axis length of an ellipse fitted to the part's area in the XY plane.	
Ratio Determines the minor/major axis ratio of an ellipse fitted to the part's area in the XY plane.	
Z Angle Determines the orientation angle of an ellipse fitted to the part's area in the XY plane.	

Features

Type	Description
Center Point	The center point of the fitted ellipse.
Major Axis	A line representing the major axis of the fitted ellipse.
Minor Axis	A line representing the minor axis of the fitted ellipse.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.

Parameter	Description
Asymmetry Detection	Resolves the orientation of an object over 360 degrees. The possible values are: 0 – None 1 – Along Major Axis 2 – Along Minor Axis
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Extend

The Extend tool creates a new surface by appending part of the previous frame's data to the current frame's data. The tool outputs the new surface data, which can be used as input by other tools. The tool is especially useful when scans are performed using fixed length surface generation, where parts might be split between two frames.

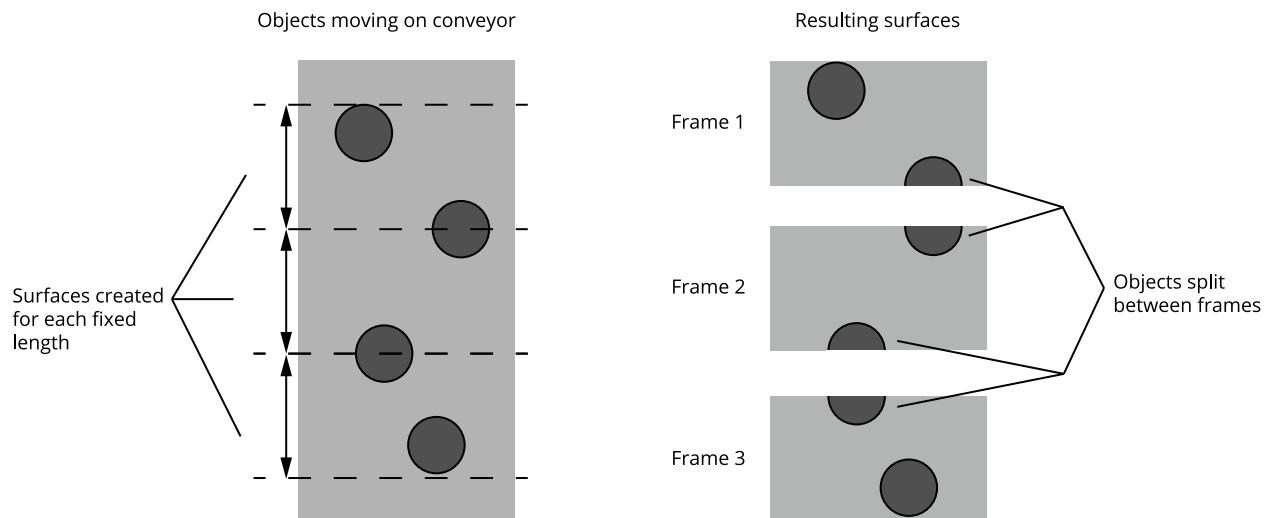

The following shows how the tool combines data:

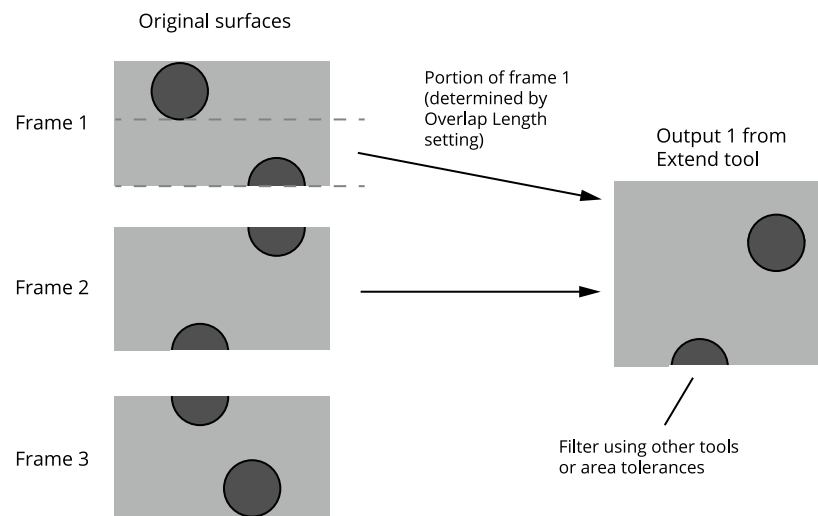

Data is only appended in one direction. Partial objects in the resulting surface output from the tool must be filtered out using downstream tools, for example, excluding them based on the expected area.

The screenshot shows the 'Measurement Panel' with two tabs: 'Parameters' and 'Data'. Under the 'Parameters' tab, the following settings are visible:

- Source: Top
- Direction: Forward
- Overlap Length: 125 mm

 The 'Data' tab is active, showing a list with one entry: 'Surface', which has a checked checkbox to its right.

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.


Data and Settings

Data

Type	Description
Extended Surface	Data containing an extended surface, available for use as input in the Stream drop-down in other tools.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Direction	Determines whether the previous frame's data is appended above or below the current frame's data.

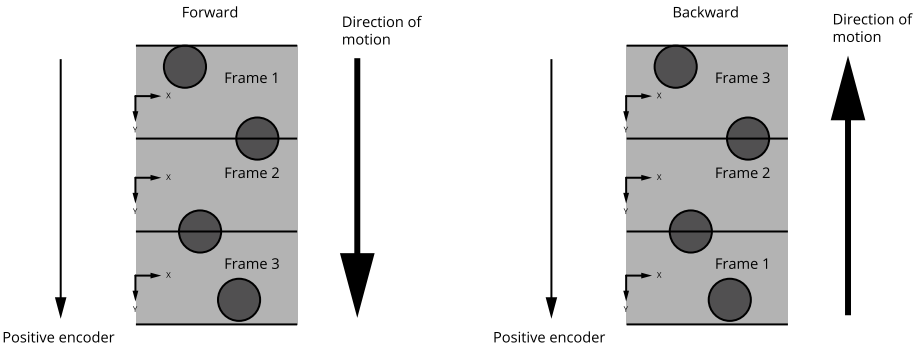

One of the following. Note that these settings depend on whether the trigger source has been set to Encoder (see *Trigger Settings* on page 87).

- **Auto:** Choose this when Encoder is selected as the trigger source, in which case the tool will know the direction of travel relative to encoder increase / decrease.
- **Forward:** Choose this when the trigger source is not set to Encoder and the direction of motion is the same as the increase of the encoder.
- **Backward:** Choose this option when the trigger source is not set to Encoder and the direction of motion is the opposite of the increase of the encoder.


Overlap Length	The amount, in millimeters, of the previous frame's data to append to the current frame's data. The combination will be output as tool data. Choose the overlap length to accommodate the size of your scan targets.
----------------	--

Filter


The Filter tool provides several common vision processing filters that you can apply to surface data, as well as a two "cropping" filters that output a subset of the surface data, letting you pre-process scan data to get more repeatable measurements. You can enable up to seven of the filters at once, in any order. Filters in the tool are chained together. Any Surface or Feature tool can use the resulting filtered surface data as input, via the tool's **Stream** drop-down.

For a list of the filters, see *Filters* on the next page.


The Filter tool provides no measurements or decisions, as its only purpose is to output processed surface data.

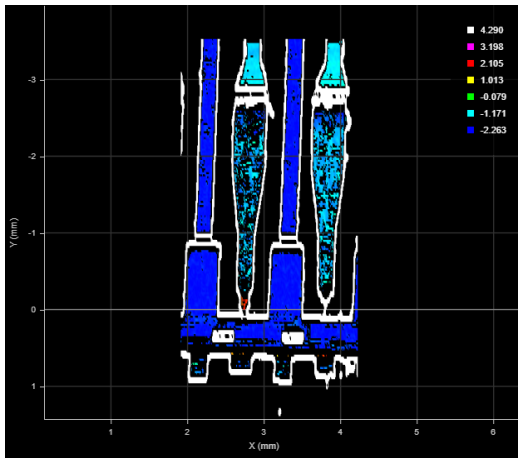

2D View (Sobel Magnitude)

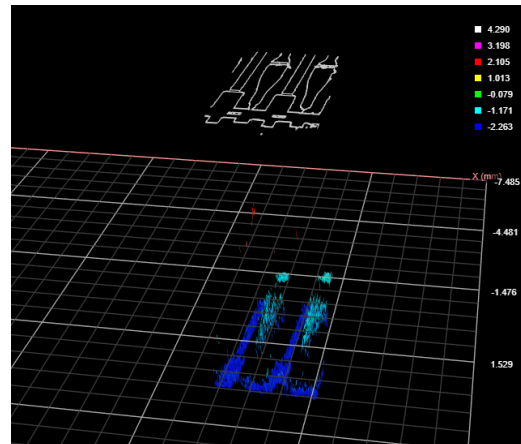

3D View (Sobel Magnitude)

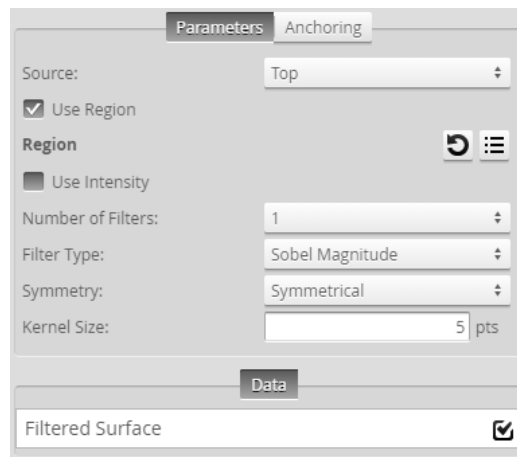

Tool Setup

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Settings and Available Filters

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145. Can only accept Surface scan data (that is, cannot accept data from other tools).
Use Region	When enabled, lets you set a region.
Region	The region whose data the tool will apply filters to. Only data within the region is output to other tools.
Use Intensity	If enabled, the tool uses intensity data instead of heightmap data. Only available if Acquire Intensity is enabled on the Scan page during the scan; for more information, see .
Number of Filters	Specify the number of filters you want to chain together. You can specify up to seven filters.
Filter Type	For each filter, specify the type of filter. For more information on the available filters, see <i>Filters</i> below.
Kernel Size	The kernel size that the filter uses. The size is represented in data points. (Not available on all filters.)

Filters

Name	Description
Median	A median filter.
Gaussian	A Gaussian filter.
Open	Erosion followed by dilation.
Close	Dilation followed by erosion.
Erode	Applies an erosion filter. Lets you specify the direction of the erosion; one of the following: • Horizontal • Vertical • Symmetrical
Dilation	Applies a dilation filter. Lets you specify the direction of the dilation; one of the following: • Horizontal • Vertical • Symmetrical
Morph Gradient	Applies a morphological gradient. The difference between dilation and erosion.
Sobel Magnitude	Applies a Sobel magnitude filter. Lets you specify the direction of the filter; one of the following: • Horizontal • Vertical • Symmetrical

Name	Description									
Laplacian	Applies a Laplacian filter. Useful for detecting areas of distinct edges. Uses the following kernel: <table><tr><td>0</td><td>-1</td><td>0</td></tr><tr><td>-1</td><td>4</td><td>-1</td></tr><tr><td>0</td><td>-1</td><td>0</td></tr></table>	0	-1	0	-1	4	-1	0	-1	0
0	-1	0								
-1	4	-1								
0	-1	0								
Negative	Inverts the height values in the scan data.									
Equalize	Normalizes the norm or value range of an array.									
Binarize	Sets height values to a fixed value for each point that is present in the data. Can be used with a region Z offset to threshold points above/below a Z value.									
Percentile	Limits the scan data to points between the values you set in High Percentile and Low Percentile , which are displayed when you choose this option.									
Relative Height	Crops scan data based on user-specified minimum and a maximum heights. Use Reference Region to set the heights relative to a reference region.									
Crop only	Crops the scan data to the user-defined region.									
Mask With Input	Uses the surface input into the tool as a mask on the data. Any points in the filtered data will be set to null if the input surface is null at the same location. For example, the Gaussian filter can extend data along the edges, adding data in areas that contain null values. This filter would remove data that the Gaussian filter introduces, preserving the null values. This filter should follow any filter that introduces this kind of unwanted data.									

Data

Type	Description
Filtered Surface	The filtered data, available for use as input in the Stream drop-down in other tools.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.

 A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.

 For more information on anchoring, see *Measurement Anchoring* on page 154.


Flatness

The Flatness tool returns various measurements related to the flatness of one or more regions on the surface of your target. The tool is ideal for general fit and finish inspection.


The tool lets you set a grid over a specific region, or more flexibly with multiple individual regions manually. In each case, "local" minimum and maximum heights, as well as flatness indicators (maximum - minimum), are returned (for grid cells or individual regions, depending on the tool's settings). In addition, "global" minimum, maximum, and flatness measurements, that combine data from all flatness measurement areas, can also be returned. The tool measures the maximum and minimum distances from a different best-fit plane for each local measurement, and from another plane fit to all data for the "global" measurements.

You can control how many data points the tool uses in its calculations to account for noise or smooth data, or otherwise exclude unwanted data.

When you configure the tool to use a grid that contains more than 15 cells, only the first 15 local measurements (which correspond to the first 15 cells of the grid) are displayed in the web interface. Flatness results for cells beyond 15 are however available in the tool data.

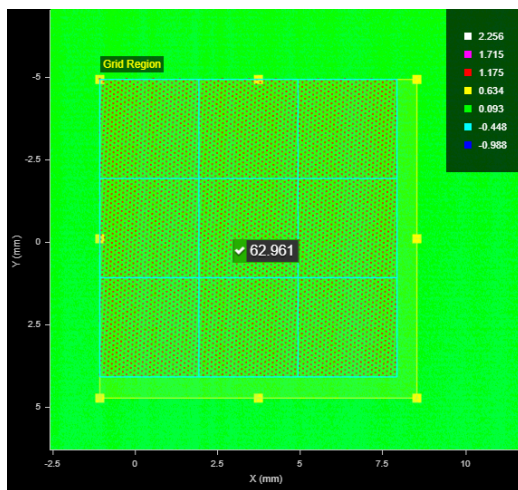

2D View

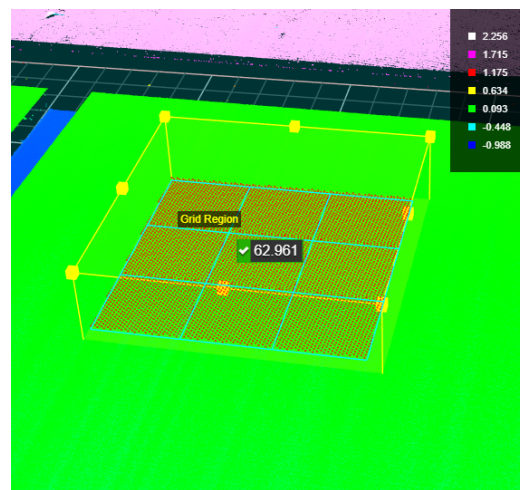

3D View

ParametersAnchoring

Source:

Top

Region Mode

Grid Pattern

Grid Region

↺

☰

Grid Width (X)

3

mm

Grid Length (Y)

3

mm

Flatness Mode

All Points

Data Filtering

None

☒ Display Points in Region

Grid Cell to Display

0

Unit

um

MeasurementsData

Global Max	34.922	☒
Global Min	-28.040	☒
Global Flatness	62.961	☒
Local Max 1		☐
Local Min 1		☐
Local Flatness 1	52.376	☒
Local Max 2		☐
Local Min 2		☐
Local Flatness 2	55.376	☒
Local Max 3		☐
Local Min 3		☐

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Data, and Settings

Measurements

Measurement

Global Max

Global Min

Global Flatness

The maximum distance, minimum distance, and flatness (maximum - minimum) calculated using the valid data from *all* the cells in the grid (when **Region Mode** is set to **Grid Pattern**), or *all* the individual regions (when **Region Mode** is set to **Flexible**).

Measurement

Local Max {n}

Local Min {n}

Local Flatness {n}

The maximum distance, minimum distance, and flatness (maximum - minimum) calculated using the valid data points from a specific grid cell (when **Region Mode** is set to **Grid Pattern**), or an individual regions (when **Region Mode** is set to **Flexible**).

Clicking a local measurement in the list of measurements selects corresponding the cell or region in the data viewer.



When a local measurement is selected, changing the value of **Grid Cell to Display** has no effect.


Data

Type	Description
Output Measurement	Data containing the measurement results. The web interface only displays up to 15 local measurements. However, if you define the grid and cell size so that you have more than 15 flatness measurement areas, these are included in the tool data. A sample included in the SDK package shows how you can use this output data in an application.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.

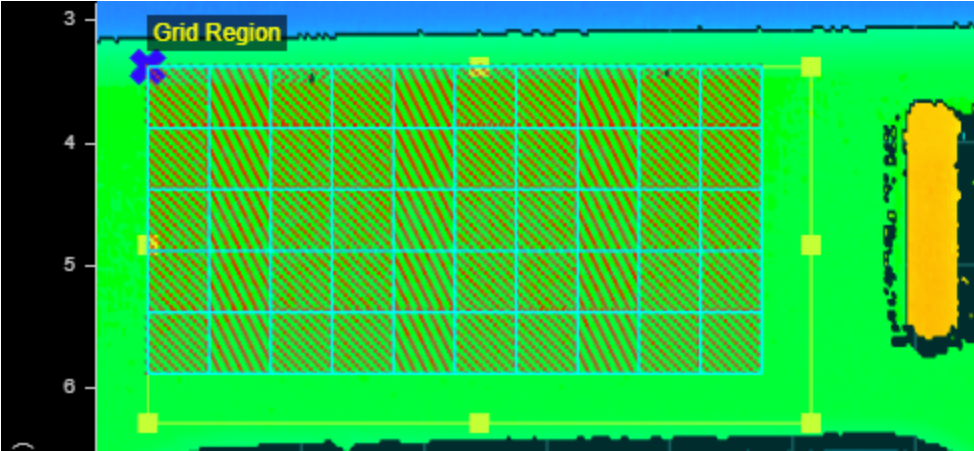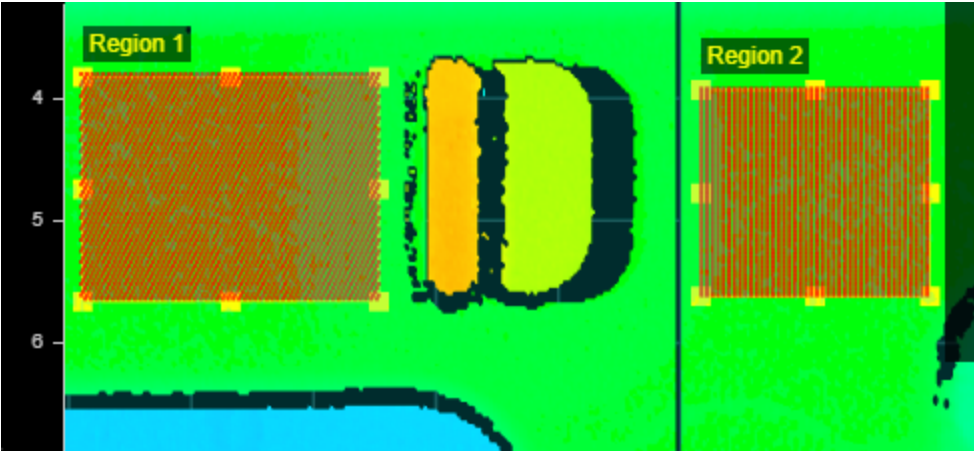Parameter	Description
Region Mode	Determines how flatness measurement areas are set up on the target. One of the following: Grid Pattern: The tool determines flatness in a grid you define on the target. This option enables settings that let you set a region that will contain the grid, as well as the width and length of the grid cells.  Flexible: The tool determines flatness in one or more (up to 15) regions that you define individually on the target. 
Grid Region <i>(used with Grid Pattern region mode)</i>	Determines the size of the grid region.
Cell Width (X) Cell Length (Y) <i>(used with Grid Pattern region mode)</i>	These settings determine the size of the cells in the grid.
Region {n}	When Region Mode is set to Flexible , for each region, the tool displays a region definition.

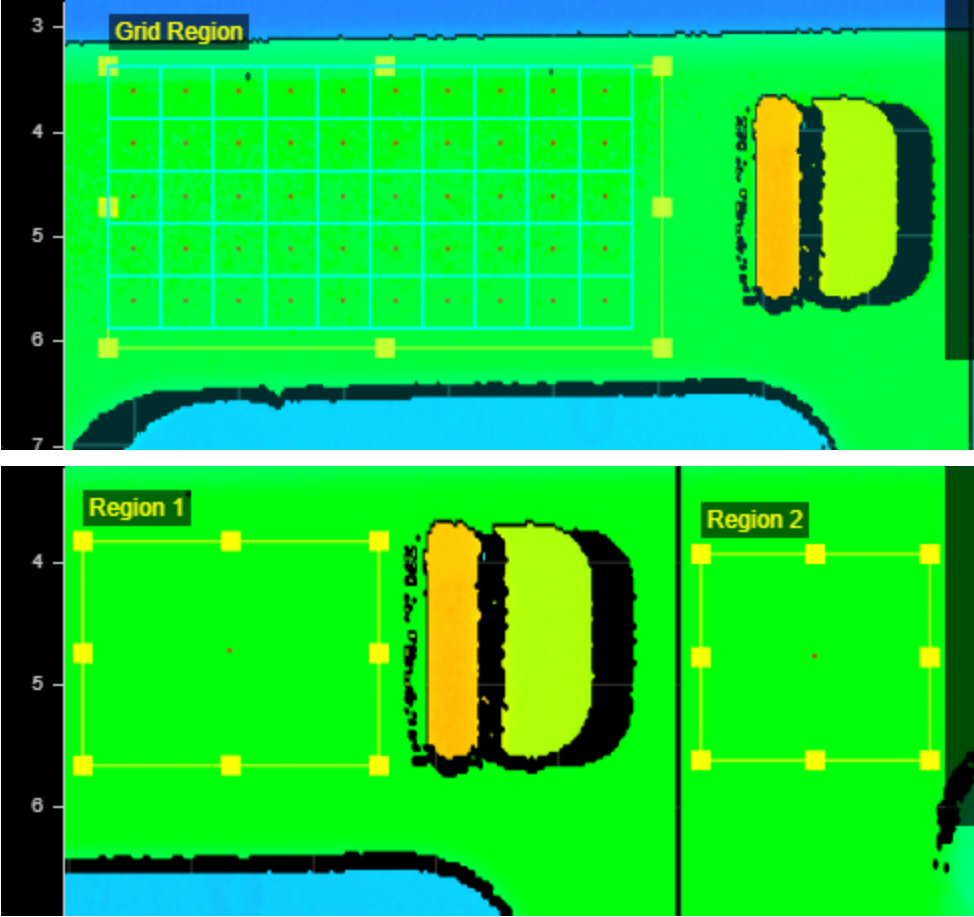Parameter	Description
Global Flatness Mode	Chooses which points the tool uses to calculate global flatness. One of the following: All Points: The tool uses all points in the measurement area (all flexible regions or the grid pattern in the region). Single Average Point: The tool uses an average of the points in the measurement area. When you choose this option, the global measurements require at least four data points to calculate the plane and statistics. This means that if you set Region Mode to Flexible, you must choose a minimum of four regions; if you set Region Mode to Grid Pattern, the size of the grid and the cells must result in at least four cells.
	
Data Filtering	Lets you filter scan data before the tool performs its calculations. Percentile - Limits the data to points between the values you set in High Percentile and Low Percentile, which are displayed when you choose this option. None - The tool performs no filtering.
Display Points in Region	Displays the data points used to calculate flatness.

Parameter	Description
Grid Cell to Display (used with Grid Pattern region mode)	When the Global Flatness measurement is selected, displays data points in the specified cell. Display Points in Region must be enabled for this to work. (When a local measurement is selected, changing this value has no effect.)
Unit	Lets you choose which units the tool uses for measurement results. One of the following: • um (micrometers) • mm (millimeters)
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Hole



The Hole tool measures a circular opening within a region of interest on the surface and returns its position and radius.




The Hole tool does not search for or detect a hole. The tool expects that a hole conforming reasonably well to the defined parameters is present and that it is on a sufficiently uniform background.

The hole can be on a surface at an angle to the sensor.

The tool uses a complex feature-locating algorithm to find a hold and then return measurements. See "Hole Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel.

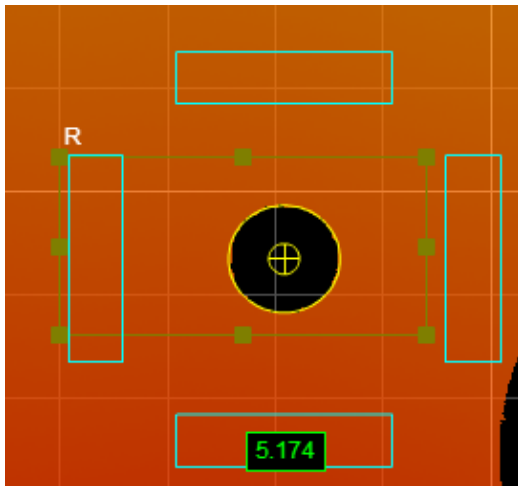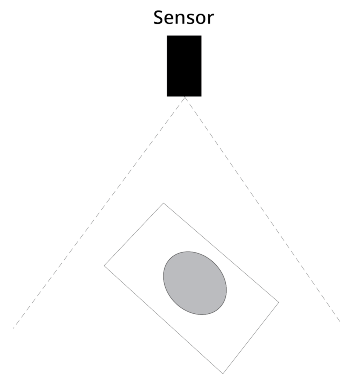

2D View

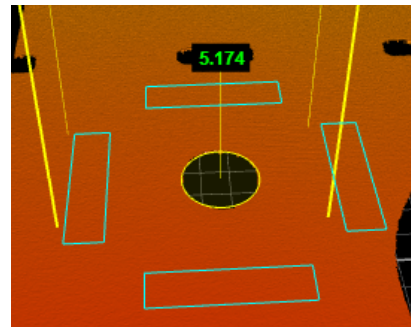

3D View

Parameters Advanced Anchoring

Source: Top

Nominal Radius: 10 mm

Radius Tolerance: 5 mm

Partial Detection: ☐

☐ Depth Limit: 5 mm

☒ Region  

Measurements Features

X	5.174	☒
Y		☐
Z		☐
Radius		☐

ID: 3

Output

Filters 

Decision

Min: 5 mm

Max: 5.2 mm

Parameter Advanced Anchoring

☒ Reference Region Auto Set

Tilt Correction Auto Set

X	☐
Y	☐
Z	☐
Radius	5.174 ☒

Id: 10

Output

Filters 

Decision

Min: 3 mm



Max: 8 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

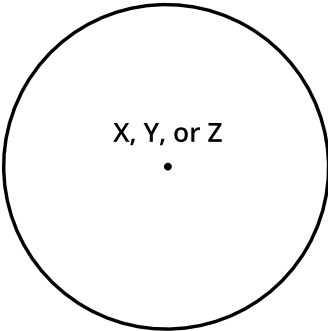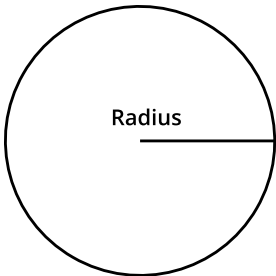Measurement	Illustration
X Determines the X position of the hole center.	
Y Determines the Y position of the hole center.	
Z Determines the Z position of the hole center.	
Radius Determines the radius of the hole.	



Features

Type	Description
Center Point	The center point of the hole. The Z position of the center point is at the Z position of the surrounding surface.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Nominal Radius	Expected radius of the hole.
Radius Tolerance	The maximum variation from the nominal radius (+/- from the nominal radius).

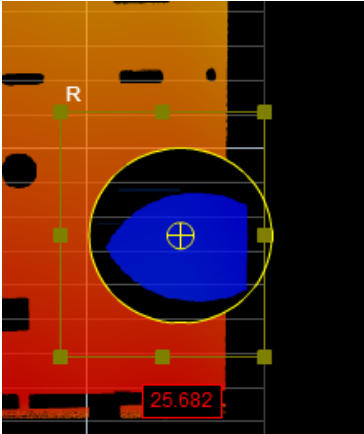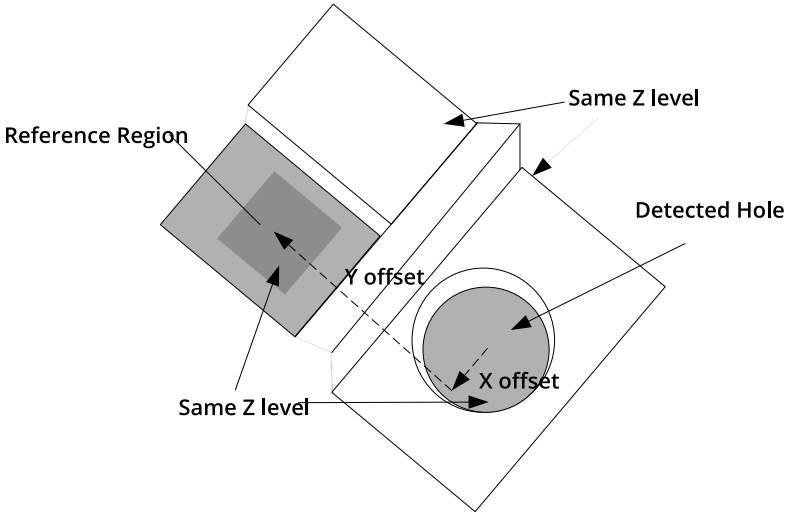Parameter	Description
Partial Detection	Enable if only part of the hole is within the measurement region. If disabled, the hole must be completely in the region of interest for results to be valid. 
Depth Limit	Data below this limit (relative to the surface) is excluded from the hole calculations.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Reference Region	The tool uses the reference regions to calculate the Z position of the hole. It is typically used in cases where the surface around the hole is not flat.  When this option is set to Autoset, the algorithm automatically determines the reference region. When the option is not set to Autoset, you must manually specify one or two reference regions. The location of the reference region is relative to the detected center of the hole and positioned on the nominal surface plane. When Reference Region is disabled, the tool measures the hole's Z position using all the data in the measurement region, except for a bounding rectangular region around the hole.

Parameter	Description
Tilt Correction	Tilt of the target with respect to the alignment plane. Autoset: The tool automatically detects the tilt. The measurement region to cover more areas on the surface plane than other planes. Custom: You must enter the X and Y angles manually in the X Angle and Y Angle parameters (see below).
X Angle	The X and Y angles you must specify when Tilt Correction is set to Custom .
Y Angle	You can use the Surface Plane tool's X Angle and Y Angle measurements to get the angle of the surrounding surface, and then copy those measurement's values to the X Angle and Y Angle parameters of this tool. For more information, see Plane .
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.





A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Measurement Region

The center of the hole must be inside the measurement region, even if the Partial Detection option is enabled.

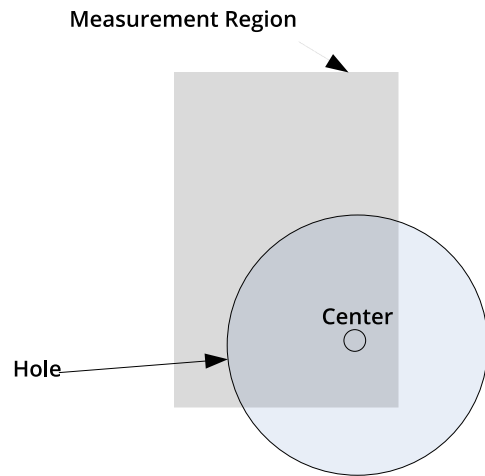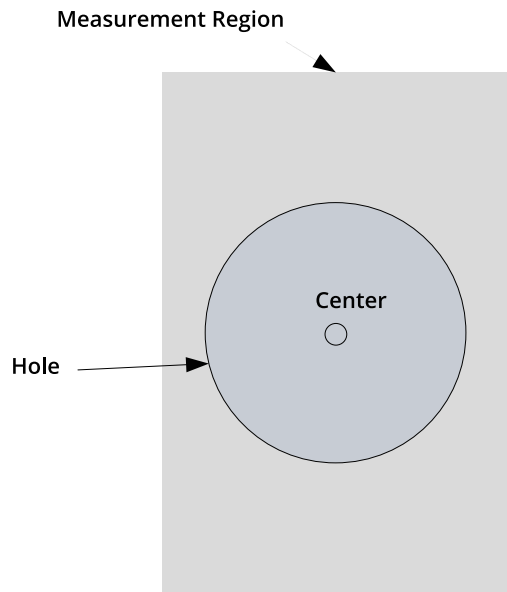


Opening

The Opening tool locates rounded, rectangular, and rounded corner openings. The opening can be on a surface at an angle to the sensor.




The Opening tool does not search for or detect an opening. The tool expects that an opening conforming reasonably well to the defined parameters is present and that it is on a sufficiently uniform background.


Rounded Slot

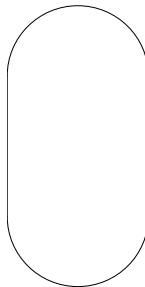

Rounded Corner Slot

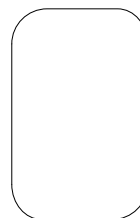


Rectangular Slot

 



The tool uses a complex feature-locating algorithm to find a hold and then return measurements. See "Opening Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel.


The algorithm can separate out background information that appears inside the opening. It can also detect a slot that only partially appears in the data.

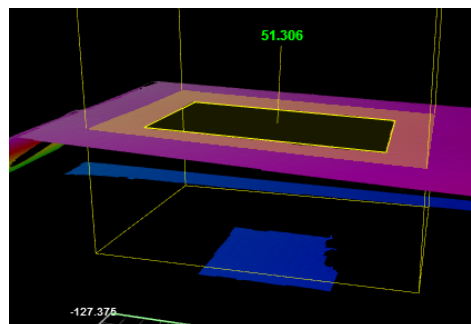


The shape of the opening is defined by its type and its nominal width, length, and radius.

The orientation defines the rotation around the normal of the alignment plane.

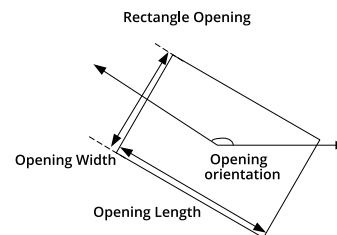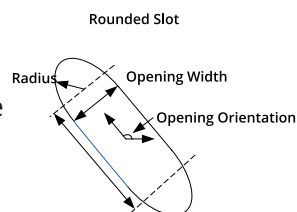

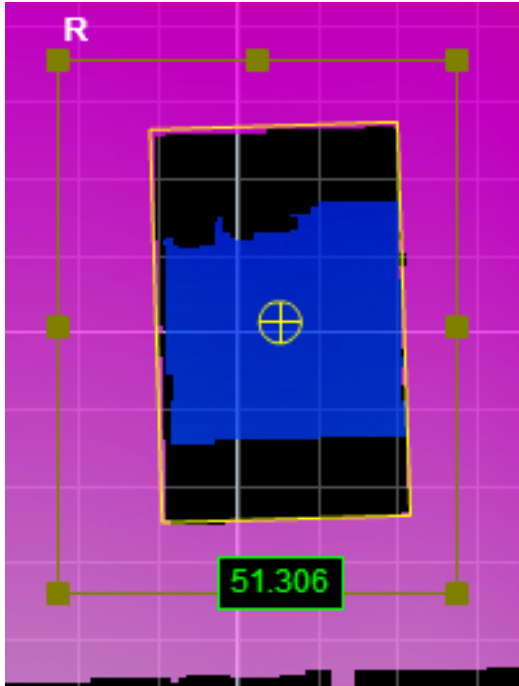

2D View

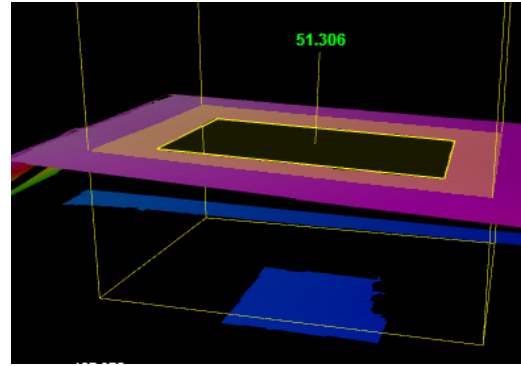

3D View

Parameters
Advanced
Anchoring

Source:
Top
Type:
Rectangle
Nominal Width:
30
mm
Nominal Length:
45
mm
Nominal Angle:
90
°
Nominal Radius:
5
mm
Width Tolerance:
10
mm
Length Tolerance:
10
mm
Angle Tolerance:
5
°
Partial Detection:
☐
☒ Depth Limit:
5
mm
☒ Region

Measurements
Features

X
☐
Y
☐
Z
☐
Width
☐
Length
51.306
☒
Angle
☐

ID:
5

Output

Filters

Decision

Min:
50
mm
Max:
60
mm

ParameterAdvancedAnchoring

Reference Region

Auto Set

Tilt Correction

Auto Set

X

Y

Z

Width

Length

Angle

51.306

Id:

11

Output

Filters

Decision

Min:

50

mm

Max:

60



mm



Measurement Panel






For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.



Measurements, Features, and Settings

Measurements

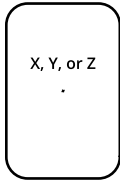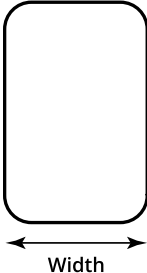Measurement	Illustration
X Determines the X position of the opening's center.	
Y Determines the Y position of the opening's center.	
Z Determines the Z position of the opening's center.	
Width Determines the width of the opening.	

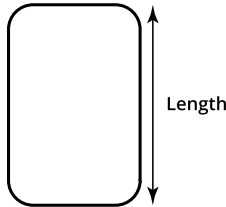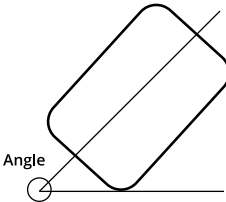Measurement	Illustration
Length Determines the length of the opening.	
Angle Determines the angle (rotation) around the normal of the alignment plane.	
Features	
Type	Description
Center Point	The center point of the opening. The Z position of the center point is at the Z position of the surrounding surface.
 For more information on geometric features, see <i>Geometric Features</i> on page 149.	
Parameters	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Type	Rounded Slot, Rectangle.
Nominal Width	Nominal width of the opening.
Nominal Length	Nominal length of the opening.

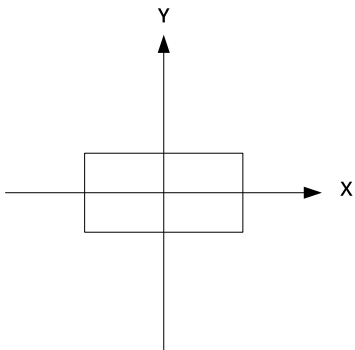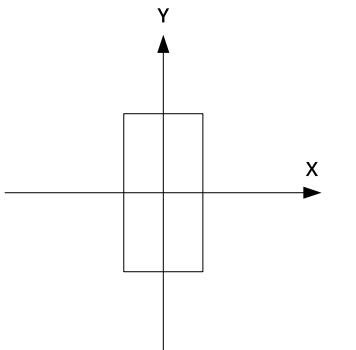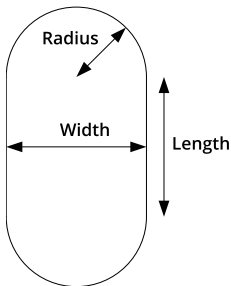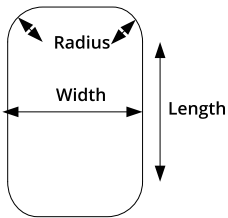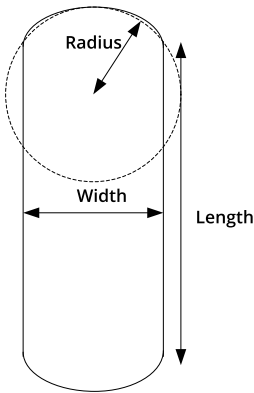Parameter	Description
Nominal Angle	Nominal angle of the opening. The default orientation is the length of the opening along the X axis. Orientation: 0 degrees  Orientation: 90 degrees  The diagram above illustrates the case where the surface is not tilted. When the surface is tilted, the orientation is defined with respect to the normal of the surface, not with respect to the X-Y plane
Nominal Radius	Nominal radius of the opening ends. If the opening type is set to rectangular, the radius setting is disabled. The opening has an oval shape if the radius is equal to $\frac{1}{2}$ of the width. The opening is a rounded rectangle when the radius is less than $\frac{1}{2}$ of the width. Radius = $\frac{1}{2}$ width  Radius < $\frac{1}{2}$ width  Radius > $\frac{1}{2}$ width 
Width Tolerance	The maximum variation from the nominal width (+/- from the nominal value).
Length Tolerance	The maximum variation from the nominal length (+/- from the nominal value).
Angle Tolerance	The maximum variation from the nominal orientation (+/- from the nominal value).
Partial Detection	Enable if only part of the opening is within the measurement region. If disabled, the opening must be completely in the region of interest for results to be valid.
Depth Limit	Data below this limit (relative to the surface) is excluded from the opening calculations.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.

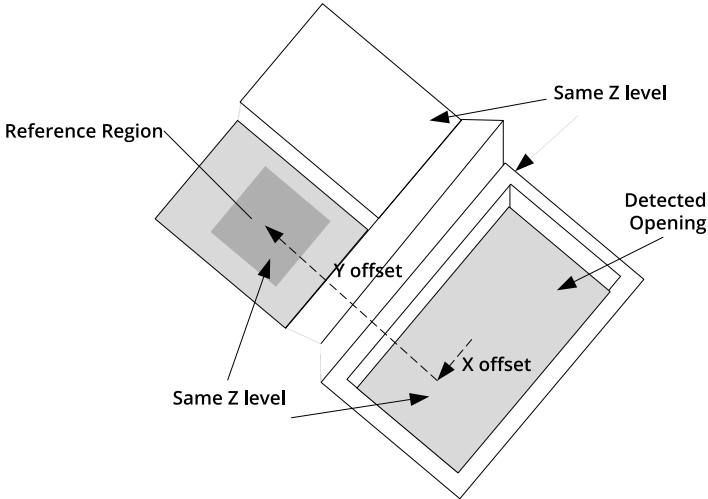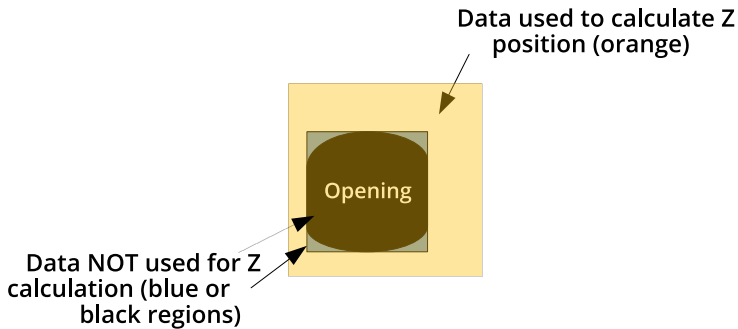Parameter	Description
Reference Regions	The tool uses the reference regions to calculate the Z position of the opening. Reference regions are relative to the center location of the feature. This option is typically used in cases where the surface around the opening is not flat.  When the Reference Regions setting is disabled, the tool measures the opening's Z position using the all data in the measurement region, except for a bounding rectangular region around the opening.  With one or more reference regions, the algorithm calculates the Z positions as the average values of the data within the regions. When you place the reference region manually, all of the data is used, whether the data is inside or outside the opening. You should place the reference region carefully.
Tilt Correction	Tilt of the target with respect to the alignment plane. Autoset: The tool automatically detects the tilt. The measurement region to cover more areas on the surface plane than other planes. Custom: You must enter the X and Y angles manually in the X Angle and Y Angle parameters (see below).

Parameter	Description
X Angle	The X and Y angles you must specify when Tilt Correction is set to Custom .
Y Angle	You can use the Surface Plane tool's X Angle and Y Angle measurements to get the angle of the surrounding surface, and then copy those measurement's values to the X Angle and Y Angle parameters of this tool. For more information, see Plane .
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Measurement Region

The center and the two sides and ends of the opening must be within the measurement region, even if **Partial Detection** is enabled.

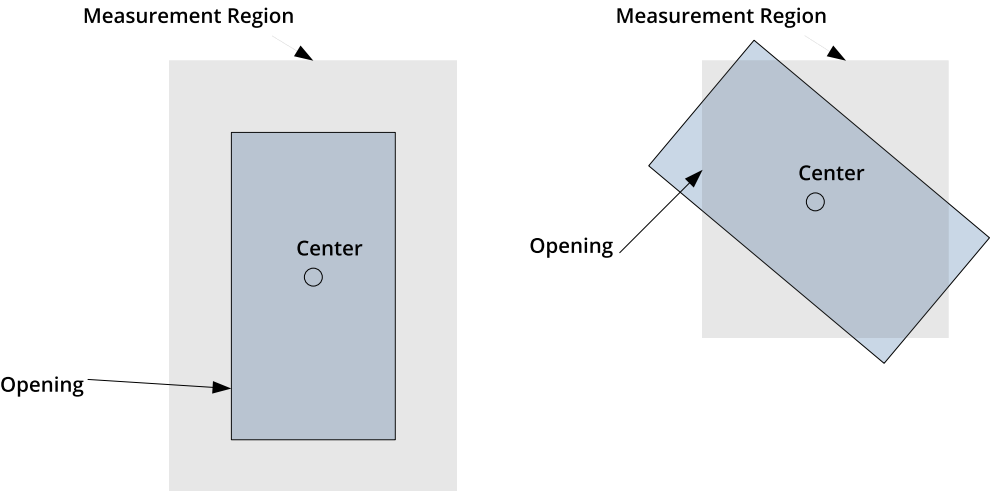


Plane


The Plane tool provides measurements that report a plane's position and orientation (X Angle, Y Angle, Z Offset, Normal, Distance), as well as the maximum and average deviations from the plane.

The Z offset reported is the Z position at zero position on the X axis and the Y axis.

The results of the Angle X and Angle Y measurements can be used to manually customize the tilt angle in the Hole, Opening, and Stud tools.

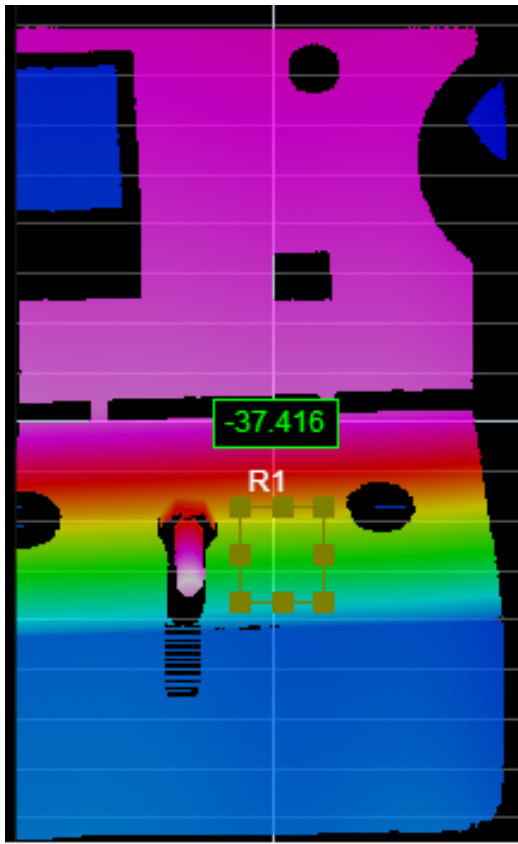

2D View

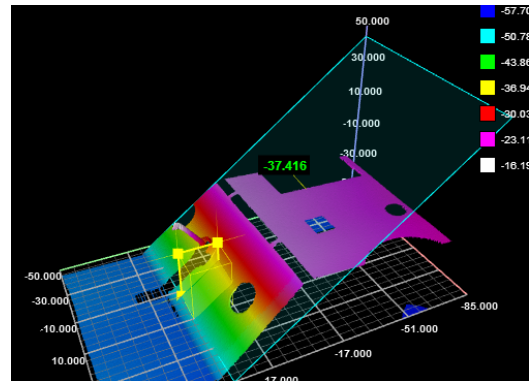

3D View

ParametersAnchoring

Source:

Top

Regions

1 Region

MeasurementsFeatures

X Angle	-37.416	☒
Y Angle		☐
Z Offset		☐
Standard Deviation		☐
Min Error		☐
Max Error		☐
X Normal		☐
Y Normal		☐
Z Normal		☐
Distance		☐

ID:

0

Output

Filters

Decision

Min:

-38 °

Max:

0 °

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

Measurement	Illustration
Angle X Determines the X angle of the surface with respect to the alignment target.	
Angle Y Determines the Y angle of the surface with respect to the alignment target.	
Offset Z Determines the Z value of intersection of the plane and the Z axis.	
Standard Deviation Measures the standard deviation of the points of the surface from the detected plane within the specified region or regions.	
Min Error Measures the minimum error from the detected plane (the maximum distance below the plane, perpendicular to the plane) within the specified region or regions.	
Max Error Measures the maximum error from the detected plane (the maximum distance above the plane, perpendicular to the plane) within the specified region or regions.	
X Normal Returns the X component of the surface normal vector.	
Y Normal Returns the Y component of the surface normal vector.	
Z Normal Returns the Z component of the surface normal vector.	
Distance Distance from the origin to the plane.	

Features

Type	Description
Plane	The fitted plane.



For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Regions	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Position

The Position tool reports the X, Y, or Z position of a part. The feature type must be specified and is one of the following: Average (the mean X, Y, and Z of the data points), Median (median X, Y, and Z of the data points), Centroid (the centroid of the data considered as a volume with respect to the $z = 0$ plane), Min X, Max X, Min Y, Max Y, Min Z, or Max Z.

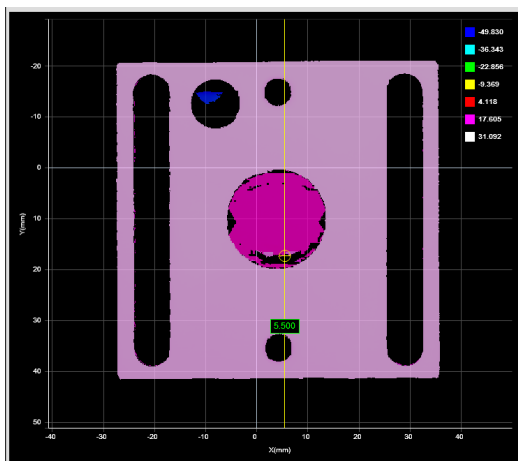

2D View

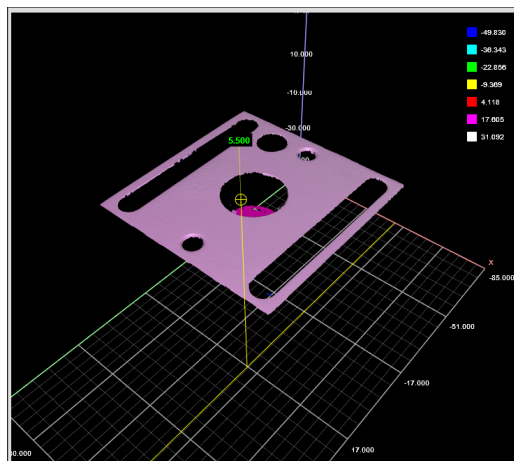

3D View


The Measurement Panel interface. It has two tabs: 'Parameters' and 'Anchoring'. Under 'Parameters', 'Source' is set to 'Top' and 'Feature' is set to 'Max Z'. Below these are 'Measurements' and 'Features' tabs. The 'Measurements' tab shows a table with columns 'X', 'Y', and 'Z'. The 'X' row is highlighted in blue and has a value of '5.500' and a checked checkbox. The 'Y' and 'Z' rows have empty checkboxes. Below the table is an 'ID' field with the value '6'. There is an 'Output' button. At the bottom, there is a 'Filters' section with a 'Decision' dropdown and 'Min' and 'Max' fields. The 'Min' field has a value of '5 mm' and the 'Max' field has a value of '6 mm'.

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

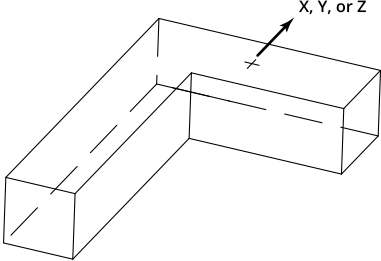Measurement	Illustration
X Determines the X position of the selected feature type.	
Y Determines the Y position of the selected feature type.	
Z Determines the Z position of the selected feature type.	

Features

Type	Description
Center Point	The returned position.

	For more information on geometric features, see <i>Geometric Features</i> on page 149.
---	--

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Feature	The feature the tool uses for its measurements. One of the following: • Average • Median • Centroid • Max X • Min X • Max Y • Min Y • Max Z • Min Z To set the region of a feature, adjust it graphically in the data viewer, or expand the feature using the expand button () and enter the values in the fields. For more information on regions, see <i>Regions</i> on page 145.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Segmentation


The Segmentation tool separates surface data into "segments," based on the tool's parameters. Segments can be touching and overlapping to a certain degree. The Segmentation tool is especially useful in the food industry, for example to identify food items that are too small or too big, or items that are damaged.

The Segmentation tool can also be used as a second stage of processing after part detection. For example, part detection could be used to detect a tray (containing parts), and the Segmentation tool could then separate the parts within the tray.


□ The Segmentation tool cannot handle large overlaps.

□ The Segmentation tool does not perform template matching.

□ To reduce processing time, consider using the decimation filter. For more information on this filter, see *Filters* on page 104.

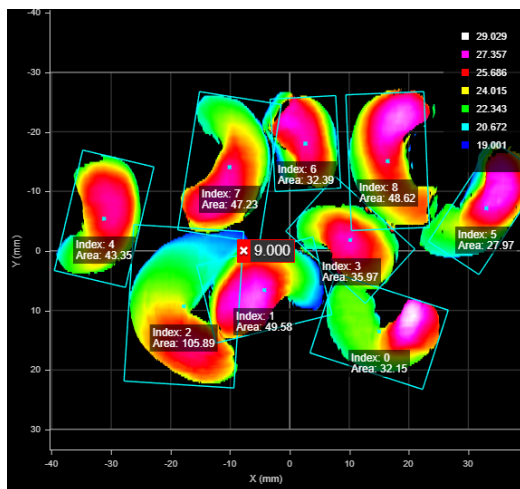

2D View

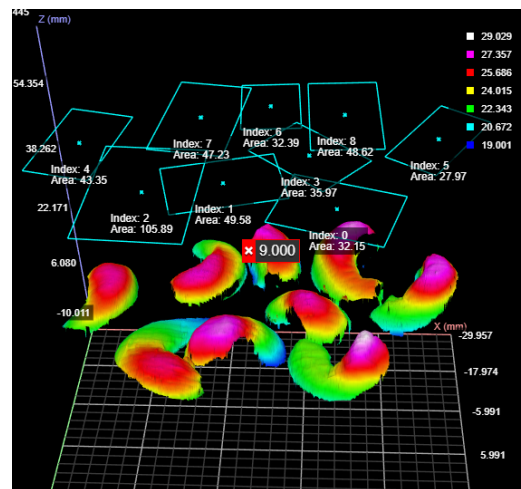

3D View

Parameters
Anchoring

Source:
Top

☐ Use Region

Part Area Min
10 mm2

Part Area Max
10000 mm2

Part Aspect Min
0

Part Aspect Max
1

Background Filter Kern Size
3 pts

Background Filter Iterations
3

Part Edge Filter Kern Size
11 pts

Part Edge Filter Threshold
2 pts

Measurements

Count	9.000	☒
Min Dimension	12.768	☒
Max Dimension	27.273	☒
Mean Width	14.946	☒
Mean Length	22.865	☒
Min Area	63.680	☒
Max Area	196.345	☒
Sum Area	1015.781	☒
Mean Area	112.865	☒
Min Height	21.288	☒
Max Height	27.405	☒
Mean Height	25.791	☒

ID:
33

Output

Filters

Decision

Min:
0 mm

Max:
0 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Data, and Settings

Measurements

Measurement

Count

Returns the number of found segments identified, based on the tool's parameters.

Measurement	
Min Dimension	
Max Dimension	
The minimum and maximum dimensions among all of the identified segments.	
Mean Width	
Mean Length	
The mean width and length of the segments, respectively.	
Min Area	
Max Area	
The minimum and maximum area among all of the identified segments.	
Sum Area	
The sum of the areas of the segments.	
Mean Area	
The mean area of the segments.	
Min Height	
Max Height	
The minimum and maximum heights among all of the identified segments.	
Mean Height	
The mean height of the segments.	
<i>Data</i>	
Type	Description
Segments Array	An array containing the segments. For an example of how to access this data from an SDK application or a GDK tool, see the appropriate sample in the SDK samples; for more information, see <i>Setup and Locations</i> on page 553. A sample included in the SDK package shows how you can use this output data in an application.
Diagnostics Surface	Surface data you can use to evaluate the impact of the tool's kern size and iteration settings, which the tool uses to separate potential segments.
<i>Parameters</i>	
Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Use region	Indicates whether the tool uses the user-defined region. If this option is not checked, the tool uses data from the entire active area.

Parameter	Description
Part Area Min Part Area Max	The minimum and maximum areas in square millimeters for a part of the scan data to be identified as a segment.
Part Aspect Min Part Aspect Max	The minimum and maximum aspect ratios (minimum axis length in mm) / (maximum axis length in mm) of the best fit ellipse to the segment contour points for a segment to qualify to be added to the list of found segments.
Background Filter Kern Size Background Filter Iterations	These settings perform background cleanup. The greater each of these values is, the more the background surface for the segment search will be adjusted. You must find a balance that removes noise adequately without degrading the segment find quality.
Part Edge Filter Kern Size	Use this value to clean up overlapping edges and find segments when noise is present in the scan data.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Sphere


The Sphere tool lets you compute characteristics of a scanned sphere by specifying a region to inspect. For example, you can use the tool to align a robot-mounted sensor to a ball-bar as shown in the images below.



For the tool to work properly, the tool's region typically must be enabled and set, and properly placed. For more information, see the table of parameters below.

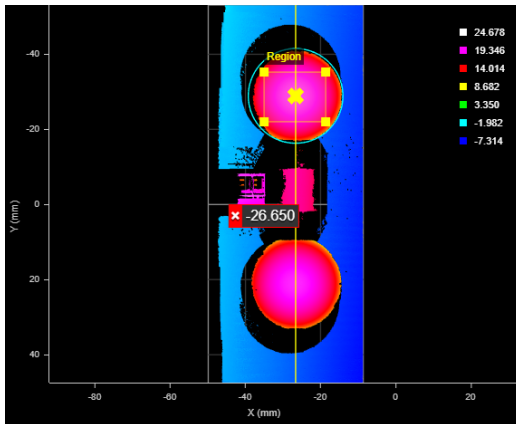

2D View

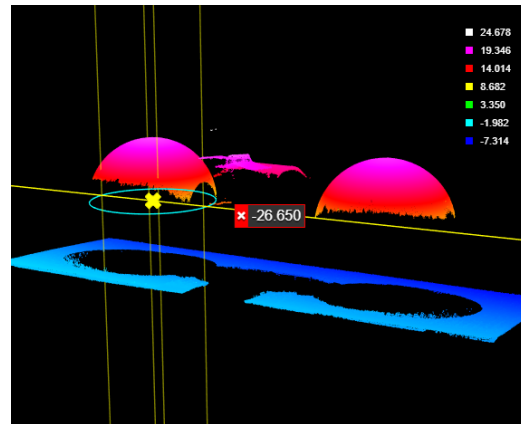

3D View



Measurements		Features	
CenterX	-26.650	☒	
CenterY	-28.910	☒	
CenterZ	8.062	☒	
Radius	12.604	☒	
StandardDeviation	0.015	☒	
ID:	0		
		Parameters	Output
Filters		⋮	
Decision			
Min:	0 mm		
Max:	0 mm		

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

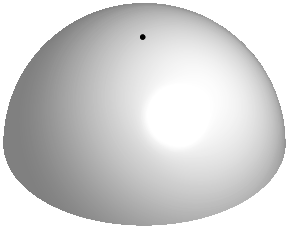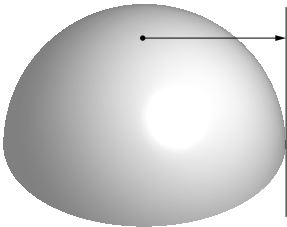Measurement	Illustration
Center X Determines the X position of the center of the sphere.	X, Y, or Z 
Center Y Determines the Y position of the center of the sphere.	
Center Z Determines the Z position of the center of the sphere.	
Radius Determines the radius of the sphere.	Radius 

StandardDeviation

Determines the error of the points compared to the computed sphere. It is defined as the square root of the variance of the distance of every point to the computed sphere.


Features

Type	Description
Center	The center of the circle encompassing the widest part of the fitted sphere.
Circle	The circle encompassing the widest part of the fitted sphere.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.

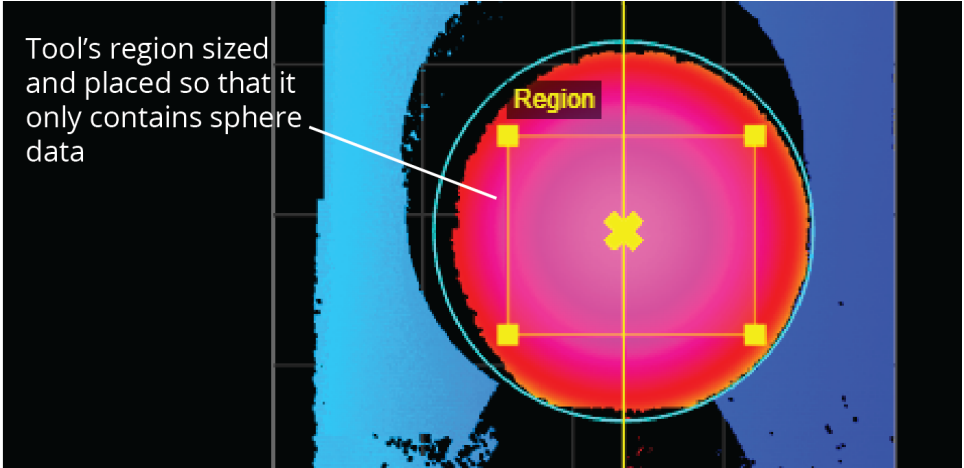Parameter	Description
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145. In order for the tool to correctly fit a sphere to the scan data, you must set the region so that it only contains data from the sphere on the target. 
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Stitch

The Stitch tool lets you combine up to 6 frames of scans into a single Surface scan. This lets you get a much larger scan volume with fewer sensors (either in a single sensor system or a multi-sensor system). For each scan, you can specify not only X, Y, and Z offsets (translations), but also X, Y, and Z angles (rotations), defining its relationship with the others. This means that when the sensor system is mounted to a robot, or if you are using, for example, an X-Y table, you can get a complete scan with fewer sensors. The resulting combined scan can then be used as input by any other Surface or Feature tool from its **Stream** drop-down.

The tool performs rotation first, and then translation.

You cannot define sections on the combined scan; for more information on sections, see *Sections* on page 135.



The tool combines data simply by overwriting in sequence: it performs no averaging or blending. The tool also performs no fitting.




Results are only as accurate as the motion system.




Seams are often seen in combined data in stitching performed in anything other than along the Y axis.

The tool returns one measurement, which simply indicates the number of scans successfully added to the combined scan data.

The following shows individual frames:

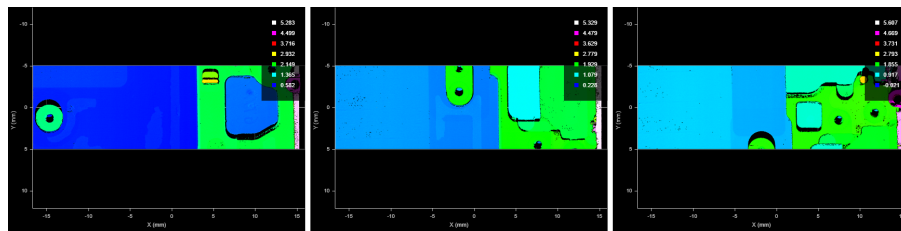

In the following, a combined surface is shown.

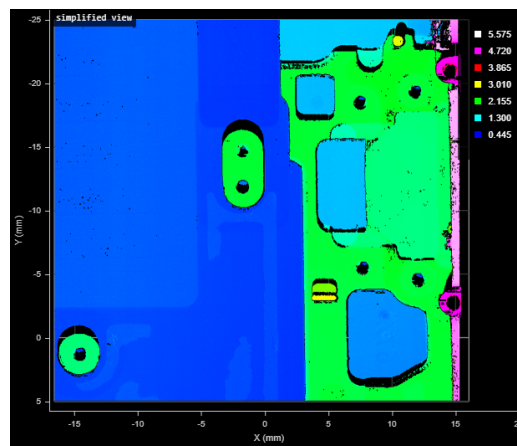

2D view

The screenshot shows a software interface with two tabs: 'Parameters' and 'Anchoring'. The 'Parameters' tab is selected and contains the following controls:

- Source:** A dropdown menu set to 'Top'.
- Surface Count:** A dropdown menu set to '3'.
- Enforce Frame Order:** A checked checkbox.
- Start Frame Index:** A text input field containing the number '1'.
- Surface Parameters 1, 2, and 3:** Three sections, each with a disabled (grayed out) checkbox.

Below the Parameters tab is the 'Data' tab, which contains a 'Combined Surface' checkbox that is checked.

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Data, and Settings

Measurements

Measurement

Captured

Indicates the number of scans successfully added to the combined surface scan.

Data

Type	Description
Stitched Surface	The stitched surface scan, available for use as input in the Stream drop-down in other tools.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Surface Count	The number of scans to combine into a single surface. For each, a "Surface Parameters" section is added. The tool accepts setting the number of scans to one: in this case it, behaves like a transform tool.
Enforce Frame Order	Restrict the stitching for specific frame indexes, starting at the frame indicated in Start Frame Index. If unchecked, an Operation drop-down is displayed (see below). This setting is disabled if you attempt to stitch data from individual scans acquired using the Snapshot button (that is, all frame indexes are at 1).

Parameter	Description
Operation	If Enforce Frame Order is disabled, the Operation drop-down is displayed. One of the following: • Normal: The tool automatically chooses this operation after you have chosen another operation. • Reset buffers: Resets the buffers used to stitch frames.
Surface Parameters {n}	For each scan to be added to the combined surface scan, a Surface Parameters checkbox is added. To configure the parameters of the individual surfaces, check the box and configure the settings. Unchecking the checkbox does not disable the scan or its settings. The following settings are available: • Data Source • X, Y, and Z Offset • X, Y, and Z Angle
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.

 A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.

 For more information on anchoring, see *Measurement Anchoring* on page 154.

Stud

The Stud tool measures the location and radius of a stud.






The Stud tool does not search for or detect a stud. The tool expects that a stud conforming reasonably well to the defined parameters is present and that it is on a sufficiently uniform background.


The tool uses a complex feature-locating algorithm to find a stud and then return measurements. See "Stud Algorithm" in the *Gocator Measurement Tool Technical Manual* for a detailed explanation of the algorithm. The behavior of the algorithm can be adjusted by changing the parameters in the measurement panel.

The location of the stud is defined at either the stud tip or the stud base. The tip is the intersection of the stud axis and the top of the stud; the base is the intersection of the stud axis and the surrounding plane.

The stud shape is defined by the tip height and base height. The base and tip heights specify where the shaft with the nominal radius begins and ends.

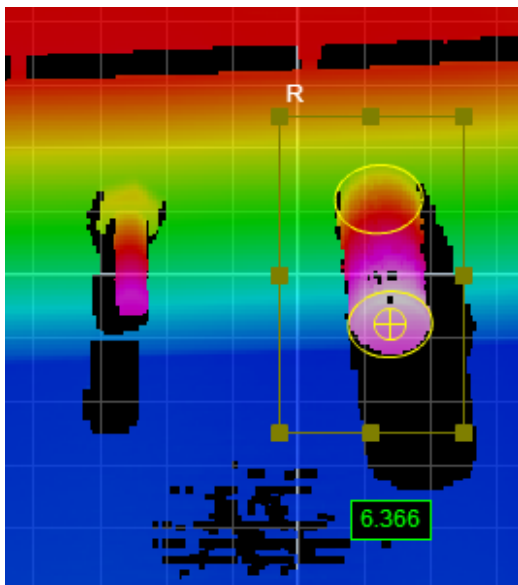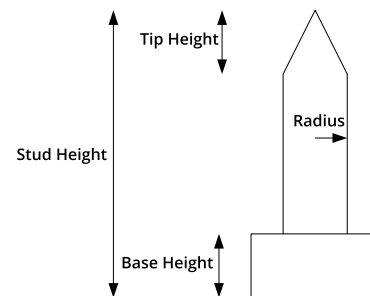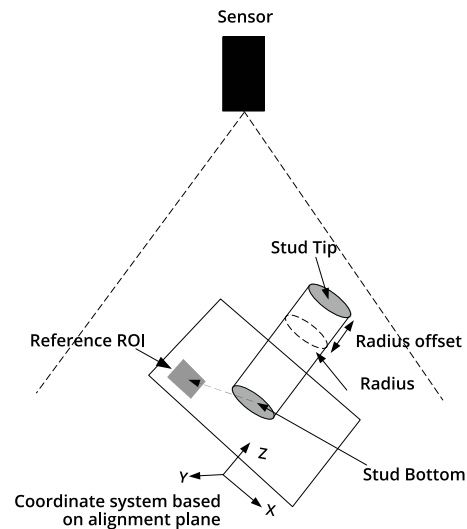

2D View

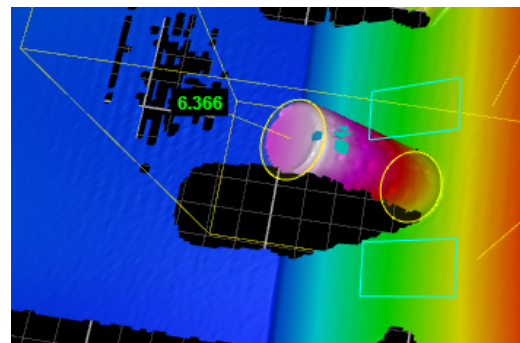

3D View

Parameters
Advanced
Anchoring

Source:
Top

Stud Radius:
5 mm

Stud Height:
20 mm

Base Height:
0 mm

Tip Height:
0 mm

☒ Region

Measurements
Features

Base X
☐

Base Y
☐

Base Z
☐

Tip X
☐

Tip Y
☐

Tip Z
☐

Radius
6.366
☒

ID:
8

Parameters
Output

Filters

Decision

Min:
6.25 mm

Max:
6.4 mm

Parameter
Advanced
Anchoring

☒ Reference Region
Auto Set

Tilt Correction
Auto Set

Base X
☐

Base Y
☐

Base Z
☐

Tip X
☐

Tip Y
☐

Tip Z
☐

Radius
6.366
☒

Id:
13

Parameters
Output

Radius Offset:
0 mm

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements, Features, and Settings

Measurements

Measurement	Illustration
Tip X Determines the X position of the stud tip.	
Tip Y Determines the Y position of the stud tip.	
Tip Z Determines the Z position of the stud tip.	
Base X Determines the X position of the stud base.	
Base Y Determines the Y position of the stud base.	
Base Z Determines the Z position of the stud base.	
Radius Determines the radius of the stud.	

Features

Type	Description
Tip Point	The center point of the tip of the stud.
Base Point	The center point of the base of the stud.

 For more information on geometric features, see *Geometric Features* on page 149.

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Stud Radius	Expected radius of the stud.
Stud Height	Expected height/length of the stud.
Base Height	The height above the base surface that will be ignored when the (truncated) cone is fit to the stud data.
Tip Height	The height from the top of the surface that will be ignored when the (truncated) cone is fit to the stud data.

Parameter	Description
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Reference Regions	The tool uses the reference regions to calculate the base plane of the stud. Reference regions are relative to the base of the stud.
Tilt Correction	Tilt of the target with respect to the alignment plane. Autoset: The tool automatically detects the tilt. The measurement region to cover more areas on the surface plane than other planes. Custom: You must enter the X and Y angles manually in the X Angle and Y Angle parameters (see below).
X Angle	The X and Y angles you must specify when Tilt Correction is set to Custom. You can use the Surface Plane tool's X Angle and Y Angle measurements to get the angle of the surrounding surface, and then copy those measurement's values to the X Angle and Y Angle parameters of this tool. For more information, see Plane.
Y Angle	
Radius Offset	The distance from the tip of the stud from which the radius is measured.
<i>(Radius measurement only)</i>	
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.



A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Measurement Region


The tip and the side of the stud must be within the measurement region.

Track


The Track tool lets you perform quality control and inspection along a path you define on representative scan data. The Track tool is especially useful for inspecting materials such as glue / sealant beads. The tool returns width and height measurements of the material, as well as OK and NG ("no good") counts, which let you monitor material overflow and breaks. A major advantage of the tool is that it removes the need to configure individual tools for each location along the path. You can use point and line geometric features to anchor the tool (for more information on geometric features, see *Geometric Features* on page 149).



Gocator sensors have a limited amount of space for storing path files. For this reason, when working with large datasets, we recommend that you run the Track tool on a PC through the Gocator accelerator. For more information on the accelerator, see *Gocator Accelerator* on page 362.

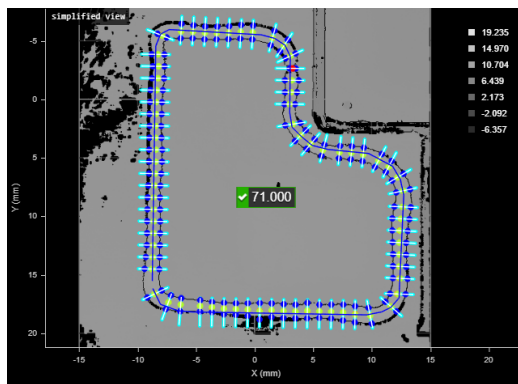

2D View

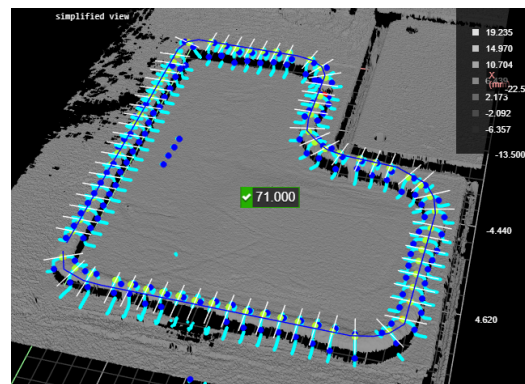

3D View

Parameters

Source:

Top

Point Feature

Disabled

Line Feature

Disabled

File

SurfaceTrack-0000.user

Operation

Normal

☐

Interpolation Along Rulers

☐

Height Filter

☐

Median Filter

Center Window Size

0.075 mm

Center Threshold

-0.05 mm

Side Detection Method

Maximum Gradient

Side Window Size

0.075 mm

Max Track Width

0.6 mm

☐

Show Path and Rulers

☐

Show Measurement Results

Nominal Width

1 mm

Width Tolerance

0.1 mm

Nominal Height

1 mm

Height Tolerance

0.1 mm

Offset Tolerance

0.1 mm

Measurements

Data

OK Count

0.000

☒

NG Count

☐

Width Min

☐

Width Max

☐

Width Avg

☐

Height Min

☐

Height Max

☐

Height Avg

☐

ID:

3

Output

Filters

Decision

Min:


0 mm

Max:

0 mm

Measurement Panel

You define the path along which the tool performs its internal measurements using a separate, PC-based utility (the "track editor"). The following shows the relationship between the Track tool and the track editor.

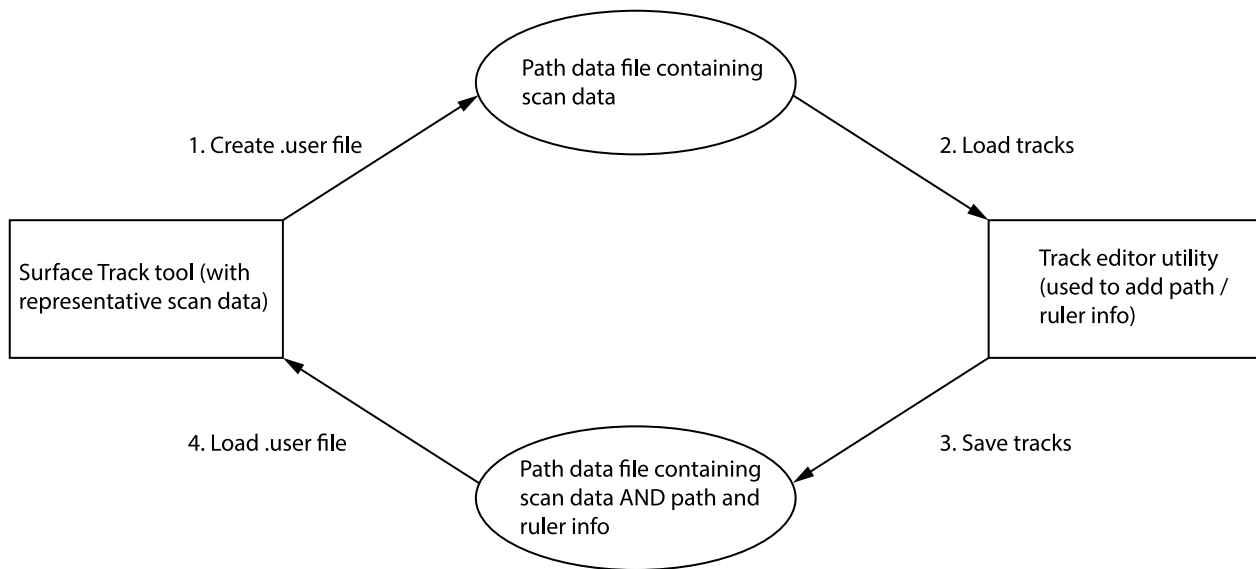

For more information on the track editor, see *Using the Track Editor* on page 305



All instances of the Track tool share the same path file set in **File** (ending in .user). For this reason, you must be careful when editing or removing path files shared by another instance of the tool.

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Key Concepts

The following are important concepts for using both the track editor (see *Using the Track Editor* on page 305) and the Track tool itself:

Track: The material being measured, for example glue or sealant. The material can sit on a flat area on the target, or sit in a groove where the material touches one or both sides.


Path: The ideal centerline of the track. You define the path in the track editor. You can define more than one path for use on scanned targets, but the Track tool returns the combined results for all paths. For more information on the track editor, see *Using the Track Editor* on page 305.

Ruler: A ruler is one of the areas perpendicular to the path you define. You define the size and spacing of the rulers in the track editor. The Track tool extracts a profile from the surface data beneath a ruler and performs internal measurements based on the values you choose in the Track tool's parameters.

Ruler profiles: The profiles extracted from the surface data under a ruler. The tool's internal measurements, which are configured using the tool's settings, are applied to these profiles.

Segment: One portion of the path, between points created by clicking on an image of scan data in the track editor. You can choose to configure rulers in segments independently, or choose to configure them in a batch mode.


The following shows a track with rulers and measurement results:

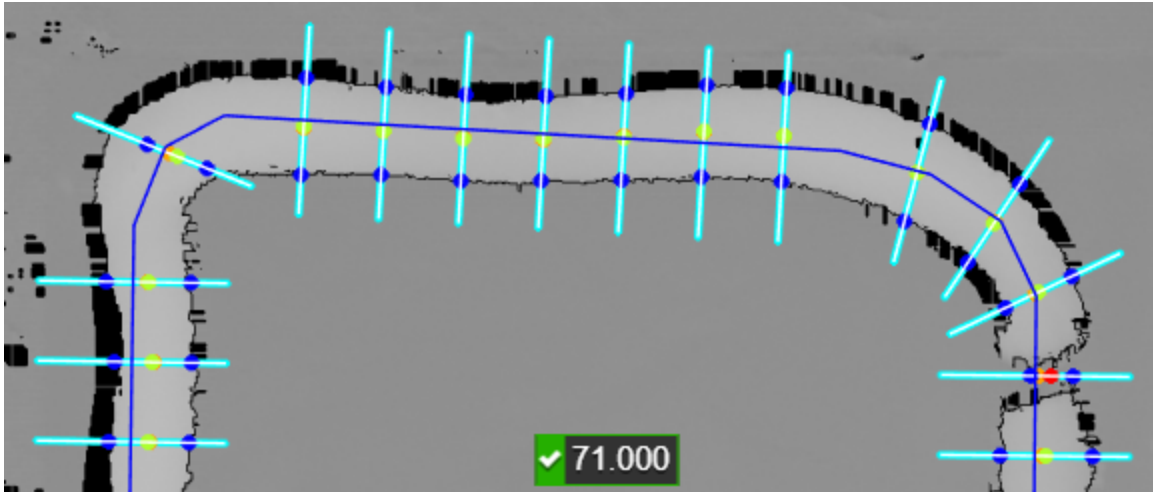


Track tool in data viewer, showing a track (lighter grey), path (dark blue line), rulers running perpendicular to the track (white lines centered on light blue dots). Dots of other colors provide additional information (see below).

When you enable **Show Measurement Results**, the Track tool displays dots on the rulers to provide the following information (see also the images below):

- Light blue dots: The data points in the ruler profile. When you enable **Show Path and Rulers**, the tool displays a white line centered on these dots to indicate the location of the ruler.
- Dark blue dots: The detected sides of the track. These represent the width of the track under that ruler.
- Green dots: Center points on rulers that pass the criteria set in the tool. These count toward the "OK Count" measurement.
- Red dots: Center points on rulers that fail at least one of the criteria set in the tool. These count toward the "NG Count" measurement.
- Orange dots: The peak (highest) point on the ruler. If the center point (green or red) is the same as the peak point, the tool only shows the center point.

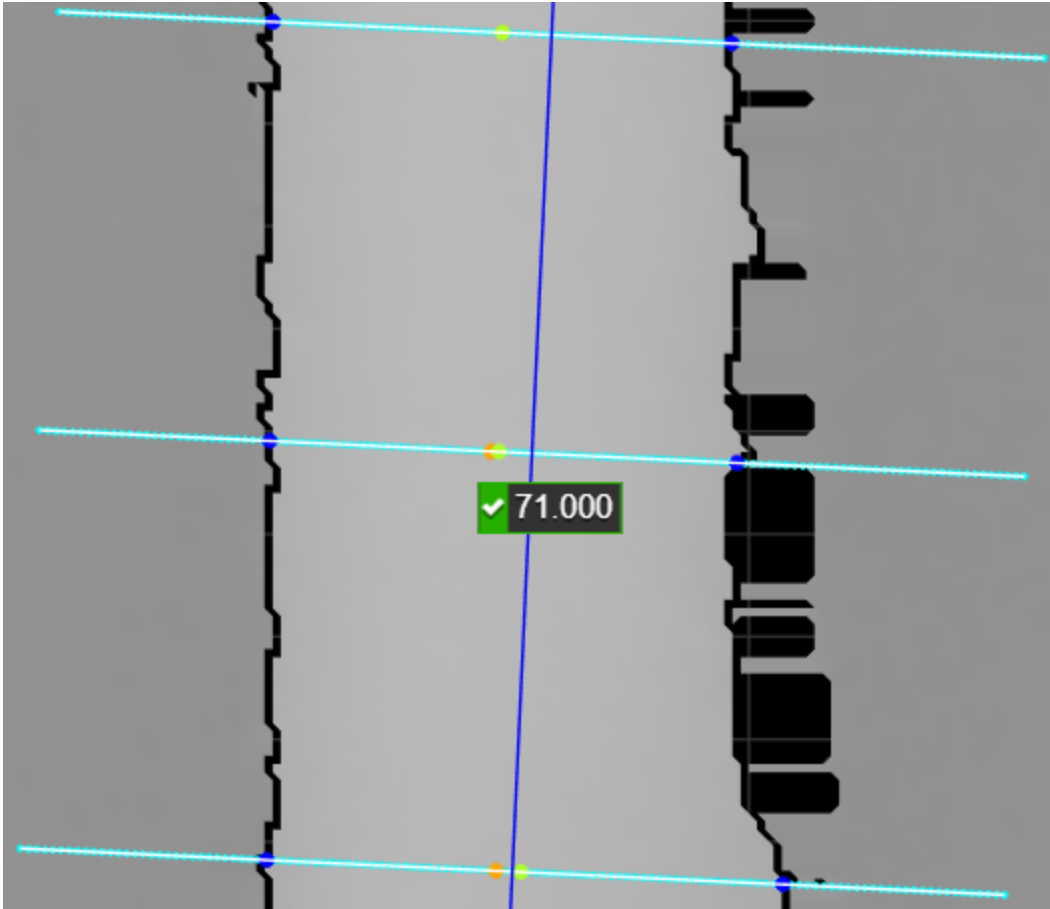

Three "OK" rulers, indicated by green center points. In the bottom two, the peak point (orange) is slightly to the left of the center point (green).

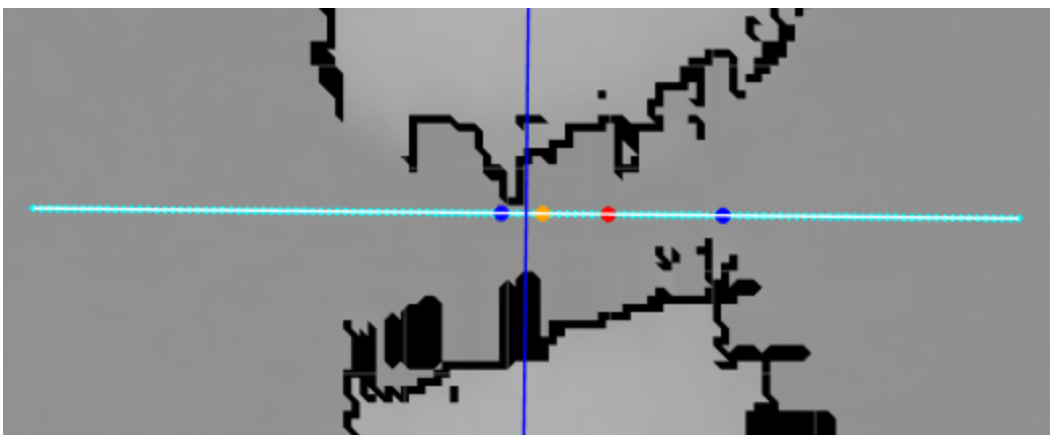


A "NG" ruler, indicated by the red center point.

Track Location

The tool attempts to locate the track using the profile data it extracts under each ruler, and does this by first locating the "peak" (the highest point on the ruler profile, based on certain criteria) and then locating the side points representing the "sides" of the track.

Peak Detection

The tool determines the peak point on a ruler profile by moving two windows—one to each side of the point being examined—and comparing the average height in those windows with the height of the point being examined. (The size of these windows is specified in **Center Window Size**.) If the height of the point being examined is greater than both the left and right average height by the value specified in **Center Threshold**, that point is considered a candidate peak point. The tool uses the candidate point with the *highest* average height over both windows as the peak point.

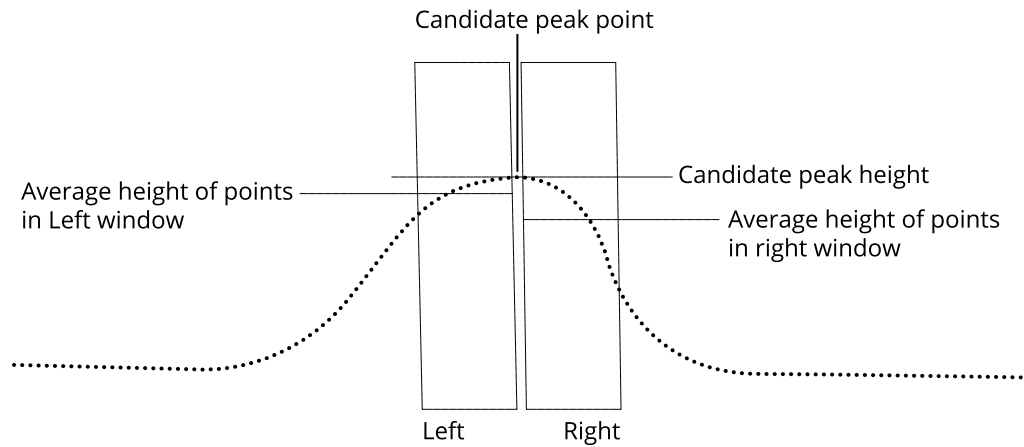

Side Detection

After the tool has located the peak point, it locates the sides of the track starting from the peak point. You can choose between two methods for side detection: Maximum Gradient and Height Threshold.

Maximum Gradient:

Use this side detection method when the slope of the two sides show a clear drop-off. The following settings define the area in which the tool searches for a maximum gradient, which will determine the edge of the track.

Maximum Gradient Side Detection Parameters

Side Window Size	The size of the two adjacent windows the tool uses to determine the maximum slope on the left and right side of the track. Set this to roughly 3 to 5 times the smaller of the X and Y resolution of the sensor.
Max Track Width	The maximum width of the track over the ruler profile the tool searches for edge points. The tool uses this value to limit where the edge of the track might be detected. Set this to slightly larger than Side Window Size .

Height Threshold:

Use this side detection method when the slope of two sides is very gradual. The tool finds the left and right edges by averaging the height of small fixed-size windows moving away from the peak point. Edge points are the left-most and right-most window locations where the average height is *below* a minimum height threshold.

Height Threshold Side Detection Parameters

Side Height Threshold	The minimum height that the average calculated in the fixed-width height threshold windows must be below.
-----------------------	---

Center Point Detection

The Track tool calculates the center point as the mid point between the left and right side points. This means that the center point may be different from the peak point.

Configuring the Track Tool

To configure the tool, you must first acquire scan data of a representative target; preferably, the material on the target will fall within the expected tolerances. Next, you save the scan data from within the Track tool, and then load the scan data into the track editor. Then, after adding a path or paths, and configuring rulers to the data, you load the track data back into the Track tool. Finally, you configure the tool. For more information on key concepts you need to understand to configure the Track tool, see *Key Concepts* on page 295.

To configure the Track tool:

1. Scan a representative target, or load previously scanned data.

For more information on loading previously scanned data, see *Recording, Playback, and Measurement Simulation* on page 61.


2. Add a Surface Track tool.

Gocator adds a Surface Track tool and creates a "C:\LMI\SurfaceTrack" folder if it doesn't exist.

For more information on adding a tool, see *Adding and Configuring a Measurement Tool* on page 142.

3. In the Surface Track tool, choose **Create** from the **Operation** drop-down.


The tool creates a file (for example, SurfaceTrack-0000.user) containing scan data in "C:\LMI\SurfaceTrack". You will use the track editor to add path data to this file.

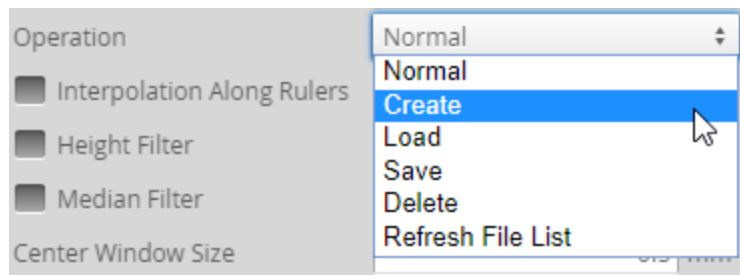

4. Launch the track editor and configure the path or paths.

For information on using the track editor, see *Using the Track Editor* on page 305.

5. After you have finished editing the track data in the track editor, in the Surface Track tool, choose **Load** in the **Operation** drop-down to load the path data you just created.




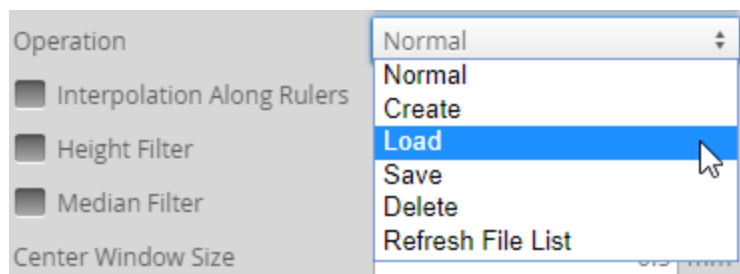


6. Configure the Track tool as required.

For information on the tool's measurements and settings, see the below.

Measurements, Data, and Settings

Measurements

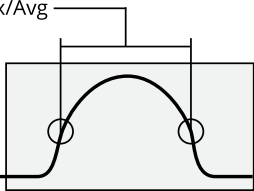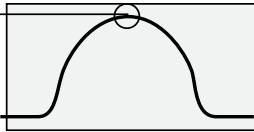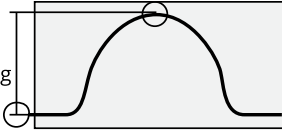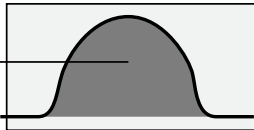Measurement	Illustration
OK Count Returns the number of rulers along the path that pass all of the criteria set in the tool's parameters.	
NG Count Returns the number of rulers along the track path that fail the criteria set in the tool's parameters. (They are "no good.")	
Width Min Width Max Width Avg These measurements return the minimum, maximum, and average width of the track.	 <i>Width measurements on a ruler profile. The Track tool's settings determine the locations of the "sides" of the track.</i>
Height Min Height Max Height Avg These measurements return the minimum, maximum, and average height of the track at the center point. When Height Mode is set to Absolute Height , the height returned is the global height. When it is set to Step Height , the height is relative to the surface next to the track.	 <i>Height measurements on a ruler profile with Height Mode set to Absolute Height.</i>  <i>Height measurements on a ruler profile with Height Mode set to Step Height.</i>
Area Min Area Max Area Avg These measurements return the minimum, maximum, and average area under the rulers.	 <i>Area measurements under a ruler profile.</i>



Data

Type	Description
Output Measurement	Data containing the results from each ruler, namely: • track ID • segment ID • track width • track height • track offset • X position of the center point • Y position of the center point A sample included in the SDK package shows how you can use this output data in an application.


Main Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Point Feature Line Feature	Point and line geometric features (produced by another tool) that you can select as anchors for translation and rotation transformations, respectively. Currently, you must select both in order for anchoring to work. For more information on geometric features, see <i>Geometric Features</i> on page 149.
File	The CSV file that contains scan and path data. You add path data to the file using the track editor. For more information on the track editor, see <i>Using the Track Editor</i> on page 305.
Operation	Provides operations related to the CSV scan / path data file. One of the following: • Normal: Selected by the tool after you perform another file operation. • Create: Creates a new CSV file for use with the track editor. • Load: Loads the path file selected in File. • Save: Saves changes made in the scan data, as well as the geometric features used as anchors in the Point Feature and Line Feature settings, to the file selected in File. • Delete: Deletes the path file selected in File. • Refresh File List: Refreshes the list of files.
Interpolation	Enables linear interpolation on the profile extracted from the rulers to achieve sub-pixel accuracy in the width and height measurements.
Height Filter Threshold High Threshold Low	When Height Filter is enabled, use the Threshold Low and Threshold High settings to set a range to filter out noise or exclude other undesired data along the ruler profiles.
Median Filter Window Size	When Median Filter is enabled, specify the window the tool will use to smooth the height values of the points in the ruler profiles in the Window Size setting.

Parameter	Description
Center Window Size	The size of the left and right windows the tool moves along the ruler profile to detect whether the point centered between the two is the highest point along a ruler (the center point). Set this to roughly 50% of the typical width of the track as a starting point.
Center Threshold	The center point is determined by moving two side-by-side windows (left and right, Center Window Size setting) over each ruler profile. At each point, the height value between the two windows is compared to the average height of the left and right windows. If the center point height is greater, by the amount set in Center Threshold, than the average height in both the left and right windows, that point is considered a candidate center point. The candidate center point with the highest average height over both windows is used as the center point. It may be necessary to use a negative number in some cases. It may be necessary to use a negative value under some circumstances. For example, when the top point slightly dips below its surroundings.
Side Detection Method	The method the tool uses to detect the two sides of the track. One of the following: Maximum Gradient or Height Threshold. For more information on side detection method settings, see <i>Track</i> on page 293.
Height Mode	Determines how height values are interpreted in the tool's Nominal Height setting and what the returned height measurements represent. One of the following: Absolute Height - Height values are interpreted globally (the entire scan data). Step Height - Height values are relative to the surrounding area of the track.
Show Path and Rulers	Displays the path and rulers (as defined in the track editor) on the scan data.
Show Measurement Result	Shows dots on each ruler representing the results of the internal measurements on the profile extracted from the surface data under the ruler. For more information, see <i>Key Concepts</i> on page 295.
Nominal Width	The expected width of the track.

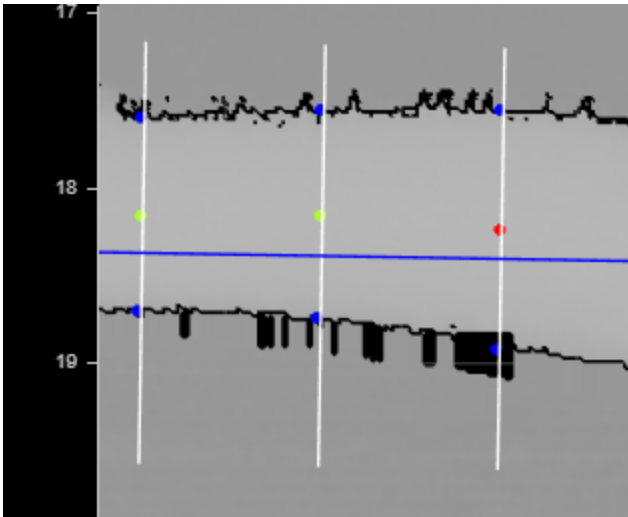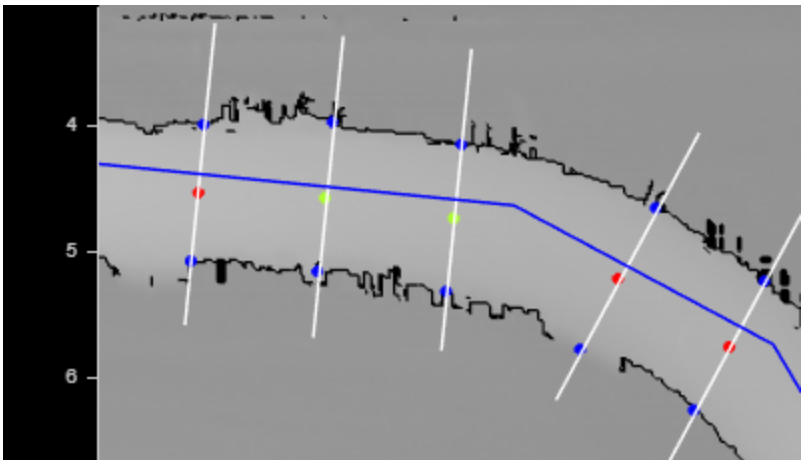Parameter	Description
Width Tolerance	The tolerance applied to the nominal width. In the following, the distance between the blue dots indicating the width of the track under the ruler to the right (white vertical line) is greater than the width tolerance; this is indicated by the red center point dot, and counts as a NG measurement. The widths of the track under the two rulers to the left are within tolerance; this is indicated by green center points, and count as OK measurements. The track is lighter grey than the surrounding surface. 
Nominal Height	The expected height of the track. The expected height is the absolute height in the scan data, not relative to the surrounding area. This setting applies to the peak point, not the center point.
Height Tolerance	The tolerance applied to the nominal height. This setting applies to the peak point, not the center point. In the following, the red center points indicate that the height at that point is outside of the height tolerance. Green points indicate heights within tolerance. The track is lighter grey than the surrounding surface. 

Parameter	Description
Nominal Area	The expected cross-sectional area under the rulers on the track.
Area Tolerance	The tolerance applied to the nominal area.
Offset Tolerance	The maximum allowed distance between the center (highest) point on a ruler and the path. This setting applies to the center point. In the following, the top and bottom center points (green) are at an acceptable distance from the blue path. The red center points fail because they are too far from the path. The track is lighter grey than the surrounding surface.

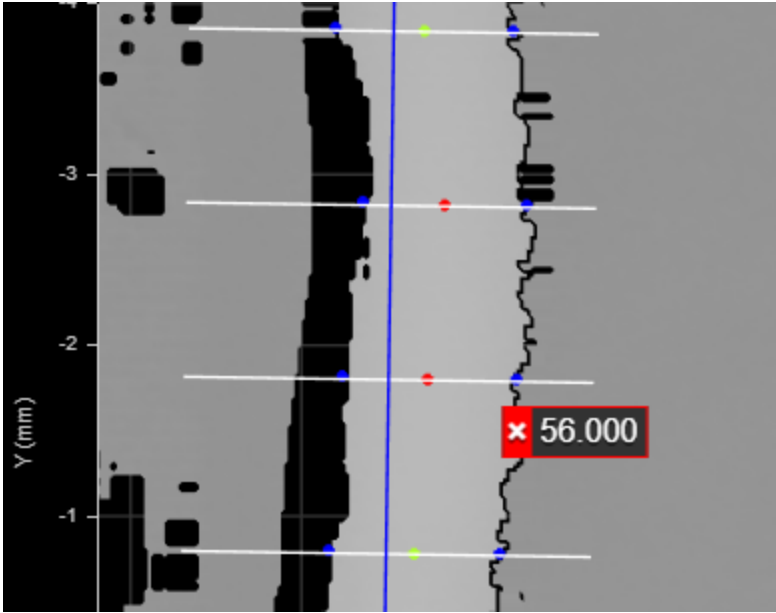

Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.


Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.

- A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.
- For more information on anchoring, see *Measurement Anchoring* on page 154.


Using the Track Editor

You use the track editor to configure "path" and "ruler" information on a frame of scan data from a sensor. The Track tool uses this information to inspect targets along the defined path.

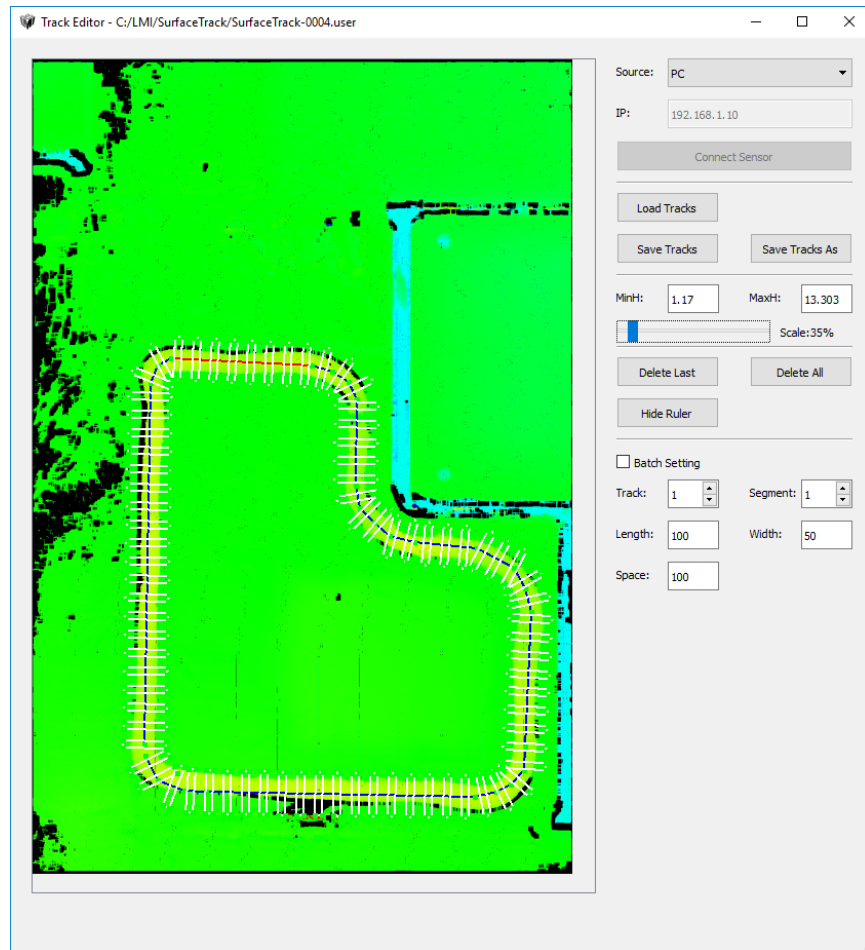

The track editor

In the track editor, you can define one or more paths, and configure rulers along these paths.

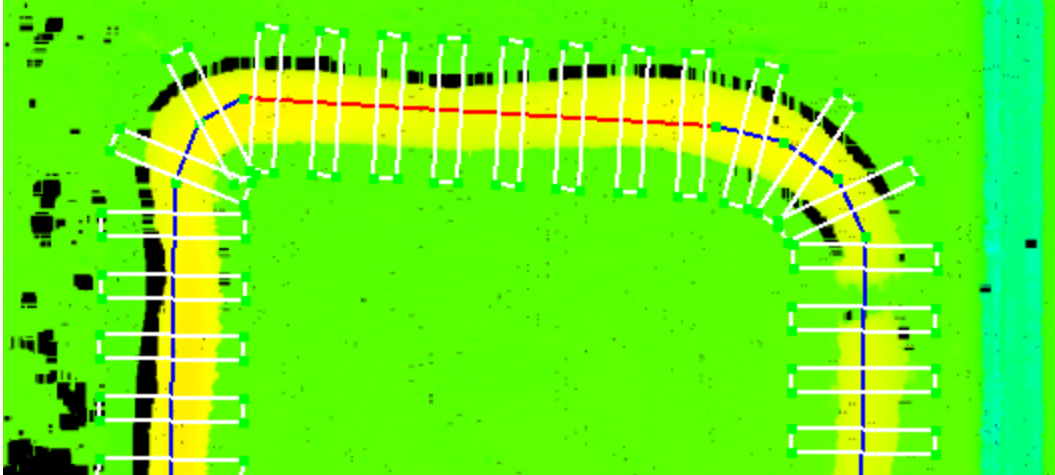


Closeup of the track editor window, showing a track of material on a surface (yellow on green), a path (blue segments; red segment for the currently selected segment), path points (green dots), and rulers (white rectangles).

The following assumes that you have already scanned a representative target and created a CSV file from within the Track tool. For more information, see the first steps of *To configure the Track tool*: on page 299.

Loading and working with scan/track data:

1. In the track editor, in the Source drop-down, choose one of the following:
 - **PC:** Choose this option if you are using the Track tool through the accelerator. The track editor will retrieve the path data file from local (PC) storage and save changes there. (Choose the same if you are using the emulator).
 - **Sensor:** Choose this option if you are not using the accelerator. The track editor will retrieve the path data file from the sensor at the IP address specified in the **IP** field. Because sensors have a limited amount of space to store path data, only use this option for simple paths.
2. Click **Load Tracks**, navigate to "C:\LMI\SurfaceTrack" (if you have chosen PC as the source), and choose the .user file you created using the Surface Track tool.

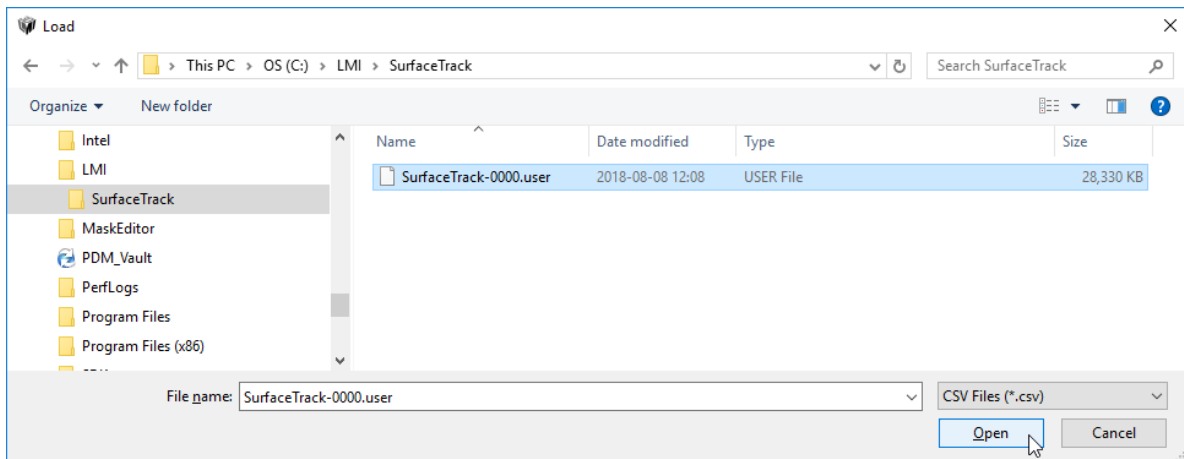

The track editor loads the data. If paths have been previously defined, they are also loaded.

3. Do one or more of the following:


- Move the slider to the left or right to zoom in or out in the editor's viewer.
- Move the data in the track editor's window using the scrollbars or the mouse wheel.
- Set MinH and MaxH and then reload the track data to assign a narrower height range to the height map colors. This may help make the track clearer in the editor.

After you have loaded the data, you must add a path and configure its rulers.

To add a path:

1. In the track editor, click on the middle of the track somewhere in the scan data, move the mouse pointer to another location and click again.


A red segment between the first two green path points appears in the editor window.

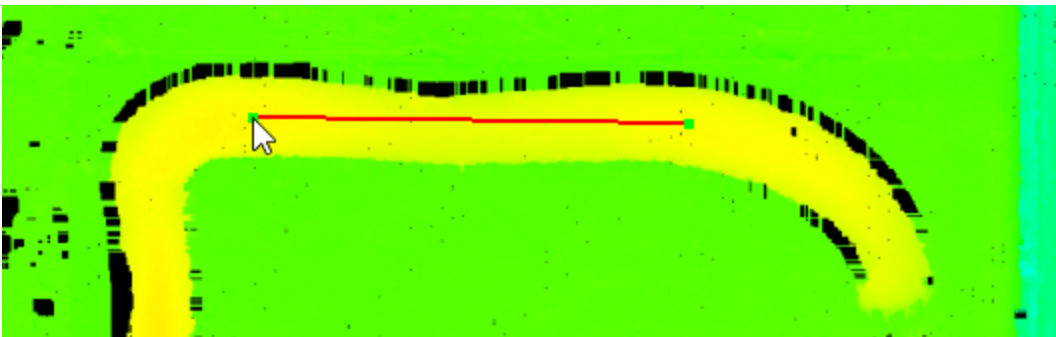

You can move path points using the mouse at any time to adjust the path. You can also delete the last point by clicking **Delete Last**. To delete all path points, click **Delete All**.

2. Continue clicking along the track to add more path points, building up the path.

When adding points on corners, add more points to follow the track more precisely.

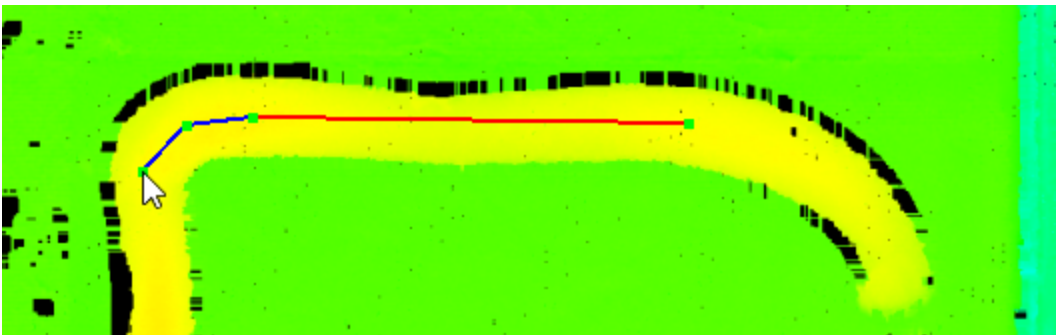


3. Continue clicking until you complete the path along the track.

You cannot close the path: simply click close to the starting path point when you have finished.


4. Click **Save Tracks** to save the path information to the data.
5. (Optional) You can add other paths if necessary by clicking somewhere in the scan data *after* you have saved the track data.

After you have finished adding a path, you must configure the rulers on the path (the dimensions and the spacing of the rulers). You can choose to apply dimensions/spacing to *all* rulers in all segments at the

same time by checking **Batch Setting**. The settings also apply to all paths if you have defined more than one path.

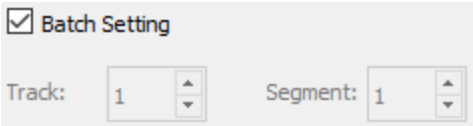

Otherwise, you must move through the individual path segments by clicking the spinner control in the **Segment** field and set the ruler dimensions for each segment. If you have defined multiple paths, you will have to click through the paths too, using the **Track** spinner.

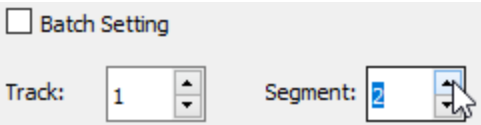

The following table lists the ruler settings available in the track editor:

Track editor: ruler settings


Setting	Description
Length	The dimension of the ruler perpendicular to the path. Be sure to use a value large enough to cover the track from one side to another and to include enough surface on each side of the track (the surface to which the material is applied) for the Track tool to properly detect the track.
Width	The dimension of the ruler along the path.
Space	The space between rulers on the path. Because you will typically place path points closer together around corners, you may need to use smaller spacing around corners.

Vibration Correction


The Vibration Correction tool analyzes variation in surface data to remove high frequency noise in the data. The tool is useful for improving repeatability and accuracy of measurements when subtle vibrations in your transport system introduce height variations. The tool's intended use is to send corrected surface data to other tools.




The Vibration Correction tool requires at least 64 lines of data in the surface data it receives as input to be able to output corrected surface data.

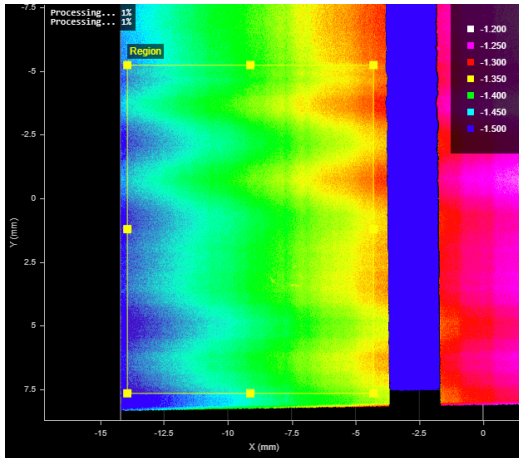

Uncorrected surface data

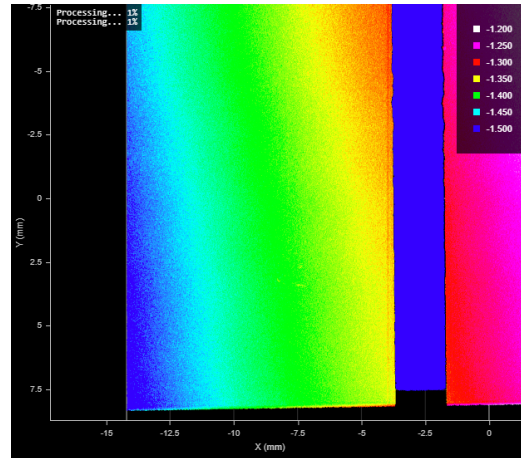

Corrected surface data: a better representation of the actual target

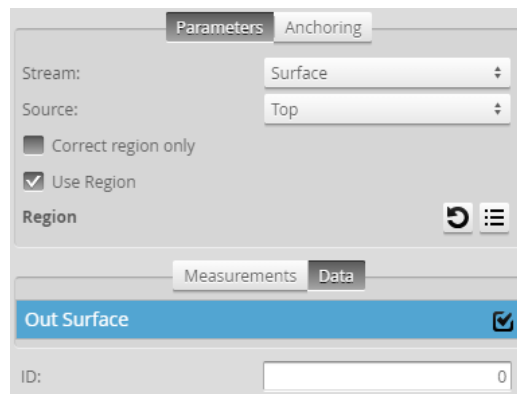

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Data and Settings

Data

Type	Description
Corrected Surface	Surface data corrected for vibration, available for use as input in the Stream drop-down in other tools.
Difference Surface	Diagnostic Surface data showing the difference between the corrected surface and the original. Available for use as input in the Stream drop-down in other tools

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Correct region only	If enabled, only the area under the region is corrected for vibration in the output surface data. This setting can be useful if vibration regularly occurs in a specific area of the scan data. This option is only displayed if Use Region is enabled.
Use Region	When enabled, lets you set a region and optionally choose to apply vibration correction only to that region (using Correct region only).
Region	The region whose data the tool will use to calculate the vibration correction.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.




For more information on anchoring, see *Measurement Anchoring* on page 154.

Volume


The Volume tool determines the volume, area, and thickness of a part.

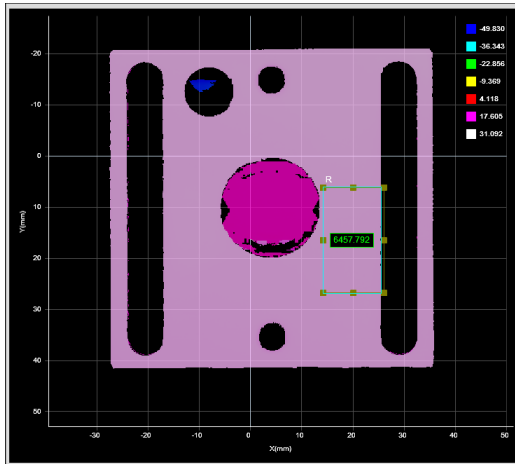

2D View

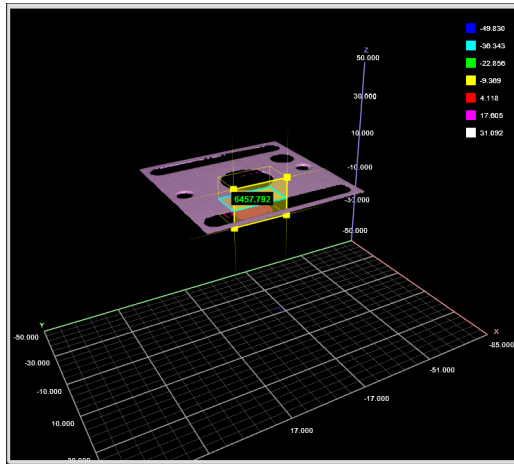




3D View

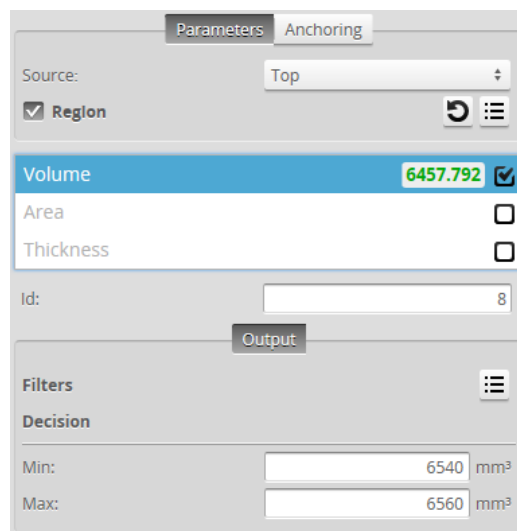A screenshot of the Measurement Panel for the Volume tool. The panel has two tabs: Parameters and Anchoring. Under Parameters, the Source is set to Top. The Region checkbox is checked. The Volume measurement is selected, showing a value of 6457.792. The Area and Thickness measurements are not selected. The Id field is set to 8. The Output button is visible. Under Filters, the Decision section shows Min: 6540 mm³ and Max: 6560 mm³.

Measurement Panel

For information on adding, managing, and removing tools and measurements, as well as detailed descriptions of settings common to most tools, see *Tools Panel* on page 142.

Measurements

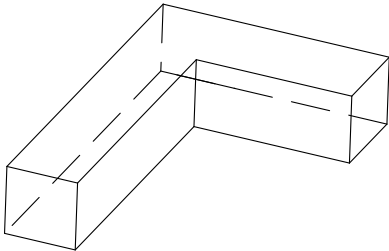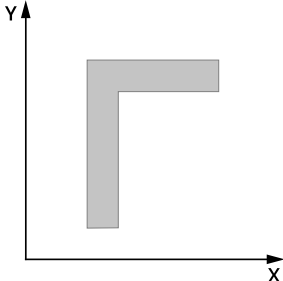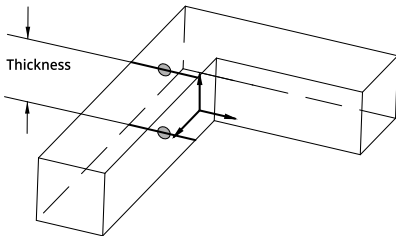Measurement	Illustration
Volume Measures volume in XYZ space.	
Area Measures area in the XY plane.	
Thickness Measures thickness (height) of a part.	

Parameters

Parameter	Description
Source	The sensor that provides data for the tool's measurements. For more information, see <i>Source</i> on page 145.
Region	The region to which the tool's measurements will apply. For more information, see <i>Regions</i> on page 145.
Location (<i>Thickness measurement only</i>)	One of the following: • Max • Min • Average • Median • 2D Centroid (height of the centroid in the XY plane) • 3D Centroid (height of the centroid in the XYZ space).
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Anchoring

Anchor	Description
X, Y, or Z	Lets you choose the X, Y, or Z measurement of another tool to use as a positional anchor for this tool.
Z angle	Lets you choose the Z Angle measurement of another tool to use as an angle anchor for this tool.




A measurement *must* be enabled in the other tool for it to be available as an anchor. The anchor measurement should also be properly configured before using it as an anchor.



For more information on anchoring, see *Measurement Anchoring* on page 154.

Script

A Script measurement can be used to program a custom measurement using a simplified C-based syntax. A script measurement can produce multiple measurement values and decisions for the output.

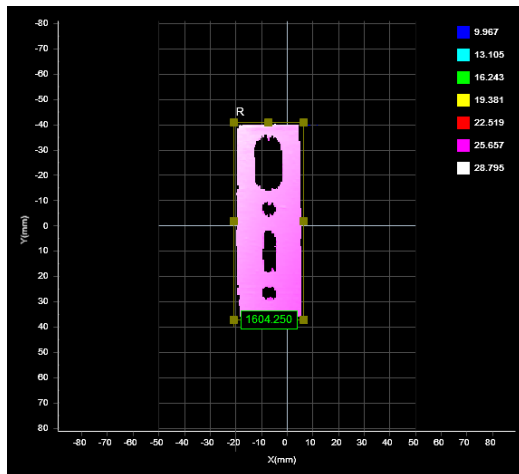

```
Code
1 double VolumeArea = Measurement_Value(4);
2
3 if (Measurement_Valid(4))
4 {
5     Output_Set(VolumeArea + 10000, 1);
6 }
7 else
8 {
9     Output_SetAt(0, 0);
10 }
```

*Press save button or 'Ctrl+S' to apply change.
Press 'Esc' to exit full screen.

Output: Add

Output 0 1604.250

Id: 0

See *Scripts* on page 324 for more information on the script syntax.

To create or edit a Script measurement:

1. Add a new Script tool or select an existing Script measurement.
2. Edit the script code.
3. Add script outputs using the **Add** button.
For each script output that is added, an index will be added to the **Output** drop-down and a unique ID will be generated.
To remove a script output, click on the ✖ button next to it.
4. Click the **Save** button  to save the script code.
If there is a mistake in the script syntax, the result will be shown as a "Invalid" with a red border in the data viewer when you run the sensor.
Outputs from multiple measurement tools can be used as inputs to the script. A typical script would take results from other measurement tools using the value and decision function, and output the result using the output function. Stamp information, such as time and encoder stamps, are available in the script, whereas the actual 3D point cloud data is not. (The script engine is not powerful enough to process the data itself.) Only one script can be created.

Feature Measurement

The following sections describe Gocator's Feature tools.

Feature tools produce measurements based on more complex geometry, letting you implement applications more quickly by reducing dependence on writing scripts to accomplish these kinds of measurements. Feature tools take [geometric features](#) generated by other tools as input and perform measurements on those features.

Feature tools are available in either Profile or Surface mode.



The Circle geometric feature currently cannot be used by any of the built-in Feature tools.

Dimension


The Feature Dimension tool provides dimensional measurements from a point [geometric feature](#) to a reference point, line, or plane geometric feature.

Some examples:


- Measuring the distance between the center of a hole and an edge.
- Measuring the distance between the centers of two holes.
- Measuring the distance between a point and a plane.
- Obtaining the length of a stud by measuring the distance between its tip and base.

Gocator compares the measurement value with the values in **Min** and **Max** to yield a decision. For more information on decisions, see *Decisions* on page 151.

See *Adding and Configuring a Measurement Tool* on page 142 for instructions on how to add measurement tools.

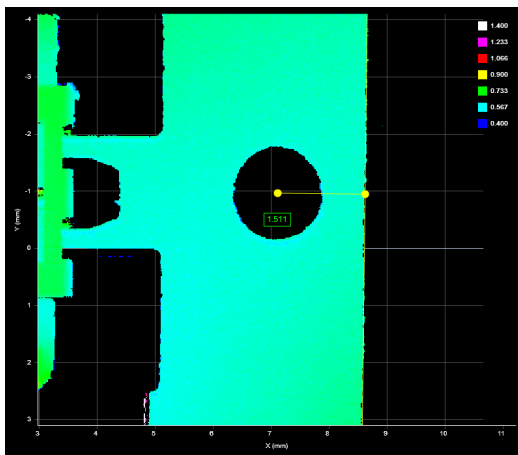

2D View

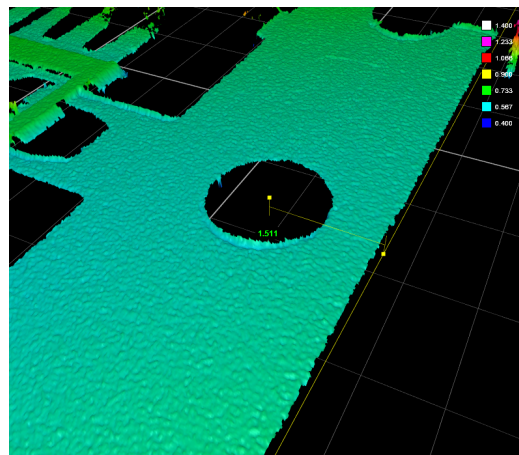

3D View

Parameters

Point Surface Hole/Center Point ▾

Reference Feature Surface Edge/Edge Line ▾

Width ☐

Length ☐

Height ☐

Distance ☐

Plane Distance 1.511 ☒

ID:

Parameters
Output

Filters ⋮

Decision

Min: mm




Max: mm

Measurement Panel

□
 In the following measurement descriptions, the first geometric feature is set in the **Point** drop-down. The second geometric feature is set in the **Reference Feature** drop-down.

Measurements

Measurement	Illustration
Width <i>Point-point:</i> The difference on the X axis between the points. <i>Point-line:</i> The difference on the X axis between the point and a point on the line. For profiles, the point on the line is at the same Z position as the first point. For surface data, the point on the line is at the same Y position. <i>Point-plane:</i> The difference on the X axis between a point and a point on the plane with the same Y and Z coordinates as the first point (or the intersection of the plane and a line from the first point, parallel to the X axis).	
Length <i>Point-point:</i> The difference on the Y axis between the points. <i>Point-line:</i> The difference on the Y axis between the point and, for profiles, the nearest point on the line; currently, always zero. For surface data, the point on the line is at the same X position as the first point. <i>Point-plane:</i> The difference on the Y axis between the point and a point on the plane with the same X and Z coordinates as the first point (or the intersection of the plane and a line from the first point, parallel to the Y axis).	

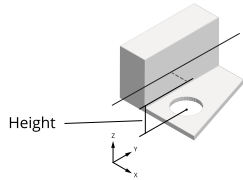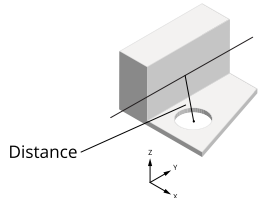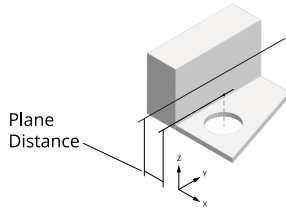Measurement	Illustration
Height <i>Point-point:</i> The difference on the Z axis between the points. <i>Point-line:</i> The difference on the Z axis between the point and, for profiles, a point on the line at the same X position as the first point. For surface data, the point on the line is the one nearest to the first point. <i>Point-plane:</i> The difference on the Z axis between the point and a point on the plane with the same X and Y coordinates as the first point (or the intersection of the plane and a line from the first point, parallel to the Z axis).	
Distance <i>Point-point:</i> The direct, Euclidean distance between two point geometric features. <i>Point-line:</i> The direct, Euclidean distance between a point and the nearest point on the line. <i>Point-plane:</i> The direct, Euclidean distance between a point and the nearest point on the plane.	
Plane Distance <i>Point-point:</i> The distance between two point geometric features. For profile data, the points are projected onto the XZ plane (always the same as the Distance measurement). For surface data, the points are projected onto the XY plane. <i>Point-line:</i> The distance between a point and a line. For profile data, projected onto the XZ plane (always the same as the Distance measurement). For surface data, the distance is projected onto the XY plane. <i>Point-plane:</i> The distance between a point and a plane. For profiles, the distance is projected onto the XZ plane (always the same as the Distance measurement). For surface data, the distance is projected onto the XY plane.	
Parameter	Description
Stream	The data that the tool will apply measurements to. In Surface mode, this setting is only displayed when a section is defined on the surface data. If you switch from one type of data to another (for example, from section profile data to surface data), currently set input features will become invalid, and you will need to choose features of the correct data type.

Parameter	Description
Point	A point geometric feature generated by another tool.
Reference Feature	A point or line geometric feature generated by another tool. Dimensional measurements are calculated <i>from</i> the reference feature <i>to</i> the point in the Point setting.
Filters	The filters that are applied to measurement values before they are output. For more information, see <i>Filters</i> on page 152.
Decision	The Max and Min settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see <i>Decisions</i> on page 151.

Intersect

The Feature Intersect tool returns the intersection of a line [geometric features](#) and a reference line or plane geometric feature. For line-line intersections, the lines are projected onto the $Z = \text{reference } Z$ line plane for features extracted from a surface, and the intersection of the lines projected onto the $Y = 0$ plane for features extracted from a profile. The angle measurement between the two lines is also returned. The lines the tool takes as input are generated by other tools, such as [Surface Edge](#) or [Surface Ellipse](#).

The Feature Intersect tool saves you from having to write complicated calculations in [script tools](#) to find intersect point between lines. Previously, calculating the intercept point of two lines was difficult and prone to bugs, involving finding lines in indirect ways.

The Feature Intersect tool's positional measurements are particularly useful as anchor sources. For example, you can easily find a corner point on a part from two edges (produced by two Surface Edge tools) and using the X and Y positions as anchor sources.

When you use these positional anchors in combination with a Z Angle anchor from tools such as Surface Edge, you can achieve extremely robust, repeatable measurements.




This tool's Angle measurement cannot be used as an angle anchor source. Only Z Angle measurements can be used as angle anchor sources.

For more information on anchoring, see *Measurement Anchoring* on page 154.

The Feature Intersect tool can also generate a point [geometric feature](#) representing the point of intersection of the lines that the [Feature Dimension](#) tool can use in measurements.

Gocator compares the measurement value with the values in **Min** and **Max** to yield a decision. For more information on decisions, see *Decisions* on page 151.

See *Adding and Configuring a Measurement Tool* on page 142 for instructions on how to add measurement tools.

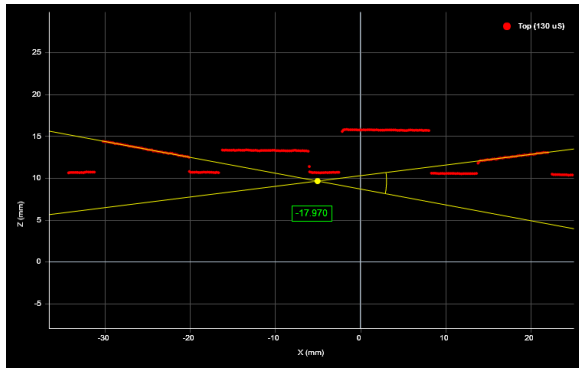

Parameters

Line: Profile Line - Left/Line

Reference Line: Profile Line - Right/Line

Measurements Features

X ☐

Y ☐

Z ☐

Angle -17.970 ☒

ID:


Parameters Output

Filters


Decision

Min: mm

Max: mm

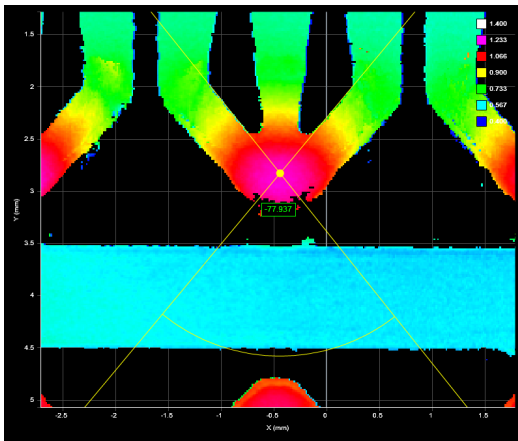

2D View

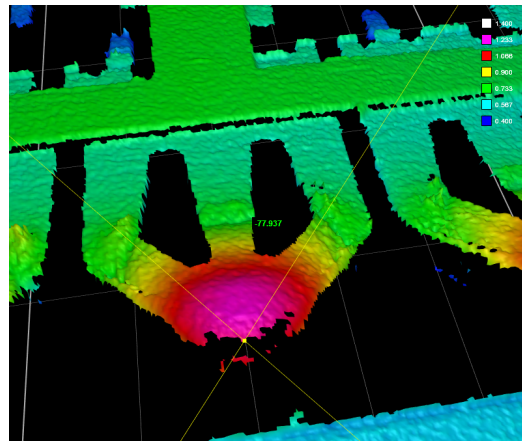

3D View

Parameters

LineSurface Edge Left/Edge Line

Reference FeatureSurface Edge Right/Edge Line

MeasurementsFeatures

X☐

Y☐

Z0.473☒

Angle-77.937☒

ID:

ParametersOutput

Filters

Decision

Min: mm

Max: mm

Measurement Panel

Measurements

Measurement

Illustration

X

Line-Line: The X position of the intersect point between the lines.

Line-Plane: The X position of the intersect point between the line and the plane.

Y


Line-Line: The Y position of the intersect point between the lines.

Line-Plane: The Y position of the intersect point between the line and the plane.

Z

Line-Line: The Z position of the intersect point between the lines.

Line-Plane: The Z position of the intersect point between the line and the plane.

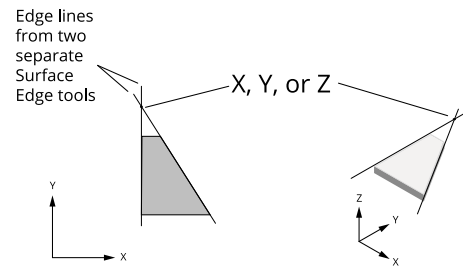

Measurement


Angle

Line-Line: The angle between the lines, as measured from the line selected in **Reference Feature** to the line selected in **Line**. Line-line angles can range over 360 degrees, expressed either as an angle from -180 to 180 or as an angle from 0 to 360 degrees.

Line-Plane: The angle between the line and the perpendicular projection of the line onto the plane, as measured from the plane geometric feature selected in **Reference Feature** to the line selected in **Line**. Line-plane angles are expressed as an angle from 90 to -90 degrees, which can be expressed as an absolute value.

In both cases, use the **Angle Range** setting to determine how angles are expressed.

Illustration

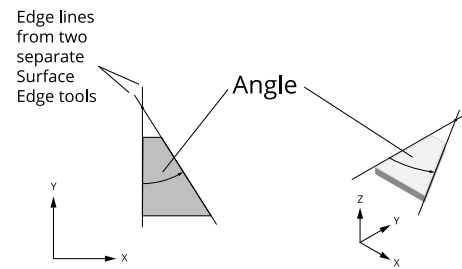

Features

Type

Intersect Point

Description

The intersect point of the two edge lines.

Parameters

Parameter

Stream

Description

The data that the tool will apply measurements to.

In Surface mode, this setting is only displayed when a section is defined on the surface data.

If you switch from one type of data to another (for example, from section profile data to surface data), currently set input features will become invalid, and you will need to choose features of the correct data type.

Line

A line [geometric feature](#) generated by another tool.

Reference Feature

A line or plane [geometric feature](#) generated by another tool. For the Angle measurement, the angle is measured *from* the reference feature.

Angle Range

Determines the angle range.

(Angle measurement only)

Filters

The filters that are applied to measurement values before they are output. For more information, see *Filters* on page 152.

Decision

The **Max** and **Min** settings define the range that determines whether the measurement tool sends a pass or fail decision to the output. For more information, see *Decisions* on page 151.

Scripts

Scripts use outputs from other measurement tools to produce custom measurements.

Similar to other measurement tools, a script measurement can output multiple measurement values and decisions. Scripts are added, configured, and removed much like other measurement tools; for more information on this, see *Script* under *Profile Measurement* on page 162 or *Surface Measurement* on page 212.

 Scripts must be less than 27,000 characters long.

Scripts use a simplified C-based syntax. The following elements of the C language are supported:

Supported Elements

Elements	Supported
Control Operators	if, while, do, for, switch and return.
Data Types	char, int, unsigned int, float, double, long long (64-bit integer).
Arithmetic and Logical Operator	Standard C arithmetic operators, except ternary operator (i.e., "condition? trueValue: falseValue"). Explicit casting (e.g., int a = (int) a_float) is not supported.
Function Declarations	Standard C function declarations with argument passed by values. Pointers are not supported.

Built-in Script Functions

The script engine provides the following types of functions:

- Measurement
- Output
- Memory
- Runtime variable
- Stamp
- Math

Measurement Functions

Function	Description
int Measurement_Exists(int id)	Determines if a measurement exists by ID. Parameters: id – Measurement ID Returns: 0 – measurement does not exist 1 – measurement exists
int Measurement_Valid(int id)	Determines if a measurement value is valid by its ID. Parameters: id - Measurement ID Returns

Function	Description
	0 - Measurement is invalid 1 - Measurement is valid
double Measurement_Value (int id)	Gets the value of a measurement by its ID. Parameters: id - Measurement ID Returns: Value of the measurement 0 – if measurement does not exist 1 – if measurement exists
int Measurement_Decision (int id)	Gets the decision of a measurement by its ID. Parameters: ID - Measurement ID Returns: Decision of the measurement 0 – if measurement decision is false 1 – If measurement decision is true
int Measurement_NameExists(char* toolName, char* measurementName)	Determines if a measurement exist by name. Parameter: toolName – Tool name measurementName – Measurement name Returns: 0 – measurement does not exist 1 – measurement exists
int Measurement_Id (char* toolName, char* measurementName)	Gets the measurement ID by the measurement name. Parameters: toolName – Tool name measurementName – Measurement name Returns: -1 – measurement does not exist Other value – Measurement ID

Output Functions

Function	Description
void Output_Set (double value, int decision)	Sets the output value and decision on Output index 0. Only the last output value / decision in a script run is kept and passed to the Gocator output. To output an invalid value, the constant INVALID_VALUE can be used (e.g., Output_SetAt(0, INVALID_VALUE, 0)) Parameters:

Function	Description
	value - value output by the script decision - decision value output by the script. Can only be 0 or 1
void Output_SetAt(unsigned int index, double value, int decision)	Sets the output value and decision at the specified output index. To output an invalid value, the constant INVALID_VALUE can be used (e.g., Output_SetAt(0, INVALID_VALUE, 0)) Parameters: index – Script output index value – value output by the script decision – decision value output by the script. Can only be 0 or 1
void Output_SetId(int id, double value, int decision)	Sets the output value and decision at the specified script output ID. To output an invalid value, the constant INVALID_VALUE can be used (e.g., Output_SetId(0, INVALID_VALUE, 0)) Parameters: id – Script output ID

Memory Functions

Function	Description
void Memory_Set64s (int id, long long value)	Stores a 64-bit signed integer in persistent memory. Parameters: id - ID of the value value - Value to store
long long Memory_Get64s (int id)	Loads a 64-bit signed integer from persistent memory. Parameters: id - ID of the value Returns: value - Value stored in persistent memory
void Memory_Set64u (int id, unsigned long long value)	Stores a 64-bit unsigned integer in the persistent memory Parameters: id - ID of the value value - Value to store
unsigned long long Memory_Get64u (int id)	Loads a 64-bit unsigned integer from persistent memory. Parameters: id - ID of the value Returns: value - Value stored in persistent memory
void Memory_Set64f (int id, double value)	Stores a 64-bit double into persistent memory. Parameters: id - ID of the value

Function	Description
	value - Value to store
double Memory_Get64f (int id)	Loads a 64-bit double from persistent memory. All persistent memory values are set to 0 when the sensor starts. Parameters: id - ID of the value Returns: value - Value stored in persistent memory
int Memory_Exists (int id)	Tests for the existence of a value by ID. Parameters: id - Value ID Returns: 0 - value does not exist 1 - value exists
void Memory_Clear (int id)	Erases a value associated with an ID. Parameters: id - Value ID
void Memory_ClearAll()	Erases all values from persistent memory

Runtime Variable Functions

Function	Description
int RuntimeVariable_Count()	Returns the number of runtime variables that can be accessed. Returns: The count of runtime variables.
int RuntimeVariable_Get32s(int id)	Returns the value of the runtime variable at the given index. Parameters: Id - ID of the runtime variable Returns: Runtime variable value

Stamp Functions

Function	Description
long long Stamp_Frame()	Gets the frame index of the current frame.
long long Stamp_Time()	Gets the time stamp of the current frame.
long long Stamp_Encoder()	Gets the encoder position of the current frame.
long long Stamp_EncoderZ()	Gets the encoder index position of the current frame.
unsigned int Stamp_Inputs()	Gets the digital input state of the current frame.

Math Functions

Function	Description
float sqrt(float x)	Calculates square root of x
float sin(float x)	Calculates sin(x) (x in radians)
float cos(float x)	Calculates cos(x) (x in radians)
float tan(float x)	Calculates tan(x) (x in radians)
float asin(float x)	Calculates asin(x) (x in radians)
float acos(float x)	Calculates acos(x) (x in radians)
float atan(float x)	Calculates atan(x) (x in radians)
float pow (float x, float y)	Calculates the exponential value. x is the base, y is the exponent
float fabs(float x)	Calculates the absolute value of x

Example

The following example shows how to create a custom measurement that is based on the values from other measurements. The example calculates the 3-Dimensional Euclidean distance between the center of a hole and the center of the base of a nearby stud, then checks decision limits on this metric before sending the output.

```
/* Calculate the 3-Dimensional Euclidean distance between two points in 3D space*/

/* Retrieve 3D coordinate from Hole X, Y and Z tools (assumes these tools have been
configured as ID 0, ID 1 and ID 2 respectively) */
double HoleX = Measurement_Value(0);
double HoleY = Measurement_Value(1);
double HoleZ = Measurement_Value(2);

/* Retrieve 3D coordinate from StudBase X, Y and Z tools (assumes these tools have been
configured as ID 3, ID 4 and ID 5 respectively) */
double StudX = Measurement_Value(3);
double StudY = Measurement_Value(4);
double StudZ = Measurement_Value(5);

/* Calculate distance between points in 3D space */
double Distance = sqrt((HoleX - StudX)*(HoleX - StudX) + (HoleY - StudY)*(HoleY - StudY)
+ (HoleZ - StudZ)*(HoleZ - StudZ));

/* Min and Max Decision Limits */
/* Note that measurement values are in the unit of thousands of a millimeter in the
script */
/* In this example the distance is considered good if it's between 17.9 mm and 18.1 mm */
double MinDecisionLimit = 17.900;
double MaxDecisionLimit = 18.100;
```

```
if (Distance > MinDecisionLimit && Distance < MaxDecisionLimit)
{
    Output_Set(Distance, 1);
}
else
{
    Output_Set(Distance, 0);
}
```


Output

The following sections describe the **Output** page.

Output Page Overview

Output configuration tasks are performed using the **Output** page. Gocator sensors can transmit data and measurement results to various external devices using several output interface options.

Up to two outputs can have scheduling enabled with ASCII as the Serial output protocol. When Selcom is the current Serial output protocol, only one other output can have scheduling enabled.

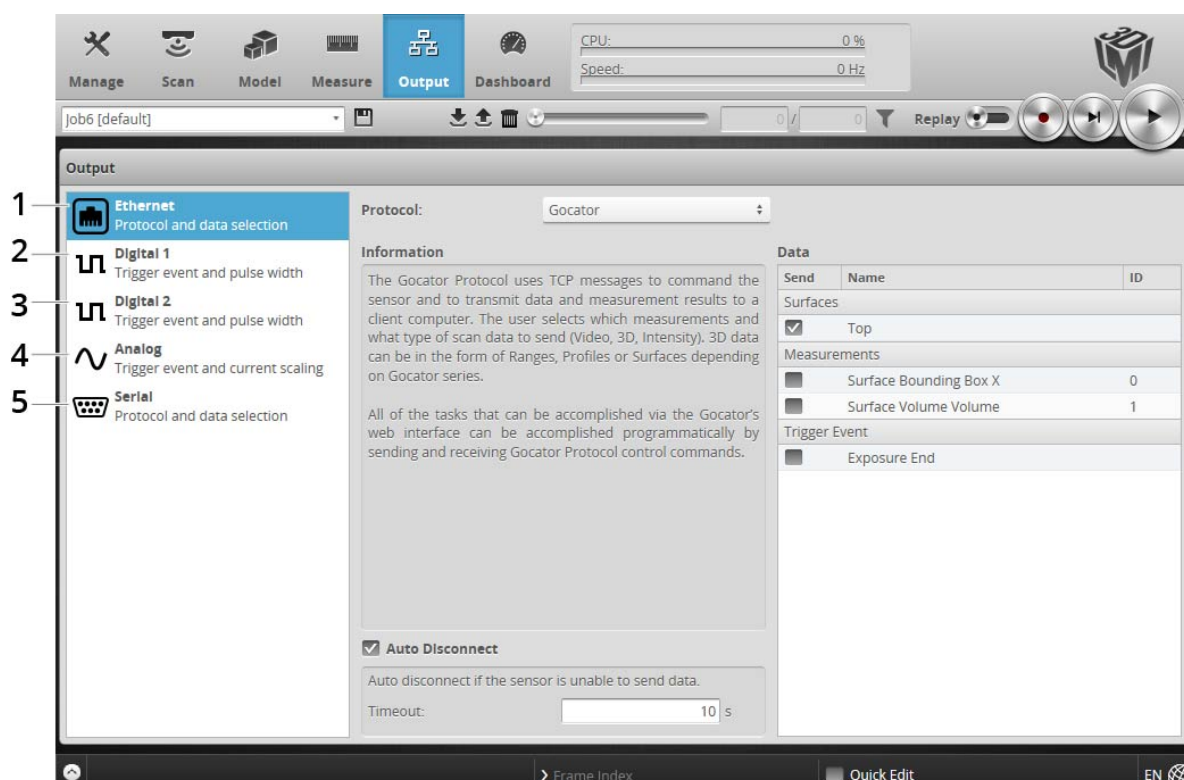

Category	Description
1 Ethernet	Used to select the data sources that will transmit data via Ethernet. See <i>Ethernet Output</i> on the next page.
2 Digital Output 1	Used to select the data sources that will be combined to produce a digital output pulse on Output 1. See <i>Digital Output</i> on page 335.
3 Digital Output 2	Used to select the data sources that will be combined to produce a digital output pulse on Output 2. See <i>Digital Output</i> on page 335.
4 Analog Panel	Used to convert a measurement value or decision into an analog output signal. See <i>Analog Output</i> on page 338.
5 Serial Panel	Used to select the measurements that will be transmitted via RS-485 serial output. See <i>Serial Output</i> on page 340.

Ethernet Output

A sensor uses TCP messages (Gocator protocol) to receive commands from client computers, and to send video, 3D point clouds, intensity, and measurement results to client computers. The sensor can also receive commands from and send measurement results to a PLC using ASCII, Modbus TCP, or EtherNet/IP protocol. See *Protocols* on page 462 for the specification of these protocols.

The specific protocols used with Ethernet output are selected and configured within the panel.

The screenshot shows the 'Output' panel of the Gocator web interface. On the left, there is a sidebar with icons for 'Ethernet', 'Digital 1', 'Digital 2', 'Analog', and 'Serial'. The 'Ethernet' option is selected and highlighted in blue. The main area is divided into three sections: 'Protocol', 'Information', and 'Data'. The 'Protocol' section has a dropdown menu set to 'Gocator'. The 'Information' section contains text explaining the Gocator protocol and a checkbox for 'Auto Disconnect' which is checked. Below this is a 'Timeout' field set to '10 s'. The 'Data' section contains a table with columns 'Send', 'Name', and 'Id'. The table lists various data items with checkboxes in the 'Send' column. The 'Surfaces' section has a checkbox for 'Top' which is checked. The 'Surface Intensities' section has a checkbox for 'Top' which is unchecked. The 'Measurements' section lists several items: 'Surface Bounding Box X' (unchecked, id 0), 'Surface Ellipse Major' (unchecked, id 2), 'Surface Hole Radius' (checked, id 10), 'Surface Opening Length' (unchecked, id 11), 'Surface Plane X Angle' (unchecked, id 5), 'Surface Position X' (checked, id 6), 'Surface Stud Radius' (unchecked, id 13), 'Surface Volume Volume' (unchecked, id 8), and 'Script Output 0' (unchecked, id 9). At the bottom, there is a 'Trigger Event' section with a checkbox for 'Exposure End' which is unchecked.


Send	Name	Id
Surfaces		
☒	Top	
Surface Intensities		
☐	Top	
Measurements		
☐	Surface Bounding Box X	0
☐	Surface Ellipse Major	2
☒	Surface Hole Radius	10
☐	Surface Opening Length	11
☐	Surface Plane X Angle	5
☒	Surface Position X	6
☐	Surface Stud Radius	13
☐	Surface Volume Volume	8
☐	Script Output 0	9
Trigger Event		
☐	Exposure End	

To receive commands and send results using Gocator Protocol messages:

1. Go to the **Output** page.
2. Click on the **Ethernet** category in the **Output** panel.
3. Select **Gocator** as the protocol in the **Protocol** drop-down.
4. Check the video, data, intensity, or measurement items to send.
5. (Optional) Uncheck the Auto Disconnect setting.
By default, this setting is checked, and the timeout is set to 10 seconds.


 Measurements shown here correspond to measurements that have been added using the **Measure** page (see *Measure Page Overview* on page 141).

All of the tasks that can be accomplished with the Gocator's web interface (creating jobs, performing alignment, sending data and health information, and software triggering, etc.) can be accomplished programmatically by sending Gocator protocol control commands.

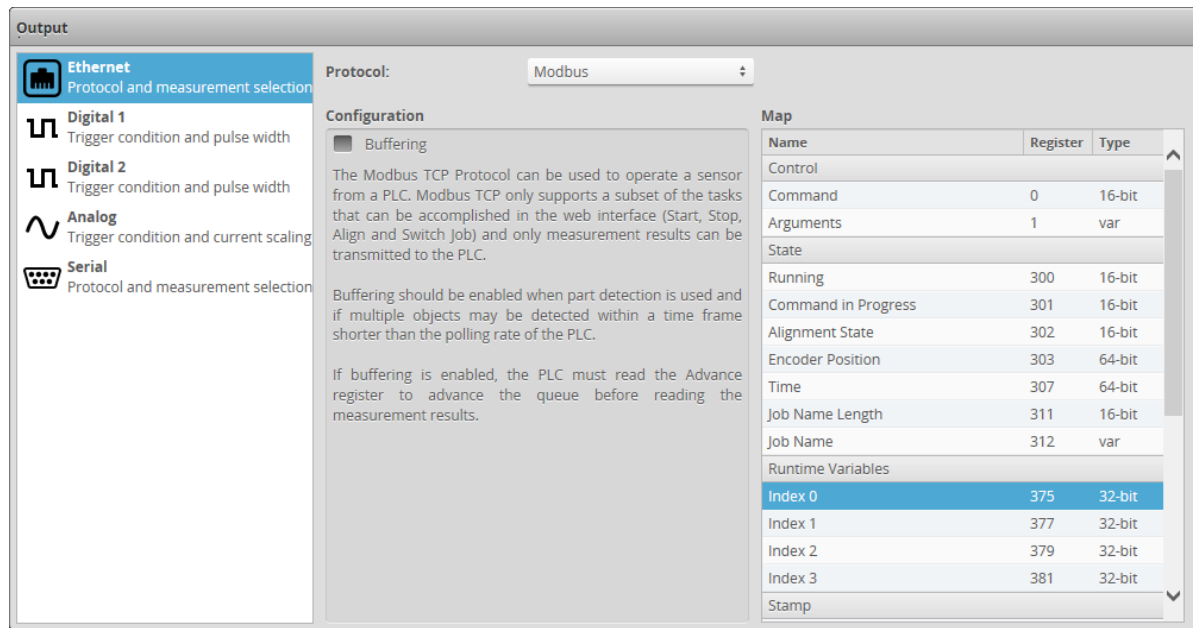


To receive commands and send results using Modbus TCP messages:

1. Go to the **Output** page.
2. Click on **Ethernet** in the **Output** panel.
3. Select **Modbus** as the protocol in the **Protocol** drop-down.
 Unlike the Gocator Protocol, you do not select which measurement items to output. The Ethernet panel will list the register addresses that are used for Modbus TCP communication.
 The Modbus TCP protocol can be used to operate a sensor. Modbus TCP only supports a subset of the tasks that can be performed in the web interface. A sensor can only process Modbus TCP commands when Modbus is selected in the **Protocol** drop-down.
4. Check the **Buffering** checkbox, if needed.
 Buffering is needed, for example, in Surface mode if multiple objects are detected within a time frame shorter than the polling rate of the PLC.
 If buffering is enabled with the Modbus protocol, the PLC must read the Advance register to advance the queue before reading the measurement results.

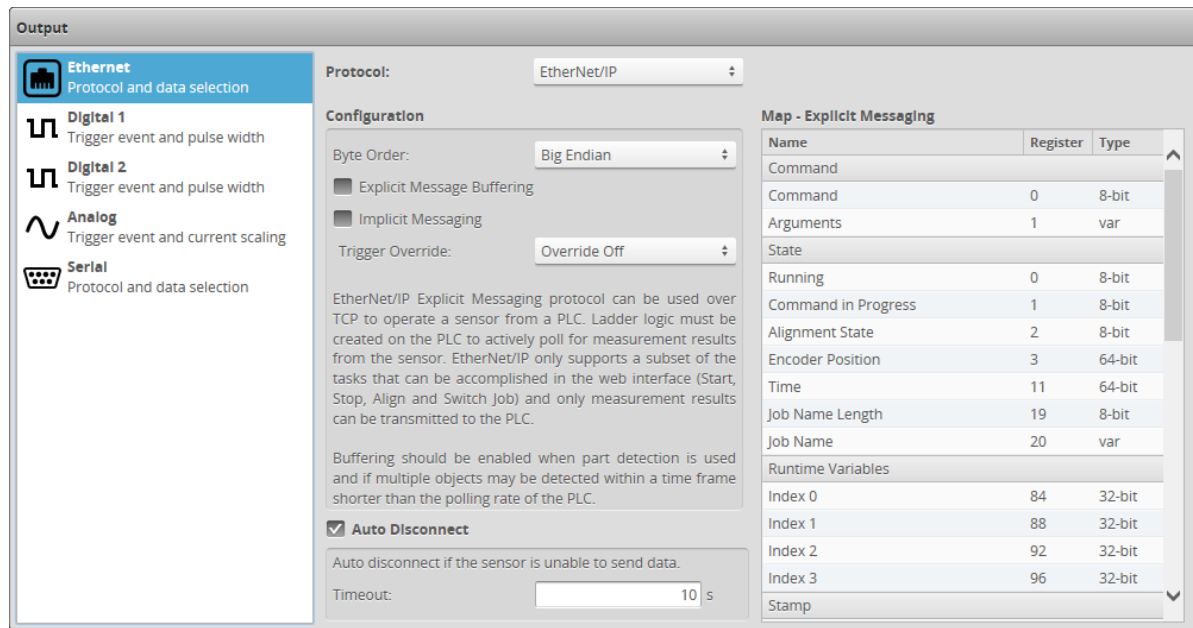


To receive commands and send results using EtherNet/IP messages:

1. Go to the **Output** page.
2. Click on **Ethernet** in the **Output** panel.
3. Select **EtherNet/IP** in the **Protocol** option.
Unlike using the Gocator Protocol, you don't select which measurement items to output. The **Ethernet** panel will list the register addresses that are used for EtherNet/IP messages communication. The EtherNet/IP protocol can be used to operate a sensor. EtherNet/IP only supports a subset of the tasks that can be accomplished in the web interface. A sensor can only process EtherNet/IP commands when the EtherNet/IP is selected in the **Protocol** option.
4. Check the **Explicit Message Buffering** option, if needed.
Buffering is needed, for example, in Surface mode if multiple objects are detected within a time frame shorter than the polling rate of the PLC. If buffering is enabled with the EtherNet/IP protocol, the buffer is automatically advanced when the Sample State Assembly Object is read (*Sample State Assembly* on page 533).
5. Check the **Implicit Messaging** option, if needed.
Implicit messaging uses UDP and is faster than explicit messaging, so it is intended for time-critical applications. However, implicit messaging is layered on top of UDP. UDP is connectionless and data delivery is not guaranteed. For this reason, implicit messaging is only suitable for applications where occasional data loss is acceptable.
For more information on setting up implicit messaging, see http://lmi3d.com/sites/default/files/APPNOTE_Implicit_Messaging_with_Allen-Bradley_PLCs.pdf.
6. Choose the byte order in the **Byte Order** dropdown.
7. Click the **Download EDS File** button to download an EDS file for use with your IDE.

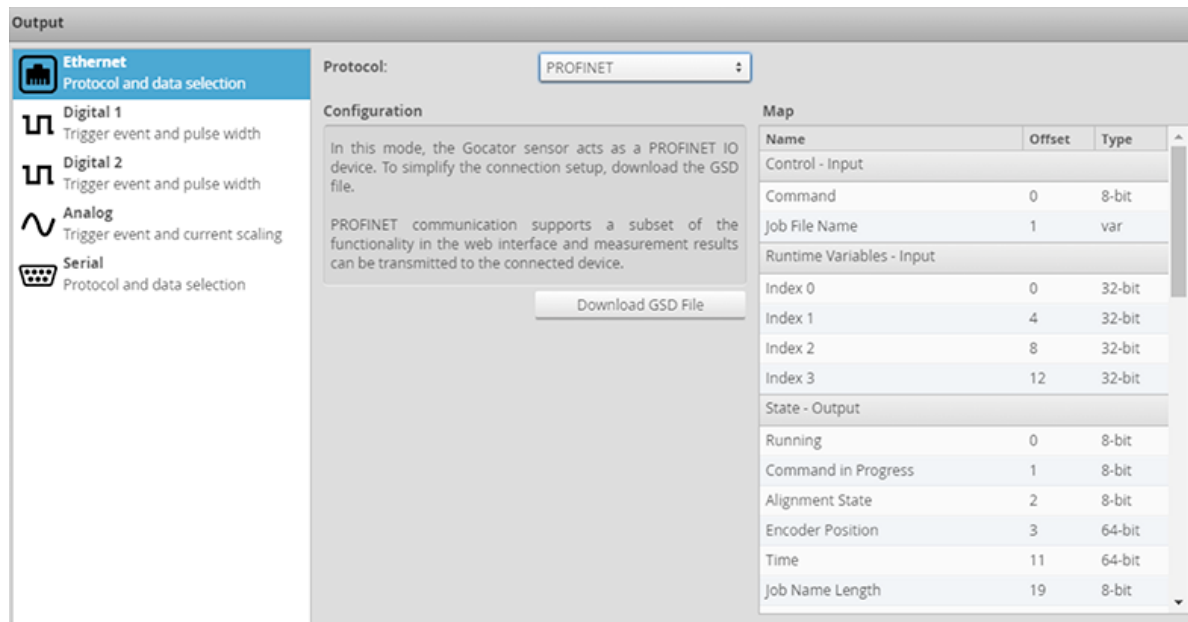

To receive commands and send results using PROFINET messages:

1. Go to the **Output** page.
2. Click on **Ethernet** in the **Output** panel.
3. Select **PROFINET** in the **Protocol** option.
4. Click the **Download GSD File** button to download a GSD file for use with your IDE.

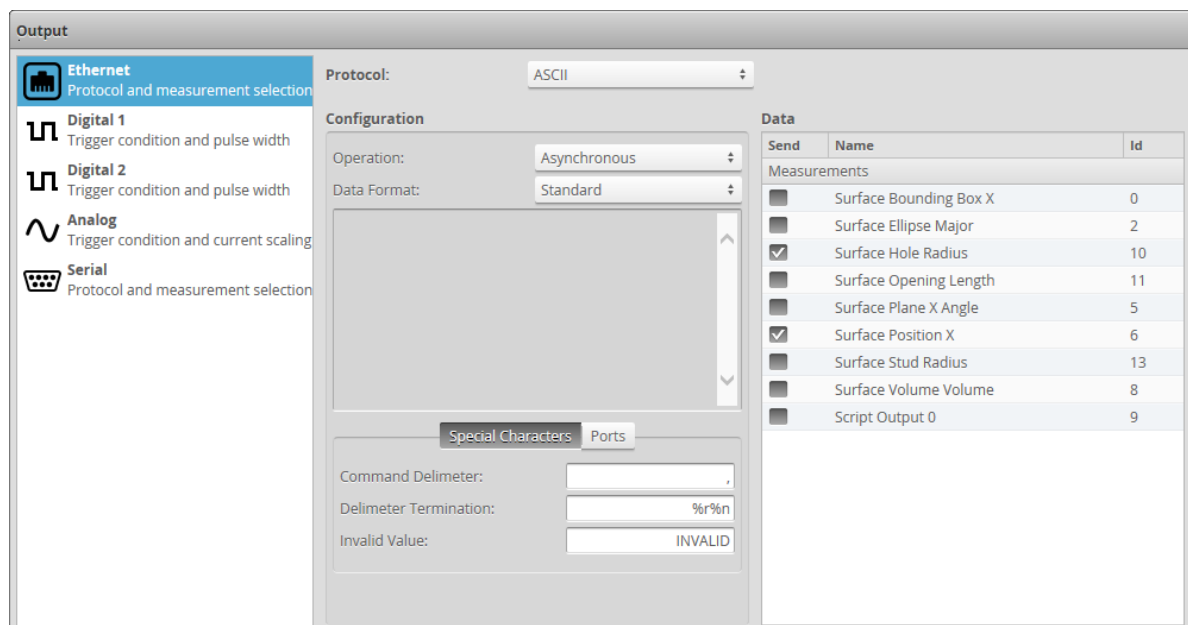

To receive commands and send results using ASCII messages:

1. Go to the **Output** page.

2. Click on **Ethernet** in the **Output** panel.
3. Select **ASCII** as the protocol in the **Protocol** drop-down.
4. Set the operation mode in the **Operation** drop-down.
In asynchronous mode, the data results are transmitted when they are available. In polling mode, users send commands on the data channel to request the latest result. See *Polling Operation Commands (Ethernet Only)* on page 542 for an explanation of the operation modes.
5. Select the data format from the **Data Format** drop-down.
Standard: The default result format of the ASCII protocol. Select the measurement to send by placing a check in the corresponding checkbox. See *Standard Result Format* on page 550 for an explanation of the standard result mode.
Standard with Stamp: Select the measurement to send by placing a check in the corresponding checkbox. See *Standard Result Format* on page 550 for an explanation of the standard result mode.
Custom: Enables the custom format editor. Use the replacement patterns listed in **Replacement Patterns** to create a custom format in the editor. C language *printf*-style formatting is also supported: for example, `%sprintf[%09d, %value[0]]`. This allows fixed length formatting for easier input parsing in PLC and robot controller logic.
6. Set the special characters in the **Special Characters** tab.
Set the command delimiter, delimiter termination, and invalid value characters. Special characters are used in commands and standard-format data results.
7. Set the TCP ports in the **Ports** tab.
Select the TCP ports for the control, data, and health channels. If the port numbers of two channels are the same, the messages for both channels are transmitted on the same port.

Digital Output

Gocator sensors can convert measurement decisions or software commands to digital output pulses, which can then be used to output to a PLC or to control external devices, such as indicator lights or air ejectors.




Digital outputs cannot be used when taking scans using the Snapshot button, which takes a single scan and is typically used to test measurement tool settings. Digital outputs can only be used when a sensor is running, taking a continuous series of scans.

A digital output can act as a measurement valid signal to allow external devices to synchronize to the timing at which measurement results are output. In this mode, the sensor outputs a digital pulse when a measurement result is ready.

A digital output can also act as a strobe signal to allow external devices to synchronize to the timing at which the sensor exposes. In this mode, the sensor outputs a digital pulse when the sensor exposes.

Each sensor supports two digital output channels. See *Digital Outputs* on page 637 for information on wiring digital outputs to external devices.

Trigger conditions and pulse width are then configured within the panel.

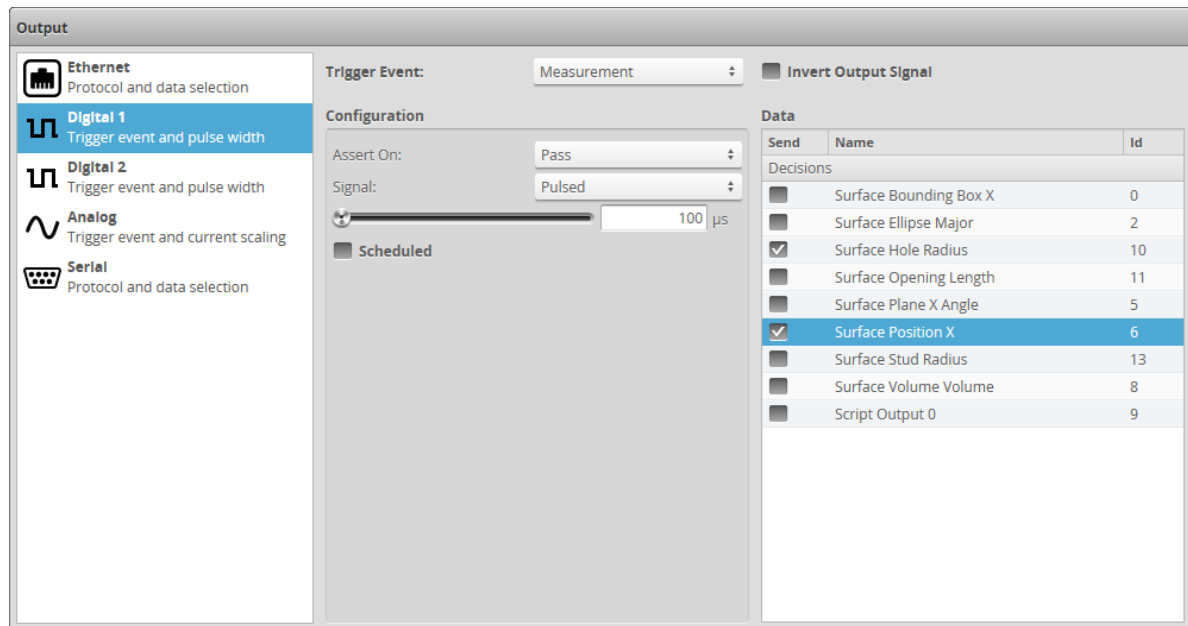

To output measurement decisions:

1. Go to the **Output** page.
2. Click **Digital 1** or **Digital 2** in the **Output** panel.
3. Set **Trigger Event** to **Measurement**.
4. In **Configuration**, set **Assert On** and select the measurements that should be combined to determine the output.
If multiple measurement decisions are selected and **Assert On** is set to **Pass**, the output is activated when all selected measurements pass.
If **Assert On** is set to **Fail**, the output is activated when any one of the selected measurements fails.
5. Set the **Signal** option.
The signal type specifies whether the digital output is a continuous signal or a pulsed signal. If **Signal** is set to **Continuous**, the signal state is maintained until the next transition occurs. If **Signal** is set to **Pulsed**, you must specify the pulse width and how it is scheduled.
6. Specify a pulse width using the slider.
The pulse width is the duration of the digital output pulse, in microseconds.
7. Check the **Scheduled** option if the output needs to be scheduled; otherwise, leave it unchecked for immediate output.
A scheduled output becomes active after the delay from the start of Gocator exposure. A scheduled output can be used to track the decisions for multiple objects as these objects travel from the sensor to the eject gates.
The **Delay** setting specifies the distance from the sensor to the eject gates.
An immediate output becomes active as soon as measurement results are available. The output activates after the sensor finishes processing the data. As a result, the time between the start of sensor exposure and output activates can vary and is dependent on the processing latency. The latency is

reported in the dashboard and in the health messages.

8. If you checked **Scheduled**, specify a delay and a delay domain.
The **Delay** specifies the time or encoder distance between the start of sensor exposure and when the output becomes active. The delay should be larger than the time needed to process the data inside the sensor. It should be set to a value that is larger than the processing latency reported in the dashboard or in the health messages.
The unit of the delay is configured with the **Delay Domain** setting.
9. If you want to invert the output signal, check **Invert Output Signal**.

To output a measurement valid signal:

1. Go to the **Output** page.
2. Click on **Digital 1** or **Digital 2** in the **Output** panel.
3. Set **Trigger Event** to **Measurement**.
4. In **Configuration**, set **Assert On** to **Always**.
5. Select the measurements.
The output activates when the selected decisions produce results. The output activates only once for each frame even if multiple decision sources are selected.
6. Specify a pulse width using the slider.
The pulse width determines the duration of the digital output pulse, in microseconds.

To respond to software scheduled commands:

1. Go to the **Output** page.
2. Click **Digital 1** or **Digital 2** in the **Output** panel.
3. Set **Trigger Event** to **Software**.
4. Specify a **Signal** type.
The signal type specifies whether the digital output is a continuous signal or a pulsed signal. If the signal is continuous, its state is maintained until the next transition occurs. If the signal is pulsed, user specifies the pulse width and the delay.
5. Specify a **Pulse Width**.
The pulse width determines the duration of the digital output pulse, in microseconds.
6. Specify if the output is immediate or scheduled.
A pulsed signal can become active immediately or be scheduled. A continuous signal always becomes active immediately.
Immediate output becomes active as soon as a scheduled digital output (*Schedule Digital Output* on page 487) is received.
Scheduled output becomes active at a specific target time or position, given by the Scheduled Digital Output command. Commands that schedule an event in the past will be ignored. An encoder value is in the future if the value will be reached by moving in the forward direction (the direction that encoder calibration was performed in).

To output an exposure signal:

1. Go to the **Output** page.
2. Click **Digital 1** or **Digital 2** in the **Output** panel.
3. Set **Trigger Event** to **Exposure Begin** or **Exposure End**.
4. Set the **Pulse Width** option.
The pulse width determines the duration of the digital output pulse, in microseconds.

To output an alignment signal:

1. Go to the **Output** page.
2. Click **Digital 1** or **Digital 2** in the **Output** panel.
3. Set **Trigger Event** to **Alignment**.
The digital output state is High if the sensor is aligned, and Low if not aligned. Whether the sensor is running does not affect the output.


To respond to exposure begin/end:

1. Go to the **Output** page.
2. Click **Digital 1** or **Digital 2** in the **Output** panel.
3. Set **Trigger Event** to **Exposure Begin** or **Exposure End**.

Analog Output

Gocator sensors can convert a measurement result or software request to an analog output. Each sensor supports one analog output channel.

For information on wiring analog output to an external device, see *Analog Output* on page 640

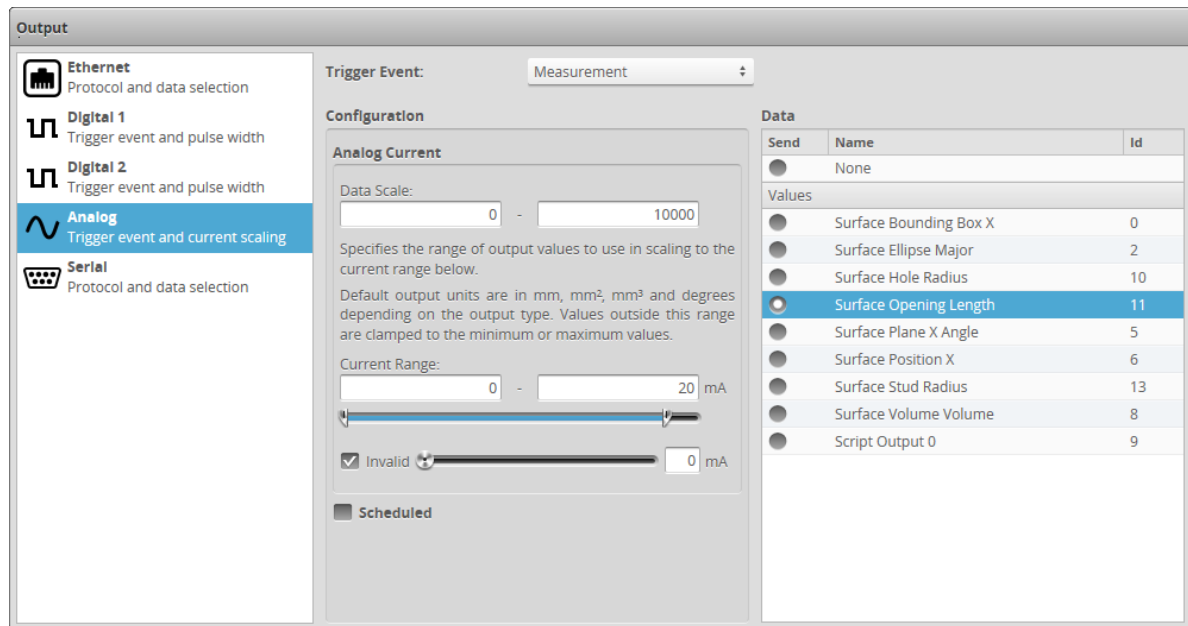

To output measurement value or decision:

1. Go to the **Output** page.
2. Click on **Analog** in the **Output** panel.
3. Set **Trigger Event** to **Measurement**.
4. Select the measurement that should be used for output.
Only one measurement can be used for analog output. Measurements shown here correspond to measurements that have been programmed using the **Measurements** page.
5. Specify **Data Scale** values.
The values specified here determine how measurement values are scaled to the minimum and maximum current output. The **Data Scale** values are specified in millimeters for dimensional measurements such as distance, square millimeters for areas, cubic millimeters for volumes, and degrees for angle results.
6. Specify **Current Range** and **Invalid** current values.
The values specified here determine the minimum and maximum current values in milliamperes. If **Invalid** is checked, the current value specified with the slider is used when a measurement value is not valid. If **Invalid** is not checked, the output holds the last value when a measurement value is not valid.
7. Specify if the output is immediate or scheduled.
An analog output can become active immediately or scheduled. Check the **Scheduled** option if the output needs to be scheduled.
A scheduled output becomes active after a specified delay from the start of Gocator exposure. A scheduled output can be used to track the decisions for multiple objects as these objects travel from the sensor to the eject gates. The delay specifies the distance from the sensor to the eject gates.
An Immediate output becomes active as soon as the measurement results are available. The output activates after the Gocator finishes processing the data. As a result, the time between the start of

Gocator exposure and output activates depends on the processing latency. The latency is reported in the dashboard and in the health messages.

8. Specify a delay.

The delay specifies the time or spatial location between the start of Gocator exposure and the output becomes active. The delay should be larger than the time needed to process the data inside the Gocator. It should be set to a value that is larger than the processing latency reported in the dashboard and in the health messages.

The unit of the delay is configured in the trigger panel. See *Triggers* on page 86 for details.



The analog output takes about 75 us to reach 90% of the target value for a maximum change, then another ~40 us to settle completely.

To respond to software scheduled commands:

1. Go to the **Output** page.
2. Click on **Analog** in the **Output** panel.
3. Set **Trigger Event** to **Software**.
4. Specify if the output is immediate or scheduled.


An analog output value becomes active immediately or scheduled. Immediate output becomes active as soon as a Scheduled Analog Output command (see *Schedule Analog Output* on page 487) is received. Software scheduled command can schedule an analog value to output at a specified future time or encoder value, or changes its state immediately. The Delay setting in the panel is ignored. Commands that schedule event in the past will be ignored. An encoder value is in future if the value will be reached by moving in the forward direction (the direction that encoder calibration was performed in).

Serial Output

Gocator's web interface can be used to select measurements to be transmitted via RS-485 serial output. Each sensor has one serial output channel.

The ASCII protocol outputs data asynchronously using a single serial port. For information on the ASCII Protocol parameters and data formats, see *ASCII Protocol* on page 541.

For information on wiring serial output to an external device, see *Serial Output* on page 640.

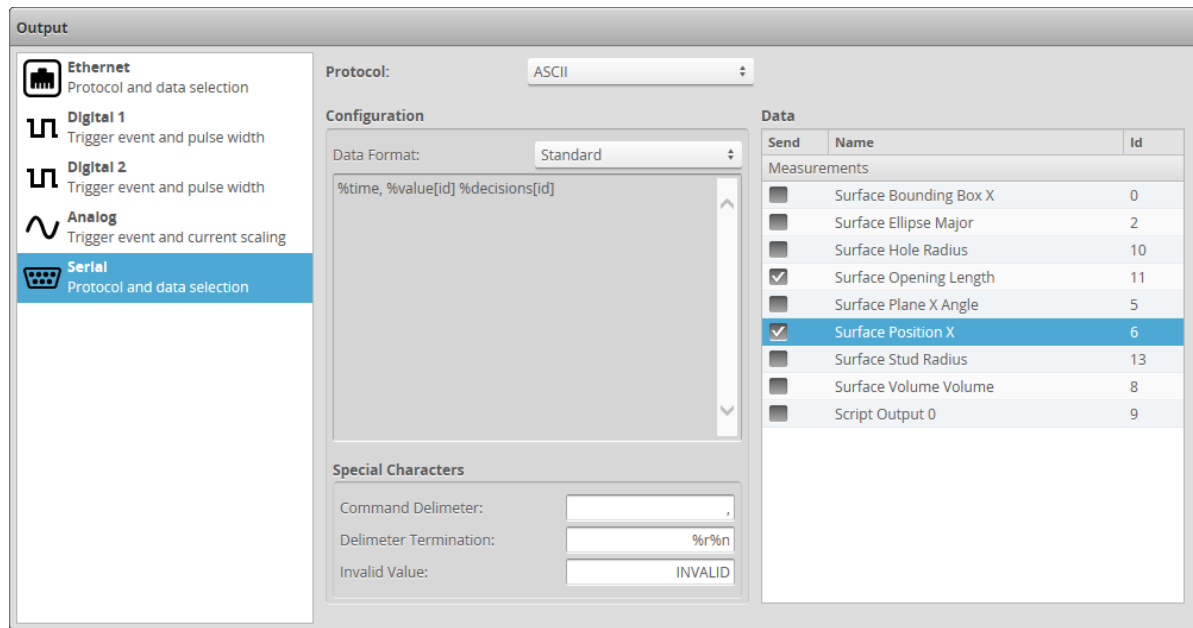

To configure ASCII output:

1. Go to the **Output** page.
2. Click on **Serial** in the **Output** panel.
3. Select **ASCII** in the **Protocol** option.
4. Select the **Data Format**.
Select **Standard** to use the default result format of the ASCII protocol. Select value and decision to send by placing a check in the corresponding check box. See *Standard Result Format* on page 550 for an explanation of the standard result mode.
Select **Custom** to customize the output result. A data format box will appear in which you can type the format string. See *Custom Result Format* on page 550 for the supported format string syntax.
5. Select the measurements to send.
Select measurements by placing a check in the corresponding check box.
6. Set the **Special Characters**.
Select the delimiter, termination and invalid value characters. Special characters are used in commands and standard-format data results.

Ethernet

Protocol and data selection

Digital 1

Trigger event and pulse width

Digital 2

Trigger event and pulse width

Analog

Trigger event and current scaling

Serial

Protocol and data selection

Protocol:

Selcom

Configuration

Rate:

96000

Format:

SLS

Data Scale:

0

-

10000

Specifies the range of output values to use in scaling to the range selected in the Format above.

Default output units are in mm, mm², mm³ and degrees depending on the output type. Values outside this range are clamped to the minimum or maximum values.

Scheduled

Delay:

3000

µs

Data

Send	Name	Id
Measurements		
☒	Range Position Z	0

Gocator Snapshot Sensors: User Manual


Gocator Web Interface • 342

Dashboard

The following sections describe the **Dashboard** page.

Dashboard Page Overview

The **Dashboard** page summarizes sensor health information and provides measurement statistics. It also provides tool performance statistics. Use this information to troubleshoot your system.

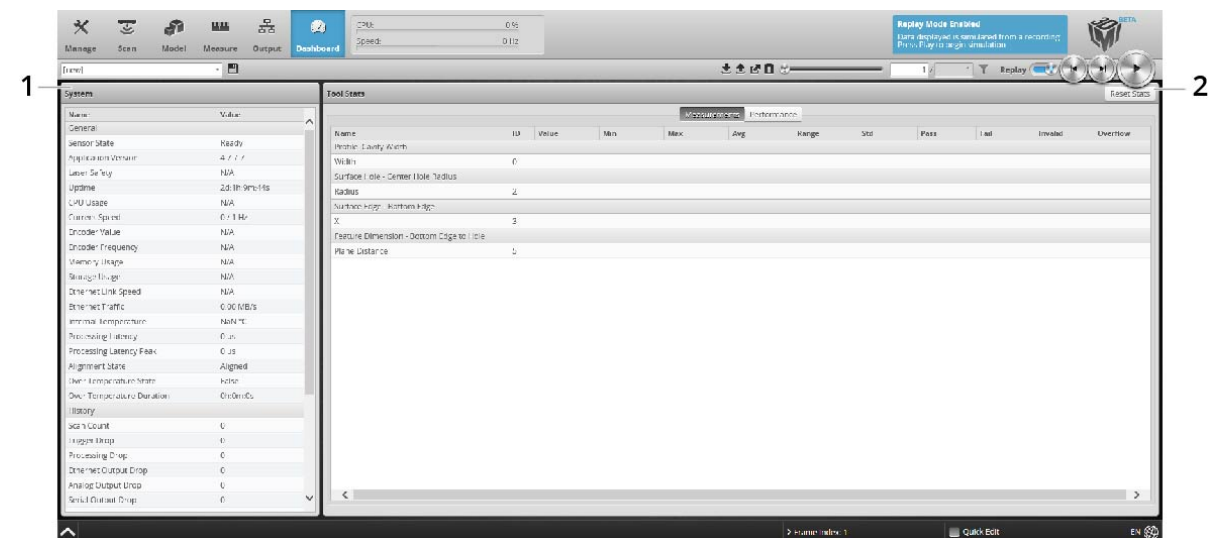

Element	Description
1 System	Displays sensor state and health information. See <i>State and Health Information</i> below.
2 Tool Stats	Displays measurement and tool performance statistics. See <i>Statistics</i> on page 345.

State and Health Information

The following state and health information is available in the **System** panel on the **Dashboard** page:

Dashboard General System Values

Name	Description
Sensor State*	Current sensor state (Conflict, Ready, or Running).
Application Version	Gocator firmware version.
Laser Safety	Whether Safety is enabled. With snapshot sensors, enabling safety is not required in order to scan.
Uptime	Length of time since the sensor was power-cycled or reset.
CPU Usage	Sensor CPU utilization.
Current Speed*	Current speed of the sensor.
Encoder Value	Current encoder value (ticks).

Name	Description
Encoder Frequency	Current encoder frequency (Hz).
Memory Usage	Sensor memory utilization (MB used / MB total available).
Storage Usage	Sensor flash storage utilization (MB used / MB total available).
Ethernet Link Speed	Speed of the Ethernet link (Mbps).
Ethernet Traffic	Network output utilization (MB/sec).
Internal Temperature	Internal sensor temperature.
Processing Latency	Last delay from camera exposure start to when the results are ready for output.
Processing Latency Peak	Peak delay from camera exposure start to when the results are ready for output.
Alignment State	Whether the sensor or sensor system has been aligned.
Over Temperature State	Whether the internal temperature of the sensor is over a predetermined level.
Over Temperature Duration	The amount of time that the internal temperature of the sensor has been over a predetermined level.

Dashboard History Values

Name	Description
Scan Count*	Number of scans performed since sensor state last changed to Running.
Trigger Drop**	Count of camera frames dropped due to excessive trigger speed.
Processing Drop**	Count of frame drops due to excessive CPU utilization.
Ethernet Output Drop**	Count of frame drops due to slow Ethernet link.
Analog Output Drop**	Count of analog output drops because last output has not been completed.
Serial Output Drop**	Count of serial output drops because last output has not been completed.
Digital Output 1 Drop**	Count of digital output drops because last output has not been completed.
Digital Output 2 Drop**	Count of digital output drops because last output has not been completed.
Digital Output 1 High Count	Count of high states on digital output.
Digital Output 2 High Count	Count of high states on digital output.
Digital Output 1 Low Count	Count of low states on digital output.
Digital Output 2 Low Count	Count of low states on digital output.
Anchor Invalid Count**	Count of invalid anchors.
Valid Spot Count	Count of valid spots detected in the last frame.
Max Spot Count*	Maximum number of spots detected since sensor was started.
Camera Search Count	Not applicable to these sensors.

* When the sensor is accelerated, the indicator's value is reported from the accelerating PC.

** When the sensor is accelerated, the indicator's value is the sum of the values reported from the sensor and the accelerating PC.

Statistics

In the **Tool Stats** pane, you can examine measurement and tool statistics in two tabs: **Measurements** and **Performance**.

To reset statistics in both tabs, use the **Reset Stats** button.

Measurements

The **Measurements** tab displays statistics for each measurement enabled in the **Measure** page, grouped by the tool that contains the measurement.

Name	ID	Value	Min	Max	Avg	Range	Std	Pass	Fail	Invalid	Overflow
Profile Area											
Centroid X	1	-13.803	-13.803	-13.803	-13.803	0	0	0	1	0	0
Area	2	0.083	0.083	0.083	0.083	0	0	0	1	0	0
Profile Line											
Offset	3	0.074	0.074	0.074	0.074	0	0	0	1	0	0
Angle	4	-0.062	-0.062	-0.062	-0.062	0	0	0	1	0	0
Profile Position											
X	5	-8.448	-8.448	-8.448	-8.448	0	0	0	1	0	0
Z	6	0.118	0.118	0.118	0.118	0	0	0	1	0	0

For each measurement, Gocator displays the following information:

Measurement Statistics

Name	Description
ID	The measurement ID as set in the measurement's ID field on the Measure page .
Value	The most recent measurement value.
Min	The minimum measurement value that has been observed.
Max	The maximum measurement value that has been observed.
Avg	The average of all measurement values collected since the sensor was started.
Range	The difference between Max and Min.
Std	The standard deviation of all measurement values collected since the sensor was started.
Pass	The number of pass decisions the measurement has generated.
Fail	The number of fail decisions the measurement has generated.
Invalid	The number of frames that returned no valid measurement value.
Overflow	The number of frames that returned an overflow.

Performance

The **Performance** tab displays performance statistics (execution time) for each tool added in the **Measure** page.

Name	Last (ms)	Min (ms)	Max (ms)	Avg (ms)	▼ Avg (%)
Profile Area	0.022	0.006	0.098	0.025	21.3
Profile Line	0.013	0.006	0.123	0.016	13.9
Profile Position	0.006	0.004	0.046	0.007	6.1

For each tool, Gocator displays the following information:

Performance Statistics


Name	Description
Last (ms)	The last execution time of the tool.
Min (ms)	The minimum execution time of the tool.
Max (ms)	The maximum execution time of the tool.
Avg (ms)	The average execution time of the tool.
Avg (%)	The average percentage the CPU the tool uses.



Tools are sorted by the *Avg (%)* column in descending order.

Gocator Emulator

The Gocator emulator is a stand-alone application that lets you run a "virtual" sensor, encapsulated in a "scenario." When running a scenario, you can test jobs, evaluate data, and even learn more about new features, rather than take a physical device off the production line to do this. You can also use a scenario to familiarize yourself with the overall interface if you are new to Gocator.

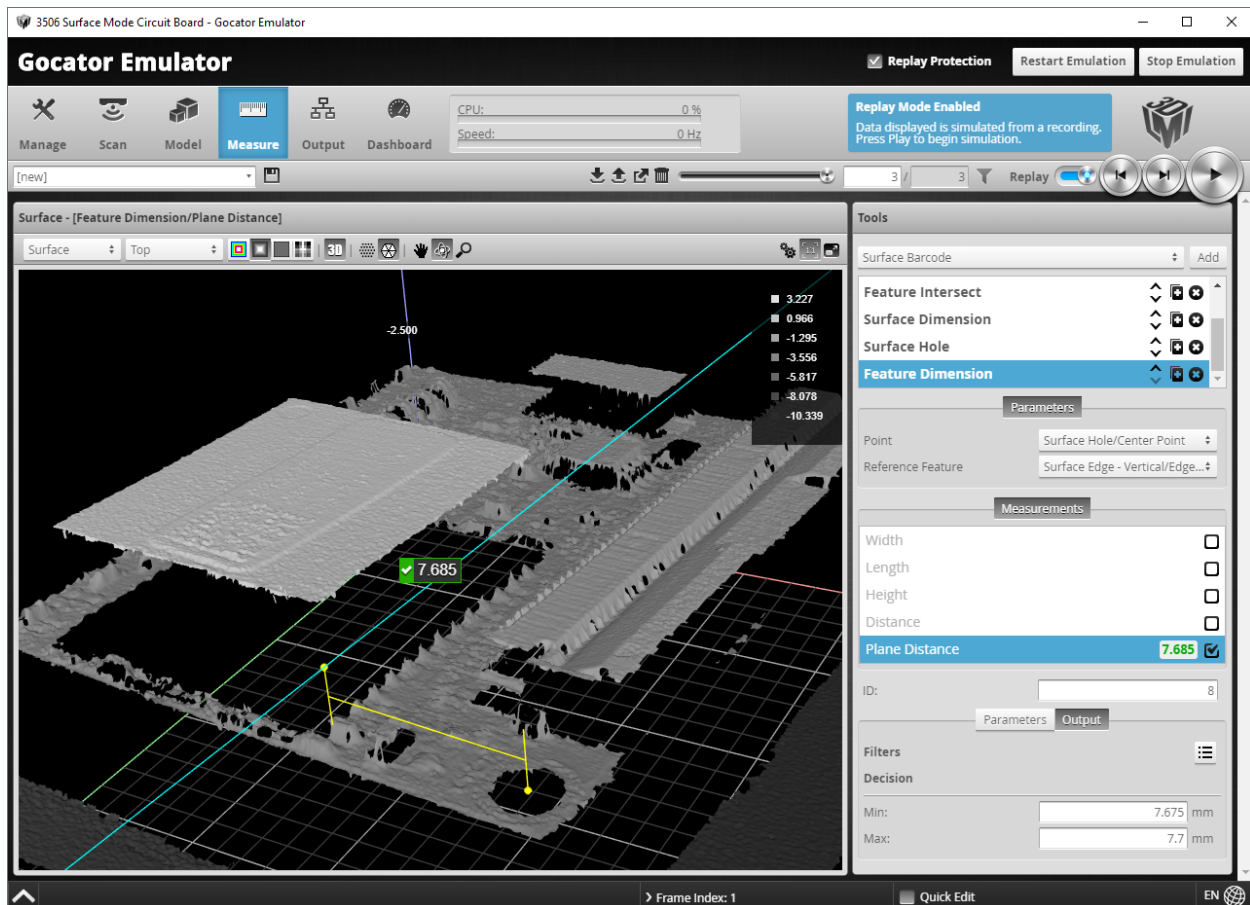

*Emulator showing a part in recorded data.
A measurement is applied to the recorded data.*

System Requirements

The following are the system requirements for the software:

- Processor: Intel Core i3 or equivalent (64-bit)
- RAM: 4 GB
- Hard drive: 500 GB
- Operating system: Windows 7, 8, or 10 (64-bit)

Limitations

In most ways, a scenario behaves like a real sensor, especially when visualizing data, setting up models and part matching, and adding and configuring measurement tools. The following are some of the limitations:

- Changes to job files in the emulator are *not* persistent (they are lost when you close or restart the emulator). However, you can keep a modified job by first [saving](#) it and then [downloading](#) it from the **Jobs** list on the **Manage** page to a client computer. The job file can then be loaded into the emulator at a later time or even onto a physical sensor for final testing.
- Performing alignment in the emulator has no effect and will never complete.
- The emulator does not support the PROFINET protocol.

For information on saving and loading jobs in the emulator, see *Creating, Saving, and Loading Jobs* on page 353.


For information on uploading and downloading jobs between the emulator and a computer, and performing other job file management tasks, see *Downloading and Uploading Jobs* on page 358.

Downloading a Support File from a Sensor

The emulator provides several preinstalled scenarios.

You can also create scenarios yourself by downloading a support file from a physical Gocator and then adding it to the emulator.

Support files can contain jobs, letting you configure systems and add measurements in an emulated sensor. Support files can also contain replay data, letting you test measurements and some configurations on real data. Dual-sensor systems are supported.

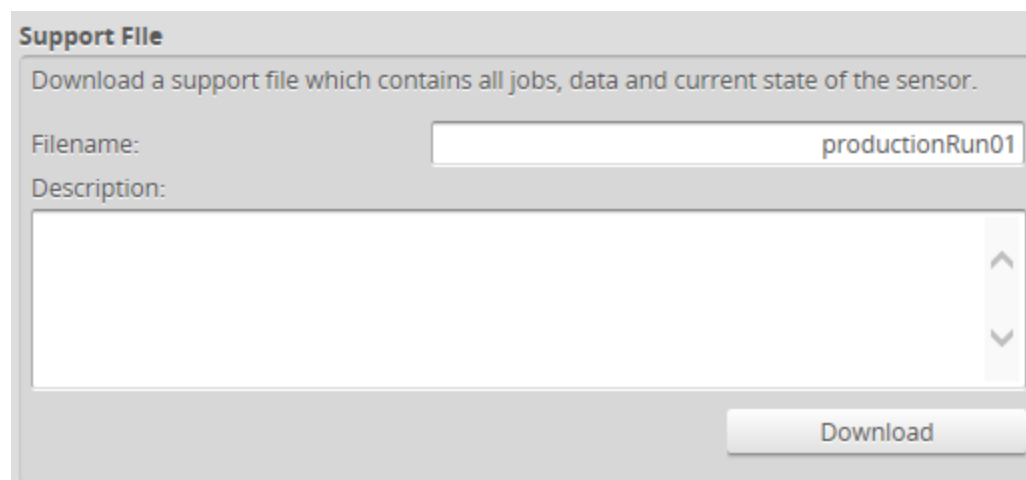

Support File

Download a support file which contains all jobs, data and current state of the sensor.

Filename:

Description:

To download a support file:

1. Go to the **Manage** page and click on the **Support** category.
2. In **Filename**, type the name you want to use for the support file.

When you create a scenario from a support file in the emulator, the filename you provide here is displayed in the emulator's scenario list.

Support files end with the .gs extension, but you do not need to type the extension in **Filename**.

3. (Optional) In **Description**, type a description of the support file.

When you create a scenario from a support file in the emulator, the description is displayed below the emulator's scenario list.


4. Click **Download**, and then when prompted, click **Save**.

 Downloading a support file stops the sensor.

Running the Emulator

The emulator is contained in the Gocator tools package (14405-x.x.x.x_SOFTWARE_GO_Tools.zip). To get the package, go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download the package from the Download Center.

To run the emulator, unzip the package and double-click the *GoEmulator* link in the unzipped emulator folder.

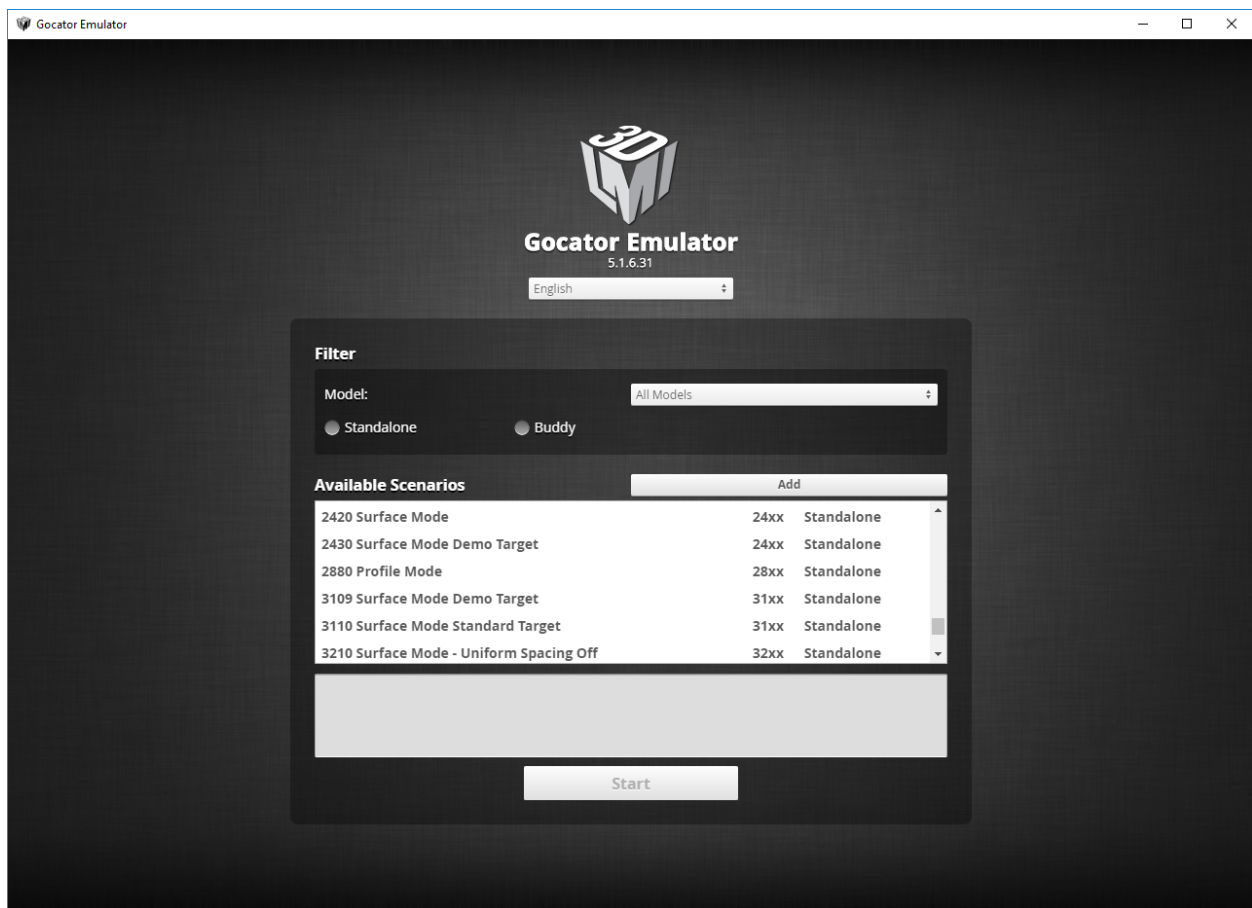

Emulator launch screen

You can change the language of the emulator's interface from the launch screen. To change the language, choose a language option from the top drop-down:



Selecting the emulator interface language

Adding a Scenario to the Emulator

To simulate a physical sensor using a support file downloaded from a sensor, you must add it as a scenario in the emulator.


 You can add support files downloaded from any series of Gocator sensors to the emulator.

To add a scenario:

1. Launch the emulator if it isn't running already.
2. Click the **Add** button and choose a previously saved support file (.gs extension) in the **Choose File to Upload** dialog.




3. (Optional) In **Description**, type a description.

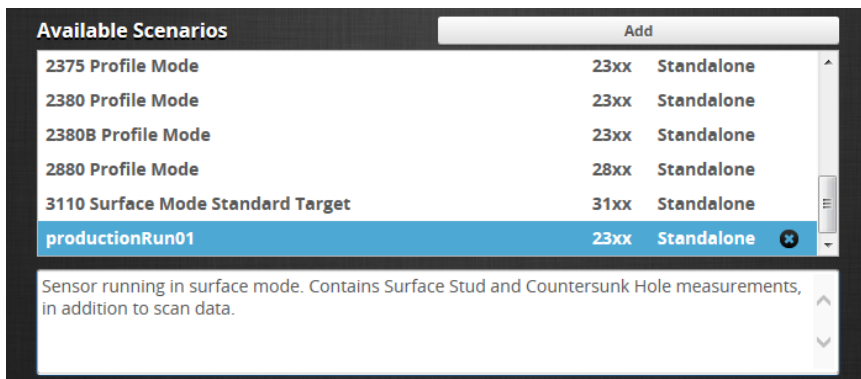

 You can only add descriptions for user-added scenarios.

Running a Scenario

After you have added a virtual sensor by uploading a support file to the emulator, you can run it from the **Available Scenarios** list on the emulator launch screen. You can also run any of the scenarios included in the installation.

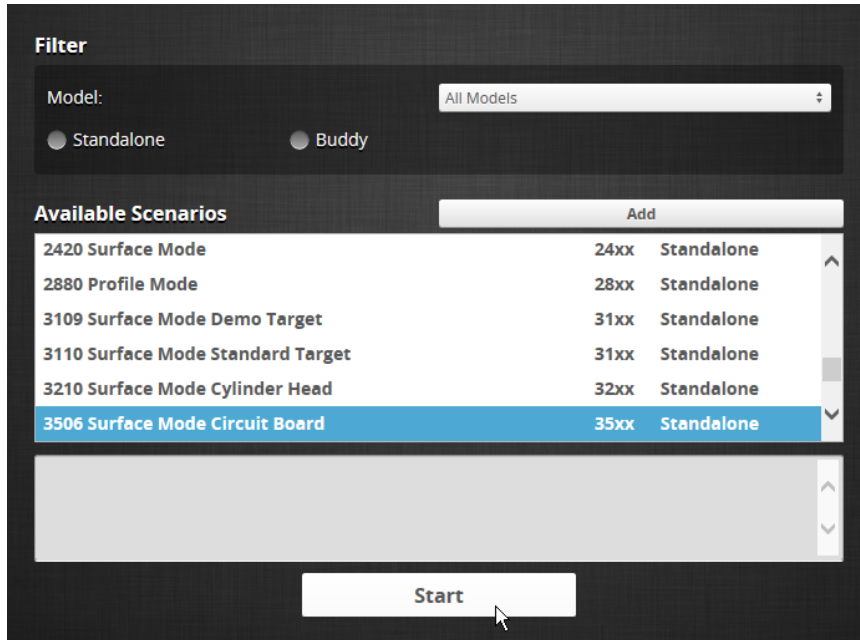


To run a scenario:

1. If you want to filter the scenarios listed in **Available Scenarios**, do one or both of the following:
 - Choose a model family in the **Model** drop-down.
 - Choose **Standalone** or **Buddy** to limit the scenarios to single-sensor or dual-/multi-sensor scenarios, respectively.
2. Select a scenario in the **Available Scenarios** list and click **Start**.


Removing a Scenario from the Emulator

 You can easily remove a scenario from the emulator.



To remove a scenario:


1. If the emulator is running a scenario, click **Stop Emulation** to stop it.
2. In the **Available Scenarios** list, scroll to the scenario you want to remove.

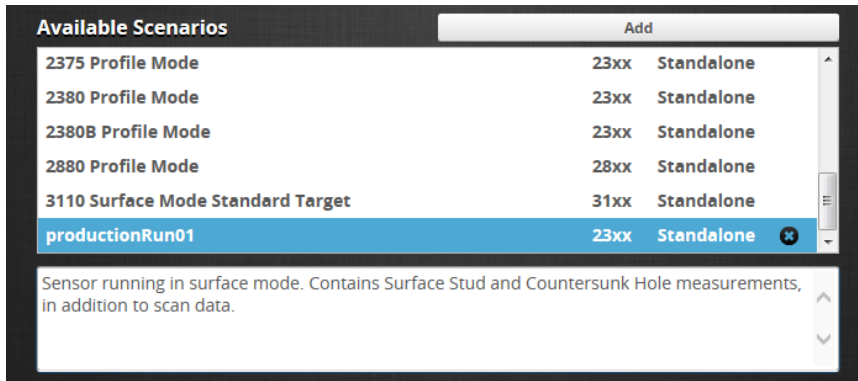

- Click the  button next to the scenario you want to remove.
The scenario is removed from the emulator.

Using Replay Protection

Making changes to certain settings on the **Scan** page causes the emulator to flush replay data. The **Replay Protection** option protects replay data by preventing changes to settings that affect replay data. Settings that do not affect replay data can be changed.

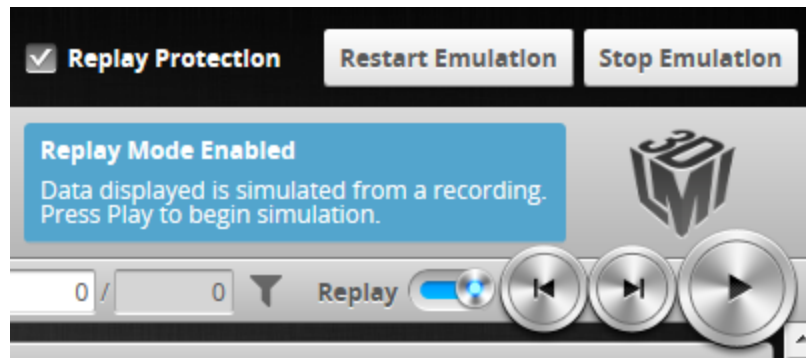


If you try to uncheck **Replay Protection**, you must confirm that you want to disable it.

Replay Protection is on by default.

Stopping and Restarting the Emulator

To stop the emulator:

 - Click **Stop Emulation**.



Stopping the emulator returns you to the launch screen.

To restart the emulator when it is running:

- Click **Restart Emulation**.


Restarting the emulator restarts the currently running simulation.

Running the Emulator in Default Browser


When you use the `/browser` command line parameter, the emulator application launches normally but also launches in your default browser. This provides additional flexibility when using the emulator. For example, you can resize the emulator running in a browser window.

To run the emulator in your default browser:

1. In Windows Explorer (Windows 7) or File Explorer (Windows 8 or 10), browse to the location of the emulator. The emulator is under `bin\win64`, in the location in which you installed the emulator.
2. Press and hold `Shift`, right-click the `win64` folder containing the emulator, and choose **Open command window here** (or **Open PowerShell window here**).

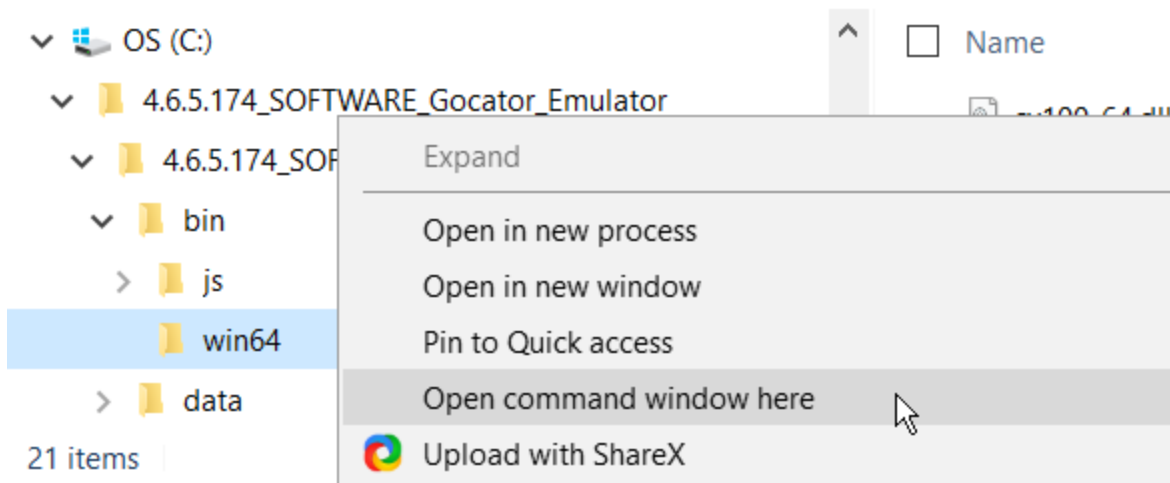

 3. In the command prompt, type `GoEmulator.exe /browser` (or `.\GoEmulator.exe /browser` for PowerShell).



After the emulator application starts, the emulator also launches in your default browser.

Working with Jobs and Data

The following topics describe how to work with jobs and replay data (data recorded from a physical sensor) in a scenario running on the emulator.

Creating, Saving, and Loading Jobs

Changes saved to job files in the emulator are *not* persistent (they are lost when you close or restart the emulator). To keep jobs permanently, you must first save the job in the emulator and then download the job file to a client computer. See below for more information on creating, saving, and switching jobs. For information on downloading and uploading jobs between the emulator and a computer, see *Downloading and Uploading Jobs* on page 358.

The job drop-down list in the toolbar shows the jobs available in the emulator. The job that is currently active is listed at the top. The job name will be marked with "[unsaved]" to indicate any unsaved changes.



To create a job:

1. Choose **[New]** in the job drop-down list and type a name for the job.
2. Click the **Save** button  or press **Enter** to save the job.
The job is saved to the emulator using the name you provided.

To save a job:

- Click the **Save** button .
- The job is saved to the emulator.

To load (switch) jobs:


- Select an existing file name in the job drop-down list.
- The job is activated. If there are any unsaved changes in the current job, you will be asked whether you want to discard those changes.

Playback and Measurement Simulation

The emulator can replay scan data previously recorded by a physical sensor, and also simulate measurement tools on recorded data. This feature is most often used for troubleshooting and fine-tuning measurements, but can also be helpful during setup.

Playback is controlled using the toolbar controls.

 Recording is not functional in the emulator.

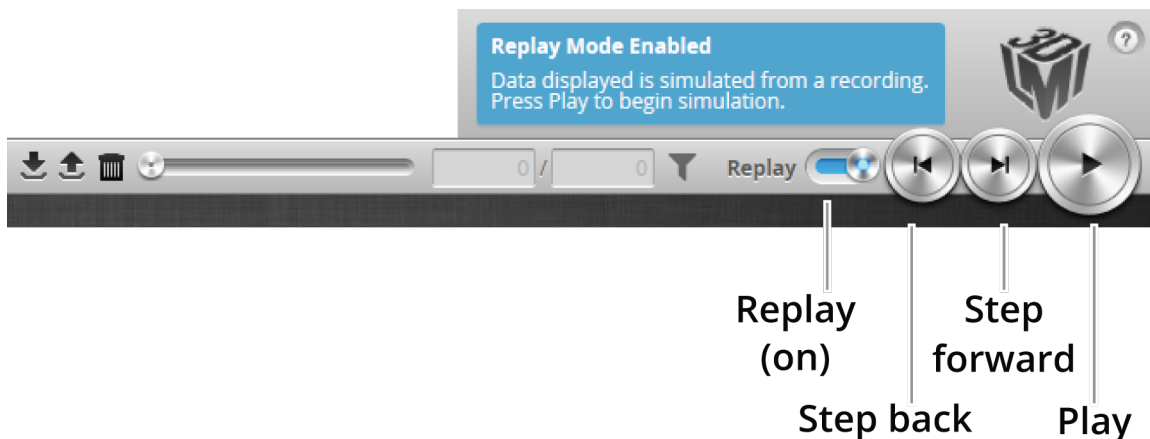


Playback controls when replay is on

To replay data:

1. Toggle **Replay** mode on by setting the slider to the right in the **Toolbar**.
The slider's background turns blue.

 To change the mode, you must uncheck **Replay Protection**.



2. Use the **Replay** slider or the **Step Forward**, **Step Back**, or **Play** buttons to review data.
The **Step Forward** and **Step Back** buttons move the current replay location forward and backward by a single frame, respectively.
The **Play** button advances the replay location continuously, animating the playback until the end of the replay data.
The **Stop** button (replaces the **Play** button while playing) can be used to pause the replay at a particular location.
The **Replay** slider (or **Replay Position** box) can be used to go to a specific replay frame.

To simulate measurements on replay data:

1. Toggle **Replay** mode on by setting the slider to the right in the **Toolbar**.
The slider's background turns blue.
To change the mode, **Replay Protection** must be unchecked.
2. Go to the **Measure** page.
Modify settings for existing measurements, add new measurement tools, or delete measurement tools as desired. For information on adding and configuring measurements, see *Measurement and Processing* on page 141.
3. Use the **Replay Slider**, **Step Forward**, **Step Back**, or **Play** button to simulate measurements.
Step or play through recorded data to execute the measurement tools on the recording.
Individual measurement values can be viewed directly in the data viewer. Statistics on the measurements that have been simulated can be viewed in the **Dashboard** page; for more information on the dashboard, see *Dashboard* on page 343.

To clear replay data:


- Click the **Clear Replay Data** button .

Downloading, Uploading, and Exporting Replay Data

Replay data (recorded scan data) can be downloaded from the emulator to a client computer, or uploaded from a client computer to the emulator.

Data can also be exported from the emulator to a client computer in order to process the data using third-party tools.

 You can only upload replay data to the same sensor model that was used to create the data.
--

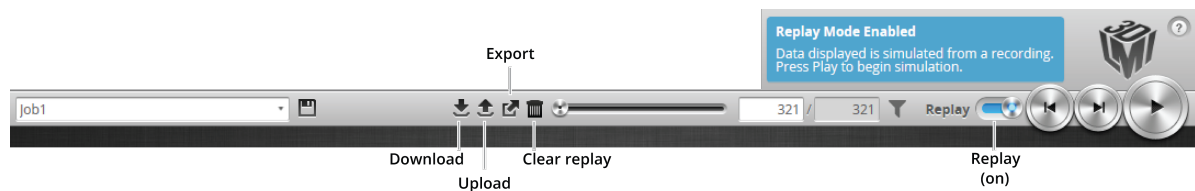


Replay data is not loaded or saved when you load or save jobs.

To download replay data:

1. Click the Download button .
2. In the **File Download** dialog, click **Save**.
3. In the **Save As...** dialog, choose a location, optionally change the name, and click **Save**.


To upload replay data:

1. Click the Upload button .
- The Upload menu appears.

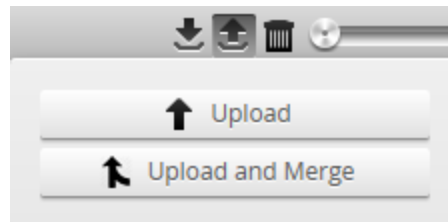

2. In the Upload menu, choose one of the following:
 - **Upload:** Unloads the current job and creates a new unsaved and untitled job from the content of the replay data file.
 - **Upload and merge:** Uploads the replay data and merges the data's associated job with the current job. Specifically, the settings on the **Scan** page are overwritten, but all other settings of the current job are preserved, including any measurements or models.

If you have unsaved changes in the current job, the firmware asks whether you want to discard the changes.

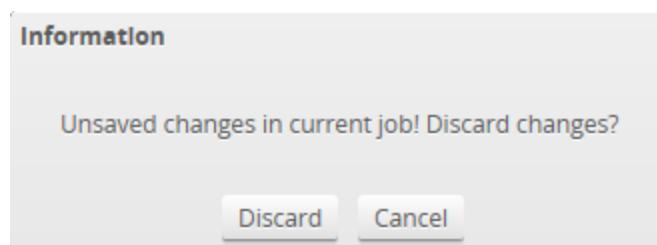


3. Do one of the following:
 - Click **Discard** to discard any unsaved changes.
 - Click **Cancel** to return to the main window to save your changes.
4. If you clicked **Discard**, navigate to the replay data to upload from the client computer and click **OK**.
The replay data is loaded, and a new unsaved, untitled job is created.

Replay data can be exported using the CSV format.



Surface intensity data cannot be exported to the CSV format. It can only be [exported separately as a bitmap](#).

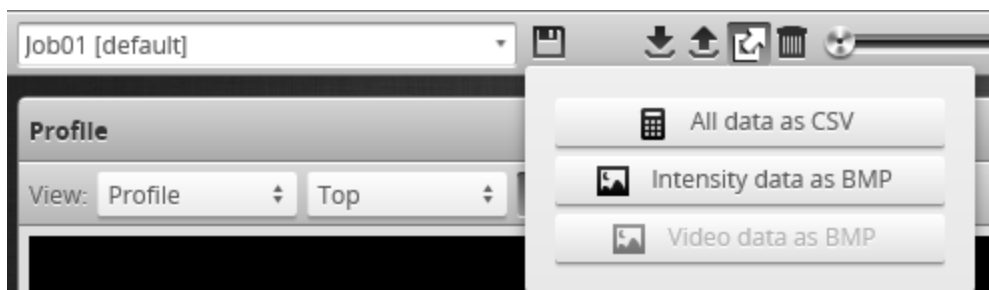

To export replay data in the CSV format:

1. In the **Scan Mode** panel, switch to Profile or Surface.
2. Switch to Replay mode.
3. Click the Export button  and select **All Data as CSV**.
Only data at the current replay location is exported.
Use the playback control buttons to move to a different replay location; for information on playback, see *To replay data in Playback and Measurement Simulation* on page 354.
4. (Optional) Convert exported data to another format using the CSV Converter Tool. For information on this tool, see *CSV Converter Tool* on page 593.



The decision values in the exported data depend on the *current* state of the job, not the state during recording. For example, if you record data when a measurement returns a *pass* decision, change the measurement's settings so that a *fail* decision is returned, and then export to CSV, you will see a *fail* decision in the exported data.

Recorded intensity data can be exported to a bitmap (.BMP format). **Acquire Intensity** must be checked in the **Scan Mode** panel while data was being recorded in order to export intensity data.

To export recorded intensity data to the BMP format:

- Switch to Replay mode and click the **Export** button  and select **Intensity data as BMP**.
Only the intensity data in the current replay location is exported.
Use the playback control buttons to move to a different replay location; for information on playback, see *To replay data in Playback and Measurement Simulation* on page 354.




To export video data to a BMP file:

1. In the **Scan Mode** panel, switch to Video mode.
Use the playback control buttons to move to a different replay location; for information on playback, see *To replay data in Playback and Measurement Simulation* on page 354.
2. Switch to Replay mode.
3. Click the Export button  and select **Video data as BMP**.

Downloading and Uploading Jobs


The **Jobs** category on the **Manage** page lets you manage the jobs in the emulator.

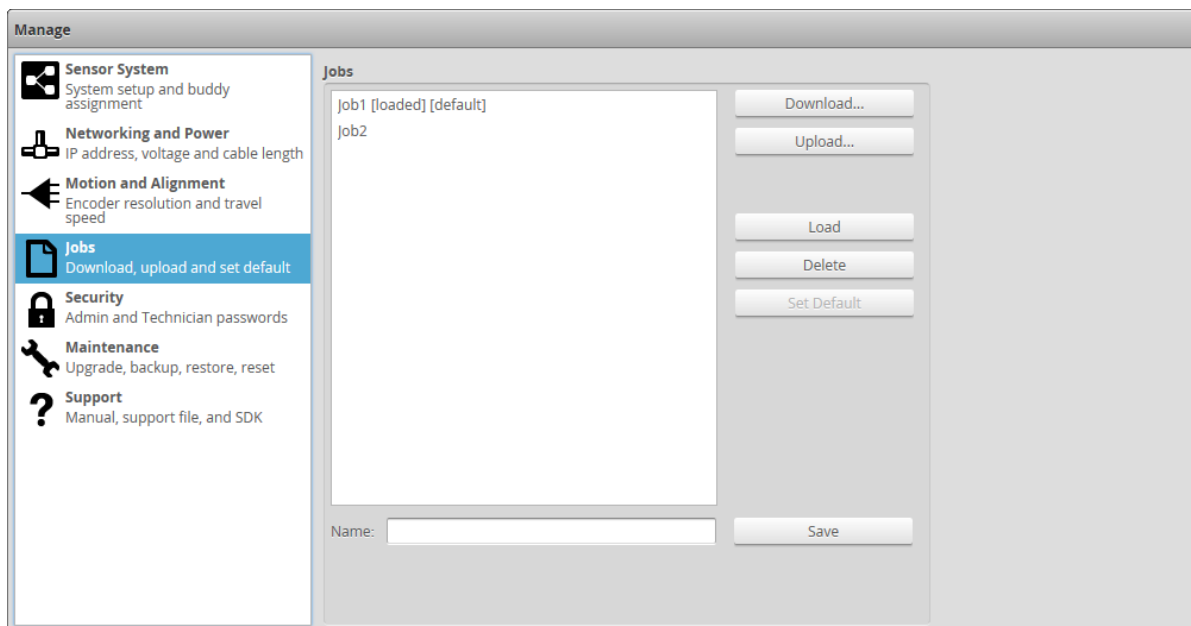

Element	Description
Name field	Used to provide a job name when saving files.
Jobs list	Displays the jobs that are currently saved in the emulator.
Save button	Saves current settings to the job using the name in the Name field. Changes to job files are not persistent in the emulator. To keep changes, first save changes in the job file, and then download the job file to a client computer. See the procedures below for instructions.

Element	Description
Load button	Loads the job that is selected in the job list. Reloading the current job discards any unsaved changes.
Delete button	Deletes the job that is selected in the job list.
Set as Default button	Setting a different job as the default is not persistent in the emulator. The job set as default when the support file (used to create a virtual sensor) was downloaded is used as the default whenever the emulator is started.
Download... button	Downloads the selected job to the client computer.
Upload... button	Uploads a job from the client computer.

Unsaved jobs are indicated by "[unsaved]".

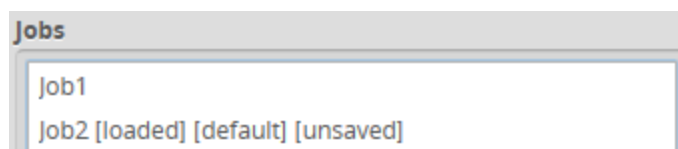



Changes to job files in the emulator are *not* persistent (they are lost when you close or restart the emulator). However, you can keep modified jobs by first saving them and then downloading them to a client computer.

To save a job:

1. Go to the **Manage** page and click on the **Jobs** category.
2. Provide a name in the **Name** field.
To save an existing job under a different name, click on it in the **Jobs** list and then modify it in the **Name** field.
3. Click on the **Save** button or press **Enter**.

To download, load, or delete a job, or to set one as a default, or clear a default:

1. Go to the **Manage** page and click on the **Jobs** category.
2. Select a job in the **Jobs** list.
3. Click on the appropriate button for the operation.

Scan, Model, and Measurement Settings

The settings on the **Scan** page related to actual scanning will clear the buffer of any scan data that is uploaded from a client computer, or is part of a support file used to create a virtual sensor. If **Replay Protection** is checked, the emulator will indicate in the log that the setting can't be changed because the change would clear the buffer. For more information on Replay Protection, see *Using Replay Protection* on page 352.

Other settings on the **Scan** page related to the post-processing of data can be modified to test their influence on scan data, without modifying or clearing the data, for example edge filtering (page 108), and filters on the X axis (page 104). Note that modifying the Y filters causes the buffer to be cleared.

For information on creating models and setting up part matching, see *Models* on page 120. For information on adding and configuring measurement tools, see *Measurement and Processing* on page 141.

Calculating Potential Maximum Frame Rate

You can use the emulator to calculate the potential maximum frame rate you can achieve with different settings.

For example, when you reduce the active area, in the **Active Area** tab on the **Sensor** panel, the maximum frame rate displayed on the **Trigger** panel is updated to reflect the increased speed that would be available in a physical Gocator sensor. (See *Active Area* on page 90 for more information on active area.)

Similarly, you can adjust exposure on the **Exposure** tab on the **Sensor** panel to see how this affects the maximum frame rate. (See *Exposure* on page 92 for more information on exposure.)



To adjust active area in the emulator, **Replay Protection** must be turned off. See *Using Replay Protection* on page 352 for more information.



Saving changes to active area causes replay data to be flushed.

Protocol Output

The emulator simulates output for all of Gocator's Ethernet-based protocols.

- [Gocator](#)
- [ASCII](#)
- [Modbus](#)
- [EtherNet/IP](#)

Clients (such as PLCs) can connect to the emulator to access the simulated output and use the protocols as they would with a physical sensor.

The emulator allows connections to emulated sensors on localhost (127.0.0.1). You can also allow connections to emulated sensors on your computer's network card; for more information, see *Remote Operation* below.

Remote Operation

You can specify the IP address of one of your computer's network cards to allow clients to connect remotely to an emulated sensor using the `/ip` command line parameter. When the `/ip` parameter is not used, emulated sensors are only available on the local machine (that is, 127.0.0.1 or localhost).




Clients can only connect to emulated sensors, not to the emulator's launch page.



You may need to contact your network administrator to allow connections to the computer running the emulated sensor.

To allow remote connections to an emulated sensor:

1. In Windows Explorer (Windows 7) or File Explorer (Windows 8 or 10), browse to the location of the emulator. The emulator is under `bin\win64`, in the location in which you installed the emulator.
2. Press and hold `Shift`, right-click the `win64` folder containing the emulator, and choose **Open command window here** (or **Open PowerShell window here**).

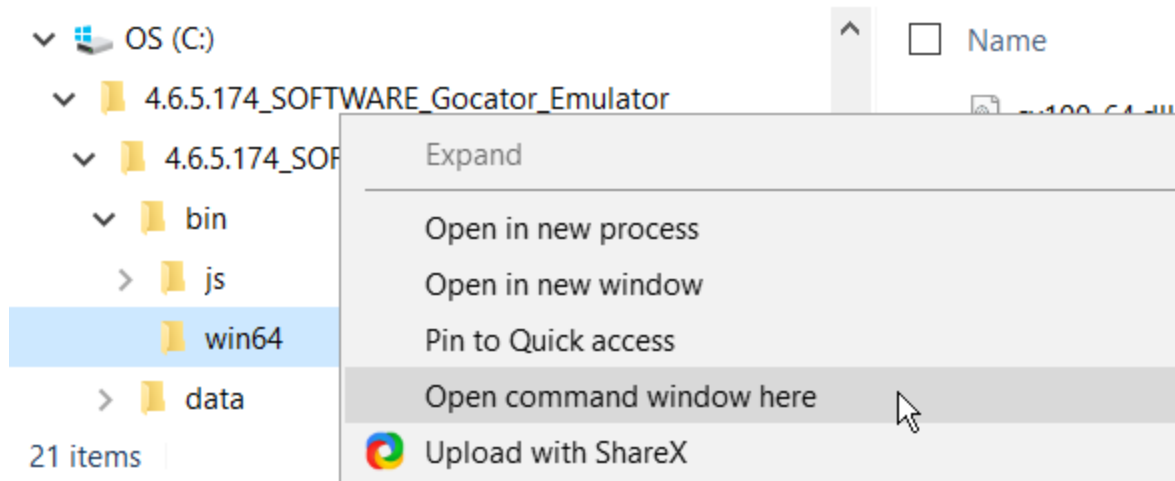

3. In the command prompt, type `GoEmulator.exe /ip`, followed by a valid IPV4 address on your network.

```
C:\WINDOWS\system32\cmd.exe
C:\4.6.5.174_SOFTWARE_Gocator_Emulator\4.6.5.174_SOFTWARE_Gocator_Emulator\bin\win64>GoEmulator.exe /ip 192.168.1.42_
```

The emulator application starts.

 The emulator does not check that the IP address is valid.


4. From the emulator launch page, start a scenario.
For more information, see *Running a Scenario* on page 351.
5. Provide the IP address you used with the `/ip` parameter, followed by port number 3191, to users who want to connect to the emulated sensor, for example:
`192.168.1.42:3191`

Gocator Accelerator

The Gocator accelerator improves a Gocator system's processing capability by transferring the processing to a PC in the system. It can accelerate one or more standalone sensors or multi-sensor systems.

The Gocator emulator and accelerator do not support the PROFINET protocol.

You can implement acceleration capabilities in client applications that you create using the [Gocator SDK](#). LMI also provides a standalone utility (GoAccelerator.exe) that you can use to accelerate systems.

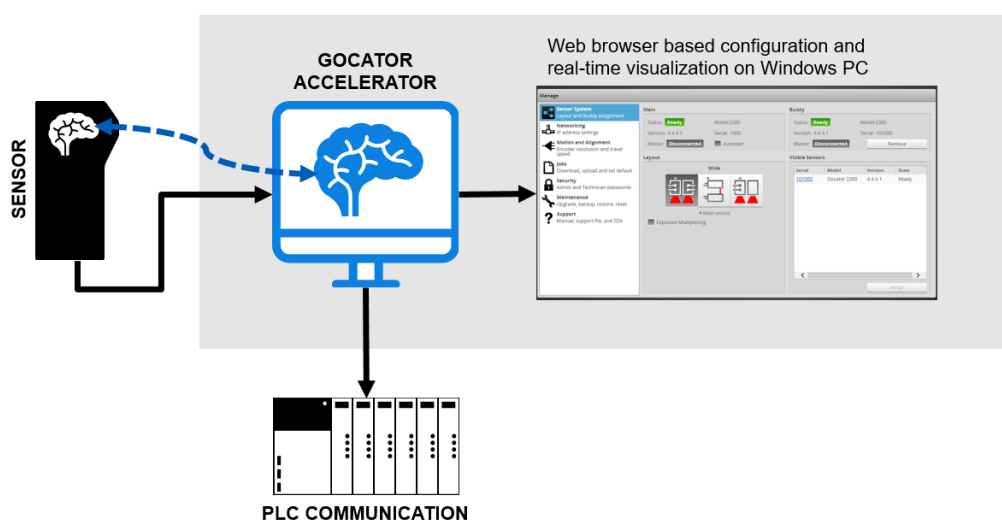

The [web interface](#) on an accelerated sensor is identical to the interface on an unaccelerated sensor. The Ethernet-based [output protocols](#) (Gocator, EtherNet/IP, ASCII, and Modbus) are also identical to those found on an unaccelerated sensor, and are fully supported.

The Gocator Accelerator supports digital, analog, and serial output from sensors. However, because output must be passed to the PC and then back to the sensor, network latency will have an impact on performance.

The firmware version of the sensor you want to accelerate must match the version of the SDK used to build an accelerator-based application (or the version of the GoAccelerator utility).

When a sensor is accelerated, it sends data directly to the accelerating application. Users access the Gocator web interface using the IP address of the computer running the application, rather than the IP of the sensor.

Some health indicators behave differently when a sensor is accelerated. For information on

which indicators in the Dashboard that acceleration affects, see *State and Health Information* on page 343. For information on which indicators available through the Gocator protocol acceleration affects, see *Health Results* on page 515.

Once a system is accelerated, an SDK application can interface to the accelerator application the same way as is possible with a physical sensor, although the IP of the accelerating PC must be used for the connection.

System Requirements and Recommendations

The following are the minimum system requirements for accelerating a single sensor with the Gocator accelerator PC application:

- Processor: Intel Core i3 or equivalent (32- or 64-bit)
- RAM: 4 GB
- Hard drive: 128 GB
- Operating system: Windows 7, 8, or 10 (32- or 64-bit)

To accelerate more sensors or run the system at higher speeds, use a computer with greater system resources.

The following are general recommendations:

- Run only the accelerator application on the PC: third-party applications can consume system resources in unpredictable ways and at random times.
- Limit background Windows processes such as drive optimization (defragmentation) or virus scans, or schedule them so that they don't interfere with scanning sessions.
- Ensure that sufficient overhead in the system's resources is available. You can review the PC's resources with the Windows Task Manager and Resource Monitor applications. We recommend that you leave at least 20% network bandwidth, CPU, memory and disk utilization at all times.
- To verify system stability and robustness, perform long-term testing over multiple days.

Benefits

Accelerated sensors provide several benefits.

Acceleration is completely transparent: because the output protocols of an accelerated sensor are identical to those of an unaccelerated sensor, SDK and PLC applications require no changes whatsoever for controlling accelerated sensors and receiving health information and data.

Measurement latency is reduced on accelerated sensors, which results in shorter cycle times. This means a sensor can scan more targets in a given time period.

The memory of accelerated sensors is limited only by the memory of the PC on which the Accelerator is running. Accelerated sensors can therefore handle large 3D point clouds more effectively.


Installation

To get the necessary packages, go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download it from the Download Center.

- For the GoAccelerator utility, download the 14405-X.X.X.X_SOFTWARE_GO_Tools.zip package.
- For the SDK libraries and DLL for integrating acceleration into a client application, download the 14400-X.X.X.X_SOFTWARE_GO_SDK.zip.

Gocator Accelerator Utility

The Gocator Accelerator utility accelerates the standalone sensors or multi-sensor systems you choose.

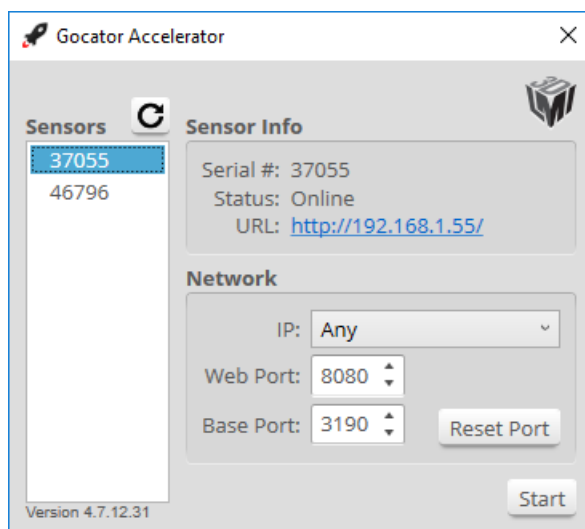


To accelerate a sensor using the Gocator Accelerator utility:


1. Power up the sensor system you want to accelerate.
2. Launch the Gocator Accelerator utility.
3. If a Windows Security alert asks whether you want to allow GoAccelerator.exe to communicate on networks, make sure **Public** and **Private** are checked, and then click **Allow Access**.
4. In the **Sensors** list, click the sensor you want to accelerate.

If you do not see the sensor, you may need to wait a few seconds and then click the Refresh button ().
In multi-sensor systems, only the Main sensor is listed.

5. (Optional) In the **IP** drop-down, choose an IP or choose **Any** to let the application choose.

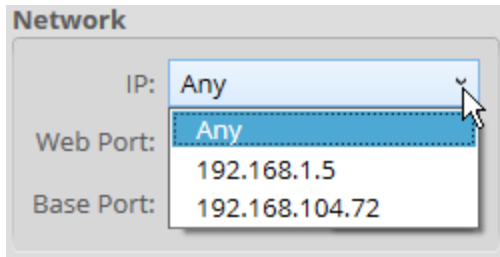

6. (Optional) Set **Web Port** to a port for use with the accelerated sensor's URL.

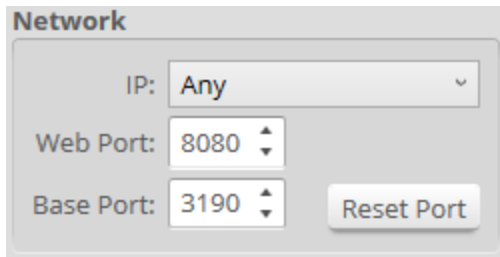

 If port 8080 is already in use, set **Web Port** to an unused port.

7. (Optional) If you are accelerating multiple systems, click on another sensor in the **Sensors** list, and repeat the steps above.


The application uses **Base Port** as an offset for several communication port numbers.

To avoid port conflicts, you should increment the base port number by at least 10 for each accelerated sensor.

Port 3190 is the default base port number, allowing connections from SDK-based applications and the web UI without manually specifying ports.

8. Click **Start**.

The sensor system is now accelerated. An icon appears next to the accelerated sensor in the **Sensors** list to indicate this.

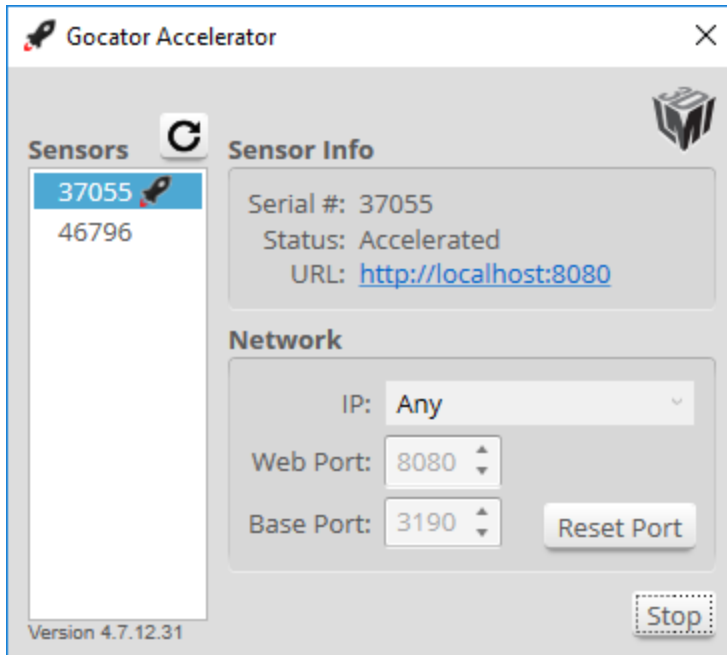

9. To open the accelerated sensor's web interface, in the Gocator Accelerator application, click the link next to **URL**.

When a sensor is accelerated, a "rocket" icon appears in the [metrics area](#).



 If you restart an accelerated sensor, the sensor will continue to be accelerated when it restarts.

To stop an accelerated sensor in the Gocator Accelerator application:

1. Select the sensor in the **Sensors** list.
2. Click **Stop**.

To exit the Gocator Accelerator application:

1. Right-click the icon Gocator Accelerator icon () in the notification tray.
Clicking the X icon in the application only minimizes the application.
2. Choose **Exit**.

Dashboard and Health Indicators

After a sensor is accelerated, the values of some health indicators come from the accelerating PC instead of the sensor. Others come from a combination of the accelerated sensor and the accelerating PC.

- For information on which indicators are affected in the Dashboard in the web interface, see *State and Health Information* on page 343.

- For information on which indicators accessed through the Gocator protocol are affected, see *Health Results* on page 515.

SDK Application Integration

Gocator acceleration can be fully integrated into an SDK application. Users simply need to instantiate the GoAccelerator object and connect it to a sensor object.

```
GoAccelerator accelerator = kNULL;

// obtain GoSensor object by sensor IP address
if ((status = GoSystem_FindSensorByIpAddress(system, &ipAddress, &sensor)) != kOK)
{
    printf("Error: GoSystem_FindSensorByIpAddress:%d\n", status);
    return;
}

// construct accelerator
if ((status = GoAccelerator_Construct(&accelerator, kNULL)) != kOK)
{
    printf("Error: GoAccelerator_Construct:%d\n", status);
    return;
}

// start accelerator
if ((status = GoAccelerator_Start(accelerator)) != kOK)
{
    printf("Error: GoAccelerator_Start:%d\n", status);
    return;
}

printf ("GoAccelerator_Start completed\n");
if ((status = GoAccelerator_Attach(accelerator, sensor)) != kOK)
{
    printf("Error: GoAccelerator_Attach:%d\n", status);
    return;
}

// create connection to GoSensor object
if ((status = GoSensor_Connect(sensor)) != kOK)
{
    printf("Error: GoSensor_Connect:%d\n", status);
    return;
}
```

After, the SDK application can control an accelerated sensor in the same way as an unaccelerated sensor.

Gocator Device Files

This section describes the user-accessible device files stored on a Gocator.

Live Files

Various "live" files stored on a Gocator sensor represent the sensor's active settings and transformations (represented together as "job" files), the active replay data (if any), and the sensor log.

By changing the live job file, you can change how the sensor behaves. For example, to make settings and transformations active, [write to](#) or [copy to](#) the `_live.job` file. You can also save active settings or transformations to a client computer, or to a file on the sensor, by [reading from](#) or [copying](#) these files, respectively.



The live files are stored in volatile storage. Only user-created job files are stored in non-volatile storage.

The following table lists the live files:

Live Files

Name	Read/Write	Description
<code>_live.job</code>	Read/Write	The active job. This file contains a Configuration component containing the current settings. If Alignment Reference in the active job is set to Dynamic, it also contains a Transform component containing transformations. For more information on job files (live and user-created), accessing their components, and their structure, see <i>Job File Structure</i> on the next page.
<code>_live.cfg</code>	Read/Write	A standalone representation of the Configuration component contained in <code>_live.job</code> . Used primarily for backwards compatibility.
<code>_live.tfm</code>	Read/Write	If Alignment Reference of the active job is set to Dynamic: A copy of the Transform component in <code>_live.job</code> . Used primarily for backwards compatibility. If Alignment Reference of the active job is set to Fixed: The transformations that are used for <i>all</i> jobs whose Alignment Reference setting is set to Fixed.
<code>_live.log</code>	Read	A sensor log containing various messages. For more information on the log file, see <i>Log File</i> below.
<code>_live.rec</code>	Read/Write	The active replay simulation data.
<code>ExtendedId.xml</code>	Read	Sensor identification.

Log File

The log file contains log messages generated by the sensor. The root element is *Log*.

To access the log file, use the [Read File](#) command, passing "_live.log" to the command. The log file is read-only.

Log Child Elements

Element	Type	Description
@idStart	64s	Identifier of the first log.
@idEnd	64s	Identifier of the final log.
List of (Info Warning Error)	List	An ordered list of log entries. This list is empty if idEnd < idStart.

Log/Info | Log/Warning | Log/Error Elements

Element	Type	Description
@time	64u	Log time, in uptime (µs).
@source	32u	The serial number of the sensor the log was produced by.
@id	32u	The Identifier, or index, of the log
@value	String	Log content; may contain printf-style format specifiers (e.g. %u).
List of (IntArg FloatArg Arg)	List	An ordered list of arguments: IntArg – Integer argument FloatArg – Floating-point argument Arg – Generic argument

The arguments are all sent as strings and should be applied in order to the format specifiers found in the content.

Job File Structure

The following sections describe the structure of job files.

Job files, which are stored in a Gocator's internal storage, control system behavior when a sensor is running. Job files contain the settings and potentially the transformations and models associated with the job (if [Alignment Reference](#) is set to Dynamic).

There are two kinds of job files:

- A special job file called "_live.job." This job file contains the *active* settings and potentially the transformations and models associated with the job. It is stored in volatile storage.
- Other job files that are stored in non-volatile storage.

Job File Components

A job file contains components that can be loaded and saved as independent files. The following table lists the components of a job file:

Job File Components

Component	Path	Description
Configuration	config.xml	The job's configurations. This component is always present. For more

Component	Path	Description
		information, see <i>Configuration</i> below.
Transform	transform.xml	Transformation values. Present only if Alignment Reference is set to Dynamic. For more information, see <i>Transform</i> on page 458.
Part model	<name>.mdl	One or more part model files. Part models are created using models and part matching . For more information, see <i>Part Models</i> on page 459.

Elements in the components contain three types of values: settings, constraints, and properties. Settings are input values that can be edited. Constraints are read-only limits that define the valid values for settings. Properties are read-only values that provide supplemental information related to sensor setup.

When a job file is received from a sensor, it will contain settings, constraints, and properties. When a job file is sent to a sensor, any constraints or properties in the file will be ignored.

Changing the value of a setting can affect multiple constraints and properties. After you upload a job file, you can download the job file again to access the updated values of the constraints and properties.

Accessing Files and Components

Job file components can be accessed individually as XML files using path notation. For example, the configurations in a user-created job file called *productionRun01.job* can be read by passing "productionRun01.job/config.xml" to the [Read File](#) command. In the same way, the configurations in the active job could be read using "_live.job/config.xml".



If [Alignment Reference](#) is set to Fixed, the active job file (_live.job) will not contain transformations. To access transformations in this case, you must access them via _live.tfm.



The following sections correspond to the XML structure used in job file components.

Configuration

The Configuration component of a job file contains settings that control how a Gocator sensor behaves.

You can access the Configuration component of the active job as an XML file, either using path notation, via "_live.job/config.xml", or directly via "_live.cfg".

You can access the Configuration component in user-created job files in non-volatile storage, for example, "productionRun01.job/config.xml". You can only access configurations in user-created job files using path notation.

See the following sections for the elements contained in this component.

All Gocator sensors share a common job file structure and settings for all features are included in job files, regardless of the model.



If a setting in a job file is not used by a sensor, the setting's *used* property is set to 0.

Configuration Child Elements

Element	Type	Description
@version	32u	Configuration version (101).
@versionMinor	32u	Configuration minor version (9).
Setup	Section	For a description of the Setup elements, see <i>Setup</i> below.
Replay	Section	Contains settings related to recording filtering (see <i>Replay</i> on page 392).
Streams	Section	Read-only collection of available data streams (see <i>Streams/Stream (Read-only)</i> on page 393).
ToolOptions	Section	List of available tool types and their information. See <i>ToolOptions</i> on page 394 for details.
Tools	Collection	Collection of sections. Each section is an instance of a tool and is named by the type of the tool it describes. For more information, see the sections for each tool under <i>Tools</i> on page 396.
Tools.options	String (CSV)	Deprecated. Replaced by ToolOptions .
Outputs	Section	For a description of the Output elements, see <i>Output</i> on page 451.

Setup

The Setup element contains settings related to system and sensor setup.

Setup Child Elements

Element	Type	Description
TemperatureSafetyEnabled	Bool	Enables laser temperature safety control. Only applies to certain laser-based sensors.
TemperatureSafetyEnabled.used	Bool	Whether or not this property is used.
ScanMode	32s	The default scan mode.
ScanMode options	String (CSV)	List of available scan modes.
OcclusionReductionEnabled	Bool	Enables occlusion reduction.
OcclusionReductionEnabled.used	Bool	Whether or not property is used.
OcclusionReductionEnabled.value	Bool	Actual value used if not configurable.
OcclusionReductionAlg	32s	The Algorithm to use for occlusion reduction: 0 – Standard 1 – High Quality
OcclusionReductionAlg.used	Bool	Whether or not property is used
OcclusionReductionAlg.value	Bool	Actual value used if not configurable
UniformSpacingEnabled	Bool	Enables uniform spacing.
UniformSpacingEnabled.used	Bool	Whether or not property is used.
UniformSpacingEnabled.value	Bool	Actual value used if not configurable.

Element	Type	Description
e		
IntensityEnabled	Bool	Enables intensity data collection.
IntensityEnabled.used	Bool	Whether or not property is used.
IntensityEnabled.value	Bool	Actual value used if not configurable.
FlickerFreeModeEnabled	Bool	Enables flicker-free operation.
FlickerFreeModeEnabled.used	Bool	Whether flicker-free operation can be used on this sensor.
ExternalInputZPulseEnabled	Bool	Enables the External Input based encoder Z Pulse feature.
ExternalInputZPulseIndex	32u	Input index to use for the input triggered z pulse feature.
ExternalInputZPulseEnabled.used	Bool	Whether the index can be set.
Filters	Section	See <i>Filters</i> below. Used by Gocator profile and snapshot sensors.
Trigger	Section	See <i>Trigger</i> on page 375.
Layout	Section	See <i>Layout</i> on page 376.
Alignment	Section	See <i>Alignment</i> on page 378.
Devices	Collection	A collection of two Device sections (with roles main and buddy). See <i>Devices / Device</i> on page 380.
SurfaceGeneration	Section	See <i>SurfaceGeneration</i> on page 386. Used by Gocator profile sensors.
SurfaceSections	Section	See <i>SurfaceSections</i> on page 387.
ProfileGeneration	Section	See <i>ProfileGeneration</i> on page 387. Used by Gocator displacement sensors.
PartDetection	Section	See <i>PartDetection</i> on page 388.
PartMatching	Section	See <i>PartMatching</i> on page 390.
Custom	Custom	Used by specialized sensors.

Filters

The Filters element contains settings related to post-processing profiles before they are output or used by measurement tools. This element is used by Gocator profile and snapshot sensors.

XSmoothing

XSmoothing Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

YSmoothing

YSmoothing Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

XGapFilling

XGapFilling Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

YGapFilling

YGapFilling Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

XMedian

XMedian Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

YMedian

YMedian Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

XDecimation

XDecimation Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

YDecimation

YDecimation Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

XSlope

 This filter is only available on displacement sensors.
--

XSlope Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

YSlope

 This filter is only available on displacement sensors.
--

YSlope Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
Enabled	Bool	Enables filtering.
Window	64f	Window size (mm).
Window.min	64f	Minimum window size (mm).
Window.max	64f	Maximum window size (mm).

Trigger

The Trigger element contains settings related to trigger source, speed, and encoder resolution.

Trigger Child Elements

Element	Type	Description
Source	32s	Trigger source: 0 – Time 3 – Software
Source.options	32s (CSV)	List of available source options.
ExternalInputIndex	32s	Index of external input when Source is set to 2 – Digital Input and connected to a Master. 0 – first digital input 1 – second digital input 2 – third digital input 3 – fourth digital input
ExternalInputIndex.options	32s (CSV)	List of available external input indices.
ExternalInputIndex.used	Bool	Whether the external input index used.
Units	32s	Sensor triggering units when source is not clock or encoder: 0 – Time 1 – Encoder
FrameRate	64f	Frame rate for time trigger (Hz).
FrameRate.min	64f	Minimum frame rate (Hz).
FrameRate.max	64f	Maximum frame rate (Hz).
FrameRate.maxSource	32s	Source of maximum frame rate limit: 0 – Imager 1 – Surface generation
TracheidRate	64f	The frame rate of Tracheid data (Read Only)
TracheidRate.used	Bool	Whether the sensor has a Tracheid data rate.
FrameDataRate	64f	The frame rate of normal (range/profile/surface) data (Read Only)
FrameDataRate.used	Bool	Whether the sensor has a separate FrameDataRate
EncoderSpacing.min	64f	Minimum encoder spacing (mm).

Element	Type	Description
EncoderSpacing.max	64f	Maximum encoder spacing (mm).
EncoderSpacing.minSource	32s	Source of minimum encoder spacing: 0 – Resolution 1 – Surface generation
EncoderSpacing.used	Bool	Whether or not this parameter is configurable.
EncoderTriggerMode	32s	Encoder triggering mode: 0 – Tracking backward 1 – Bidirectional 2 – Ignore backward
Delay	64f	Trigger delay (µs or mm).
Delay.min	64f	Minimum trigger delay (µs or mm).
Delay.max	64f	Maximum trigger delay (µs or mm).
GateEnabled	Bool	Enables digital input gating.
GateEnabled.used	Bool	True if this parameter can be configured.
GateEnabled.value	Bool	Actual value if the parameter cannot be configured.
BurstEnabled	Bool	Enables burst triggering.
BurstEnabled.Used	Bool	Whether or not this parameter is configurable.
BurstCount	32u	Number of scans to take during burst triggering.
BurstCount.used	Bool	Whether or not this parameter is configurable.
BurstCount.max	32u	Maximum burst count.
ReversalDistanceAutoEnabled	Bool	Whether or not to use auto-calculated value.
ReversalDistanceAutoEnabled.used	Bool	Whether or not this parameter can be configured.
ReversalDistance	64f	Encoder reversal threshold (for jitter handling)
ReversalDistance.used	Bool	Whether or not this parameter is used.
ReversalDistance.value	64f	Actual value.
LaserSleepMode.used	Bool	Whether or not this feature can be configured. Laser sleep mode settings are not used by snapshot sensors.
LaserSleepMode/Enabled	Bool	Enables or disables the feature.
LaserSleepMode/IdleTime	64u	Idle time before laser is turned off (µs).
LaserSleepMode/WakupEncoderTravel	64u	Minimum amount of encoder movement before laser turns on (mm).

Layout

Layout Child Elements

Element	Type	Description
DataSource	32s	Data source of the layout output (read-only):

Element	Type	Description
		0 – Top 1 – Bottom 2 – Top left 3 – Top right 4 – Top Bottom 5 – Left Right
XSpacingCount	32u	Number of points along X when data is resampled.
YSpacingCount	32u	Number of points along Y when data is resampled.
TransformedDataRegion	Region3D	Transformed data region of the layout output.
Orientation	32s	Sensor orientation: 0 – Normal (single-sensor system) / Wide (dual-sensor system) 1 – Opposite 2 – Reverse 3 – Grid
Grid	Grid	Grid representation of the multi-sensor layout.
Orientation.options	32s (CSV)	List of available orientation options.
Orientation.value	32s	Actual value used if not configurable.
MultiplexBuddyEnabled	Bool	Enables multiplexing for buddies.
MultiplexSingleEnabled	Bool	Enables multiplexing for a single sensor configuration.
MultiplexSingleExposureDuration	64f	Exposure duration in μ s (currently rounded to integer when read by the sensor)
MultiplexSingleDelay	64f	Delay in μ s. (Currently gets rounded up when read by the sensor.)
MultiplexSinglePeriod	64f	Period in μ s. (Currently gets rounded up when read by the sensor.)
MultiplexSinglePeriod.min	64f	Minimum period in μ s.

Region3D Child Elements

Element	Type	Description
X	64f	X start (mm).
Y	64f	Y start (mm).
Z	64f	Z start (mm).
Width	64f	X extent (mm).
Length	64f	Y extent (mm).
Height	64f	Z extent (mm).
ZAngle	64f	Z Angle start (degrees).
ZAngle.used	Bool	Whether or not this property is used.

Grid Elements

Element	Type	Description
ColumnCount	32u	Column count.
ColumnCount.value	32u	Column count value.

Alignment

The Alignment element contains settings related to alignment and encoder calibration.

Alignment Child Elements

Element	Type	Description
@used	Bool	Whether or not this field is used
InputTriggerEnabled	Bool	Enables digital input-triggered alignment operation.
InputTriggerEnabled.used	Bool	Whether or not this feature can be enabled. This feature is available only on some sensor models.
InputTriggerEnabled.value	Bool	Actual feature status.
Type	32s	Type of alignment operation: 0 – Stationary 1 – Moving
Type.options	32s (CSV)	List of available alignment types.
StationaryTarget	32s	Stationary alignment target: 0 – None 1 – Disk 2 – Bar 3 – Plate
StationaryTarget.options	32s (CSV)	List of available stationary alignment targets.
MovingTarget	32s	Moving alignment target: 1 – Disk 2 – Bar
MovingTarget.options	32s (CSV)	List of available moving alignment targets.
EncoderCalibrateEnabled	Bool	Enables encoder resolution calibration.
Disk	Section	See <i>Disk</i> below.
Bar	Section	See <i>Bar</i> on the next page.
Plate	Section	See <i>Plate</i> on the next page.
Polygon	Section	See <i>Polygon</i> on the next page.

Disk

Disk Child Elements

Element	Type	Description
Diameter	64f	Disk diameter (mm).
Height	64f	Disk height (mm).

Bar

Bar Child Elements

Element	Type	Description
Width	64f	Bar width (mm).
Height	64f	Bar height (mm).
HoleCount	32u	Number of holes.
HoleCount.value	32u	Actual number of holes expected by system.
HoleCount.used	Bool	Whether the hole count will be used in the bar alignment procedure.
HoleDistance	64f	Distance between holes (mm).
HoleDistance.used	Bool	Whether the hole distance will be used in the bar alignment procedure.
HoleDiameter	64f	Diameter of holes (mm).
HoleDiameter.used	Bool	Whether the hole diameter will be used in the bar alignment procedure.
DegreesOfFreedom	32s	Degrees of freedom (DOF) to align: 42 – 3 DOF: x, z, y angle 58 – 4 DOF: x, y, z, y angle 59 – 5 DOF: x, y, z, y angle, z angle

Plate

Plate Child Elements

Element	Type	Description
Height	64f	Plate height (mm).
HoleCount	32u	Number of holes.
RefHoleDiameter	64f	Diameter of reference hole (mm).
SecHoleDiameter	64f	Diameter of secondary hole(s) (mm).

Polygon

Polygon Child Elements

Element	Type	Description
Corners	List	Contains a list of Corners (described below).
Corners.minCount	32s	Minimum number of corners.

Polygon/Corner

Corner Child Elements

Element	Type	Description
X	64f	X Position
Y	64f	Y Position
Devices	List of 32u	List of devices this corner is assigned to.
Devices.options	List of 32u	List of valid options for this field.

Devices / Device

Devices / Device Child Elements

Element	Type	Description
@index	32u	Ordered index of devices in device list.
@role	32s	Sensor role: 0 – Main
Layout	Layout	Multiplexing bank settings.
DataSource	32s	Data source of device output (read-only): 0 – Top
XSpacingCount	32u	Number of resampled points along X (read-only).
YSpacingCount	32u	Number of resampled points along Y (read-only).
ActiveArea	Region3D	Active area. (Contains min and max attributes for each element.)
TransformedDataRegion	Region3D	Active area after transformation (read-only).
FrontCamera	Window	Front camera window (read-only).
BackCamera	Window	Back camera window (read-only).
BackCamera.used	Bool	Whether or not this field is used.
PatternSequenceType	32s	The projector pattern sequence to display when a projector equipped device is running. The following types are possible: -1 – None 0 – Default 100 – Nine Lines
PatternSequenceType.options	32s	List of available pattern sequence types.
PatternSequenceType.used	Bool	Whether or not this field is used.
PatternSequenceCount	32u	Number of frames in the active sequence (read-only).
ExposureMode	32s	Exposure mode: 0 – Single exposure 1 – Multiple exposures
ExposureMode.options	32s (CSV)	List of available exposure modes.
Exposure	64f	Single exposure (μs).
Exposure.min	64f	Minimum exposure (μs).
Exposure.max	64f	Maximum exposure (μs).
Exposure.used	Bool	Whether or not this field is used.
DynamicExposureMin	64f	Dynamic exposure range minimum (μs).
DynamicExposureMax	64f	Dynamic exposure range maximum (μs).
ExposureSteps	64f (CSV)	Multiple exposure list (μs).
ExposureSteps.countMin	32u	Minimum number of exposure steps.

Element	Type	Description
ExposureSteps.countMax	32u	Maximum number of exposure steps.
IntensitySource	32s	Intensity source: 0 – Both cameras 1 – Front camera 2 – Back camera
IntensitySource.options	32s (CSV)	List of available intensity sources.
IntensityMode	32s	Intensity Mode: 0 – Auto 1 – Preserve
IntensityMode.used	Bool	Whether intensity mode is used
ZSubsampling	32u	Subsampling factor in Z.
ZSubsampling.options	32u (CSV)	List of available subsampling factors in Z.
SpacingInterval	64f	Uniform spacing interval (mm).
SpacingInterval.min	64f	Minimum spacing interval (mm).
SpacingInterval.max	64f	Maximum spacing interval (mm).
SpacingInterval.used	Bool	Whether or not field is used.
SpacingInterval value	64f	Actual value used.
SpacingIntervalType	32s	Spacing interval type: 0 – Maximum resolution 1 – Balanced 2 – Maximum speed 3 – Custom
SpacingIntervalType.used	Bool	Whether or not this field is used.
Tracking	Section	See <i>Tracking Child Elements</i> on the next page.
Material	Section	See <i>Material Child Elements</i> on page 383.
Tracheid	Section	See <i>Tracheid Child Elements</i> on page 385.
IndependentExposures	Section	See <i>IndependentExposures Child Elements</i> on page 385
Custom	Custom	Used by specialized sensors.

Region3D Child Elements

Element	Type	Description
X	64f	X start (mm).
Y	64f	Y start (mm).
Z	64f	Z start (mm).
Width	64f	X extent (mm).
Length	64f	Y extent (mm).

Element	Type	Description
Height	64f	Z extent (mm).
ZAngle	64f	Z Angle start (degrees).
ZAngle.used	Bool	Whether or not this property is used.

Window Child Elements

Element	Type	Description
X	32u	X start (pixels).
Y	32u	Y start (pixels).
Width	32u	X extent (pixels).
Height	32u	Y extent (pixels).

Layout Child Elements

Element	Type	Description
Grid	Grid	Layout grid information.
MultiplexingBank	32u	Multiplexing bank ID
MultiplexingBank.used	32u	Whether or not this field can be specified
MultiplexingBank.value	32u	Actual value used by system

Grid Child Elements

Element	Type	Description
@used	Bool	Whether or not this section is used.
Row	32s	Device row position in grid layout.
Row.value	32s	Value in use by the sensor, useful for determining value when used is false.
Column	32s	Device column position in grid layout.
Column.value	32s	Value in use by the sensor, useful for determining value when used is false.
Direction	32s	Sensor orientation direction.
Direction.value	32s	Value in use by the sensor, useful for determining value when used is false.



Tracking is only available on Gocator 2300 and 2400 series sensors.

Tracking Child Elements

Element	Type	Description
Enabled	Bool	Enables tracking.
Enabled.used	Bool	Whether or not this field is used.
SearchThreshold	64f	Percentage of spots that must be found to remain in track.
Height	64f	Tracking window height (mm).
Height.min	64f	Minimum tracking window height (mm).
Height.max	64f	Maximum tracking window height (mm).

Material Child Elements

Element	Type	Description
Type	32s	Type of Material settings to use. 0 – Custom 1 – Diffuse 3 – Reflective
Type.used	Bool	Determines if the setting's value is currently used.
Type.value	32s	Value in use by the sensor, useful for determining value when used is false.
Type.options	32u (CSV)	List of available material types.
SpotThreshold	32s	Spot detection threshold.
SpotThreshold.used	Bool	Determines if the setting's value is currently used.
SpotThreshold.value	32s	Value in use by the sensor, useful for determining value when used is false.
SpotWidthMax	32s	Spot detection maximum width.
SpotWidthMax.used	Bool	Determines if the setting's value is currently used.
SpotWidthMax.value	32s	Value in use by the sensor, useful for determining value when used is false.
SpotWidthMax.min	32s	Minimum allowed spot detection maximum value.
SpotWidthMax.max	32s	Maximum allowed spot detection maximum value.
SpotSelectionType	32s	Spot selection type 0 – Best. Picks the strongest spot in a given column. 1 – Top. Picks the spot which is most Top/Left on the imager 2 – Bottom. Picks the spot which is most Bottom/Right on the imager 3 – None. All spots are available. This option may not be available in some configurations. 4 – Continuity. Picks the most continuous spot.
SpotSelectionType.used	Bool	Determines if the setting's value is currently used.
SpotSelectionType.value	32s	Value in use by the sensor, useful for determining value when used is false.
SpotSelectionType.options	32s (CSV)	List of available spot selection types.
CameraGainAnalog	64f	Analog camera gain factor.
CameraGainAnalog.used	Bool	Determines if the setting's value is currently used.
CameraGainAnalog.value	64f	Value in use by the sensor, useful for determining value when used is false.
CameraGainAnalog.min	64f	Minimum value.

Element	Type	Description
CameraGainAnalog.max	64f	Maximum value.
CameraGainDigital	64f	Digital camera gain factor.
CameraGainDigital.used	Bool	Determines if the setting's value is currently used.
CameraGainDigital.value	64f	Value in use by the sensor, useful for determining value when used is false.
CameraGainDigital.min	64f	Minimum value.
CameraGainDigital.max	64f	Maximum value.
DynamicSensitivity	64f	Dynamic exposure control sensitivity factor. This can be used to scale the control setpoint.
DynamicSensitivity.used	Bool	Determines if the setting's value is currently used.
DynamicSensitivity.value	64f	Value in use by the sensor, useful for determining value when used is false.
DynamicSensitivity.min	64f	Minimum value.
DynamicSensitivity.max	64f	Maximum value.
DynamicThreshold	32s	Dynamic exposure control threshold. If the detected number of spots is fewer than this number, the exposure will be increased.
DynamicThreshold.used	Bool	Determines if the setting's value is currently used.
DynamicThreshold.value	32s	Value in use by the sensor, useful for determining value when used is false.
DynamicThreshold.min	32s	Minimum value.
DynamicThreshold.max	32s	Maximum value.
SensitivityCompensationEnabled	Bool	Sensitivity compensation toggle. Used in determining analog and digital gain, along with exposure scale.
SensitivityCompensationEnabled.used	Bool	Determines if the setting's value is currently used.
SensitivityCompensationEnabled.value	Bool	Value in use by the sensor, useful for determining value when used is false.
GammaType	32s	Gamma type.
GammaType used	Bool	Determines if the setting's value is currently used.
GammaType value	32s	Value in use by the sensor. Useful for determining value when used is false.
SpotContinuitySorting	Section	See <i>SpotContinuitySorting Child Elements</i> on the next page.
SurfaceEncoding	32s	Surface encoding type: 0 – Standard 1 – Interreflection (advanced use only)
SurfaceEncoding.used	Bool	Determines if the setting's value is currently used.
SurfaceEncoding.value	Bool	Value in use by the sensor, useful for determining value when used is false.
SurfacePhaseFilter	32s	Surface phase filter (correction type)

Element	Type	Description
		0 – None 1 – Reflective 2 – Translucent
SurfacePhaseFilter.used	Bool	Determines if the setting's value is currently used.
SurfacePhaseFilter.value	Bool	Value in use by the sensor, useful for determining value when used is false.

SpotContinuitySorting Child Elements

Element	Type	Description
MinimumSegmentSize	32u	Smallest continuous segment considered in continuity sorting.
SearchWindow/X	32u	X component of continuity sorting search window size.
SearchWindow/Y	32u	Y component of continuity sorting search window size.

 IndependentExposures settings are only supported by Gocator 3000 series sensors.

IndependentExposures Child Elements

Element	Type	Description
@used	Bool	Whether this field is used
Enabled	Bool	Whether to allow using separate exposure values for each camera
FrontCameraExposure	64f	The exposure value to use for the front camera
FrontCameraExposure.min	64f	The minimum exposure value possible for front camera
FrontCameraExposure.max	64f	The maximum exposure value possible for back camera
BackCameraExposure	64f	The exposure value to use for the front camera
BackCameraExposure.min	64f	The minimum exposure value possible for front camera
BackCameraExposure.max	64f	The maximum exposure value possible for back camera

 Tracheid settings are only supported by Gocator 200 series multi-point sensors.

Tracheid Child Elements

Element	Type	Description
@used	Bool	Whether this field is used
TracheidExposureEnabled	Bool	Whether to use a unique exposure for tracheid capture
TracheidExposure	64f	The exposure value to use for tracheid measurements
TracheidExposure.min	64f	The minimum exposure value possible tracheid measurements
TracheidExposure.max	64f	The maximum exposure value possible for tracheid measurements
Camera0Threshold	32u	The tracheid threshold for camera 0
Camera1Threshold	32u	The tracheid threshold for camera 1

SurfaceGeneration

The SurfaceGeneration element contains settings related to surface generation.

This element is used by Gocator laser profile sensors.

SurfaceGeneration Child Elements

Element	Type	Description
Type	32s	Surface generation type: 0 – Continuous 1 – Fixed length 2 – Variable length 3 – Rotational
FixedLength	Section	See <i>FixedLength</i> below.
VariableLength	Section	See <i>VariableLength</i> below.
Rotational	Section	See <i>Rotational</i> below.

FixedLength

FixedLength Child Elements

Element	Type	Description
StartTrigger	32s	Start trigger condition: 0 – Sequential 1 – Digital input
Length	64f	Surface length (mm).
Length.min	64f	Minimum surface length (mm).
Length.max	64f	Maximum surface length (mm).

VariableLength

VariableLength Child Elements

Element	Type	Description
MaxLength	64f	Maximum surface length (mm).
MaxLength.min	64f	Minimum value for maximum surface length (mm).
MaxLength.max	64f	Maximum value for maximum surface length (mm).

Rotational

Rotational Child Elements

Element	Type	Description
Circumference	64f	Circumference (mm).
Circumference.min	64f	Minimum circumference (mm).
Circumference.max	64f	Maximum circumference (mm).

SurfaceSections

SurfaceSections Child Elements

Element	Type	Description
@used	Bool	Whether surface sectioning is enabled.
@xMin	64f	The minimum valid X value to be used for section definition.
@xMax	64f	The maximum valid X value to be used for section definition.
@yMin	64f	The minimum valid Y value to be used for section definition.
@yMax	64f	The maximum valid Y value to be used for section definition.
Section	Collection	A series of Section elements.

Section Child Elements

Element	Type	Description
@id	32s	The ID assigned to the surface section.
@name	String	The name associated with the surface section.
StartPoint	Point64f	The beginning point of the surface section.
EndPoint	Point64f	The end point of the surface section.
CustomSpacingIntervalEnabled	Bool	Indicates whether a user specified custom spacing interval is to be used for the resulting section.
SpacingInterval	64f	The user specified spacing interval.
SpacingInterval.min	64f	The spacing interval limit minimum.
SpacingInterval.max	64f	The spacing interval limit maximum.
SpacingInterval.value	64f	The current spacing interval used by the system.

ProfileGeneration

The ProfileGeneration element contains settings related to profile generation.

This element is used by Gocator laser displacement sensors.

ProfileGeneration Child Elements

Element	Type	Description
Type	32s	Profile generation type: 0 – Continuous 1 – Fixed length 2 – Variable length 3 – Rotational
FixedLength	Section	See <i>FixedLength</i> on the next page.
VariableLength	Section	See <i>VariableLength</i> on the next page.
Rotational	Section	See <i>Rotational</i> on the next page.

FixedLength

FixedLength Child Elements

Element	Type	Description
StartTrigger	32s	Start trigger condition: 0 – Sequential 1 – Digital input
Length	64f	Profile length (mm).
Length.min	64f	Minimum profile length (mm).
Length.max	64f	Maximum profile length (mm).

VariableLength

VariableLength Child Elements

Element	Type	Description
MaxLength	64f	Maximum surface length (mm).
MaxLength.min	64f	Minimum value for maximum profile length (mm).
MaxLength.max	64f	Maximum value for maximum profile length (mm).

Rotational

Rotational Child Elements

Element	Type	Description
Circumference	64f	Circumference (mm).
Circumference.min	64f	Minimum circumference (mm).
Circumference.max	64f	Maximum circumference (mm).

PartDetection

PartDetection Child Elements

Element	Type	Description
Enabled	Bool	Enables part detection.
Enabled.used	Bool	Whether or not this field is used.
Enabled value	Bool	Actual value used if not configurable.
MinArea	64f	Minimum area (mm ²).
MinArea.min	64f	Minimum value of minimum area.
MinArea.max	64f	Maximum value of minimum area.
MinArea.used	Bool	Whether or not this field is used.
GapWidth	64f	Gap width (mm).
GapWidth.min	64f	Minimum gap width (mm).
GapWidth.max	64f	Maximum gap width (mm).
GapWidth.used	Bool	Whether or not this field is used.

Element	Type	Description
GapLength	64f	Gap length (mm).
GapLength.min	64f	Minimum gap length (mm).
GapLength.max	64f	Maximum gap length (mm).
GapLength.used	Bool	Whether or not this field is used.
PaddingWidth	64f	Padding width (mm).
PaddingWidth.min	64f	Minimum padding width (mm).
PaddingWidth.max	64f	Maximum padding width (mm).
PaddingWidth.used	Bool	Whether or not this field is used.
PaddingLength	64f	Padding length (mm).
PaddingLength.min	64f	Minimum padding length (mm).
PaddingLength.max	64f	Maximum padding length (mm).
PaddingLength.used	Bool	Whether or not this field is used.
MinLength	64f	Minimum length (mm).
MinLength.min	64f	Minimum value of minimum length (mm).
MinLength.max	64f	Maximum value of minimum length (mm).
MinLength.used	Bool	Whether or not this field is used.
MaxLength	64f	Maximum length (mm).
MaxLength.min	64f	Minimum value of maximum length (mm).
MaxLength.max	64f	Maximum value of maximum length (mm).
MaxLength.used	Bool	Whether or not this field is used.
Threshold	64f	Height threshold (mm).
Threshold.min	64f	Minimum height threshold (mm).
Threshold.max	64f	Maximum height threshold (mm).
ThresholdDirection	32u	Threshold direction: 0 – Above 1 – Below
FrameOfReference	32s	Part frame of reference: 0 – Sensor 1 – Scan 2 – Part
FrameOfReference.used	Bool	Whether or not this field is used.
FrameOfReference.value	32s	Actual value.
IncludeSinglePointsEnabled	Bool	Enables preservation of single data points in Top+Bottom layout
IncludeSinglePointsEnabled. used	Bool	Whether or nto this field is available to be modified
EdgeFiltering	Section	See <i>EdgeFiltering</i> on the next page.

EdgeFiltering

EdgeFiltering Child Elements

Element	Type	Description
@used	Bool	Whether or not this section is used.
Enabled	Bool	Enables edge filtering.
PreserveInteriorEnabled	Bool	Enables preservation of interior.
ElementWidth	64f	Element width (mm).
ElementWidth.min	64f	Minimum element width (mm).
ElementWidth.max	64f	Maximum element width (mm).
ElementLength	64f	Element length (mm).
ElementLength.min	64f	Minimum element length (mm).
ElementLength.max	64f	Maximum element length (mm).

PartMatching

The PartMatching element contains settings related to part matching.

PartMatching Child Elements

Element	Type	Description
Enabled	Bool	Enables part matching.
Enabled.used	Bool	Whether or not this field is used.
MatchAlgo	32s	Match algorithm. 0 – Edge points 1 – Bounding Box 2 – Ellipse
Edge	Section	See <i>Edge</i> below.
BoundingBox	Section	See <i>BoundingBox</i> below.
Ellipse	Section	See <i>Ellipse</i> on the next page.

Edge

Edge Child Elements

Element	Type	Description
ModelName	String	Name of the part model to use. Does not include the .mdl extension.
Acceptance/Quality/Min	64f	Minimum quality value for a match.

BoundingBox

BoundingBox Child Elements

Element	Type	Description
ZAngle	64f	Z rotation to apply to bounding box (degrees).
AsymmetryDetectionType	32s	Determine whether to use asymmetry detection and, if enabled, which dimension is the basis of detection. The possible values are:

Element	Type	Description
		0 – None 1 – Length 2 – Width
Acceptance/Width/Min	64f	Minimum width (mm).
Acceptance/Width/Max	64f	Maximum width (mm).
Acceptance/Width/Tolerance	64f	Width acceptance tolerance value
Acceptance/Width/Tolerance.deprecated	Bool	Whether this tolerance field is deprecated
Acceptance/Length/Min	64f	Minimum length (mm).
Acceptance/Length/Max	64f	Maximum length (mm).
Acceptance/Length/Tolerance	64f	Length acceptance tolerance value
Acceptance/Length/Tolerance.deprecated	Bool	Whether this tolerance field is deprecated
X	64f	X value
X.deprecated	Bool	Whether this X field is deprecated
Y	64f	Y value
Y.deprecated	Bool	Whether this Y field is deprecated
Width	64f	Width value
Width.deprecated	Bool	Whether this width field is deprecated
Length	64f	Length value
Length.deprecated	Bool	Whether this length field is deprecated

Ellipse

Ellipse Child Elements

Element	Type	Description
ZAngle	64f	Z rotation to apply to ellipse (degrees).
AsymmetryDetectionType	32s	Determine whether to use asymmetry detection and, if enabled, which dimension is the basis of detection. The possible values are: 0 – None 1 – Major 2 – Minor
Acceptance/Major/Min	64f	Minimum major length (mm).
Acceptance/Major/Max	64f	Maximum major length (mm).
Acceptance/Major/Tolerance	64f	Major acceptance tolerance value
Acceptance/Major/Tolerance.deprecated	Bool	Whether this tolerance field is deprecated
Acceptance/Minor/Min	64f	Minimum minor length (mm).

Element	Type	Description
Acceptance/Minor/Max	64f	Maximum minor length (mm).
Acceptance/Minor/Tolerance	64f	Minor acceptance tolerance value
Acceptance/Minor/Tolerance.deprecated	Bool	Whether this tolerance field is deprecated
X	64f	X value
X.deprecated	Bool	Whether this X field is deprecated
Y	64f	Y value
Y.deprecated	Bool	Whether this Y field is deprecated
Width	64f	Width value
Width.deprecated	Bool	Whether this width field is deprecated
Length	64f	Length value
Length.deprecated	Bool	Whether this length field is deprecated

Replay

Contains settings related to recording filtering.

RecordingFiltering

RecordingFiltering Child Elements

Element	Type	Description
ConditionCombineType	32s	0 – Any: If any enabled condition is satisfied, the current frame is recorded. 1 – All: All enabled conditions must be satisfied for the current frame to be recorded.
Conditions	Collection	A collection of AnyMeasurement , AnyData , or Measurement conditions.

Conditions/AnyMeasurement

Conditions/AnyMeasurement Elements

Element	Type	Description
Enabled	Bool	Indicates whether the condition is enabled.
Result	32s	The measurement decision criteria to be included in the filter. Possible values are: 0 – Pass 1 – Fail 2 – Valid 3 – Invalid

Conditions/AnyData

Conditions/AnyData Elements

Element	Type	Description
Enabled	Bool	Indicates whether the condition is enabled.
RangeCountCase	32s	The case under which to record data: 0 – Range count at or above threshold of valid data points. 1 – Range count below threshold.
RangeCountThreshold	32u	The threshold for the number of range points that are valid.

Conditions/Measurement

Conditions/Measurement Elements

Element	Type	Description
Enabled	Bool	Indicates whether the condition is enabled.
Result	32s	The measurement decision criteria for the selected ID to be included in the filter. Possible values are: 0 – Pass 1 – Fail 2 – Valid 3 – Invalid
Ids	32s	The ID of the measurement to filter.

Streams/Stream (Read-only)

Streams/Stream Child Elements

Element	Type	Description
Step	32s	The data step of the stream being described. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Id	32u	The stream ID.
CadenceId	32u	Represents a stage in the data processing pipeline. The greater the number, the farther removed from the initial acquisition stage. One of the following: 0 – Primary 1 – Auxiliary 10 – Diagnostic
DataType	32s	The stream data type 0 – None 4 – Uniform Profile

Element	Type	Description
		16 – Uniform Surface
ColorEncoding	32s	The color encoding type. Only appears for Video stream steps (1). 0 – None 1 – Bayer BGGR 2 – Bayer GBRG 3 – Bayer RGGB 4 – Bayer GRBG
IntensityEnabled	Bool	Whether the stream includes intensity data
Sources	Collection	A collection of Source elements as described below.

Source Child Elements

Element	Type	Description
Id	32s	The ID of the data source. Possible values are: 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right 4 – Top Bottom 5 – Left Right
Capability	32s	The capability of the data stream source. Possible values are: 0 – Full 1 – Diagnostic only 2 – Virtual
Region	Region3d	The region of the given stream source.
AdditionalRegions	Collection	Collection of additional regions (for example, for the second camera).
AdditionalRegions/Region	Region3d	Additional regions.

ToolOptions

The ToolOptions element contains a list of available tool types, their measurements, and settings for related information.

ToolOptions Child Elements

Element	Type	Description
<Tool Names>	Collection	A collection of tool name elements. An element for each tool type is present.

Tool Name Child Elements

Element	Type	Description
@displayName	String	Display name of the tool.

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
MeasurementOptions	Collection	See <i>MeasurementOptions</i> below
FeatureOptions	Collection	See <i>FeatureOptions</i> below.
StreamOptions	Collection	See <i>StreamOptions</i> on the next page.

MeasurementOptions

MeasurementOptions Child Elements

Element	Type	Description
<Measurement Names>	Collection	A collection of measurement name elements. An element for each measurement is present.

<Measurement Name> Child Elements

Element	Type	Description
@displayName	String	Display name of the tool.
@minCount	32u	Minimum number of instances in a tool.
@maxCount	32u	Maximum number of instances in a tool.

FeatureOptions

FeatureOptions Child Elements

Element	Type	Description
<Feature Names>	Collection	A collection of feature name elements. An element for each measurement is present.

<Feature Name> Child Elements

Element	Type	Description
@displayName	String	Display name of the feature.
@minCount	32u	Minimum number of instances in a tool.
@maxCount	32u	Maximum number of instances in a tool.
@dataType	String	The data type of the feature. One of: – PointFeature – LineFeature – CircleFeature – PlaneFeature

StreamOptions

StreamOptions Child Elements

Element	Type	Description
@step	32s	The data step of the stream being described. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
@ids	CSV	A list representing the available IDs associated with the given step.

Tools

The Tools element contains measurement tools. The following sections describe each tool and its available measurements.

Tools Child Elements

Element	Type	Description
@options	String (CSV)	A list of the tools available in the currently selected scan mode.
<ToolType>	Section	An element for each added tool.

Profile Types

The following types are used by various measurement tools.

ProfileFeature

An element of type ProfileFeature defines the settings for detecting a feature within an area of interest.

ProfileFeature Child Elements

Element	Type	Description
Type	32s	Determine how the feature is detected within the area: 0 – Max Z 1 – Min Z 2 – Max X 3 – Min X 4 – Corner 5 – Average 6 – Rising Edge 7 – Falling Edge 8 – Any Edge 9 – Top Corner 10 – Bottom Corner 11 – Left Corner 12 – Right Corner

Element	Type	Description
		13 – Median
RegionEnabled	Bool	Indicates whether feature detection applies to the defined Region or to the entire active area.
Region	ProfileRegion2D	Element for feature detection area.

ProfileLine

An element of type ProfileLine defines measurement areas used to calculate a line.

ProfileLine Child Elements

Element	Type	Description
RegionCount	32s	Count of the regions.
Regions	(Collection)	The regions used to calculate a line. Contains one or two Region elements of type ProfileRegion2D , with RegionEnabled fields for each.

ProfileRegion2d

An element of type ProfileRegion2d defines a rectangular area of interest.

ProfileRegion2d Child Elements

Element	Type	Description
X	64f	Setting for profile region X position (mm).
Z	64f	Setting for profile region Z position (mm).
Width	64f	Setting for profile region width (mm).
Height	64f	Setting for profile region height (mm).

Surface Types

The following types are used by the various measurement tools.

Region3D

An element of type Region3D defines a rectangular area of interest in 3D.

Region3D Child Elements

Element	Type	Description
X	64f	Volume X position (mm).
Y	64f	Volume Y position (mm).
Z	64f	Volume Z position (mm).
Width	64f	Volume width (mm).
Length	64f	Volume length (mm).
Height	64f	Volume height (mm).

SurfaceFeature

An element of type SurfaceFeature defines the settings for detecting a feature within an area of interest.

SurfaceFeature Child Elements

Element	Type	Description
Type	32s	Setting to determine how the feature is detected within the area: 0 – Average (formerly Centroid 2d) 1 – Centroid (formerly Centroid 3d) 2 – X Max 3 – X Min 4 – Y Max 5 – Y Min 6 – Z Max 7 – Z Min 8 – Median
RegionEnabled	Boolean	Setting to enable/disable region: 0 – Disable 1 – Enable
Region	Region3D	Element for feature detection volume.

SurfaceRegion2d

An element of type SurfaceRegion2d defines a rectangular area of interest on the X-Y plane.

SurfaceRegion2d Child Elements

Element	Type	Description
X	64f	Setting for surface region X position (mm).
Y	64f	Setting for surface region Y position (mm).
Width	64f	Setting for region width (mm).
Length	64f	Setting for region length (mm).

Geometric Feature Types

The Geometric Feature type is used by various measurement tools.

Feature Child Elements

Element	Type	Description
@id	32s	The identifier of the geometric feature. -1 if unassigned.
@dataType	String	The data type of the feature. One of: – PointFeature – LineFeature
@type	String	Type name of feature.
Name	String	The display name of the feature.
Enabled	Bool	Whether the given feature output is enabled.
Parameters	Collection	Collection of GdkParam elements.

Parameter Types

The following types are used by internal and custom (user-created) GDK-based tools.

GDK Parameter Child Elements

Element	Type	Description
@label	String	Parameter label.
@type	String	Type of parameter. It is one of the following (see tables below for elements found in each type): - Bool - Int - Float - ProfileRegion - SurfaceRegion2d - SurfaceRegion3d - GeometricFeature
@options	Variant (CSV)	Options available for this parameter.
@optionNames	String (CSV)	Names

GDK Parameter Bool Type

Element	Type	Description
	Bool	Boolean value of parameter.

GDK Parameter Int Type

Element	Type	Description
	32s	Integer value of parameter of integer type.

GDK Parameter Float Type

Element	Type	Description
	64f	Floating point value of parameter.

GDK Parameter String Type

Element	Type	Description
	String	String value of parameter.

GDK Parameter Profile Region Type

Element	Type	Description
X	64f	X value of region.
Z	64f	Z value of region.
Width	64f	Width value of region.
Height	64f	Height value of region.

GDK Parameter Surface Region 2D Type

Element	Type	Description
X	64f	X value of region.
X	64f	X value of region.

Element	Type	Description
Y	64f	Y value of region.
Width	64f	Width value of region.
Length	64f	Length value of region.

GDK Parameter Surface Region 3D Type

Element	Type	Description
X	64f	X value of region.
Y	64f	Y value of region.
Z	64f	Z value of region.
Width	64f	Width value of region.
Length	64f	Length value of region.
Height	64f	Height value of region.
ZAngle	64f	ZAngle value of region.

GDK Parameter Geometric Feature Type

Element	Type	Description
	32s	Geometric feature Id for parameter.

ProfileArea

A ProfileArea element defines settings for a profile area tool and one or more of its measurements.

ProfileArea Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>ProfileArea</i> above.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are:

Element	Type	Description
		1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
Type	Boolean	Area to measure: 0 – Object (convex shape above the baseline) 1 – Clearance (concave shape below the baseline)
Type.used	Boolean	Whether or not field is used.
Baseline	Boolean	Baseline type: 0 – X-axis 1 – Line
Baseline.used	Boolean	Whether or not field is used.
RegionEnabled	Boolean	If enabled, the defined region is used for measurements. Otherwise, the full active area is used.
Region	ProfileRegion2d	Measurement region.
Line	ProfileLine	Line definition when Baseline is set to Line.
Measurements\Area	Area tool measurement	Area measurement.
Measurements\CentroidX	Area tool measurement	CentroidX measurement.
Measurements\CentroidZ	Area tool measurement	CentroidZ measurement.
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature.
Area Tool Measurement		
Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable

Element	Type	Description
		1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

ProfileBoundingBox

A ProfileBoundingBox element defines settings for a profile bounding box tool and one or more of its measurements.

ProfileBoundingBox Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>ProfileBoundingBox</i> above.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RegionEnabled	Bool	Whether or not to use the region. If the region is disabled,

Element	Type	Description
		all available data is used.
Region	ProfileRegion2d	Measurement region.
Measurements\X	Bounding Box tool measurement	X measurement.
Measurements\Z	Bounding Box tool measurement	Z measurement.
Measurements\Width	Bounding Box tool measurement	Width measurement.
Measurements\Height	Bounding Box tool measurement	Height measurement.
Measurements\GlobalX	Bounding Box tool measurement	GlobalX measurement
Measurements\GlobalY	Bounding Box tool measurement	GlobalY measurement
Measurements\GlobalAngle	Bounding Box tool measurement	GlobalAngle measurement
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature.
Features\CornerPoint	GeometricFeature	CornerPoint PointFeature.

Bounding Box Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.

Element	Type	Description
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

ProfileCircle

A ProfileCircle element defines settings for a profile circle tool and one or more of its measurements.

ProfileCircle Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>ProfileCircle</i> above.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RegionEnabled	Bool	Whether or not to use the region. If the region is disabled, all available data is used.
Region	ProfileRegion2d	Measurement region.
Measurements\X	Circle tool measurement	X measurement.
Measurements\Z	Circle tool measurement	Z measurement.
Measurements\Radius	Circle tool measurement	Radius measurement.

Element	Type	Description
Measurements\StdDev	CircleMeasurement	Standard deviation measurement
Measurements\MinError	CircleMeasurement	Minimum error measurement
Measurements\MinErrorX	CircleMeasurement	Minimum error X measurement
Measurements\MinErrorZ	CircleMeasurement	Minimum error Z measurement
Measurements\MaxError	CircleMeasurement	Maximum error measurement
Measurements\MaxErrorX	CircleMeasurement	Maximum error X measurement
Measurements\MaxErrorZ	CircleMeasurement	Maximum error Z measurement
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature.

Circle Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

ProfileDimension

A ProfileDimension element defines settings for a profile dimension tool and one or more of its measurements.

ProfileDimension Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.

Element	Type	Description
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RefFeature	ProfileFeature	Reference measurement region.
Feature	ProfileFeature	Measurement region.
Measurements\Width	Dimension tool measurement	Width measurement.
Measurements\Height	Dimension tool measurement	Height measurement.
Measurements\Distance	Dimension tool measurement	Distance measurement.
Measurements\CenterX	Dimension tool measurement	CenterX measurement.
Measurements\CenterZ	Dimension tool measurement	CenterZ measurement.
<i>Dimension Tool Measurement</i>		
Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state:

Element	Type	Description
		0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Absolute (Width and Height measurements only)	Boolean	Setting for selecting absolute or signed result: 0 – Signed 1 – Absolute

ProfileGroove

A ProfileGroove element defines settings for a profile groove tool and one or more of its measurements.

The profile groove tool is dynamic, meaning that it can contain multiple measurements of the same type in the Measurements element.

ProfileGroove Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.

Element	Type	Description
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
Shape	32s	Shape: 0 – U-shape 1 – V-shape 2 – Open
MinDepth	64f	Minimum depth.
MinWidth	64f	Minimum width.
MaxWidth	64f	Maximum width.
RegionEnabled	Bool	Whether or not to use the region. If the region is disabled, all available data is used.
Region	ProfileRegion2d	Measurement region.
Measurements\X	Groove tool measurement	X measurement.
Measurements\Z	Groove tool measurement	Z measurement.
Measurements\Width	Groove tool measurement	Width measurement.
Measurements\Depth	Groove tool measurement	Depth measurement.

Groove Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable

Element	Type	Description
		1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
SelectType	32s	Method of selecting a groove when multiple grooves are found: 0 – Max depth 1 – Ordinal, from left 2 – Ordinal, from right
SelectIndex	32s	Index when SelectType is set to 1 or 2.
Location (X and Z measurements only)	32s	Setting for groove location to return from: 0 – Bottom 1 – Left corner 2 – Right corner

ProfileIntersect

A ProfileIntersect element defines settings for a profile intersect tool and one or more of its measurements.

ProfileIntersect Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>ProfileIntersect</i> above.

Element	Type	Description
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
RefType	32s	Reference line type: 0 – Fit 1 – X Axis
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RefLine	ProfileLine	Definition of reference line. Ignored if RefType is not 0.
Line	ProfileLine	Definition of line.
Measurements\X	Intersect tool measurement	X measurement.
Measurements\Z	Intersect tool measurement	Z measurement.
Measurements\Angle	Intersect tool measurement	Angle measurement.
Features\IntersectPoint	GeometricFeature	IntersectPoint PointFeature.
Features\Line	GeometricFeature	Line LineFeature.
Features\BaseLine	GeometricFeature	BaseLine LineFeature.

Intersect Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable

Element	Type	Description
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Absolute (Angle measurement only)	Boolean	Setting for selecting the angle range: 0 – A range of -90 to 90 degrees is used. 1 – A range of 0 to 180 degrees is used.

ProfileLine

A ProfileLine element defines settings for a profile line tool and one or more of its measurements.

ProfileLine Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>ProfileLine</i> above.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range

Element	Type	Description
		3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RegionEnabled	Bool	Whether or not to use the region. If the region is disabled, all available data is used.
Region	ProfileRegion2d	Measurement region.
FittingRegions	ProfileLine	ProfileLine describing up to 2 regions to fit to.
FittingRegionsEnabled	Bool	Whether the fitting regions are enabled.
Measurements\StdDev	Line tool measurement	StdDev measurement.
Measurements\MaxError	Line tool measurement	MaxError measurement.
Measurements\MinError	Line tool measurement	MinError measurement.
Measurements\Percentile	Line tool measurement	Percentile measurement.
Measurements\Offset	Line tool measurement	Offset measurement.
Measurements\Angle	Line tool measurement	Angle measurement.
Measurements\MinErrorX	Line tool measurement	Minimum Error in X measurement.
Measurements\MinErrorZ	Line tool measurement	Minimum Error in Z measurement.
Measurements\MaxErrorX	Line tool measurement	Maximum Error in X measurement.
Measurements\MaxErrorZ	Line tool measurement	Maximum Error in Z measurement.
Features\Line	GeometricFeature	Line LineFeature.
Features>ErrorMinPoint	GeometricFeature	ErrorMinPoint PointFeature.
Features>ErrorMaxPoint	GeometricFeature	ErrorMaxPoint PointFeature.

Line Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable

Element	Type	Description
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Percent	64f	Error percentile.

(Percentile measurement only)

ProfilePanel

A ProfilePanel element defines settings for a profile panel tool and one or more of its measurements.

ProfilePanel Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video

Element	Type	Description
		2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RefSide	32s	Setting for reference side to use.
MaxGapWidth	64f	Setting for maximum gap width (mm).
LeftEdge	ProfilePanelEdge	Element for left edge configuration.
RightEdge	ProfilePanelEdge	Element for right edge configuration.
Measurements\Gap	Gap/Flush measurement	Gap measurement.
Measurements\Flush	Gap/Flush measurement	Flush measurement.
Measurements\LeftGapX	Gap/Flush measurement	Left Gap X measurement.
Measurements\LeftGapZ	Gap/Flush measurement	Left Gap Z measurement.
Measurements\LeftFlushX	Gap/Flush measurement	Left Flush X measurement.
Measurements\LeftFlushZ	Gap/Flush measurement	Left Flush Z measurement.
Measurements\LeftSurfaceAngle	Gap/Flush measurement	Left Surface Angle measurement.
Measurements\RightGapX	Gap/Flush measurement	Right Gap X measurement.
Measurements\RightGapZ	Gap/Flush measurement	Right Gap Z measurement.
Measurements\RightFlushX	Gap/Flush measurement	Right Flush X measurement.
Measurements\RightFlushZ	Gap/Flush measurement	Right Flush Z measurement.
Measurements\RightSurfaceAngle	Gap/Flush measurement	Right Surface Angle measurement.
<i>ProfilePanelEdge</i>		
Element	Type	Description
EdgeType	32s	Edge type: 0 – Tangent 1 – Corner
MinDepth	64f	Minimum depth.

Element	Type	Description
MaxVoidWidth	64f	Maximum void width.
SurfaceWidth	64f	Surface width.
SurfaceOffset	64f	Surface offset.
NominalRadius	64f	Nominal radius.
EdgeAngle	64f	Edge angle.
RegionEnabled	Bool	Whether or not to use the region. If the region is disabled, all available data is used.
Region	ProfileRegion2d	Edge region.

Gap/Flush Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Axis (Gap measurement only)	32s	Measurement axis: 0 – Edge 1 – Surface 2 – Distance
Absolute (Flush measurement only)	Boolean	Setting for selecting absolute or signed result: 0 – Signed 1 – Absolute

ProfilePosition

A ProfilePosition element defines settings for a profile position tool and one or more of its measurements.

ProfilePosition Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>ProfilePosition</i> above.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
Feature	ProfileFeature	Element for feature detection.
Measurements\X	Position tool measurement	X measurement.
Measurements\Z	Position tool measurement	Z measurement.
Features\Point	GeometricFeature	Point PointFeature

Position Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state:

Element	Type	Description
		0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

ProfileRoundCorner

A ProfileRoundCorner element defines settings for a profile round corner tool and one or more of its measurements.

ProfileRoundCorner Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are:

Element	Type	Description
		1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RefDirection	32s	Setting for reference side to use: 0 – Left 1 – Right
Edge	ProfilePanelEdge	Element for edge configuration
Measurements\X	Round Corner tool measurement	X measurement.
Measurements\Z	Round Corner tool measurement	Z measurement.
Measurements\Angle	Round Corner tool measurement	Angle measurement.
Features\CenterPoint	Geometric Feature	Circle Center PointFeature.
Features\EdgePoint	Geometric Feature	Edge PointFeature.

ProfilePanelEdge

Element	Type	Description
EdgeType	32s	Edge type: 0 – Tangent 1 – Corner
MinDepth	64f	Minimum depth.
MaxVoidWidth	64f	Maximum void width.
SurfaceWidth	64f	Surface width.
SurfaceOffset	64f	Surface offset.
NominalRadius	64f	Nominal radius.
EdgeAngle	64f	Edge angle.
RegionEnabled	Bool	Whether or not to use the region. If the region is disabled, all available data is used.
Region	ProfileRegion2d	Edge region.

Round Corner Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state:

Element	Type	Description
		0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

ProfileStrip

A ProfileStrip element defines settings for a profile strip tool and one or more of its measurements.

The profile strip tool is dynamic, meaning that it can contain multiple measurements of the same type in the Measurements element.

ProfileStrip Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Profile source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.

Element	Type	Description
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
BaseType	32s	Setting for the strip type: 0 – None 1 – Flat
LeftEdge	Bitmask	Setting for the left edge conditions: 1 – Raising 2 – Falling 4 – Data End 8 – Void
RightEdge	Bitmask	Setting for the right edge conditions: 1 – Raising 2 – Falling 4 – Data End 8 – Void
TiltEnabled	Boolean	Setting for tilt compensation: 0 – Disabled 1 – Enabled
SupportWidth	64f	Support width of edge (mm).
TransitionWidth	64f	Transition width of edge (mm).
MinWidth	64f	Minimum strip width (mm).
MinHeight	64f	Minimum strip height (mm).
MaxVoidWidth	64f	Void max (mm).
Region	ProfileRegion2d	Region containing the strip.
Measurements\X	Strip tool measurement	X measurement.
Measurements\Z	Strip tool measurement	Z measurement.
Measurements\Width	Strip tool measurement	Width measurement.
Measurements\Height	Strip tool measurement	Width measurement.

Strip Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
SelectType	32s	Method of selecting a groove when multiple grooves are found: 0 – Best 1 – Ordinal, from left 2 – Ordinal, from right
SelectIndex	32s	Index when SelectType is set to 1 or 2.
Location (X, Z, and Height measurements only)	32s	Setting for groove location to return from: 0 – Left 1 – Right 2 – Center

Script

A Script element defines settings for a script measurement.

Script Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool:

Element	Type	Description
		0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Code	String	Script code.
Measurements\Output	(Collection)	Dynamic list of Output elements.

Output

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.

SurfaceBoundingBox

A SurfaceBoundingBox element defines settings for a surface bounding box tool and one or more of its measurements.

SurfaceBoundingBox Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfaceBoundingBox</i> above.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.

Element	Type	Description
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
ZRotationEnabled	Boolean	Setting to enable/disable rotation of bounding box
AsymmetryDetectionType	32s	Determine whether to use asymmetry detection and if enabled, which dimension would be the basis of detection. The possible values are: 0 – None 1 – Length 2 – Width
RegionEnabled	Boolean	Setting to enable/disable region.
Region	Region3D	Measurement region.
Measurements\X	Bounding Box tool measurement	X measurement.
Measurements\Y	Bounding Box tool measurement	Y measurement.
Measurements\Z	Bounding Box tool measurement	Z measurement.
Measurements\Width	Bounding Box tool measurement	Width measurement.
Measurements\Length	BoundingBoxMeasurement	Length measurement
Measurements\Height	Bounding Box tool measurement	Height measurement.
Measurements\ZAngle	Bounding Box tool measurement	ZAngle measurement.
Measurements\GlobalX	Bounding Box tool measurement	Global X measurement.
Measurements\GlobalY	Bounding Box tool measurement	Global Y measurement.
Measurements\GlobalZAngle	Bounding Box tool measurement	Global Z Angle measurement.
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature
Features\AxisLine	GeometricFeature	AxisLine LineFeature

Bounding Box Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfaceCsHole

A SurfaceCsHole element defines settings for a surface countersunk hole tool and one or more of its measurements.

SurfaceCsHole Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfaceCsHole</i> above.
Source	32s	Surface source.

Element	Type	Description
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
NominalBevelAngle	64f	Nominal bevel angle (mm).
NominalOuterRadius	64f	Nominal outer radius (mm).
NominalInnerRadius	64f	Nominal inner radius (mm).
BevelRadiusOffset	64f	Bevel radius offset (mm).
Shape	32s	The shape of the countersunk hole: 0 – Cone 1 – Counterbore
PartialDetectionEnabled	Boolean	Setting to enable/disable partial detection: 0 – Disable 1 – Enable
RegionEnabled	Boolean	Setting to enable/disable region: 0 – Disable 1 – Enable
Region	Region3D	Measurement region.
RefRegionsEnabled	Boolean	Setting to enable/disable reference regions: 0 – Disable 1 – Enable
RefRegionCount	32s	Count of the reference regions which are to be used
RefRegions	(Collection)	Reference regions. Contains 2 SurfaceRegion2D elements.
AutoTiltEnabled	Boolean	Setting to enable/disable tilt correction: 0 – Disable

Element	Type	Description
		1 – Enable
TiltXAngle	64f	Setting for manual tilt correction angle X.
TiltYAngle	64f	Setting for manual tilt correction angle Y.
CurveFitEnabled	Boolean	Setting to enable/disable curve fitting: 0 – Disable 1 – Enable
CurveOrientation	64f	The orientation of the curvature, in degrees.
PlaneFitRangeEnabled	Boolean	Setting to enable/disable the use of the plane fit range
PlaneFitRange	64f	Setting for the tolerance to use when doing the plane fit
Measurements\X	Countersunk Hole tool measurement	X measurement.
Measurements\Y	Countersunk Hole tool measurement	Y measurement.
Measurements\Z	Countersunk Hole tool measurement	Z measurement.
Measurements\OuterRadius	Countersunk Hole tool measurement	Outer Radius measurement.
Measurements\Depth	Countersunk Hole tool measurement	Depth measurement.
Measurements\BevelRadius	Countersunk Hole tool measurement	Bevel Radius measurement.
Measurements\BevelAngle	Countersunk Hole tool measurement	Bevel Angle measurement.
Measurements\XAngle	Countersunk Hole tool measurement	X Angle measurement.
Measurements\YAngle	Countersunk Hole tool measurement	Y Angle measurement.
Measurements\CounterboreDepth	Countersunk Hole tool measurement	CounterboreDepth measurement.
Measurements\AxisTilt	CsHoleMeasurement	Axis tilt measurement
Measurements\AxisOrientation	CsHoleMeasurement	Axis orientation measurement.
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature

Countersunk Hole Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfaceCsHole</i> on page 424.

Element	Type	Description
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfaceDimension

A SurfaceDimension element defines settings for a surface dimension tool and one or more of its measurements.

SurfaceDimension Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.

Element	Type	Description
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
Measurements\CenterX	Dimension tool measurement	Center X measurement
Measurements\CenterY	Dimension tool measurement	Center Y measurement
Measurements\CenterZ	Dimension tool measurement	Center Z measurement
Measurements\Distance	Dimension tool measurement	Distance measurement
Measurements\PlaneDistance	Dimension tool measurement	Plane Distance measurement
Measurements\Height	Dimension tool measurement	Height measurement
Measurements\Length	Dimension tool measurement	Length measurement
Measurements\Width	Dimension tool measurement	Width measurement

Dimension Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable

Element	Type	Description
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Absolute (Height, Length, and Width measurements only)	Boolean	Setting for selecting absolute or signed result. 0 – Signed 1 – Absolute

Tool (type SurfaceEdge)

A Tool element of type SurfaceEdge defines settings for a surface edge tool and one or more of its measurements.

SurfaceEdge Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
@type	String	Type name of the tool.
@version	String	Version string for custom tool.
Name	String	Tool name.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.

Element	Type	Description
Parameters\UseIntensity	GdkParamBool	Use intensity data.
Parameters\RegionCount	GdkParamInt	Count of regions.
Parameters\Region	GdkParamSurfaceRegion3d	Edge region parameters.
Parameters\Region1	GdkParamSurfaceRegion3d	Second edge region parameters.
Parameters\Region2	GdkParamSurfaceRegion3d	Third eddge region parameters.
Parameters\Region3	GdkParamSurfaceRegion3d	Fourth edge region parameter.
Parameters\SearchDirection	GdkParamInt	Direction of search.
Parameters\FixedAngleValue	GdkParamFloat	Fixed angle value
Parameters\FixedAngleValue.units	String	Units of fixed angle (e.g.: deg)
Parameters\UseFixedAngle	GdkParamBool	Use fixed angle boolean.
Parameters\PathSpacing	GdkParamFloat	Path spacing value
Parameters\PathSpacing.units	String	Units of path spacing (eg: mm)
Parameters\PathWidth	GdkParamFloat	Path width.
Parameters\PathWidth.units	String	Units of path width (e.g.: mm).
Parameters\SelectEdge	GdkParamInt	Edge selection type. Is either: 0 – Best 1 – First 2 – Last
Parameters\EdgeDirection	GdkParamInt	Edge direction type. Is either: 0 – Rising 1 – Falling 2 – Rising or Falling
Parameters\EdgeThreshold	GdkParamFloat	Edge threshold value.
Parameters\EdgeThreshold.units	String	Units of edge threshold (e.g.: mm).
Parameters\IntensityThreshold	GdkParamFloat	Intensity threshold value.
Parameters\UseRelativeThreshold	GdkParamBool	Use relative threshold boolean
Parameters\RelativeThreshold	GdkParamFloat	Relative threshold value.
Parameters\RelativeThreshold.units	String	Units of relative threshold (e.g.: %)

Element	Type	Description
Parameters\EdgeSmoothing	GdkParamFloat	Edge smoothing value.
Parameters\EdgeSmoothing.units	String	Units of edge smoothing (e.g.: mm).
Parameters\EdgeWidth	GdkParamFloat	The step width.
Parameters\EdgeWidth.units	String	Units of edge (e.g.: mm).
Parameters\EdgeMaxGap	GdkParamFloat	Edge max gap value.
Parameters\EdgeMaxGap.units	String	Units of edge max gap (eg: mm).
Parameters\FillBackground	GdkParamBool	Fill background boolean
Parameters\FillValue	GdkParamFloat	Fill value value.
Parameters\FillValue.units	String	Units of fill value (e.g.: mm).
Parameters\IntensityFillValue	GdkParamFloat	Intensity fill value value.
Parameters\IntensityFillValue.min	GdkParamFloat	Intensity fill value minimum value.
Parameters\IntensityFillValue.max	GdkParamFloat	Intensity fill value maximum value.
Parameters\RenderDetail	GdkParamBool	Render detail Boolean.
Measurements\Measurement @type=X	Edge Measurement	Base X measurement.
Measurements\Measurement @type=Y	Edge Measurement	Base Y measurement.
Measurements\Measurement @type=Z	Edge Measurement	Base Z measurement.
Measurements\Measurement @type=ZAngle	Edge Measurement	Base ZAngle measurement.
Measurements\Measurement @type=Height	Edge Measurement	Base Height measurement.
Features\Feature @type=EdgeLine	Gdk Feature	EdgeLine line feature.
Features\Feature @type=CenterPoint	Gdk Feature	CenterPoint point feature.

Edge Measurement Child Elements

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
@type	String	Type name of measurement.
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable

Element	Type	Description
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfaceEllipse

A SurfaceEllipse element defines settings for a surface ellipse tool and one or more of its measurements.

SurfaceEllipse Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfaceEllipse</i> above.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.

Element	Type	Description
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RegionEnabled	Boolean	Setting to enable/disable region.
Region	Region3D	Measurement region.
AsymmetryDetectionType	32s	Determine whether to use asymmetry detection and if enabled, which dimension would be the basis of detection. The possible values are: 0 – None 1 – Major 2 – Minor
Measurements\Major	Ellipse tool measurement	Major measurement.
Measurements\Minor	Ellipse tool measurement	Minor measurement.
Measurements\Ratio	Ellipse tool measurement	Ratio measurement.
Measurements\ZAngle	Ellipse tool measurement	ZAngle measurement.
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature
Features\MajorAxisLine	GeometricFeature	MajorAxisLine LineFeature
Features\MinroAxisLine	GeometricFeature	MinorAxisLine LineFeature

Ellipse Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable

Element	Type	Description
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfaceHole

A SurfaceHole element defines settings for a surface hole tool and one or more of its measurements.

SurfaceHole Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfaceHole</i> above.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video

Element	Type	Description
		2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
NominalRadius	64f	Nominal radius (mm).
RadiusTolerance	64f	Radius tolerance (mm).
PartialDetectionEnabled	Boolean	Setting to enable/disable partial detection: 0 – Disable 1 – Enable
DepthLimitEnabled	Boolean	Setting to enable/disable depth limit: 0 – Disable 1 – Enable
DepthLimit	64f	The depth limit relative to the surface. Data below this limit is ignored.
RegionEnabled	Boolean	Setting to enable/disable region: 0 – Disable 1 – Enable
Region	Region3D	Measurement region.
RefRegionsEnabled	Boolean	Setting to enable/disable reference regions: 0 – Disable 1 – Enable
RefRegionCount	32s	Count of the reference regions that are to be used. (Advanced tab.)
RefRegions	(Collection)	Reference regions. Contains up to two RefRegion elements of type SurfaceRegion2D . (Advanced tab.)
AutoTiltEnabled	Boolean	Setting to enable/disable tilt correction: 0 – Auto Set 1 – Custom
TiltXAngle	64f	Setting for custom tilt correction angle X.
TiltYAngle	64f	Setting for custom tilt correction angle Y.
Measurements\X	Hole tool measurement	X measurement.
Measurements\Y	Hole tool measurement	Y measurement.
Measurements\Z	Hole tool measurement	Z measurement.
Measurements\Radius	Hole tool	Radius measurement.

Element	Type	Description
	measurement	
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature

Hole Tool Measurement

Element	Type	Description
@id	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfaceOpening

A SurfaceOpening element defines settings for a surface opening tool and one or more of its measurements.

SurfaceOpening Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.

Element	Type	Description
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfaceOpening</i> on the previous page.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
Type	32s	Type of the opening: 0 – Rounded 1 – Slot
NominalWidth	64f	Nominal width (mm).
NominalLength	64f	Nominal length (mm).
NominalAngle	64f	Nominal angle (degrees).
NominalRadius	64f	Nominal radius (mm).
WidthTolerance	64f	Radius tolerance (mm).
LengthTolerance	64f	Length tolerance (mm).
AngleTolerance	64f	Angle tolerance (degrees).
PartialDetectionEnabled	Boolean	Setting to enable/disable partial detection: 0 – Disable 1 – Enable
DepthLimitEnabled	Boolean	Setting to enable/disable depth limit: 0 – Disable 1 – Enable
DepthLimit	64f	The depth limit relative to the surface. Data below this limit

Element	Type	Description
		is ignored.
RegionEnabled	Boolean	Setting to enable/disable region: 0 – Disable 1 – Enable
Region	Region3D	Measurement region.
RefRegionsEnabled	Boolean	Setting to enable/disable reference regions (Advanced tab): 0 – Disable 1 – Enable
RefRegionCount	32s	Count of the reference regions that are to be used. (Advanced tab.)
RefRegions	(Collection)	Reference regions. Contains two RefRegion elements of type SurfaceRegion2D .
AutoTiltEnabled	Boolean	Setting to enable/disable tilt correction (Advanced tab): 0 – Disable 1 – Enable
TiltXAngle	64f	Setting for custom tilt correction angle X.
TiltYAngle	64f	Setting for custom tilt correction angle Y.
Measurements\X	Opening tool measurement	X measurement.
Measurements\Y	Opening tool measurement	Y measurement.
Measurements\Z	Opening tool measurement	Z measurement.
Measurements\Width	Opening tool measurement	Width measurement.
Measurements\Length	Opening tool measurement	Length measurement.
Measurements\Angle	Opening tool measurement	Angle measurement.
Features\CenterPoint	GeometricFeature	CenterPoint PointFeature

Opening Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable

Element	Type	Description
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfacePlane

A SurfacePlane element defines settings for a surface plane tool and one or more of its measurements.

SurfacePlane Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.

Element	Type	Description
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RegionsEnabled	Boolean	Setting to enable/disable regions: 0 – Disable 1 – Enable
RegionCount	32s	Count of the regions.
Regions	(Collection)	Measurement regions. Contains up to four Region elements of type Region3D .
Measurements\XAngle	Plane tool measurement	XAngle measurement.
Measurements\YAngle	Plane tool measurement	YAngle measurement.
Measurements\ZOffset	Plane tool measurement	ZOffset measurement.
Measurements\StdDev	Plane tool measurement	Standard deviation measurement
Measurements\MinError	Plane tool measurement	Minimum error measurement
Measurements\MaxError	Plane tool measurement	Maximum error measurement
Measurements\XNormal	PlaneMeasurement	XNormal measurement
Measurements\YNormal	PlaneMeasurement	YNormal measurement
Measurements\ZNormal	PlaneMeasurement	ZNormal measurement
Measurements\Distance	PlaneMeasurement	Distance from normal measurement
Features\Plane	GeometricFeature	Resulting plane PlaneFeature.

Plane Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state:

Element	Type	Description
		0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfacePosition

A SurfacePosition element defines settings for a surface position tool and one or more of its measurements.

SurfacePosition Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>SurfacePosition</i> above.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.

Element	Type	Description
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
Feature	SurfaceFeature	Measurement feature.
Measurements\X	Position tool measurement	X measurement.
Measurements\Y	Position tool measurement	Y measurement.
Measurements\Z	Position tool measurement	Z measurement.
Features\Point	GeometricFeature	Point PointFeature

Position Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.

Element	Type	Description
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.

SurfaceStud

A SurfaceStud element defines settings for a surface stud tool and one or more of its measurements.

SurfaceStud Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
Name	String	Tool name.
Features	Collection	Collection of geometric feature outputs available in the tool. See <i>Feature Child Elements</i> on page 445.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
StudRadius	64f	Radius of stud (mm).
StudHeight	64f	Height of stud (mm).
BaseHeight	64f	Height of stud's base.

Element	Type	Description
TipHeight	64f	Height of stud's tip.
RegionEnabled	Boolean	Setting to enable/disable region.
Region	Region3D	Measurement region.
RefRegionsEnabled	Boolean	Setting to enable/disable reference regions: 0 – Disable 1 – Enable
RefRegionCount	32s	Count of the reference regions that are to be used. (Advanced tab.)
RefRegions	(Collection)	Reference regions. Contains up to four RefRegion elements of type SurfaceRegion2D . (Advanced tab.)
AutoTiltEnabled	Boolean	Setting to enable/disable tilt correction (Advanced tab) : 0 – Auto Set 1 – Custom
TiltXAngle	64f	Setting for custom tilt correction angle X.
TiltYAngle	64f	Setting for custom tilt correction angle Y.
Measurements\BaseX	Stud tool measurement	BaseX measurement.
Measurements\BaseY	Stud tool measurement	BaseY measurement.
Measurements\BaseZ	Stud tool measurement	BaseZ measurement.
Measurements\TipX	Stud tool measurement	TipX measurement.
Measurements\TipY	Stud tool measurement	TipY measurement.
Measurements\TipZ	Stud tool measurement	TipZ measurement.
Measurements\Radius	Stud tool measurement	Radius measurement.
Features\TipPoint	GeometricFeature	TipPoint PointFeature
Features\BasePoint	GeometricFeature	BasePoint PointFeature

Stud Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable

Element	Type	Description
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
RadiusOffset	64f	Radius offset of the stud.
<i>(Radius measurement only)</i>		

Feature Child Elements

Element	Type	Description
@id	32s	The identifier of the geometric feature. -1 if unassigned.
@dataType	String	The data type of the feature. One of: – PointFeature – LineFeature
Name	String	The display name of the feature.
Enabled	Bool	Whether the given feature output is enabled.

SurfaceVolume

A SurfaceVolume element defines settings for a surface volume tool and one or more of its measurements.

SurfaceVolume Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.

Element	Type	Description
Name	String	Tool name.
Features	Collection	Not used.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Anchor\ZAngle	String (CSV)	The Z Angle measurements (IDs) used for anchoring.
Anchor\ZAngle.options	String (CSV)	The Z measurements (IDs) available for anchoring.
StreamOptions	Collection	A collection of StreamOptions elements.
Stream\Step	32s	The stream source step. Possible values are: 1 – Video 2 – Range 3 – Surface 4 – Section
Stream\ld	32u	The stream source ID.
RegionEnabled	Boolean	Setting to enable/disable region.
Region	Region3D	Measurement region.
Measurements\Volume	Volume tool measurement	Volume measurement.
Measurements\Area	Volume tool measurement	Area measurement.
Measurements\Thickness	Volume tool measurement	Thickness measurement.

Volume Tool Measurement

Element	Type	Description
id (attribute)	32s	Measurement ID. Optional (measurement disabled if not set).
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable

Element	Type	Description
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Location (Thickness measurement only)	32s	Measurement type: 0 – Maximum 1 – Minimum 2 – 2D Centroid 3 – 3D Centroid 4 – Average 5 – Median

Tool (type FeatureDimension)

A Tool element of type FeatureDimension defines settings for a feature dimension tool and one or more of its measurements.

Tool Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
@type	String	Type name of the tool.
@version	String	Version string for custom tool.
Name	String	Tool name.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.

Element	Type	Description
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Parameters\RefPoint	GdkParamGeometricFeature	Reference point feature.
Parameters\Feature	GdkParamGeometricFeature	Reference feature.
Measurements\Measurement @type=Width	Dimension Measurement	Width measurement.
Measurements\Measurement @type=Length	Dimension Measurement	Length measurement.
Measurements\Measurement @type=Height	Dimension Measurement	Width measurement.
Measurements\Measurement @type=Distance	Dimension Measurement	Distance measurement.
Measurements\Measurement @type=PlaneDistance	Dimension Measurement	Plane distance measurement.
<i>Dimension Measurement Child Elements</i>		
@id	32s	Measurement ID. Optional (measurement disabled if not set).
@type	String	Type name of measurement.
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Parameters\WidthAbsolute	GdkParamBool	Absolute width enabled boolean.

(Width measurement only)

Parameters\LengthAbsolute	GdkParamBool	Absolute length enabled boolean.
---------------------------	--------------	----------------------------------

(Length measurement only)

Parameters\HeightAbsolute	GdkParamBool	Absolute height enabled boolean.
---------------------------	--------------	----------------------------------

(Height measurement only)

Tool (type FeatureIntersect)

A Tool element of type FeatureIntersect defines settings for a feature intersection tool and one or more of its measurements.

Tool Child Elements

Element	Type	Description
@isCustom	Bool	Reserved for future use.
@format	32s	Format type of the tool: 0 – Standard built-in tool 1 – GDK user-defined tool 2 – Internal GDK tool
@id	32s	The tool's ID.
@type	String	Type name of the tool.
@version	String	Version string for custom tool.
Name	String	Tool name.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Parameters\Line	GdkParamGeometricFeature	Line feature input.
Parameters\RefLine	GdkParamGeometricFeature	Reference line feature input.
Measurements\Measurement @type=X	Intersect Measurement	X measurement.
Measurements\Measurement @type=Y	Intersect Measurement	Y measurement.
Measurements\Measurement @type=Z	Intersect Measurement	Z measurement.
Measurements\Measurement @type=Angle	Intersect Measurement	Angle measurement.
Features\IntersectPoint	GDK Feature	Intersect point feature.

Intersect Measurement Child Elements

@id	32s	Measurement ID. Optional (measurement disabled if not set).
@type	String	Type name of measurement.
Name	String	Measurement name.
Enabled	Boolean	Measurement enable state: 0 – Disable 1 – Enable
HoldEnabled	Boolean	Output hold enable state: 0 – Disable 1 – Enable
SmoothingEnabled	Boolean	Smoothing enable state: 0 – Disable 1 – Enable
PreserveInvalidsEnabled	Boolean	Preserve invalid measurements enable state 0 – Disable 1 – Enable
SmoothingWindow	32u	Smoothing window.
Scale	64f	Output scaling factor.
Offset	64f	Output offset factor.
DecisionMin	64f	Minimum decision threshold.
DecisionMax	64f	Maximum decision threshold.
Parameters\AngleRange	GdkParamInt	Angle range option choice. Is one of: 0 – -180 To 180 1 – 0 To 360

Custom

A Custom element defines settings for a user-created GDK-based tool and one or more of its measurements.

Custom Child Elements

Element	Type	Description
@type	String	Type name of the tool.
@version	String	Version string for custom tool.
Name	String	Tool name.
Source	32s	Surface source.
Anchor\X	String (CSV)	The X measurements (IDs) used for anchoring.
Anchor\X.options	String (CSV)	The X measurements (IDs) available for anchoring.
Anchor\Y	String (CSV)	The Y measurements (IDs) used for anchoring.

Element	Type	Description
Anchor\Y.options	String (CSV)	The Y measurements (IDs) available for anchoring.
Anchor\Z	String (CSV)	The Z measurements (IDs) used for anchoring.
Anchor\Z.options	String (CSV)	The Z measurements (IDs) available for anchoring.
Parameters	GDK Parameter	Collection of parameters . The element name in the job file is the name of the parameter.
Measurements	GDK Measurement	Collection of measurements .
Features	GDK Feature	Collection of features .

Output

The Output element contains the following sub-elements: Ethernet, Serial, Analog, Digital0, and Digital1. Each of these sub-elements defines the output settings for a different type of Gocator output.

For all sub-elements, the source identifiers used for measurement outputs correspond to the measurement identifiers defined in each tool's Measurements element. For example, in the following XML, in the options attribute of the Measurements element, 2 and 3 are the identifiers of measurements that are enabled and available for output. The value of the Measurements element (that is, 2) means that only the measurement with id 2 (Surface Hole X) will be sent to output.

```
<SurfaceHole>    ...
  <Measurements>
    <X id="2">    ...
    <Y id="3">    ...

<Output>
  <Ethernet>      ...
    <Measurements options="2,3">2</Measurements>
```

Ethernet

The Ethernet element defines settings for Ethernet output.

In the Ethernet element, the source identifiers used for video, range, profile, and surface output, as well as range, profile, and surface intensity outputs, correspond to the *sensor* that provides the data. For example, in the XML below, the *options* attribute of the Surfaces element shows that only two sources are available (see the table below for the meanings of these values). The value in this element—0—indicates that only data from that source will be sent to output.

```
<Output>
  <Ethernet>
    ...
    <Ranges options=""/>
    <Profiles options=""/>
    <Surfaces options="0,1">0</Surfaces>
    ...
```

Ethernet Child Elements

Element	Type	Description
Ethernet.used	Boolean	Indicates if the output is available on the sensor.
Protocol	32s	Ethernet protocol: 0 – Gocator 1 – Modbus 2 – EtherNet/IP 3 – ASCII 4 – PROFINET
Protocol.options	32s (CSV)	List of available protocol options.
TimeoutEnabled	Boolean	Enable or disable auto-disconnection timeout. Applies only to the Gocator protocol.
Timeout	64f	Disconnection timeout (seconds). Used when TimeoutEnabled is true and the Gocator protocol is selected.
Ascii	Section	See <i>Ascii</i> on page 454.
EIP	Section	See <i>EIP</i> on page 454.
Modbus	Section	See <i>Modbus</i> on page 454.
Profinet	Section	See <i>Profinet</i> on page 455.
Videos	32s (CSV)	Selected video sources: 0 – Top 1 – Bottom 2 – Top left 3 – Top right
Videos.options	32s (CSV)	List of available video sources (see above).
Ranges	32s (CSV)	Selected range sources: 0 – Top 1 – Bottom 2 – Top left 3 – Top right
Ranges.options	32s (CSV)	List of available range sources (see above).
Profiles	32s (CSV)	Selected profile sources: 0 – Top 1 – Bottom 2 – Top left 3 – Top right
Profiles.options	32s (CSV)	List of available profile sources (see above).
Surfaces	32s (CSV)	Selected surface sources:

Element	Type	Description
		0 – Top 1 – Bottom 2 – Top left 3 – Top right
Surfaces.options	32s (CSV)	List of available surface sources (see above).
SurfaceSections	32s (CSV)	Selected surface section sources.
SurfaceSections.options	32s (CSV)	List of available surface section sources.
RangeIntensities	32s (CSV)	Selected range intensity sources. 0 – Top 1 – Bottom 2 – Top left 3 – Top right
RangeIntensities.options	32s (CSV)	List of available range intensity sources (see above).
ProfileIntensities	32s (CSV)	Selected profile intensity sources. 0 – Top 1 – Bottom 2 – Top left 3 – Top right
ProfileIntensities.options	32s (CSV)	List of available profile intensity sources (see above).
SurfaceIntensities	32s (CSV)	Selected surface intensity sources.
SurfaceIntensities.options	32s (CSV)	List of available surface intensity sources (see above).
SurfaceSectionIntensities	32s (CSV)	Selected surface section intensity sources
SurfaceSectionIntensities.options	32s (CSV)	List of available surface section intensity sources.
Tracheids	32s (CSV)	Selected tracheid sources.
Tracheids.options	32s (CSV)	List of available tracheid sources.
Measurements	32u (CSV)	Selected measurement sources.
Measurements.options	32u (CSV)	List of available measurement sources.
Events	32u (CSV)	Selected events
Events.Options	32u (CSV)	CSV list of possible event options: 0 – Exposure Begins 1 – Exposure Ends
Features	32u (CSV)	Selected feature sources.
Features.options	32u (CSV)	List of available feature sources.
ToolData	32u (CSV)	Selected tool data sources.
ToolData.options	32u (CSV)	List of available tool data sources.

Ascii

Ascii Child Elements

Element	Type	Description
Operation	32s	Operation mode: 0 – Asynchronous 1 – Polled
ControlPort	32u	Control service port number.
HealthPort	32u	Health service port number.
DataPort	32u	Data service port number.
Delimiter	String	Field delimiter.
Terminator	String	Line terminator.
InvalidValue	String	String for invalid output.
CustomDataFormat	String	Custom data format.
CustomFormatEnabled	Bool	Enables custom data format.
StandardFormatMode	32u	The formatting mode used if not a custom format: 0 – Standard 1 – Standard with Stamp

EIP

EIP Child Elements

Element	Type	Description
BufferEnabled	Bool	Enables EtherNet/IP output buffering.
EndianOutputType	32s	Endian output type: 0 – Big endian 1 – Little endian
ImplicitOutputEnabled	Bool	Enables Implicit (I/O) Messaging.
ImplicitTriggerOverride	32s	Override requested trigger type by client: 0 – No override 1 – Cyclic 2 – Change of State

Modbus

Modbus Child Elements

Element	Type	Description
BufferEnabled	Bool	Enables Modbus output buffering.

Profinet

Profinet Child Elements

Element	Type	Description
IpAddress	String	Address in dotted notation (e.g. 1.1.1.1).
PrefixLength	32u	Length of prefix for the subnet.
SubnetMask	String	Address in dotted notation (e.g. 1.1.1.1).
Gateway	String	Address in dotted notation (e.g. 1.1.1.1).
DeviceName	String	Profinet name for the device.

Digital0 and Digital1

The Digital0 and Digital1 elements define settings for the Gocator's two digital outputs.

Digital0 and Digital1 Child Elements

Element	Type	Description
Digital0.used	Boolean	Indicates if the output is available on the sensor.
Event	32s	Triggering event: 0 – None (disabled) 1 – Measurements 2 – Software 3 – Alignment state 4 – Acquisition start 5 – Acquisition end
SignalType	32s	Signal type: 0 – Pulse 1 – Continuous
ScheduleEnabled	Bool	Enables scheduling.
PulseWidth	64f	Pulse width (µs).
PulseWidth.min	64f	Minimum pulse width (µs).
PulseWidth.max	64f	Maximum pulse width (µs).
PassMode	32s	Measurement pass condition: 0 – AND of measurements is true 1 – AND of measurements is false 2 – Always assert
Delay	64f	Output delay (µs or mm, depending on delay domain defined below).
DelayDomain	32s	Output delay domain: 0 – Time (µs) 1 – Encoder (mm)
Inverted	Bool	Whether the sent bits are flipped.
Measurements	32u (CSV)	Selected measurement sources.
Measurements.options	32u (CSV)	List of available measurement sources.

Analog

The Analog element defines settings for analog output.

The range of valid measurement values [DataScaleMin, DataScaleMax] is scaled linearly to the specified current range [CurrentMin, CurrentMax].

Only one Value or Decision source can be selected at a time.

Analog Child Elements

Element	Type	Description
Analog.used	Boolean	Indicates if the output is available on the sensor.
Event	32s	Triggering event: 0 – None (disabled) 1 – Measurements 2 – Software
ScheduleEnabled	Bool	Enables scheduling.
CurrentMin	64f	Minimum current (mA).
CurrentMin.min	64f	Minimum value of minimum current (mA).
CurrentMin.max	64f	Maximum value of minimum current (mA).
CurrentMax	64f	Maximum current (mA).
CurrentMax.min	64f	Minimum value of maximum current (mA).
CurrentMax.max	64f	Maximum value of maximum current (mA).
CurrentInvalidEnabled	Bool	Enables special current value for invalid measurement value.
CurrentInvalid	64f	Current value for invalid measurement value (mA).
CurrentInvalid.min	64f	Minimum value for invalid current (mA).
CurrentInvalid.max	64f	Maximum value for invalid current (mA).
DataScaleMax	64f	Measurement value corresponding to maximum current.
DataScaleMin	64f	Measurement value corresponding to minimum current.
Delay	64f	Output delay (μs or mm, depending on delay domain defined below).
DelayDomain	32s	Output delay domain: 0 – Time (μs) 1 – Encoder (mm)
Measurement	32u	Selected measurement source.
Measurement.options	32u (CSV)	List of available measurement sources.



The delay specifies the time or position at which the analog output activates. Upon activation, there is an additional delay before the analog output settles at the correct value.

Serial

The Serial element defines settings for Serial output.

Serial Child Elements

Element	Type	Description
Serial.used	Boolean	Indicates if the output is available on the sensor.
Protocol	32s	Serial protocol: 0 – ASCII 1 – Selcom
Protocol.options	32s (CSV)	List of available protocols.
Selcom	Section	See <i>Selcom</i> below.
Ascii	Section	See <i>Ascii</i> below.
Measurements	32u (CSV)	Selected measurement sources.
Measurements.options	32u (CSV)	List of available measurement sources.

Selcom

Selcom Child Elements

Element	Type	Description
Rate	32u	Output bit rate.
Rate.options	32u (CSV)	List of available rates.
Format	32s	Output format: 0 – 12-bit 1 – 12-bit with search 2 – 14-bit 3 – 14-bit with search
Format.options	32s (CSV)	List of available formats.
DataScaleMin	64f	Measurement value corresponding to minimum word value.
DataScaleMax	64f	Measurement value corresponding to maximum word value.
Delay	64u	Output delay in μ s.

Ascii

Ascii Child Elements

Element	Type	Description
Rate	32u	Output bit rate.
Rate.options	32u (CSV)	List of available rates.
Delimiter	String	Field delimiter.
Terminator	String	Line terminator.
InvalidValue	String	String for invalid output.
CustomDataFormat	String	Custom data format.
CustomFormatEnabled	Bool	Enables custom data format.
StandardFormatMode	32u	The formatting mode used if not a custom format: 0 – Standard 1 – Standard with Stamp

Transform

The transformation component contains information about the physical system setup that is used to:

- Transform data from sensor coordinate system to another coordinate system (e.g., world)
- Define encoder resolution for encoder-based triggering
- Define the travel offset (Y offset) between sensors for staggered operation

You can access the Transform component of the active job as an XML file, either using path notation, via "_live.job/transform.xml", or directly via "_live.tfm".

You can access the Transform component in user-created job files in non-volatile storage, for example, "productionRun01.job/transform.xml". You can only access transformations in user-created job files using path notation.

See the following sections for the elements contained in this component.

Transformation Example:

```
<?xml version="1.0" encoding="UTF-8"?>
<Transform version="100">
  <EncoderResolution>1</EncoderResolution>
  <Speed>100</Speed>
  <Devices>
    <Device role="0">
      <X>-2.3650924829</X>
      <Y>0.0</Y>
      <Z>123.4966803469</Z>
      <XAngle>5.7478302588</XAngle>
      <YAngle>3.7078302555</XAngle>
      <ZAngle>2.7078302556</XAngle>
    </Device>
    <Device id="1">
      <X>0</X>
      <Y>0.0</Y>
      <Z>123.4966803469</Z>
      <XAngle>5.7478302588</XAngle>
      <YAngle>3.7078302555</XAngle>
      <ZAngle>2.7078302556</XAngle>
    </Device>
  </Devices>
</Transform>
```

The Transform element contains the alignment record for the sensor.

Transform Child Elements

Element	Type	Description
@version	32u	Major transform version (100).
@versionMinor	32u	Minor transform version (0).
EncoderResolution	64f	Encoder Resolution (mm/tick).
Speed	64f	Travel Speed (mm/s).
Devices	(Collection)	Contains two Device elements.

Device

A Device element defines the transformation for a sensor. There is one entry element per sensor, identified by a unique role attribute (0 for main and 1 for buddy):

Device Child Elements

Element	Type	Description
@role	32s	Role of device described by this section: 0 – Main 1 – Buddy
X	64f	Translation on the X axis (mm).
Y	64f	Translation on the Y axis (mm).
Z	64f	Translation on the Z axis (mm).
XAngle	64f	Rotation around the X axis (degrees).
YAngle	64f	Rotation around the Y axis (degrees).
ZAngle	64f	Rotation around the Z axis (degrees).

The rotation (counter-clockwise in the X-Z plane) is performed before the translation.

Part Models

Part models represent models created using the part matching feature.

You can access a model in the active job using path notation. For example, to access a model called scan.mdl, use "_live.job/scan.mdl".

You can access part models in user-created job files in non-volatile storage, for example, "productionRun01.job/model1.mdl". You can only access part models in user-created job files using path notation.

See the following sections for the elements contained in a model.

Part models contain the following subcomponents. You can access the subcomponents using path notation, for example, "productionRun01.job/myModel.mdl/config.xml".

Part Model Child Elements

Element	Type	Description
Configuration	config.xml	Model configuration XML. It is always present. (See <i>Configuration</i> on page

Element	Type	Description
		461.)
Edge Points	edge-height-top	Edge points for the top heightmap. (See <i>Edge Points</i> below.)
Edge Points	edge-height-bottom	Edge points for the bottom heightmap.
Edge Points	edge-intensity-top	Edge points for the top intensity map.
Edge Points	edge-intensity-bottom	Edge points for the bottom intensity map.

The edge points file exists only when the model contains the source data for the edge points.

Edge Points

Edge Points Data

Field	Type	Offset	Description
id	16s	0	Sender ID -1 – Part matching
source	8s	2	Source 0 – Model 1 – Target
imageType	8s	3	Image type 0 – Height map 1 – Intensity map
imageSource	8s	4	Image source 0 – Top 1 – Bottom
width	32u	5	Width of model space, in units of xScale
length	32u	9	Length of model space, un units of yScale
xScale	32u	13	X scale (nm)
yScale	32u	17	Y scale (nm)
xOffset	32s	21	X offset (μm)
yOffset	32s	25	Y offset μm
zAngle	32s	29	Z rotation (microdegrees)
pointCount	32u	33	Number of edge points
points[pointCount]	(32u, 32u)	37	Edge points collection. Each point is a tuple of x and y values, in units of xScale and yScale, respectively.

Configuration

Configuration Child Elements

Element	Type	Description
@version	32u	Major version (1).
@versionMinor	32u	Minor version (0).
Edges	Collection	Collection of Edge items (described below).
EdgeSensitivity	64f	Sensitivity recorded during model edges generation (read-only).
TransformedDataRegion	Region3d	Data region of the model.
ZAngle	64f	Additional rotation applied to the model (degrees).
TargetEdgeSensitivity	64f	Sensitivity used to generate target edges.
ImageType	32s	Selects type of image used to generate edges: 0 – Height map 1 – Intensity map
ImageType.options	32s (CSV)	List of available image types.

Protocols

Gocator supports protocols for communicating with sensors over Ethernet (TCP/IP) and serial output. For a protocol to output data, it must be enabled and configured in the active job.



If you switch jobs or make changes to a job using the SDK or a protocol (from a PLC), the switch or changes are not automatically displayed in the web interface: you must refresh the browser to see these.

Protocols available over Ethernet

- [Gocator](#)
- [Modbus](#)
- [EtherNet/IP](#)
- [PROFINET](#)
- [ASCII](#)

Protocols available over serial

- [ASCII](#)

Gocator Protocol

This section describes the TCP and UDP commands and data formats used by a client computer to communicate with Gocator sensors using the Gocator protocol. It also describes the connection types (Discovery, Control, Upgrade, Data, and Health), and data types. The protocol enables the client to:

- Send commands to run sensors, provide software triggers, read/write files, etc.
- Receive data, health, and diagnostic messages.
- Upgrade firmware.



The Gocator 4.x firmware uses mm, mm², mm³, and degrees as standard units. In all protocols, values are scaled by 1000, as values in the protocols are represented as integers. This results in effective units of mm/1000, mm²/1000, mm³/1000, and deg/1000 in the protocols.

To use the Gocator protocol, it must be enabled and configured in the active job.



Gocator sensors send UDP broadcasts over the network over the Internal Discovery channel (port 2016) at regular intervals during operation to perform peer discovery.



The Gocator SDK provides open source C language libraries that implement the network commands and data formats defined in this section. For more information, see *GoSDK* on page 552.

For information on configuring the protocol using the Web interface, see *Ethernet Output* on page 331.

For information on job file structures (for example, if you wish to create job files programmatically), see *Job File Structure* on page 369.

Data Types

The table below defines the data types and associated type identifiers used in this section.

All values except for IP addresses are transmitted in little endian format (least significant byte first) unless stated otherwise. The bytes in an IP address "a.b.c.d" will always be transmitted in the order a, b, c, d (big endian).

Data Types

Type	Description	Null Value
char	Character (8-bit, ASCII encoding)	-
byte	Byte.	-
8s	8-bit signed integer.	-128
8u	8-bit unsigned integer.	255U
16s	16-bit signed integer.	-32768 (0x8000)
16u	16-bit unsigned integer.	65535 (0xFFFF)
32s	32-bit signed integer.	-2147483648 (0x80000000)
32u	32-bit unsigned integer.	4294967295 (0xFFFFFFFF)
64s	64-bit signed integer.	-9223372036854775808 (0x8000000000000000)
64u	64-bit unsigned integer.	18446744073709551615 (0xFFFFFFFFFFFFFFFF)
64f	64-bit floating point	-1.7976931348623157e+308
Point16s	Two 16-bit signed integers	-
Point64f	Two 64-bit floating point values	-
Point3d64f	Three 64-bit floating point values	-
Rect64f	Four 64-bit floating point values	-
Rect3d64f	Eight 64-bit floating point values	-

Commands

The following sections describe the commands available on the Discovery (page 464), Control (page 467), and Upgrade (page 502) channels.

When a client sends a command over the Control or Upgrade channel, the sensor sends a reply whose identifier is the same as the command's identifier. The identifiers are listed in the tables of each of the commands.

Status Codes

Each reply on the Discovery, Control, and Upgrade channels contains a *status* field containing a status code indicating the result of the command. The following status codes are defined:

Status Codes

Label	Value	Description
OK	1	Command succeeded.
Failed	0	Command failed.
Invalid State	-1000	Command is not valid in the current state.
Item Not Found	-999	A required item (e.g., file) was not found.
Invalid Command	-998	Command is not recognized.
Invalid Parameter	-997	One or more command parameters are incorrect.
Not Supported	-996	The operation is not supported.
Simulation Buffer Empty	-992	The simulation buffer is empty.

Discovery Commands

Sensors ship with the following default network configuration:

Setting	Default
DHCP	0 (disabled)
IP Address	192.168.1.10
Subnet Mask	255.255.255.0
Gateway	0.0.0.0 (disabled)

Use the [Get Address](#) and [Set Address](#) commands to modify a sensor's network configuration. These commands are UDP broadcast messages:

Destination Address	Destination Port
255.255.255.255	3220

When a sensor accepts a discovery command, it will send a UDP broadcast response:

Destination Address	Destination Port
255.255.255.255	Port of command sender.

The use of UDP broadcasts for discovery enables a client computer to locate a sensor when the sensor and client are configured for different subnets. All you need to know is the serial number of the sensor in order to locate it on an IP network.

Get Address

The Get Address command is used to discover Gocator sensors across subnets.

Command

Field	Type	Offset	Description
length	64s	0	Command length.
type	64s	8	Command type (0x1).

Field	Type	Offset	Description
signature	64s	16	Message signature (0x0000504455494D4C)
deviceld	64s	24	Serial number of the device whose address information is queried. 0 selects all devices.

Reply

Field	Type	Offset	Description
length	64s	0	Reply length.
type	64s	8	Reply type (0x1001).
status	64s	16	Operation status.
signature	64s	24	Message signature (0x0000504455494D4C)
deviceld	64s	32	Serial number.
dhcpEnabled	64s	40	0 – Disabled 1 – Enabled
reserved[4]	byte	48	Reserved.
address[4]	byte	52	The IP address in left to right order.
reserved[4]	byte	56	Reserved.
subnetMask[4]	byte	60	The subnet mask in left to right order.
reserved[4]	byte	64	Reserved.
gateway[4]	byte	68	The gateway address in left to right order.
reserved[4]	byte	72	Reserved.
reserved[4]	byte	76	Reserved.

Set Address

The Set Address command modifies the network configuration of a Gocator sensor. On receiving the command, the Gocator will perform a reset. You should wait 30 seconds before re-connecting to the Gocator.

Command

Field	Type	Offset	Description
length	64s	0	Command length.
type	64s	8	Command type (0x2).
signature	64s	16	Message signature (0x0000504455494D4C)
deviceld	64s	24	Serial number of the device whose address information is queried. 0 selects all devices.
dhcpEnabled	64s	32	0 – Disabled 1 – Enabled
reserved[4]	byte	40	Reserved.
address[4]	byte	44	The IP address in left to right order.
reserved[4]	byte	48	Reserved.
subnetMask[4]	byte	52	The subnet mask in left to right order.
reserved[4]	byte	56	Reserved.

Field	Type	Offset	Description
gateway[4]	byte	60	The gateway address in left to right order.
reserved[4]	byte	64	Reserved.
reserved[4]	byte	68	Reserved.

Reply

Field	Type	Offset	Description
length	64s	0	Reply length.
type	64s	8	Reply type (0x1002).
status	64s	16	Operation status. For a list of status codes, see <i>Commands</i> on page 463.
signature	64s	24	Message signature (0x0000504455494D4C).
deviceld	64s	32	Serial number.

Get Info

The Get Info command is used to retrieve sensor information.

Command

Field	Type	Offset	Description
length	64s	0	Command length.
type	64s	8	Command type (0x5).
signature	64s	16	Message signature (0x0000504455494D4C).
deviceld	64s	24	Serial number of the device whose address information is queried. 0 selects all devices.

Reply

Field	Type	Offset	Description
length	64s	0	Reply length.
type	64s	8	Reply type (0x1005).
status	64s	16	Operation status. For a list of status codes, see <i>Commands</i> on page 463.
signature	64s	24	Message signature (0x0000504455494D4C).
attrCount	16u	32	Byte count of the attributes (begins after this field and ends before propertyCount).
id	32u	34	Serial number.
version	32u	38	Version as a 4-byte integer (encoded in little-endian).
uptime	64u	42	Sensor uptime (microseconds).
ipNegotiation	byte	50	IP negotiation type: 0 – Static 1 – DHCP

Field	Type	Offset	Description
addressVersion	byte	51	IP address version (always 4).
address[4]	byte	52	IP address.
reserved[12]	byte	56	Reserved.
prefixLength	32u	68	Subnet prefix length (in number of bits).
gatewayVersion	byte	72	Gateway address version (always 4).
gatewayAddress[4]	byte	73	Gateway address.
reserved[12]	byte	77	Reserved.
controlPort	16u	89	Control channel port.
upgradePort	16u	91	Upgrade channel port.
healthPort	16u	93	Health channel port.
dataPort	16u	95	Data channel port.
webPort	16u	97	Web server port.
propertyCount	8u	99	Number of sensor ID properties.
properties [propertyCount]	Property	100	List of sensor ID properties.

Property

Field	Type	Description
nameLength	8u	Length of the name.
name[nameLength]	char	Name string.
valueLength	8u	Length of the value.
value[valueLength]	char	Value string.

Control Commands

A client sends control commands for most operations over the Control TCP channel (port 3190).

The Control channel and the Upgrade channel (port 3192) can be connected simultaneously. For more information on Upgrade commands, see *Upgrade Commands* on page 502.

States

A Gocator system can be in one of two states: Ready or Running. The client sends the [Start](#) and [Stop](#) control commands to change the system's current state to Running and Ready, respectively. The sensor can also be configured to boot in either the Ready or Running state, by enabling or disabling autostart, respectively, using the [Set Auto Start Enabled](#) command.

In the Ready state, a sensor can be configured. In the Running state, a sensor responds to input signals, performs measurements, drives its outputs, and sends data messages to the client.

The state of the sensor can be retrieved using the [Get States](#) or [Get System Info](#) command.

Progressive Reply

Some commands send replies progressively, as multiple messages. This allows the sensor to stream data without buffering it first, and allows the client to obtain progress information on the stream.

A progressive reply begins with an initial, standard reply message. If the *status* field of the reply indicates success, the reply is followed by a series of “continue” reply messages.

A continue reply message contains a block of data of variable size, as well as status and progress information. The series of continue messages is ended by either an error, or a continue message containing 0 bytes of data.

Protocol Version

The Protocol Version command returns the protocol version of the connected sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4511)

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4511).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
majorVersion	8u	10	Major version.
minorVersion	8u	11	Minor version.

Get Address

The Get Address command is used to get a sensor address.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x3012)

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x3012).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
dhcpEnabled	byte	10	0 – DHCP not used 1 – DHCP used
address[4]	byte	11	IP address (most significant byte first).
subnetMask[4]	byte	15	Subnet mask.
gateway[4]	byte	19	Gateway address.

Set Address

The Set Address command modifies the network configuration of a Gocator sensor. On receiving the command, the Gocator will perform a reset. You should wait 30 seconds before re-connecting to the Gocator.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x3013)
dhcpEnabled	byte	6	0 – DHCP not used 1 – DHCP used
address[4]	byte	7	IP address (most significant byte first).
subnetMask[4]	byte	11	Subnet mask.
gateway[4]	byte	15	Gateway address.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x3013).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get System Info V2

The Get System Info command reports information about the local node, remote nodes and assigned buddies.

Firmware version refers to the version of the Gocator's firmware installed on each individual sensor. The client can upgrade the Gocator's firmware by sending the Start Upgrade command (see *Start Upgrade* on page 502). Firmware upgrade files are available from the downloads section under the support tab on the LMI web site. For more information on getting the latest firmware, see *Firmware Upgrade* on page 79.

Every Gocator sensor contains factory backup firmware. If a firmware upgrade command fails (e.g., power is interrupted), the factory backup firmware will be loaded when the sensor is reset or power cycled. In this case, the sensors will fall back to the factory default IP address. To avoid IP address conflicts in a multi-sensor system, connect to one sensor at a time and re-attempt the firmware upgrade.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4010)

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4010).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
localInfoSize	16u	10	Size of localInfo structure. Current: 52.
localInfo	Device Info	12	Info for this device.
remoteCount	32u	-	Number of discovered sensors.
remoteInfoSize	16u	-	Size of remoteInfo structure. Current 60.
remoteInfo [remoteCount]	Remote Info	-	List of info for discovered sensors.
buddyInfoCount	32u	-	Number of buddies assigned (can be 0).
buddyInfoSize	16u	-	Size of buddyInfo structure. Current: 8.
Buddies[buddyCount]	Buddy Info	-	List of info for the assigned buddies.

Sensor Info

Field	Type	Offset	Description
deviceId	32u	0	Serial number of the device.
address[4]	byte	4	IP address (most significant byte first).
modelName[32]	char	8	Model name.
firmwareVersion[4]	byte	40	Firmware version (most significant byte first).
state	32s	44	Sensor state 0 – Ready 1 – Running For more information on states, see <i>Control Commands</i> on page 467.
role	32s	48	Sensor role 0 – Main

Remote Info

Field	Type	Offset	Description
deviceId	32u	0	Serial number of the device.
address[4]	byte	4	IP address (most significant byte first).
modelName[32]	char	8	Model name.
firmwareVersion[4]	byte	40	Firmware version (most significant byte first).
state	32s	44	Sensor state 0 – Ready 1 – Running For more information on states, see <i>Control Commands</i> on page

Field	Type	Offset	Description
			467.
role	32s	48	Sensor role 0 – Main
mainId	32u	52	Serial number of the main device, or zero.
buddiableStatus	32s	56	Whether or not the device can be buddied: 1 – Can be buddied
			Errors: 0 – Unbuddiable (General Error) -100 – Already buddied -99 – Invalid State (e.g. running) -98 – Version Mismatch -97 – Model Mismatch

Buddy Info

Field	Type	Offset	Description
deviceId	32u	2	Serial number of the device.
state	k32s	6	Buddy state 2 - Connecting 1 – Connected
			Errors: 0 – Unbuddiable (General Error) -100 – Already buddied -99 – Invalid State (e.g. running) -98 – Version Mismatch -97 – Model Mismatch -95 – Device Missing

Get System Info



This version of the Get System Info command is deprecated. Use [Get System Info \(v2\)](#) instead.

The Get System Info command reports information for sensors that are visible in the system.

Firmware version refers to the version of the Gocator's firmware installed on each individual sensor. The client can upgrade the Gocator's firmware by sending the Start Upgrade command (see *Start Upgrade* on page 502). Firmware upgrade files are available from the downloads section under the support tab on the LMI web site. For more information on getting the latest firmware, see *Firmware Upgrade* on page 79.

Every Gocator sensor contains factory backup firmware. If a firmware upgrade command fails (e.g., power is interrupted), the factory backup firmware will be loaded when the sensor is reset or power cycled. In this case, the sensors will fall back to the factory default IP address. To avoid IP address conflicts in a multi-sensor system, connect to one sensor at a time and re-attempt the firmware upgrade.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4002)

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4002).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
localInfo	Sensor Info	10	Info for this device.
remoteCount	32u	66	Number of discovered sensors.
remoteInfo [remoteCount]	Sensor Info	70	List of info for discovered sensors.

Sensor Info

Field	Type	Offset	Description
deviceId	32u	0	Serial number of the device.
address[4]	byte	4	IP address (most significant byte first).
modelName[32]	char	8	Model name.
firmwareVersion[4]	byte	40	Firmware version (most significant byte first).
state	32s	44	Sensor state 0 – Ready 1 – Running For more information on states, see <i>Control Commands</i> on page 467.
role	32s	48	Sensor role 0 – Main

Get States

The Get States command returns various system states.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4525)

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4525).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
count	32u	10	Number of state variables.
sensorState	32s	14	Sensor state 0 – Ready 1 – Running For more information on states, see <i>Control Commands</i> on page 467.
loginState	32s	18	Device login state 0 – No user 1 – Administrator 2 – Technician
alignmentReference	32s	22	Alignment reference 0 – Fixed 1 – Dynamic
alignmentState	32s	26	Alignment state 0 – Unaligned 1 – Aligned
recordingEnabled	32s	30	Whether or not recording is enabled 0 – Disabled 1 – Enabled
playbackSource	32s	34	Playback source 0 – Live data 1 – Recorded data
uptimeSec	32s	38	Uptime (whole seconds component)
uptimeMicrosec	32s	42	Uptime (remaining microseconds component)
playbackPos	32s	46	Playback position
playbackCount	32s	50	Playback frame count
autoStartEnabled	32s	54	Auto-start enable (boolean)

Log In/Out

The Log In/Out command is used to log in or out of a sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4003).
userType	32s	6	Defines the user type 0 – None (log out) 1 – Administrator 2 – Technician
password[64]	char	10	Password (required for log-in only).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4003).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Change Password

The Change Password command is used to change log-in credentials for a user.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4004).
user type	32s	6	Defines the user type 0 – None (log out) 1 – Administrator 2 – Technician
password[64]	char	10	New password.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4004).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



Passwords can only be changed if a user is logged in as an administrator.

Set Buddy

The Set Buddy command is used to assign or unassign a Buddy sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4005).
buddyId	32u	6	Id of the sensor to acquire as buddy. Set to 0 to remove buddy.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4005).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

List Files

The List Files command returns a list of the files in the sensor's file system.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x101A).
extension[64]	char	6	Specifies the extension used to filter the list of files (does not include the "."). If an empty string is used, then no filtering is performed.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x101A).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
count	32u	10	Number of file names.
fileNames[count][64]	char	14	File names.

Copy File

The Copy File command copies a file from a source to a destination within the connected sensor (a .job file, a component of a job file, or another type of file; for more information, see *Job File Structure* on page 369).

To make a job active (to load it), copy a saved job to "_live.job".

To "save" the active job, copy from "_live.job" to another file.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x101B).
source[64]	char	6	Source file name.
destination[64]	char	70	Destination file name.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x101B).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Read File

Downloads a file from the connected sensor (a .job file, a component of a job file, or another type of file; for more information, see *Job File Structure* on page 369).

To download the live configuration, pass "_live.job" in the *name* field.

To read the configuration of the live configuration only, pass "_live.job/config.xml" in the *name* field.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1007).
name[64]	char	6	Source file name.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1007).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
length	32u	10	File length.
data[length]	byte	14	File contents.

Write File

The Write File command uploads a file to the connected sensor (a .job file, a component of a job file, or another type of file; for more information, see *Job File Structure* on page 369).

To make a job file live, write to "_live.job". Except for writing to the live file, the file is permanently stored on the sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1006).
name[64]	char	6	Source file name.
length	32u	70	File length.
data[length]	byte	74	File contents.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1006).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Delete File

The Delete File command removes a file from the connected sensor (a .job file, a component of a job file, or another type of file; for more information, see *Job File Structure* on page 369).

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1008).
name[64]	char	6	Source file name.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1008).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

User Storage Used

The User Storage Used command returns the amount of user storage that is used.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1021).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1021).
status	32s	6	Reply status.
spaceUsed	64u	10	The used storage space in bytes.

User Storage Free

The User Storage Free command returns the amount of user storage that is free.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1022).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1022).
status	32s	6	Reply status.
spaceFree	64u	10	The free storage space in bytes.

Get Default Job

The Get Default Job command gets the name of the job the sensor loads when it powers up.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4100).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4100).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
name[64]	char	10	The file name (null-terminated) of the job the sensor loads when it powers up.

Set Default Job

The Set Default Job command sets the job the sensor loads when it powers up.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4101).
fileName[64]	char	6	File name (null-terminated) of the job the sensor loads when it powers up.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4101).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Loaded Job

The Get Loaded Job command returns the name and modified status of the currently loaded file.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4512).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4512).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
fileName[64]	char	10	Name of the currently loaded job.
changed	8u	74	Whether or not the currently loaded job has been changed (1: yes; 0: no).

Get Alignment Reference

The Get Alignment Reference command is used to get the sensor's alignment reference.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4104).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4104).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
reference	32s	10	Alignment reference 0 – Fixed 1 – Dynamic

Set Alignment Reference

The Set Alignment Reference command is used to set the sensor's alignment reference.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4103).
reference	32s	6	Alignment reference 0 – Fixed 1 – Dynamic

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4103).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Clear Alignment

The Clear Alignment command clears sensor alignment.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4102).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4102).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Timestamp

The Get Timestamp command retrieves the sensor's timestamp, in clock ticks. All devices in a system are synchronized with the system clock; this value can be used for diagnostic purposes, or used to synchronize the start time of the system.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x100A).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x100A).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
timestamp	64u	10	Timestamp, in clock ticks.

Get Encoder

This command retrieves the current system encoder value.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x101C).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x101C).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
encoder	64s	10	Current encoder position, in ticks.

Reset Encoder

The Reset Encoder command is used to reset the current encoder value.



The encoder value can be reset only when the encoder is connected directly to a sensor. When the encoder is connected to the master, the value cannot be reset via this command.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x101E).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x101E).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Start

The Start command starts the sensor system (system enters the Running state). For more information on states, see *Control Commands* on page 467.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x100D).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x100D).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Scheduled Start

The scheduled start command starts the sensor system (system enters the Running state) at target time or encoder value (depending on the trigger mode). For more information on states, see *Control Commands* on page 467.

Command

Field	Type	Offset	Description
length	32u	0	Command size – in bytes.
id	16u	4	Command identifier (0x100F).
target	64s	6	Target scheduled start value (in ticks or μ s, depending on the trigger type).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size – in bytes.
id	16u	4	Reply identifier (0x100F).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Stop

The Stop command stops the sensor system (system enters the Ready state). For more information on states, see *Control Commands* on page 467.

Command

Field	Type	Type	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1001).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1001).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Auto Start Enabled

The Get Auto Start Enabled command returns whether the system automatically starts after booting.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x452C).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x452C).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
enable	8u	10	0: disabled 1: enabled

Set Auto Start Enabled

The Set Auto Start Enabled command sets whether the system automatically starts after booting (enters Running state; for more information on states, see *Control Commands* on page 467).

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x452B).
enable	8u	6	0: disabled 1: enabled

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x452B).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Voltage Settings

The Get Voltage Settings command returns the sensor's voltage and cable length settings.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4539).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4539).
Voltage	16u	10	0: 48 Volts; 1: 24 Volts.
Cable Length	32u	12	0 – 100: Meters

Set Voltage Settings

The Set Voltage Settings command sets the sensor's voltage and cable length settings.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4538).
Voltage	16u	6	0: 48 Volts; 1: 24 Volts.
Cable Length	32u	8	0 – 100: Meters

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4538).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Quick Edit Enabled

The Get Quick Edit Enabled command returns whether Quick Edit mode is enabled on the sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4541).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4541).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
Enable	8u	10	0: disabled; 1: enabled.

Set Quick Edit Enabled

The Set Quick Edit Enabled command enables or disables Quick Edit mode on the sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4540).
enable	8u	6	0: disabled; 1: enabled.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4540).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Start Alignment

The Start Alignment command is used to start the alignment procedure on a sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4600).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4600).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page

Field	Type	Offset	Description
			463.
opId	32u	10	Operation ID. Use this ID to correlate the command/reply on the Command channel with the correct Alignment Result message on the Data channel. A unique ID is returned each time the client uses this command.

Start Exposure Auto-set

The Start Exposure Auto-set command is used to start the exposure auto-set procedure on a sensor.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4601).
role	32s	6	Role of sensors to auto-set. 0 – Main 1 – Buddy

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4601).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
opId	32u	10	Operation ID. Use this ID to correlate the command/reply on the Command channel with the correct Exposure Calibration Result message on the Data channel. A unique ID is returned each time the client uses this command.

Software Trigger

The Software Trigger command causes the sensor to take a snapshot while in software mode and in the Running state.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4510).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4510).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Schedule Digital Output

The Schedule Digital Output command schedules a digital output event. The digital output must be configured to accept software-scheduled commands and be in the Running state.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4518).
index	16u	6	Index of the output (starts from 0).
target	64s	8	Specifies the time (clock ticks) when or position (μm) at which the digital output event should happen. The target value is ignored if ScheduleEnabled is set to false. (Scheduled is unchecked in Digital in the Output panel.) The output will be triggered immediately.
value	8u	16	Specifies the target state: 0 – Set to low (continuous) 1 – Set to high (continuous) Ignored if output type is pulsed.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4518).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Schedule Analog Output

The Schedule Analog Output command schedules an analog output event. The analog output must be configured to accept software-scheduled commands and be in the Running state.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4519).
index	16u	6	Index of the output. Must be 0.
target	64s	8	Specifies the time (clock ticks) or position (encoder ticks) of when the event should happen. The target value is ignored if ScheduleEnabled is set to false. (Scheduled is unchecked in Analog in the Output panel.) The output will be triggered immediately.
value	32s	16	Output current (microamperes).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4519).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



The analog output takes about 75 us to reach 90% of the target value for a maximum change, then roughly another 40 us to settle completely.

Ping

The Ping command can be used to test the control connection. This command has no effect on sensors.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x100E).
timeout	64u	6	Timeout value (microseconds).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x100E).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



If a non-zero value is specified for timeout, the client must send another ping command before the timeout elapses; otherwise the server would close the connection. The timer is reset and updated with every command.

Reset

The Reset command reboots the Main sensor and any Buddy sensors. All sensors will automatically reset 3 seconds after the reply to this command is transmitted.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4300).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4300).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Backup

The Backup command creates a backup of all files stored on the connected sensor and downloads the backup to the client.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1013).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1013).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
length	32u	10	Data length.
data[length]	byte	14	Data content.

Restore

The Restore command uploads a backup file to the connected sensor and then restores all sensor files from the backup.



The sensor must be reset or power-cycled before the restore operation can be completed.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x1014).
length	32u	6	Data length.
data[length]	byte	10	Data content.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x1014).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Restore Factory

The Restore Factory command restores the connected sensor to factory default settings.



The command erases the non-volatile memory of the main device.

This command has no effect on connected Buddy sensors.

Note that the sensor must be reset or power-cycled before the factory restore operation can be completed.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4301).
resetip	8u	6	Specifies whether IP address should be restored to default: 0 – Do not reset IP 1 – Reset IP

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4301).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Recording Enabled

The Get Recording Enabled command retrieves whether recording is enabled.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4517).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4517).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
enable	8u	10	0: disabled; 1: enabled.

Set Recording Enabled

The Set Recording Enabled command enables recording for replay later.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4516).
enable	8u	6	0: disabled; 1: enabled.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4516).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Clear Replay Data

The Clear Replay Data command clears the sensors replay data..

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4513).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4513).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Playback Source

The Get Playback Source command gets the data source for data playback.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4524).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4524).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
source	32s	10	Source 0 – Live 1 – Replay buffer

Set Playback Source

The Set Playback Source command sets the data source for data playback.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4523).
source	32s	6	Source 0 – Live 1 – Replay buffer

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4523).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Simulate

The Simulate command simulates the last frame if playback source is live, or the current frame if playback source is the replay buffer.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4522).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4522).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
bufferValid	8u	10	Whether or not the buffer is valid.



A reply status of -996 means that the current configuration (mode, sensor type, etc.) does not support simulation.

A reply status of -992 means that the simulation buffer is empty. Note that the buffer can be valid even if the simulation buffer is actually empty due to optimization choices. This scenario means that the simulation buffer would be valid if data were recorded.

Seek Playback

The Seek Playback command seeks to any position in the current playback dataset. The frame is then sent.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4503).
frame	32u	6	Frame index.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4503).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Step Playback

The Step Playback command advances playback by one frame.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4501).
direction	32s	6	Define step direction 0 – Forward 1 – Reverse

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4501).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



When the system is running in the Replay mode, this command advances replay data (playback) by one frame. This command returns an error if no live playback data set is loaded. You can use the [Copy File](#) command to load a replay data set to _live.rec.

Playback Position

The Playback Position command retrieves the current playback position.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4502).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4502).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
Frame Index	32u	10	Current frame index (starts from 0).
Frame Count	32u	14	Total number of available frames/objects.

Clear Measurement Stats

The Clear Measurement Stats command clears the sensor's measurement statistics.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4526).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4526).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Read Live Log

The Read Live Log command returns an XML file containing the log messages between the passed start and end indexes.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x101F).
Start	32u	6	First log to read
End	32u	10	Last log to read

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x101F).
status	32s	6	Reply status.
length	32u	10	File length
data[length]	byte	14	XML Log File

Clear Log

The Clear Log command clears the sensor's log.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x101D).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x101D).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Simulate Unaligned

The Simulate Unaligned command simulates data before alignment transformation.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x452A).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x452A).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Acquire

The Acquire command acquires a new scan.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4528).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4528).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



The command returns after the scan has been captured and transmitted.

Acquire Unaligned

The Acquire Unaligned command acquires a new scan without performing alignment transformation.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4527).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4527).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



The command returns after the scan has been captured and transmitted.

Create Model

The Create Model command creates a new part model from the active simulation scan.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4602).
modelName[64]	char	6	Name of the new model (without .mdl extension)

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4602).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Detect Edges

The Detect Edges command detects and updates the edge points of a part model.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4604).
modelName[64]	char	6	Name of the model (without .mdl extension)
sensitivity	16u	70	Sensitivity (in thousandths).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4604).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Add Tool

The Add Tool command adds a tool to the live job.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4530).
typeName[64]	char	6	Type name of the tool (e.g., ProfilePosition)
name[64]	char	70	User-specified name for tool instance

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4530).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Add Measurement

The Add Measurement command adds a measurement to a tool instance.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4531).
toolIndex	32u	6	Index of the tool instance the new measurement is added to.
typeName[64]	char	10	Type name of the measurement (for example, X).
name[64]	char	74	User-specified name of the measurement instance.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4531).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.



This command can only be used with dynamic tools (tools with a dynamic list of measurements). The maximum number of instances for a given measurement type can be found in the [ToolOptions](#) node. For dynamic tools, the maximum count is greater than one, while for static tools it is one.

Read File (Progressive)

The progressive Read File command reads the content of a file as a stream.

This command returns an initial reply, followed by a series of "continue" replies if the initial reply's *status* field indicates success. The continue replies contain the actual data, and have 0x5000 as their identifier.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4529).
name[64]	char	6	Source file name.

Initial Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4529).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
progressTotal	32u	10	Progress indicating completion (100%).
progress	32u	14	Current progress.

Continue Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x5000).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
progressTotal	32u	10	Progress indicating completion (100%).
progress	32u	14	Current progress.
size	32u	18	Size of the chunk in bytes.
data[size]	byte	22	Chunk data.

Export CSV (Progressive)

The progressive Export CSV command exports replay data as a CSV stream.

This command returns an initial reply, followed by a series of "continue" replies if the initial reply's *status* field indicates success. The continue replies contain the actual data, and have 0x5000 as their identifier.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4507).

Initial Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4507).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
progressTotal	32u	10	Progress indicating completion (100%).
progress	32u	14	Current progress.

Continue Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x5000).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
progressTotal	32u	10	Progress indicating completion (100%).
progress	32u	14	Current progress.
size	32u	18	Size of the chunk in bytes.
data[size]	byte	22	Chunk data.



Only the current surface scan, as determined by the playback position, is exported to the CSV stream.

Export Bitmap (Progressive)

The progressive Export Bitmap command exports replay data as a bitmap stream.

This command returns an initial reply, followed by a series of "continue" replies if the initial reply's *status* field indicates success. The continue replies contain the actual data, and have 0x5000 as their identifier.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4508).
type	32s	6	Data type: 0 – Range or video 1 – Intensity
source	32s	10	Data source to export.

Initial Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4508).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
progressTotal	32u	10	Progress indicating completion (100%).
progress	32u	14	Current progress.

Continue Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x5000).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
progressTotal	32u	10	Progress indicating completion (100%).
progress	32u	14	Current progress.
size	32u	18	Size of the chunk in bytes.
data[size]	byte	22	Chunk data.

Get Flag

The Get Flag command returns the given flag value as a string.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4533).
name[256]	Char	6	A string representing the flag name whose value is to be retrieved.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4533).
valueLength	32u	10	The length of the string representing the flag's value.
value[valueLength]	Char	14	The value of the flag.

Set Flag

The Set Flag command sets the string value for the given flag name.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4534).
Variablename[256]	Char	6	A string representing the flag name whose value is to be retrieved.
valueLength	32u	262	The length of the flag's value string.
value[valueLength]	Char	266	The string representing the flag's value.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4534).
status	32s	6	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Runtime Variable Count

The Get Runtime Variable Count command gets the number of runtime variables that can be accessed.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4537).

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4537).
status	32s	6	Reply status.
valueLength	32u	10	The count of runtime variables.

Set Runtime Variables

The Set Runtime Variables command sets the runtime variables at the given index for the given length.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4536).
index	32u	6	The starting index of the variables to set.
length	32u	10	The number of values to set from the starting index.
values[length]	32s	14	The runtime variable values to set.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4536).
status	32s	6	Reply status.

Get Runtime Variables

The Get Runtime Variables command gets the runtime variables for the given index and length.

Command

Field	Type	Offset	Description
length	32u	0	Command size including this field, in bytes.
id	16u	4	Command identifier (0x4535).
index	32u	6	The starting index of the variables to retrieve.
length	32u	10	The number of values to retrieve from the starting index.

Reply

Field	Type	Offset	Description
length	32u	0	Reply size including this field, in bytes.
id	16u	4	Reply identifier (0x4535).
status	32s	6	Reply status.
index	32u	10	The starting index of the variables being returned.
length	32u	14	The number of values being returned.
values[length]	32s	18	The runtime variable values.

Upgrade Commands

A client sends firmware upgrade commands over the Upgrade TCP channel (port 3192).

The Control channel (port 3190) and the Upgrade channel can be connected simultaneously. For more information on Control commands, see *Control Commands* on page 467.

After connecting to a Gocator sensor, you can use the [Protocol Version](#) command to retrieve the protocol version. Protocol version refers to the version of the Gocator Protocol supported by the *connected sensor* (the sensor to which a command connection is established), and consists of major and minor parts. The minor part is updated when backward-compatible additions are made to the Gocator Protocol. The major part is updated when breaking changes are made to the Gocator Protocol.

Start Upgrade

The Start Upgrade command begins a firmware upgrade for the sensors in a system. All sensors automatically reset 3 seconds after the upgrade process is complete.

Command

Field	Type	Offset	Description
length	64s	0	Command size including this field, in bytes.
id	64s	8	Command identifier (0x0000).
length	64s	16	Length of the upgrade package (bytes).
data[length]	byte	24	Upgrade package data.

Reply

Field	Type	Offset	Description
length	64s	0	Reply size including this field, in bytes.
id	64s	8	Reply identifier (0x0000).
status	64s	16	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Start Upgrade Extended

The Start Upgrade Extended command begins a firmware upgrade for the sensors in a system. All sensors automatically reset 3 seconds after the upgrade process is complete.

Command

Field	Type	Offset	Description
length	64s	0	Command size including this field, in bytes.
id	64s	8	Command identifier (0x0003).
skipValidation	64s	16	Whether or not to skip validation (0 – do not skip, 1 – skip).
length	64s	24	Length of the upgrade package (bytes).
data[length]	byte	32	Upgrade package data.

Reply

Field	Type	Offset	Description
length	64s	0	Reply size including this field, in bytes.
id	64s	8	Reply identifier (0x0003).
status	64s	16	Reply status. For a list of status codes, see <i>Commands</i> on page 463.

Get Upgrade Status

The Get Upgrade Status command determines the progress of a firmware upgrade.

Command

Field	Type	Offset	Description
length	64s	0	Command size including this field, in bytes.
id	64s	8	Command identifier (0x1)

Reply

Field	Type	Offset	Description
length	64s	0	Reply size including this field, in bytes.
id	64s	8	Reply identifier (0x1).
status	64s	16	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
state	64s	24	Upgrade state: -1 – Failed 0 – Completed 1 – Running 2 – Completed, but should run again
progress	64s	32	Upgrade progress (valid when in the Running state)

Get Upgrade Log

The Get Upgrade Log command can retrieve an upgrade log in the event of upgrade problems.

Command

Field	Type	Offset	Description
length	64s	0	Command size including this field, in bytes.
id	64s	8	Command identifier (0x2)

Reply

Field	Type	Offset	Description
length	64s	0	Reply size including this field, in bytes.
id	64s	8	Reply identifier (0x2).
status	64s	16	Reply status. For a list of status codes, see <i>Commands</i> on page 463.
length	64s	24	Length of the log (bytes).
log[length]	char	32	Log content.

Results

The following sections describe the results (data and health) that Gocator sends.

Data Results

A client can receive data messages from a Gocator sensor by connecting to the Data TCP channel (port 3196).

The Data channel and the Health channel (port 3194) can be connected at the same time. The sensor accepts multiple connections on each port. For more information on the Health channel, see *Health Results* on page 515.

Messages that are received on the Data and Health channels use a common structure, called Gocator Data Protocol (GDP). Each GDP message consists of a 6-byte header, containing *size* and *control* fields,

followed by a variable-length, message-specific content section. The structure of the GDP message is defined below.

Gocator Data Protocol

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last Message flag Bits 0-14: Message type identifier. (See individual data result sections.)

GDP messages are always sent in groups. The Last Message flag in the *control* field is used to indicate the final message in a group. If there is only one message per group, this bit will be set in each message.

Stamp

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 1.
count (C)	32u	6	Count of stamps in this message.
size	16u	10	Stamp size, in bytes (min: 56, current: 56).
source	8u	12	Source (0 – Main).
reserved	8u	13	Reserved.
stamps[C]	Stamp	14	Array of stamps (see below).

Stamp

Field	Type	Offset	Description
frameIndex	64u	0	Frame index (counts up from zero).
timestamp	64u	8	Timestamp (µs).
encoder	64s	16	Current encoder value (ticks).
encoderAtZ	64s	24	Encoder value latched at z/index mark (ticks).
status	64u	32	Bit field containing various frame information: Bit 0: sensor digital input state Bit 4: master digital input state Bit 8-9: inter-frame digital pulse trigger (Master digital input if master is connected, otherwise sensor digital input. Value is cleared after each frame and clamped at 3 if more than 3 pulses are received).
serialNumber	32u	40	Sensor serial number. (In a dual-sensor system, the serial number of the main sensor.)
reserved[2]	32u	44	Reserved.

Video

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 2.
attributesSize	16u	6	Size of attributes, in bytes (min: 20, current: 20).
height (H)	32u	8	Image height, in pixels.
width (W)	32u	12	Image width, in pixels.
pixelSize	8u	16	Pixel size, in bytes.
pixelFormat	8u	17	Pixel format: 1 – 8-bit greyscale 2 – 8-bit color filter 3 – 8-bits-per-channel color (B, G, R, X)
colorFilter	8u	18	Color filter array alignment: 0 – None 1 – Bayer BG/GR 2 – Bayer GB/RG 3 – Bayer RG/GB 4 – Bayer GR/BG
source	8u	19	Source 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right
cameraIndex	8u	20	Camera index.
exposureIndex	8u	21	Exposure index.
exposure	32u	22	Exposure (ns).
flippedX	8u	26	Indicates whether the video data must be flipped horizontally to match up with profile data.
flippedY	8u	27	Indicates whether the video data must be flipped vertically to match up with profile data.
streamStep	32s	28	Data stream step number. For video, values are: 0 – video stream step 8 – tool data stream step
streamStepId	32s	32	Data stream step identifier within the stream step.
pixels[H][W]	(Variable)	36	Image pixels. (Depends on pixelSize above.)

Uniform Surface

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 8.
attributeSize	16u	6	Size of attributes, in bytes (min: 40, current: 48).
length (L)	32u	8	Surface length (rows).
length (W)	32u	12	Surface width (columns).
xScale	32u	16	X scale (nm).
yScale	32u	20	Y scale (nm).
zScale	32u	24	Z scale (nm).
xOffset	32s	28	X offset (μm).
yOffset	32s	32	Y offset (μm).
zOffset	32s	36	Z offset (μm).
source	8u	40	Source 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right
exposure	32u	41	Exposure (ns).
reserved[7]	8u	45	Reserved.
streamStep	32s	52	Data stream step number. For a surface, values are: 3 – surface stream step 8 – tool data stream step
streamStepId	32s	56	Data stream step identifier within the stream step.
ranges[L][W]	16s	60	Surface ranges.

Surface Point Cloud

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 28.
attributeSize	16u	6	Size of attributes, in bytes (min: 44, current: 48).
length (L)	32u	8	Surface length (rows).
length (W)	32u	12	Surface width (columns).
xScale	32u	16	X scale (nm).

Field	Type	Offset	Description
yScale	32u	20	Y scale (nm).
zScale	32u	24	Z scale (nm).
xOffset	32s	28	X offset (μm).
yOffset	32s	32	Y offset (μm).
zOffset	32s	36	Z offset (μm).
source	8u	40	Source 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right
exposure	32u	41	Exposure (ns).
isAdjacent	Bool	45	Is the data Adjacent/Sorted? (That is, graphable?)
streamStep	32s	46	Data stream step number. For a surface, values are: 3 – surface stream step 8 – tool data stream step
streamStepId	32s	50	Data stream step identifier within the stream step.
ranges[L][W]	Point3d16s	54	Surface ranges. Tuple (x, y, z) 16s

Surface Intensity

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 9.
attributeSize	16u	6	Size of attributes, in bytes (min: 32, current: 32).
length (L)	32u	8	Surface length (rows).
width (W)	32u	12	Surface width (columns).
xScale	32u	16	X scale (nm).
yScale	32u	20	Y scale (nm).
xOffset	32s	24	X offset (μm).
yOffset	32s	28	Y offset (μm).
source	8u	32	Source 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right
exposure	32u	33	Exposure (ns).

Field	Type	Offset	Description
reserved[3]	8u	37	
streamStep	32s	40	Data stream step number. For surface, values are: 3 – surface stream step 8 – tool data stream step
streamStepId	32s	44	Data stream step identifier within the stream step.
intensities[H][W]	8u	48	Surface intensities.

Surface Section

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 20.
attributeSize	16u	6	Size of attributes, in bytes (min: 45, current: 45).
count (C)	32u	8	Number of profile arrays.
width (W)	32u	12	Number of points per profile array.
xScale	32u	16	X scale (nm).
zScale	32u	20	Z scale (nm).
xOffset	32s	24	X offset (μm).
zOffset	32s	28	Z offset (μm).
source	8u	32	Source 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right
sectionId	32u	33	Section Id
exposure	32u	37	Exposure (ns).
poseAngle	32s	41	Z angle of the pose (microdegrees).
poseX	32s	45	X offset of the pose (μm)
poseY	32s	49	Y offset of the pose (μm)
streamStep	32s	53	Data stream step.
streamStepId	32s	57	Data stream step ID.
ranges[C][W]	16s	61	Profile ranges.



The pose can be used to transform the section data into the surface frame of reference, via a rotation and then a translation.

Surface Section Intensity

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 21.
attributesSize	16u	6	Size of attributes, in bytes (min: 37, current: 37).
count (C)	32u	8	Number of profile intensity arrays
width (W)	32u	12	Number of points per profile intensity array
xScale	32u	16	X scale (nm).
xOffset	32s	20	X offset (μm).
source	8u	24	Source 0 – Top 1 – Bottom 2 – Top Left 3 – Top Right
sectionId	32u	25	Section Id.
exposure	32u	29	Exposure (ns).
poseAngle	32s	33	Z angle of the pose (microdegrees).
poseX	32s	37	X offset of the pose (μm).
poseY	32s	41	Y offset of the pose (μm).
streamStep	32s	45	Data stream step.
streamStepId	32s	49	Data stream step ID.
points[C][W]	8u	53	Intensity arrays.

Measurement

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 10.
count (C)	32u	6	Count of measurements in this message.
reserved[2]	8u	10	Reserved.
id	16u	12	Measurement identifier.
measurements[C]	Measurement	14	Array of measurements (see below).

Measurement

Field	Type	Offset	Description
value	32s	0	Measurement value.

Field	Type	Offset	Description
decision	8u	4	Measurement decision bitmask. Bit 0: 1 – Pass 0 – Fail Bits 1-7: 0 – Measurement value OK 1 – Invalid value 2 – Invalid anchor
reserved[3]	8u	5	Reserved.

Alignment Result

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 11.
attributesSize	16u	6	Size of attributes, in bytes (min: 8, current: 8).
opId	32u	8	Operation ID.
status	32s	12	Operation status. 1 – OK 0 – General failure -1 – No data in the field of view for stationary alignment -2 – No profiles with sufficient data for line fitting for travel alignment -3 – Invalid target detected. Examples include: - Calibration disk diameter too small. - Calibration disk touches both sides of the field of view. - Too few valid data points after outlier rejection. -4 – Target detected in an unexpected position. -5 – No reference hole detected in bar alignment. -6 – No change in encoder value during travel calibration -988 – User aborted -993 – Timed out -997 – Invalid parameter

Exposure Calibration Result

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 12.
attributesSize	16u	6	Size of attributes, in bytes (min: 8, current: 8).
opId	32u	8	Operation ID.
status	32s	12	Operation status.
exposure	32u	16	Exposure result (ns).

Edge Match Result

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 16.
decision	8u	6	Overall match decision.
xOffset	32s	7	Target x offset in model space (μm).
yOffset	32s	11	Target y offset in model space (μm).
zAngle	32s	15	Target z rotation in model space (microdegrees).
quality	32s	19	Match quality (thousandth).
qualityDecision	8u	23	Quality match decision.
reserved[2]	8u	24	Reserved.

Bounding Box Match Result

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 17.
decision	8u	6	Overall match decision.
xOffset	32s	7	Target x offset in model space (μm).
yOffset	32s	11	Target y offset in model space (μm).
zAngle	32s	15	Target z rotation in model space (microdegrees).
width	32s	19	Width axis length (μm)
widthDecision	8u	23	Width axis decision.
length	32s	24	Length axis length (μm)
lengthDecision	8u	28	Length axis decision.

Ellipse Match Result

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 18.
decision	8u	6	Overall match decision.
xOffset	32s	7	Target x offset in model space (μm).
yOffset	32s	11	Target y offset in model space (μm).
zAngle	32s	15	Target z rotation in model space (microdegrees).
minor	32s	19	Minor axis length (μm)
minorDecision	8u	23	Minor axis decision.
major	32s	24	Major axis length (μm)
majorDecision	8u	28	Major axis decision.

Event

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 22.
attributesSize	16u	6	Size of attributes, in bytes (min: 8, current: 8).
eventType	32u	8	The type of event: 0 – Exposure Begin 1 – Exposure End
length	32u	12	The number of bytes containing additional data.
data[length]	8u	16	Additional data.

Feature Point

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 24.
id	16u	6	Feature Id
Point.x	64s	8	X Coordinate of Point (Scaled by 10 ⁶)
Point.y	64s	16	Y Coordinate of Point (Scaled by 10 ⁶)
Point.z	64s	24	Z Coordinate of Point (Scaled by 10 ⁶)

Feature Line

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 25.
id	16u	6	Feature Id
Point.x	64s	8	X Coordinate of Point (Scaled by 10^6)
Point.y	64s	16	Y Coordinate of Point (Scaled by 10^6)
Point.z	64s	24	Z Coordinate of Point (Scaled by 10^6)
Direction.x	64s	32	X Component of Direction Vector (Scaled by 10^6)
Direction.y	64s	40	Y Component of Direction Vector (Scaled by 10^6)
Direction.z	64s	48	Z Component of Direction Vector (Scaled by 10^6)

Feature Plane

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 26.
id	16u	6	Feature Id
Normal.x	64s	8	X Component of Normal Vector (Scaled by 10^6)
Normal.y	64s	16	Y Component of Normal Vector (Scaled by 10^6)
Normal.z	64s	24	Z Component of Normal Vector (Scaled by 10^6)
originDistance	64s	32	Distance to Origin (Scaled by 10^6)

Feature Circle

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 27.
id	16u	6	Feature Id
Point.x	64s	8	X Coordinate of Point (Scaled by 10^6)
Point.y	64s	16	Y Coordinate of Point (Scaled by 10^6)
Point.z	64s	24	Z Coordinate of Point (Scaled by 10^6)
Normal.x	64s	32	X Component of Normal Vector (Scaled by 10^6)
Normal.y	64s	40	Y Component of Normal Vector (Scaled by 10^6)
Normal.z	64s	48	Z Component of Normal Vector (Scaled by 10^6)
radius	64s	56	Radius of Circle (Scaled by 10^6)

GenericMessage

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. For this message, set to 29.
attributeSize	16u	6	Size of attributes, in bytes (min: 32, current: 40).
streamStep	32s	8	Data stream step.
streamStepId	32s	12	Data stream step ID.
userType	32u	16	User-define data type ID
isObject	8u	20	0 – Content is raw byte buffer 1 – Content is an kObject
contentLength	32u	21	Length of content array, in bytes
Content[contentLength]	byte	25	Content array. If isObject is true, the byte buffer should be deserialized using kDat6Serializer.

Health Results

A client can receive health messages from a Gocator sensor by connecting to the Health TCP channel (port 3194).

The Data channel (port 3196) and the Health channel can be connected at the same time. The sensor accepts multiple connections on each port. For more information on the Data channel, see *Data Results* on page 504.

Messages that are received on the Data and Health channels use a common structure, called Gocator Data Protocol (GDP). Each GDP message consists of a 6-byte header, containing *size* and *control* fields, followed by a variable-length, message-specific content section. The structure of the GDP message is defined below.

Gocator Data Protocol

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last Message flag Bits 0-14: Message type identifier. (See individual data result sections.)

GDP messages are always sent in groups. The Last Message flag in the *control* field is used to indicate the final message in a group. If there is only one message per group, this bit will be set in each message.

A Health Result contains a single data block for health *indicators*. Each indicator reports the current status of some aspect of the sensor system, such as CPU usage or network throughput.

Health Result

Field	Type	Offset	Description
size	32u	0	Count of bytes in message (including this field).
control	16u	4	Bit 15: Last message flag. Bits 0-14: Message type identifier. Always 0.
count (C)	32u	6	Count of indicators in this message.
source	8u	10	Source (0 – Main, 1 – Buddy).
reserved[3]	8u	11	Reserved
indicators[C]	Indicator	14	Array of indicators (see format below).

The indicators block contains a 2-dimensional array of indicator data. Each row in the array has the following format:

Indicator Format

Field	Type	Offset	Description
id	32u	0	Unique indicator identifier (see <i>Indicator identifiers</i> below table below).
instance	32u	4	Indicator instance.
value	64s	8	Value (identifier-specific meaning).

The following health indicators are defined for Gocator sensor systems.



When a sensor is accelerated, some health indicators report values from the *PC* that is accelerating the sensor, or a combination of both. In the table below, values are reported from the sensor unless otherwise indicated.



Undocumented indicators may be included in addition to the indicators defined below.

Indicator identifiers

Indicator	ID	Instance	Value
Encoder Value	1003	-	Current system encoder tick.
Encoder Frequency	1005	-	Current system encoder frequency (ticks/s).
App Version	2000	-	Firmware application version.
Internal Temperature	2002	-	Internal temperature (centidegrees Celsius).
Uptime	2017	-	Time elapsed since node boot-up or reset (seconds).
Projector Temperature	2404	-	Projector module temperature (centidegrees Celsius). Only available on projector based devices.
Control Temperature	2028	-	Control module temperature (centidegrees Celsius). Available only on 3B-class devices.

Indicator	ID	Instance	Value
Memory Usage	2003	-	Amount of memory currently used (bytes).
Memory Capacity	2004	-	Total amount of memory available (bytes).
Storage Usage	2005	-	Amount of non-volatile storage used (bytes).
Storage Capacity	2006	-	Total amount of non-volatile storage available (bytes).
Alignment State	20008	-	Alignment state: 0 – not aligned 1 - aligned
CPU Usage	2007	-	CPU usage (percentage of maximum).
Net Out Capacity	2009	-	Total available outbound network throughput (bytes/s).
Net Out Link Status	2034	-	Current Ethernet link status.
Sync Source*	2043	-	Gocator synchronization source. 1 - FireSync Master device 2 - Sensor
Digital Inputs*	2024	-	Current digital input status (one bit per input).
Event Count	2102	-	Total number of events triggered.
Camera Trigger Drops	2201	-	Number of dropped triggers.
Analog Output Drops	21014 (previously 2501)	Output Index	Number of dropped outputs.
Digital Output Drops	21015 (previously 2601)	Output Index	Number of dropped outputs.
Serial Output Drops	21016 (previously 2701)	Output Index	Number of dropped outputs.
Sensor State*	20000	-	Gocator sensor state. -1 – Conflict 0 – Ready 1 – Running
Current Sensor Speed*	20001	-	Current sensor speed. (Hz)
Maximum Speed*	20002	-	The sensor's maximum speed.
Spot Count*	20003	-	Number of spots found in the last unresampled profile/surface.
Max Spot Count*	20004	-	Maximum number of spots that can be found.
Scan Count*	20005	-	Number of surfaces detected from a top device.

Indicator	ID	Instance	Value
Master Status*	20006	0 for main 1 for buddy	Master connection status: 0 – Not connected 1 – Connected The indicator with instance = buddy does not exist if the buddy is not connected.
Cast Start State*	20007		The state of the second digital input. (NOTE: Only available on XLine capable licensed devices)
Point Count	20015	-	Number of points found in last resampled Profile/Surface.
Max Point Count	20016	-	Maximum number of points that can be found.
Laser Overheat*	20020	-	Indicates whether laser overheat has occurred. 0 – Has not overheated 1 – Has overheated Only available on certain 3B laser devices.
Laser Overheat Duration*	20021	-	The length of time in which the laser overheating state occurred. Only available on certain 3B laser devices.
Playback Position*	20023	-	The current replay playback position.
Playback Count*	20024	-	The number of frames present in the replay.
FireSync Version	20600	-	The FireSync version used by the Gocator build.
Processing Drops**	21000	-	Number of dropped frames. The sum of various processing drop related indicators.
Last Processing Latency	21001	-	Last delay from camera exposure to availability of all results.
Max Processing Latency	21002	-	Maximum value of processing latency.
Ethernet Output	21003	-	Number of bytes transmitted.
Ethernet Rate	21004	-	The average number of bytes per second being transmitted.
Ethernet Drops	21005	-	Number of dropped Ethernet packets.
Digital Output Pass	21006	Output Index	Number of pass digital output pulse.
Digital Output Fail	21007	Output Index	Number of fail digital output pulse.
Trigger Drops**	21010		Number of dropped triggers. The sum of various triggering-related drop indicators.
Output Drops**	21011		Number of dropped output data. The sum of all output drops (analog, digital, serial, host server, and ASCII server).
Controlled Trigger Drops	21017		Trigger drops from the Controlled Triggering System (Grouped with “Trigger Drops” indicator)

Indicator	ID	Instance	Value
Surface Processing Time	21018		Processing Time of Frame on 35XX/32XX (microseconds)
Max Frame Rate	21019		Max Configurable frame rate given above Processing Time (scaled by 1x10-6)
Range Valid Count**	21100	-	Number of valid ranges.
Range Invalid Count**	21101	-	Number of invalid ranges.
Anchor Invalid Count**	21200	-	Number of frames with anchoring invalid.
First Log Id	21301		ID of the first available log entry.
Last Log Id	21300		ID of the last available log entry. It is inclusive: for example, if first = 3 and last = 5, the available log IDs are 3, 4, 5. If no log is available, the last ID is less than the first ID.
Z-Index Drop Count	22000	-	The number of dropped surfaces due to a lack of z-encoder pulse during rotational part detection.
Tool Run Time	22004	Tool Index	The most recent time taken to execute the tool.
Part Total Emitted	22006	-	Total number of parts emitted by profile part detection.
Part Length Limit	22007	-	Number of parts emitted due to reaching the length limit.
Part Min Area Drops	22008	-	Number of parts dropped due to being smaller than the minimum area.
Part Backtrack Drops	22009	-	Number of parts dropped due to backtracking.
Parts Currently Active	22010	-	Number of parts currently being tracked.
Part Length	22011	-	Length of largest active part.
Part Start Y	22012	-	Start Y position of the largest active part.
Part Tracking State	22013	-	Tracking state of the largest active part.
Part Capacity Exceeded	22014	-	Part detection part or run capacity has been exceeded.
Part X Position	22015	-	Center X position of the largest active part.
Tool Runtime Minimum	22016	-	Minimum time spent for tool to process a sample
Tool Runtime Maximum	22017	-	Maximum time spent for tool to process a sample
Tool Runtime Average	22018	-	Average time for tool to process a sample
Tool Runtime Percent Average	22019	-	Average percentage of total time spent running this tool
Value	30000	Measurement ID	Measurement Value.
Pass	30001	Measurement ID	Number of pass decision.
Fail	30002	Measurement ID	Number of fail decision.
Min	30003	Measurement ID	Minimum measurement value.

Indicator	ID	Instance	Value
Max	30004	Measurement ID	Maximum measurement value.
Average	30005	Measurement ID	Average measurement value.
Std. Dev.	30006	Measurement ID	Measurement value standard deviation.
Invalid Count	30007	Measurement ID	Number of invalid values.
Overflow	30008	Measurement ID	Number of times this measurement has overflowed on any output. Multiple simultaneous overflows result in only a single increment to this counter. Overflow conditions include: -Value exceeds bit representation available for given protocol -Analog output (mA) falls outside of acceptable range (0-20 mA) When a measurement value overflow occurs, the value is set to the null value appropriate for the given protocol's measurement value output type. The Overflow health indicator increments.

* When the sensor is accelerated, the indicator's value is reported from the accelerating PC.

** When the sensor is accelerated, the indicator's value is the sum of the values reported from the sensor and the accelerating PC.

Modbus Protocol

Modbus is designed to allow industrial equipment such as Programmable Logic Controllers (PLCs), sensors, and physical input/output devices to communicate over an Ethernet network.

Modbus embeds a Modbus frame into a TCP frame in a simple manner. This is a connection-oriented transaction, and every query expects a response.

This section describes the Modbus TCP commands and data formats. Modbus TCP communication lets the client:

- Switch jobs.
- Align and run sensors.
- Receive measurement results, sensor states, and stamps.

To use the Modbus protocol, it must be enabled and configured in the active job. For information on configuring the protocol using the Web interface, see *Ethernet Output* on page 331.



The Gocator 4.x firmware uses mm, mm², mm³, and degrees as standard units. In all protocols, values are scaled by 1000, as values in the protocols are represented as integers. This results in effective units of mm/1000, mm²/1000, mm³/1000, and deg/1000 in the protocols.

If buffering is enabled with the Modbus protocol, the PLC must read the Buffer Advance output register (see *State* on page 524) to advance the queue before reading the measurement results.


Concepts

A PLC sends a command to start each Gocator. The PLC then periodically queries each Gocator for its latest measurement results. In Modbus terminology, the PLC is a Modbus Client. Each Gocator is a Modbus Server which serves the results to the PLC.

The Modbus protocol uses TCP for connection and messaging. The PLC makes a TCP connection to the Gocator on port 502. Control and data messages are communicated on this TCP connection. Up to eight clients can be connected to the Gocator simultaneously. A connection closes after 10 minutes of inactivity.

Messages

All Modbus TCP messages consist of an MBAP header (Modbus Application Protocol), a function code, and a data payload.

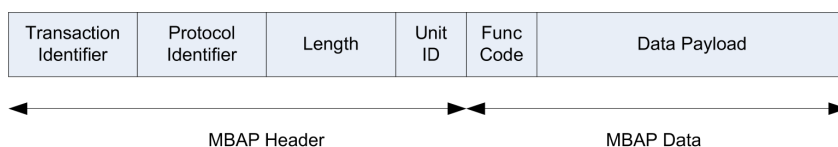

The MBAP header contains the following fields:

Modbus Application Protocol Header

Field	Length (Bytes)	Description
Transaction ID	2	Used for transaction pairing. The Modbus Client sets the value and the Server (Gocator) copies the value into its responses.
Protocol ID	2	Always set to 0.
Length	2	Byte count of the rest of the message, including the Unit identifier and data fields.
Unit ID	1	Used for intra-system routing purpose. The Modbus Client sets the value and the Server (Gocator) copies the value into its responses.

Modbus Application Protocol Specification describes the standard function codes in detail. Gocator supports the following function codes:

Modbus Function Code

Function Code	Name	Data Size (bits)	Description
3	Read Holding Registers	16	Read multiple data values from the sensor.
4	Read Input Registers	16	Read multiple data values from the sensor.
6	Write Single Register	16	Send a command or parameter to the sensor.
16	Write Multiple Registers	16	Send a command and parameters to the sensor.

The data payload contains the registers that can be accessed by Modbus TCP messages. If a message accesses registers that are invalid, a reply with an exception is returned. Modbus Application Protocol Specification defines the exceptions and describes the data payload format for each function code.

The Gocator data includes 16-bit, 32-bit, and 64-bit data. All data are sent in big endian format, with the 32-bit and 64-bit data spread out into two and four consecutive registers.

32-bit Data Format

Register	Name	Bit Position
0	32-bit Word 1	31 .. 16
1	32-bit Word 0	15 .. 0

64-bit Data Format

Register	Name	Bit Position
0	64-bit Word 3	63 .. 48
1	64-bit Word 2	47 .. 32
2	64-bit Word 1	31 .. 16
3	64-bit Word 0	15 .. 0

Registers

Modbus registers are 16 bits wide and are either control registers or output registers.

Control registers are used to control the sensor states (e.g., start, stop, or calibrate a sensor).

The output registers report the sensor states, stamps, and measurement values and decisions. You can read multiple output registers using a single Read Holding Registers or a single Read Input Registers command. Likewise, you can control the state of the sensor using a single Write Multiple Register command.

Control registers are write-only, and output registers are read-only.

Register Map Overview

Register Address	Name	Read/Write	Description
0 - 124	Control Registers	WO	Registers for Modbus commands. See <i>Control Registers</i> below for detailed descriptions.
300 - 899	Sensor States	RO	Report sensor states. See <i>State</i> on the next page for detailed descriptions.
900 - 999	Stamps	RO	Return stamps associated with each surface. See <i>State</i> on the next page for detailed descriptions.
1000 - 1059	Measurements & Decisions	RO	20 measurement and decision pairs. See <i>Measurement Registers</i> on page 526 for detailed descriptions.

Control Registers

Control registers are used to operate the sensor. Register 0 stores the command to be executed. Subsequent registers contain parameters for the commands if applicable. The Gocator executes a command when the value in register 0 is changed. To set the parameters before a command is executed, you should set up the parameters and the command using a single Multiple Write register command.

Control Register Map

Register Address	Name	Read/Write	Description
0	Command Register	WO	Takes a 16-bit command. For a list of the available commands, see table below.
1 - 64	Command Parameters	WO	For Load Job (5) command: Null-terminated filename. Each 16-bit register holds a single character. Specifies the filename. If the file extension ".job" is missing, it is automatically appended to the filename. For Set Runtime Variables (6) command: Registers 1-8 are used to set the values of the runtime variables.

The 16-bit values used for Command Register are described below.

Command Register Values

Value	Name	Description
0	Stop Running	Stops the sensor. No effect if sensor is already stopped.
1	Start Running	Starts the sensor. No effect if sensor is already started.
2	Align (stationary target)	Starts the stationary alignment process. State register 301 will be set to 1 (busy). When the alignment process is complete, the register is set back to zero.
3	Align (moving target)	Starts moving alignment process and also calibrate encoder resolution. State register 301 will be set to 1 (busy). When the alignment process is complete, the register is set back to zero.
4	Clear Alignment	Clears the alignment.
5	Load Job	Activates the specified job file. Set registers 1-64 to the null-terminated filename, one filename character per 16-bit register, including the null terminator character. The ".job" extension is optional; if it is missing, it is automatically appended to the file name.
6	Set Runtime Variables	Sets the runtime variables. Set registers 1 through 8 to the values of all four 32-bit runtime variables.

Output Registers

Output registers are used to output states, stamps, and measurement results. Each register address holds a 16-bit data value.

State

State registers report the current sensor state.

State Register Map

Register Address	Name	Type	Description
300	Sensor State	16u	Sensor State: 0 - Stopped 1 - Running
301	Modbus Command in Progress	16u	1 when the sensor is busy performing the last command, 0 when done. Registers 302 and 311-371 below are only valid when there is no command in progress.
302	Alignment State	16u	Current Alignment State: 0 - Not aligned 1 - Aligned (Valid when register 301 = 0.)
303 – 306	Encoder Value	64u	Current Encoder value (ticks).

Register Address	Name	Type	Description
307 – 310	Time	64s	Current time (μs).
311	Job File Name Length	16u	Number of characters in the current job file name. (Valid when register 301 = 0.)
312 – 371	Live Job Name	16u	Name of currently loaded job file. Does not include the extension. Each 16-bit register contains a single character. (Valid when register 301 = 0.)
375	Runtime Variable 0 High	32s	Runtime variable value stored in two register locations.
376	Runtime Variable 0 Low		
...	...	...	...
381	Runtime Variable 3 High	32s	Runtime variable value stored in two register locations.
382	Runtime Variable 3 Low		

Stamp

Stamps contain trigger timing information used for synchronizing a PLC's actions. A PLC can also use this information to match up data from multiple Gocator sensors.

In Surface mode, the stamps are updated after each surface has been processed.

Stamp Register Map

Register Address	Name	Type	Description
960-975	reserved		Not used.
976	Buffer Advance		If buffering is enabled, this address must be read by the PLC Modbus client first to advance the buffer. After the buffer advance read operation, the Modbus client can read the updated Measurements & Decisions in addresses 1000-1059.
977	Buffer Counter	16u	Number of buffered messages currently in the queue.
978	Buffer Overflow Flag	16u	Buffer Overflow Indicator: 0 - No overflow 1 - Overflow. (Indicates data is being lost.)
979	Inputs	16u	Digital input state.
980	zPosition High	64u	Encoder value when the index is last triggered.
981	zPosition		
982	zPosition		
983	zPosition Low		
984	Exposure High	32u	Exposure (μs).

Register Address	Name	Type	Description
985	Exposure Low		
986	Temperature High	32u	Sensor temperature in degrees Celcius * 100 (centidegrees).
987	Temperature Low		
988	Position High	64u	Encoder position
989	Position		
990	Position		
991	Position Low		
992	Time Low	64u	Timestamp (µs).
993	Time		
994	Time		
995	Time Low		
996	Frame Index High	64u	Frame counter. Each new sample is assigned a frame number.
997	Frame Index		
998	Frame Index		
999	Fame Index Low		

Measurement Registers

Measurement results are reported in pairs of values and decisions. Measurement values are 32 bits wide and decisions are 8 bits wide.

The measurement ID is used to find the register address of each pair. The register address of the first word can be calculated as $(1000 + 3 * ID)$. For example, a measurement with ID set to 4 can be read from registers 1012 (high word) and 1013 (low word), and the decision at 1015.

In Surface mode, the measurement results are updated after each discrete part has been processed.

Measurement Register Map

Register Address	Name	Type	Description
1000	Measurement 0 High	32u	Measurement value in µm (0x80000000 if invalid)
1001	Measurement 0 Low		
1002	Decision 0	16u	Measurement decision. A bit mask, where: Bit 0: 1 - Pass 0 - Fail Bits 1-7:

Register Address	Name	Type	Description
			0 - Measurement value OK 1 - Invalid value 2 - Invalid anchor
1003	Measurement 1 High		
1004	Measurement 1 Low		
1005	Decision 1		
1006	Measurement 2 High		
1007	Measurement 2 Low		
1008	Decision 2		
...	...	...	...
1996	Measurement 332 High		
1997	Measurement 332 Low		
1998	Decision 332		

EtherNet/IP Protocol

EtherNet/IP is an industrial protocol that allows bidirectional data transfer with PLCs. It encapsulates the object-oriented Common Industrial Protocol (CIP).

This section describes the EtherNet/IP messages and data formats. EtherNet/IP communication enables the client to:

- Switch jobs.
- Align and run sensors.
- Receive sensor states, stamps, and measurement results.
- Set and retrieve runtime variables.

To use the EtherNet/IP protocol, it must be enabled and configured in the active job. For information on configuring the protocol using the Web interface, see *Ethernet Output* on page 331.



The Gocator 4.x firmware uses mm, mm², mm³, and degrees as standard units. In all protocols, values are scaled by 1000, as values in the protocols are represented as integers. This results in effective units of mm/1000, mm²/1000, mm³/1000, and deg/1000 in the protocols.

Gocator supports unconnected or connected explicit messaging (with TCP), as well as implicit (or I/O) messaging. For information on explicit messaging assemblies and objects, see *Explicit Messaging* below. For information on implicit messaging assemblies and objects, see *Implicit Messaging* on page 534.

Explicit Messaging

To EtherNet/IP-enabled devices on the network, the sensor information is seen as a collection of objects, which have attributes that can be queried.

Gocator supports all required objects for explicit messaging, such as the [Identity](#) object, [TCP/IP](#) object, and [Ethernet Link](#) object. In addition, an [Assembly object](#) is used for sending sensor and sample data and receiving commands. The Assembly object contains four assemblies: the command assembly (32 bytes), the runtime variable configuration assembly (64 bytes), the sensor state assembly (100 bytes), and the sample state assembly object (380 bytes). The data attribute (0x03) of the assembly objects is a byte array containing information about the sensor. The data attribute can be accessed with the Get Attribute and Set Attribute commands.

The PLC sends a command to start a Gocator. The PLC then periodically queries the attributes of the assembly objects for its latest measurement results. In EtherNet/IP terminology, the PLC is a scanner and the Gocator is an adapter.

For detailed information on setting up explicit messaging using Allen-Bradley PLCs, see http://lmi3d.com/sites/default/files/APPNOTE_Implicit_Messaging_with_Allen-Bradley_PLCs.pdf.

The following sections describe the explicit messaging assemblies and objects.

Identity Object (Class 0x01)

Attribute	Name	Type	Value	Description	Access
1	Vendor ID	UINT	1256	ODVA-provided vendor ID	Get
2	Device Type	UINT	43	Device type	Get
3	Product Code	UINT	2000	Product code	Get
4	Revision	USINT	x.x	Byte 0 - Major revision	Get
		USINT		Byte 1 - Minor revision	
6	Serial number	UDINT	32-bit value	Sensor serial number	Get
7	Product Name	SHORT STRING	"Gocator"	Gocator product name	Get
		32			

TCP/IP Object (Class 0xF5)

The TCP/IP Object contains read-only network configuration attributes such as IP Address. TCP/IP configuration via Ethernet/IP is not supported. See Volume 2, Chapter 5-3 of the CIP Specification for a complete listing of TCP/IP object attributes.

Attribute	Name	Type	Value	Description	Access
1	Status	UDINT	0	TCP interface status	Get
2	Configuration Capability	UINT	0		Get
3	Configuration Control	UINT	0	Product code	Get
4	Physical Link Object	Structure (See description)		See 5.3.3.2.4 of CIP Specification Volume 2: Path size (UINT) Path (Padded EPATH)	Get
5	Interface Configuration	Structure (See description)		See 5.3.3.2.5 of CIP Specification Volume 2: IP address (UDINT) Network mask (UDINT) Gateway address (UDINT) Name server (UDINT) Secondary name (UDINT) Domain name (UDINT)	Get

Ethernet Link Object (Class 0xF6)

The Ethernet Link Object contains read-only attributes such as MAC Address (Attribute 3). See Volume 2, Chapter 5-4 of the CIP Specification for a complete listing of Ethernet Link object attributes.

Attribute	Name	Type	Value	Description	Access
1	Interface Speed	UDINT	1000	Ethernet interface data rate (mbps)	Get

Attribute	Name	Type	Value	Description	Access
2	Interface Flags	UDINT		See 5.4.3.2.1 of CIP Specification Volume 2: Bit 0: Link Status 0 – Inactive 1 – Active Bit 1: Duplex 0 – Half Duplex 1 – Full Duplex	Get
3	Physical Address	Array of 6 USINTs		MAC address (for example: 00 16 20 00 2E 42)	Get

Assembly Object (Class 0x04)

For explicit messaging, the Gocator Ethernet/IP object model includes the following assemblies: command, runtime variable configuration, sensor state, and sample state.

All assembly object instances are static. Data in a data byte array in an assembly object are stored in the big endian format.

Command Assembly

The command assembly object is used to start, stop, and align the sensor, and also to switch jobs on the sensor.

Command Assembly

Information	Value
Class	0x4
Instance	0x310
Attribute Number	3
Length	32 bytes
Supported Service	0x10 (SetAttributeSingle)

Attributes 1 and 2 are not implemented, as they are not required for the static assembly object.

Attribute 3

Attribute	Name	Type	Value	Description	Access
3	Command	Byte Array	See Below	Command parameters Byte 0 - Command. See table below for specification of the values.	Get, Set

Command Definitions

Value	Name	Description
0	Stop running	Stop the sensor. No action if the sensor is already stopped
1	Start Running	Start the sensor. No action if the sensor is already started.
2	Stationary Alignment	Start the stationary alignment process. Byte 1 of the sensor state assembly will be set to 1 (busy) until the alignment process is complete, then back to

Value	Name	Description
		zero.
4	Clear Alignment	Clear the alignment.
5	Load Job	Load the job. Set bytes 1-31 to the file name (one character per byte. File name must be null-terminated. The job name and extension are case-sensitive. If the extension “.job” is missing, it is automatically appended to the file name.

Runtime Variable Configuration Assembly

The runtime variable configuration assembly object contains the sensor's intended runtime variables.

Runtime Variable Configuration Assembly

Information	Value
Class	0x04
Instance	0x311
Attribute Number	3
Length	64 bytes
Supported Service	0x10 (SetAttributeSingle)

Attribute 3

Attribute	Name	Type	Value	Description	Access
3	Command	Byte Array	See below	Runtime variable configuration information. See below for more details.	Get

Sensor State Information

Byte	Name	Type	Description
0-3	Runtime Variable 0	32s	Stores the intended value of the Runtime Variable at index 0.
4-7	Runtime Variable 1	32s	Stores the intended value of the Runtime Variable at index 1.
8-11	Runtime Variable 2	32s	Stores the intended value of the Runtime Variable at index 2.
12-15	Runtime Variable 3	32s	Stores the intended value of the Runtime Variable at index 3.
16-63	Reserved		

Sensor State Assembly

The sensor state assembly object contains the sensor's states, such as the current sensor temperature, frame count, and encoder values.

Sensor State Assembly

Information	Value
Class	0x04
Instance	0x320
Attribute Number	3
Length	100 bytes
Supported Service	0x0E (GetAttributeSingle)

Attributes 1 and 2 are not implemented, as they are not required for the static assembly object.

Attribute 3

Attribute	Name	Type	Value	Description	Access
3	Command	Byte Array	See below	Sensor state information. See below for more details.	Get

Sensor State Information

Byte	Name	Type	Description
0	Sensor State		Sensor state: 0 - Stopped 1 - Running
1	EtherNet/IP Command in Progress		Command busy status: 0 - Not busy 1 - Busy performing the last command Bytes 2 and 19-83 below are only valid when there is no command in progress.
2	Alignment State		Alignment status: 0 - Not aligned 1 - Aligned The value is only valid when byte1 is set to 0.
3-10	Encoder	64s	Current encoder position
11-18	Time	64s	Current timestamp
19	Current Job Filename Length	8u	Number of characters in the current job filename. (e.g., 11 for "current.job"). The length includes the .job extension. Valid when byte 1 = 0.
20-83	Current Job Filename		Name of currently loaded job, including the ".job" extension. Each byte contains a single character. Valid when byte 1 = 0.
84-87	Runtime Variable 0	32s	Runtime variable value at index 0
...	...		
96-99	Runtime Variable 3	32s	Runtime variable value at index 3

Sample State Assembly

The sample state object contains measurements and their associated stamp information.

Sample State Assembly

Information	Value
Class	0x04
Instance	0x321
Attribute Number	3
Length	380 bytes
Supported Service	0x0E (GetAttributeSingle)

Attribute 3

Attribute	Name	Type	Value	Description	Access
3	Command	Byte Array	See below	Sample state information. See below for more details.	Get

Sample State Information

Byte	Name	Type	Description
0-1	Inputs	16u	Digital input state.
2-9	Z Index Position	64u	Encoder position at time of last index pulse.
14-17	Temperature	32u	Sensor temperature in degrees Celsius * 100 (centidegrees).
18-25	Position	64u	Encoder position.
26-33	Time	64u	Time.
34-41	Frame Counter	64u	Frame counter.
42	Buffer Counter	8u	Number of buffered messages currently in the queue.
43	Buffer Overflowing	8u	Buffer overflow indicator: 0 - No overflow 1 - Overflow
44 - 79	Reserved		Reserved bytes.
80-83	Measurement 0	32s	Measurement value in μm (0x80000000 if invalid).
84	Decision 0	8u	Measurement decision. A bit mask, where: Bit 0: 1 - Pass 0 - Fail Bits 1-7: 0 - Measurement value OK 1 - Invalid value

Byte	Name	Type	Description
			2 - Invalid anchor
...	...		
375-378	Measurement 59	32s	Measurement value in μm (0x80000000 if invalid).
379	Decision 59	8u	Measurement decision. A bit mask, where: Bit 0: 1 - Pass 0 - Fail Bits 1-7: 0 - Measurement value OK 1 = Invalid value 2 = Invalid anchor

Measurement results are reported in pairs of values and decisions. Measurement values are 32 bits wide and decisions are 8 bits wide.

The measurement ID defines the byte position of each pair within the state information. The position of the first word can be calculated as $(80 + 5 * \text{ID})$. For example, a measurement with ID set to 4 can be read from byte 100 (high word) to 103 (low word) and the decision at 104.

In Surface mode, the measurement results are updated after each discrete part has been processed. If buffering is enabled in the Ethernet Output panel, reading the Extended Sample State Assembly Object automatically advances the buffer. See *Ethernet Output* on page 331 for information on the **Output** panel.

Implicit Messaging

Implicit messaging uses UDP and is faster than explicit messaging, and is ideal for time-critical applications. However, implicit messaging is layered on top of UDP. UDP is connectionless and data delivery is not guaranteed. For this reason, implicit messaging is only suitable for applications where occasional data loss is acceptable.

For detailed information on setting up implicit messaging using Allen-Bradley PLCs, see http://lmi3d.com/sites/default/files/APPNOTE_Implicit_Messaging_with_Allen-Bradley_PLCs.pdf.

The following sections describe the implicit messaging assemblies.

Assembly Object (Class 0x04)

For implicit messaging, the Gocator Ethernet/IP object model includes the following assemblies: implicit messaging command and implicit messaging output.

All assembly object instances are static. Data in a data byte array in an assembly object are stored in the big endian format.

Implicit Messaging Command Assembly

Implicit Messaging Command Assembly

Information	Value
Class	0x04
Instance	0x64
Attribute Number	3
Length	32 bytes

Implicit Messaging Command Assembly Information

Byte	Name	Type	Description
0	Command	8u	A bit mask where setting the following bits will only perform the action with highest priority*: 1 – Stop sensor 2 – Start sensor 4 – Perform stationary alignment 8 – Perform moving alignment 16 – Clear alignment 32 – Set runtime variables 64 – Load job file *The priority of commands is currently as follows: 1. Stop sensor 2. Start sensor 3. Perform stationary alignment 4. Perform moving alignment 5. Clear alignment 6. Set runtime variables 7. Load job file
1-31	Reserved (except for configuring runtime variables and loading job file)		If you are setting the runtime variables, use bytes 4-19 to define the values of each of the four runtime variables in little endian format. If you are loading job file, use bytes 1-31 for the filename, one character per byte. The job name and extension are case-sensitive. The filename must be null terminated and must end with ".job".

Implicit Messaging Output Assembly

Implicit Messaging Output Assembly

Information	Value
Class	0x04
Instance	0x322
Attribute Number	3
Length	376 bytes

Implicit Messaging Output Assembly Information

Byte	Name	Type	Description
0	Sensor State	8u	Sensor state is a bit mask where: Bit 0: 1 – Running 0 – Stopped Bits [1-7]: 0 – No state issue Non-zero – Conflict
1	Alignment and Command state	8u	A bit mask where: Bit 0: 1 – Explicit or Implicit Command in progress 0 – No Explicit or Implicit command is in progress Bit 1 1 – Aligned 0 – Not aligned
2-3	Inputs	16u	Digital input state
4-11	Z Index Position	64u	Encoder position at time of last index pulse
12-15	Exposure	32u	Exposure in μ s.
16-19	Temperature	32u	Sensor temperature in degrees celsius * 100 (centidegrees)
20-27	Encoder Position	64s	Encoder position
28-35	Time	64u	Time
36-43	Scan Count	64u	Represents the number of scans
44-55	Reserved		
56	Decision 0	8u	Measurement decision is a bit mask where: Bit 0: 1 – Pass 0 – Fail Bits [1-7]:

Byte	Name	Type	Description
			0 – Measurement value OK 1 – Invalid Value 2 – Invalid Anchor
...	...		
119	Decision 63	8u	Measurement decision is a bit mask where: Bit 0: 1 – Pass 0 – Fail Bits [1-7]: 0 – Measurement value OK 1 – Invalid Value 2 – Invalid Anchor
120-123	Measurement 0	32s	Measurement value in μm . (0x80000000 if invalid)
...	...		
372-375	Measurement 63	32s	Measurement value in μm . (0x80000000 if invalid)

PROFINET Protocol

PROFINET is an Industrial Ethernet network protocol that allows controllers such as PLCs to communicate with Gocator sensors. Gocator sensors are PROFINET IO devices with Conformance Class A.

 The Gocator emulator and accelerator do not support the PROFINET protocol.

This section describes the PROFINET modules that let a controller do the following:

- Switch jobs.
- Align and run sensors.
- Receive sensor states, stamps, and measurement results.
- Set and retrieve runtime variables.

To use the PROFINET protocol, it must be enabled and configured in the active job. For information on configuring the protocol using the Web interface, see *Ethernet Output* on page 331.

 The Gocator 4.x firmware uses mm, mm², mm³, and degrees as standard units. In all protocols, values are scaled by 1000, as values in the protocols are represented as integers. This results in effective units of mm/1000, mm²/1000, mm³/1000, and deg/1000 in the protocols.

Control Module

The client sends the Control module to the sensor. The length of the Control module is 256 bytes. Unused space is for future expansion.

Control Module Elements

Byte Index	Type	Description
0	Command Register	Takes a 8-bit command as given in the table below.
1-64	Command Parameters. (Job filename in the case of command 5)	For command 5, these registers contains the null terminated job file name. The “.job” extension is required.

Command Definitions

Value	Name	Description
0	Stop running	Stop the sensor. If already stopped, do nothing
1	Start Running	Start the sensor. If already running, do nothing
2	Stationary Alignment	Start the stationary alignment process. State register 301 will be set to 1 (busy) until the alignment process is complete, then back to zero.
3	Moving Alignment	Start the moving alignment process. State register 301 will be set to 1 (busy) until the alignment process is complete, then back to zero.
4	Clear Alignment	Clear the alignment
5	Load Job	Set bytes 1 - 64 for the null terminated file name, one file name character per 16-bit register, including the null terminator character. The “.job”

Value	Name	Description
		extension is required.
6	Set Runtime Variables	The runtime variables are expected to be sent in the Runtime Variables module. The runtime variables are not included as part of the Control module.

Runtime Variables Module

The length of the Runtime Variables module is 16 bytes. The client sends the variables to the sensor in big endian format.

Byte Index	Name	Data Type	Description
0-3	Runtime Variable 0	32s	Stores the intended value of the Runtime Variable at index 0.
4-7	Runtime Variable 1	32s	Stores the intended value of the Runtime Variable at index 1.
8-11	Runtime Variable 2	32s	Stores the intended value of the Runtime Variable at index 2.
12-15	Runtime Variable 3	32s	Stores the intended value of the Runtime Variable at index 3.

State Module

The length of the State module is 116 bytes. The sensor sends the module to the client. The runtime variables are received from the sensor in big endian format. The extra unused space is for future expansion.

Byte Index	Name	Data Type	Description
0	Sensor state		0= stopped, 1 = running
1	Command in progress		1 when the sensor is busy performing the last command, 0 when done. Bytes 2, 19->83 below are only valid when there is no command in progress
2	Alignment State		0 - not calibrated, 1 calibrated (valid when byte 1 = 0)
3-10	Encoder Position	64s	Encoder position
11-18	Time	64s	Timestamp
19	Current Job filename length	8u	Number of characters in the current job filename. (eg. 11 for "current.job") (valid when byte 1 = 0)
20-83	Current job filename		Name of currently loaded job, including extension. Each byte contains a single character. Max 64 bytes. (valid when byte 1 = 0)

Byte Index	Name	Data Type	Description
84-87	Runtime Variable 0	32s	Runtime variable value at index 0
...	...		
96-99	Runtime Variable 3	32s	Runtime variable value at index 3

Stamp Module

The length of the Stamp module is 45 bytes. The sensor sends the module to the client. The extra unused space is for future expansion.

Byte Index	Name	Data Type	Description
0-1	Inputs	16u	
2-9	zPosition	64u	Encoder position at time of last index pulse
10-13	Exposure	32u	Laser exposure in us
14-17	Temperature	32u	Sensor temperature in degrees celsius * 100 (centidegrees)
18-25	Position	64u	Encoder position
26-33	Time	64u	Timestamp
34-41	Frame Count	64u	Each new sample is assigned a frame number

Measurements Module

The length of the Measurement module is 800 bytes. The sensor sends the module to the client. The measurements and decisions are sent in big endian format only. Each measurement plus decision takes 5 bytes so this module can hold a maximum of $800/5 = 160$ measurements + decisions.

Byte Index	Name	Data Type	Description
0-3	Measurement 0	32s	measurement value (0x80000000 if invalid)
4	Decision 0	8u	Measurement decision is a bit mask where: Bit 0: 1 – Pass, 0 – Fail Bits [1-7]: 0 – Measurement value OK 1 – Invalid Value 2 – Invalid Anchor
5-8	Measurement 1		

Byte Index	Name	Data Type	Description
9	Decision 1		
...	...		
795-798	Measurement 159		
799	Decision 159		



The byte mapping of each measurement/decision pair depends on its ID as specified in the Gocator measurement interface. Each measurement will begin at byte $(0 + 5 \times \text{ID})$. For example, a measurement with ID set to 4 can be read from bytes 20 (high byte) to 23 (low byte) and the decision at 24.

ASCII Protocol

This section describes the ASCII protocol.

The ASCII protocol is available over either serial output or Ethernet output. Over serial output, communication is asynchronous (measurement results are automatically sent on the Data channel when the sensor is in the running state and results become available). Over Ethernet, communication can be asynchronous or can use polling. For more information on polling commands, see *Polling Operation Commands (Ethernet Only)* on the next page.

The protocol communicates using ASCII strings. The output result format from the sensor is user-configurable.

To use the ASCII protocol, it must be enabled and configured in the active job.



The Gocator 4.x firmware uses mm, mm², mm³, and degrees as standard units. In all protocols, values are scaled by 1000, as values in the protocols are represented as integers. This results in effective units of mm/1000, mm²/1000, mm³/1000, and deg/1000 in the protocols.

For information on configuring the protocol with the Web interface (when using the protocol over Ethernet), see *Ethernet Output* on page 331.

For information on configuring the protocol with the Web interface (when using the protocol over Serial), see *Serial Output* on page 340.

Connection Settings

Ethernet Communication

With Ethernet ASCII output, you can set the connection port numbers of the three channels used for communication (Control, Data, and Health):

Ethernet Ports for ASCII

Name	Description	Default Port
Control	To send commands to control the	8190

Name	Description	Default Port
	sensor.	
Data	To retrieve measurement output.	8190
Health	To retrieve specific health indicator values.	8190

Channels can share the same port or operate on individual ports. The following port numbers are reserved for Gocator internal use: 2016, 2017, 2018, and 2019. Each port can accept multiple connections, up to a total of 16 connections for all ports.

Serial Communication

Over serial, Gocator ASCII communication uses the following connection settings:

Serial Connection Settings for ASCII

Parameter	Value
Start Bits	1
Stop Bits	1
Parity	None
Data Bits	8
Baud Rate (b/s)	115200
Format	ASCII
Delimiter	CR

Up to 16 users can connect to the sensor for ASCII interfacing at a time. Any additional connections will remove the oldest connected user.

Polling Operation Commands (Ethernet Only)

On the Ethernet output, the Data channel can operate asynchronously or by polling.

Under asynchronous operation, measurement results are automatically sent on the Data channel when the sensor is in the running state and results become available. The result is sent on all connected data channels.

Under polling operation, a client can:

- Switch to a different job.
- Align, run, and trigger sensors.
- Receive sensor states, health indicators, stamps, and measurement results

Gocator sends Control, Data, and Health messages over separate channels. The Control channel is used for commands such as starting and stopping the sensor, loading jobs, and performing alignment (see *Command Channel* on the next page).

The Data channel is used to receive and poll for measurement results. When the sensor receives a [Result](#) command, it will send the latest measurement results on the same data channel that the request is received on. See *Data Channel* on page 547 for more information.

The Health channel is used to receive health indicators (see *Health Channel* on page 549).

Command and Reply Format

Commands are sent from the client to the Gocator. Command strings are not case sensitive. The command format is:

<COMMAND><DELIMITER><PARAMETER><TERMINATION>

If a command has more than one parameter, each parameter is separated by the delimiter. Similarly, the reply has the following format:

<STATUS><DELIMITER><OPTIONAL RESULTS><DELIMITER>

The status can either be "OK" or "ERROR". The optional results can be relevant data for the command if successful, or a text based error message if the operation failed. If there is more than one data item, each item is separated by the delimiter.

The delimiter and termination characters are configured in the Special Character settings.

Special Characters

The ASCII Protocol has three special characters.

Special Characters

Special Character	Explanation
Delimiter	Separates input arguments in commands and replies, or data items in results. Default value is ",".
Terminator	Terminates both commands and result output. Default value is "%r%n".
Invalid	Represents invalid measurement results. Default value is "INVALID"

The values of the special characters are defined in the Special Character settings. In addition to normal ASCII characters, the special characters can also contain the following format values.

Format values for Special Characters

Format Value	Explanation
%t	Tab
%n	New line
%r	Carriage return
%%	Percentage (%) symbol

Command Channel

The following sections list the actions available on the command channel.

Optional parameters are shown in *italic*. The placeholder for data is surrounded by brackets (<>). In the examples, the delimiter is set to ','.

Start

The Start command starts the sensor system (causes it to enter the Running state). This command is only valid when the system is in the Ready state. If a start target is specified, the sensor starts at the target time or encoder (depending on the trigger mode).

Formats

Message	Format
Command	Start,start target
	The start target (optional) is the time or encoder position at which the sensor will be started. The time and encoder target value should be set by adding a delay to the time or encoder position returned by the Stamp command. The delay should be set such that it covers the command response time of the Start command.
Reply	OK or ERROR, <Error Message>

Examples:

```
Command: Start
Reply: OK
Command: Start,1000000
Reply: OK
Command: Start
Reply: ERROR, Could not start the sensor
```

Stop

The stop command stops the sensor system (causes it to enter the Ready state). This command is valid when the system is in the Ready or Running state.

Formats

Message	Format
Command	Stop
Reply	OK or ERROR, <Error Message>

Examples:

```
Command: Stop
Reply: OK
```

Trigger

The Trigger command triggers a single frame capture. This command is only valid if the sensor is configured in the Software trigger mode and the sensor is in the Running state.

Formats

Message	Format
Command	Trigger
Reply	OK or ERROR, <Error Message>

Examples:

Command: Trigger

Reply: OK

LoadJob

The Load Job command switches the active sensor configuration.

Formats

Message	Format
Command	LoadJob,job file name If the job file name is not specified, the command returns the current job name. An error message is generated if no job is loaded. ".job" is appended if the filename does not have an extension.
Reply	OK or ERROR, <Error Message>

Examples:

Command: LoadJob,test.job

Reply: OK,test.job loaded successfully

Command: LoadJob

Reply: OK,test.job

Command: LoadJob,wrongname.job

Reply: ERROR, failed to load wrongname.job

Stamp

The Stamp command retrieves the current time, encoder, and/or the last frame count.

Formats

Message	Format
Command	Stamp,time,encoder,frame If no parameters are given, time, encoder, and frame will be returned. There could be more than one selection.
Reply	If no arguments are specified: OK, time, <time value>, encoder, <encoder position>, frame, <frame count> ERROR, <Error Message> If arguments are specified, only the selected stamps will be returned.

Examples:

Command: Stamp

Reply: OK,Time,9226989840,Encoder,0,Frame,6

Command: Stamp, frame

Reply: OK, 6

Clear Alignment

The Clear Alignment command clears the alignment record generated by the alignment process.

Formats

Message	Format
Command	ClearAlignment
Reply	OK or ERROR, <Error Message>

Examples:

Command: ClearAlignment

Reply: OK

Stationary Alignment

The Stationary Alignment command performs an alignment based on the settings in the sensor's live job file. A reply to the command is sent when the alignment has completed or failed. The command is timed out if there has been no progress after one minute.

Formats

Message	Format
Command	StationaryAlignment
Reply	If no arguments are specified OK or ERROR, <Error Message>

Examples:

Command: StationaryAlignment

Reply: OK

Command: StationaryAlignment

Reply: ERROR, ALIGNMENT FAILED

Set Runtime Variables

The Set Runtime Variables command sets the runtime variables, using the specified index, length, and data. Values are integers.

Formats

Message	Format
Command	setvars, index, length, data
	Where <i>data</i> is the delimited integer values to be set.
Reply	OK or ERROR

Examples:

Command: `setvars,0,4,1,2,3,4`

Reply: `OK`

Get Runtime Variables

The Get Runtime Variables command gets the runtime variables, using the specified index and length.

Formats

Message	Format
Command	<code>setvars,index,length</code>
Reply	<code>OK,data</code>

Where *data* is the delimited data for the passed length.

Examples:

Command: `getvars,0,4`

Reply: `OK,1,2,3,4`

Data Channel

The following sections list the actions available on the data channel.

Optional parameters are shown in *italic*. The placeholder for data is surrounded by brackets (<>). In the examples, the delimiter is set to ','.

Result

The Result command retrieves measurement values and decisions.

Formats

Message	Format
Command	<code>Result,measurement ID,measurement ID...</code>
Reply	If no arguments are specified, the custom format data string is used. <code>OK, <custom data string> ERROR, <Error Message></code> If arguments are specified, <code>OK, <data string in standard format></code> <code>ERROR, <Error Message></code>

Examples:

Standard data string for measurements ID 0 and 1:

`Result,0,1`

`OK,M00,00,V151290,D0,M01,01,V18520,D0`

Standard formatted measurement data with a non-existent measurement of ID 2:

Result,2

ERROR,Specified measurement ID not found. Please verify your input

Custom formatted data string (%time, %value[0], %decision[0]):

Result

OK,1420266101,151290,0

Value

The Value command retrieves measurement values.

Formats

Message	Format
Command	Value,measurement ID,measurement ID...
Reply	If no arguments are specified, the custom format data string is used. OK, <custom data string> ERROR, <Error Message> If arguments are specified, OK, <data string in standard format, except that the decisions are not sent> ERROR, <Error Message>

Examples:

Standard data string for measurements ID 0 and 1:

Value,0,1

OK,M00,00,V151290,M01,01,V18520

Standard formatted measurement data with a non-existent measurement of ID 2:

Value,2

ERROR,Specified measurement ID not found. Please verify your input

Custom formatted data string (%time, %value[0]):

Value

OK, 1420266101, 151290

Decision

The Decision command retrieves measurement decisions.

Formats

Message	Format
Command	Decision,measurement ID,measurement ID...
Reply	If no arguments are specified, the custom format data string is used. OK, <custom data string> ERROR, <Error Message> If arguments are specified, OK, <data string in standard format, except that the values are not sent> ERROR, <Error Message>

Examples:

Standard data string for measurements ID 0 and 1:

```
Decision,0,1
```

```
OK,M00,00,D0,M01,01,D0
```

Standard formatted measurement data with a non-existent measurement of ID 2:

```
Decision,2
```

```
ERROR,Specified measurement ID not found. Please verify your input
```

Custom formatted data string (%time, %decision[0]):

```
Decision
```

```
OK,1420266101, 0
```

Health Channel

The following sections list the actions available on the health channel.

Optional parameters are shown in *italic*. The placeholder for data is surrounded by brackets (<>). In the examples, the delimiter is set to ','.

Health

The Health command retrieves health indicators. See *Health Results* on page 515 for details on health indicators.

Formats

Message	Format
Command	Health,health indicator ID.Optional health indicator instance ... More than one health indicator can be specified. Note that the health indicator instance is optionally attached to the indicator ID with a '!'. If the health indicator instance field is used the delimiter cannot be set to '!'.
Reply	OK, <health indicator of first ID>, <health indicator of second ID> ERROR, <Error Message>

Examples:

health,2002,2017

OK,46,1674

Health

ERROR,Insufficient parameters.

Standard Result Format

Gocator can send measurement results either in the standard format or in a custom format. In the standard format, you select in the web interface which measurement values and decisions to send. For each measurement the following message is transmitted:

M	t _n	,	i _n	,	V	v _n	,	D	d ₁	CR
---	----------------	---	----------------	---	---	----------------	---	---	----------------	----

Field	Shorthand	Length	Description
MeasurementStart	M	1	Start of measurement frame.
Type	t _n	n	Hexadecimal value that identifies the type of measurement. The measurement type is the same as defined elsewhere (see <i>Data Results</i> on page 504).
Id	i _n	n	Decimal value that represents the unique identifier of the measurement.
ValueStart	V	1	Start of measurement value.
Value	v _n	n	Measurement value, in decimal. The unit of the value is measurement-specific.
DecisionStart	D	1	Start of measurement decision.
Decision	d ₁	1	Measurement decision, a bit mask where: Bit 0: 1 – Pass 0 – Fail Bits 1-7: 0 – Measurement value OK 1 – Invalid value 2 – Invalid anchor

Custom Result Format

In the custom format, you enter a format string with place holders to create a custom message. The default format string is "%time, %value[0], %decision[0]".

Result Placeholders

Format Value	Explanation
%time	Timestamp
%encoder	Encoder position
%frame	Frame number
%value[Measurement ID]	Measurement value of the specified measurement ID. The ID must correspond to an existing measurement. The value output will be displayed as an integer in micrometers.
%decision[Measurement ID]	Measurement decision, where the selected measurement ID must correspond to an existing measurement. Measurement decision is a bit mask where: Bit 0: 1 – Pass 0 – Fail Bits 1-7: 0 – Measurement value OK 1 – Invalid value 2 - Invalid anchor

C language *printf*-style formatting is also supported: for example, `%sprintf[%09d, %value[0]]`. This allows fixed length formatting for easier input parsing in PLC and robot controller logic.

Development Kits

These sections describe the following development kits:

- [Software Development Kit \(GoSDK\)](#)
- [Gocator Development Kit \(GDK\)](#)

GoSDK

The Gocator Software Development Kit (GoSDK) includes open-source software libraries and documentation that can be used to programmatically access and control Gocator sensors. To get the latest version of the *Gocator SDK* package, go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download it from the Download Center.



If you switch jobs or make changes to a job using the SDK or a protocol (from a PLC), the switch or changes are not automatically displayed in the web interface: you must refresh the browser to see these.

You can download the Gocator SDK from within the Web interface.

Software Development Kit (SDK):

Download

To download the SDK:

1. Go to the **Manage** page and click on the **Support** category
2. Next to **Software Development Kit (SDK)**, click **Download**
3. Choose the location for the SDK on the client computer.

Applications compiled with previous versions of the SDK are compatible with Gocator firmware if the major version numbers of the protocols match. For example, an application compiled with version 5.0 of the SDK (which uses protocol version 5.0) will be compatible with a Gocator running firmware version 5.1 (which uses protocol version 5.1). However, any new features in firmware version 5.1 would not be available.

Applications compiled using SDK version 4.x are compatible with sensors running firmware 5.x.

Applications compiled using SDK version 3.x are not compatible with sensors running firmware 4.x. In this case, you must rewrite the application with the SDK version corresponding to the sensor firmware in use.

The Gocator API, included in the SDK, is a C language library that provides support for the commands and data formats used with Gocator sensors. The API is written in standard C to allow the code to be compiled for any operating system. A pre-built DLL is provided to support 32-bit and 64-bit Windows operating systems. Projects and makefiles are included to support other editions of Windows and Linux.

For Windows users, code examples for C, C#, and VB.NET are provided in the SDK package.

For more information about programming with the Gocator SDK, refer to the class reference and sample programs included in the Gocator SDK.

Setup and Locations

Class Reference

The full GoSDK class reference is found by accessing the following file:

14400-4.x.x.xx_SOFTWARE_GO_SDK\GO_SDK\doc\GoSdk\Gocator_3x00\GoSdk.html

Examples

Examples showing how to perform various operations are provided, each one targeting a specific area. For Visual Studio, the examples can be found in solution files specific to different versions of Visual Studio. For example, *GoSdk-2017.sln* is for use with Visual Studio 2017. A make file for Linux systems is also provided.



To compile the examples in Visual Studio, you may need to retarget the solution to the installed Windows SDK version. You can do this through the **Retarget solution** option in the solution context menu.


To run the GoSDK examples, make sure the required DLLs are copied beside the executable. In most cases only *GoSDK.dll* and *kApi.dll* are required, but with .NET and the accelerator additional DLLs are needed. Please refer to the SDK samples to see which DLLs are required.

Header Files

Header files are referenced with GoSdk as the source directory, for example: `#include <GoSdk/GoSdk.h>`. The SDK header files also reference files from the *kApi* directory.

Functional Hierarchy of Classes

This section describes the functional hierarchy of the classes in the Gocator 4.x SDK ("GoSDK"). In the following diagram, classes higher in the hierarchy often provide resources for classes lower in the hierarchy, and for this reason should be instantiated earlier in a client application.

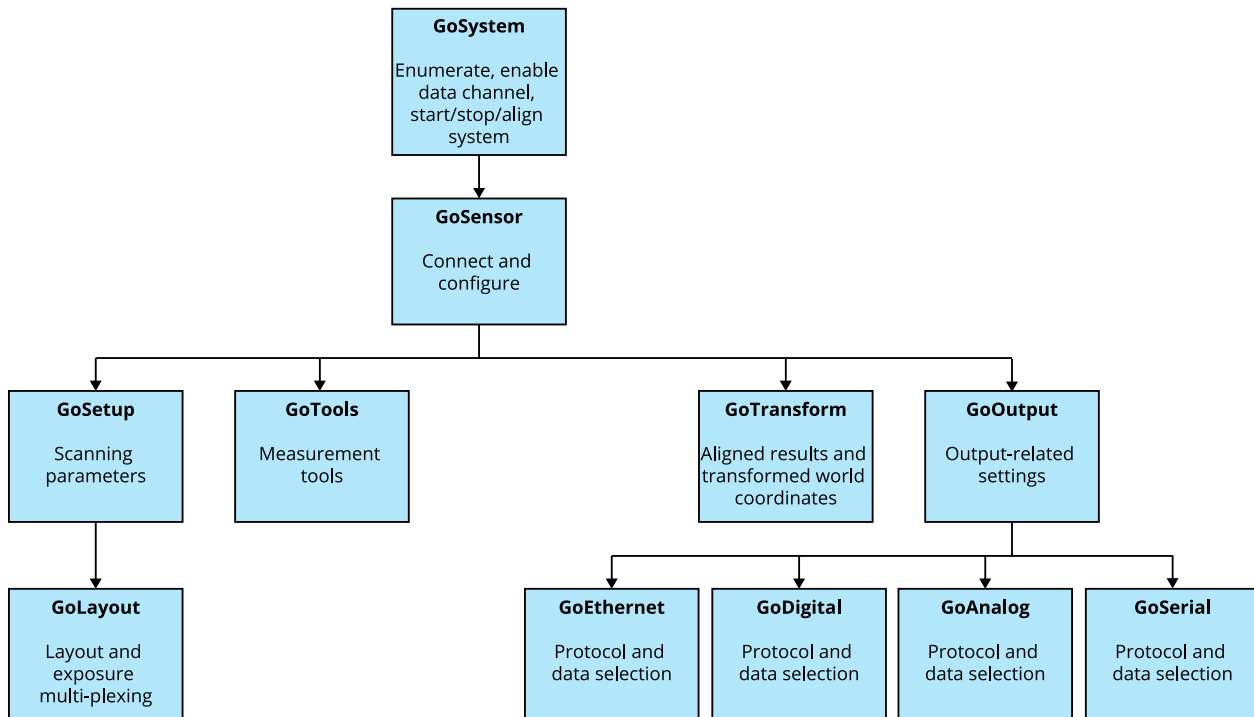

GoSystem

The *GoSystem* class is the top-level class in Gocator 4.x. Multiple sensors can be enabled and connected in one *GoSystem*. Only one *GoSystem* object is required for multi-sensor control.

Refer to the *How To Use The Open Source SDK To Fully Control A Gocator Multi-sensor System* how-to guide in http://lmi3d.com/sites/default/files/APPNOTE_Gocator_4.x_Multi_Sensor_Guide.zip for details on how to control and operate a multi-sensor system using the SDK.



All objects that are explicitly created by the user or passed via callbacks should be destroyed by using the *GoDestroy* function.

GoSensor

GoSensor represents a physical sensor. If the physical sensor is the Main sensor in a dual-sensor setup, it can be used to configure settings that are common to both sensors.

GoSetup

The *GoSetup* class represents a device's configuration. The class provides functions to get or set all of the settings available in the Gocator web interface.

GoSetup is included inside *GoSensor*. It encapsulates scanning parameters, such as exposure, resolution, spacing interval, etc. For parameters that are independently controlled for Main and Buddy sensors, functions accept a role parameter.

GoLayout

The *GoLayout* class represents layout-related sensor configuration.

GoTools

The *GoTools* class is the base class of the measurement tools. The class provides functions for getting and setting names, retrieving measurement counts, etc.

GoTransform

The *GoTransform* class represents a sensor transformation and provides functions to get and set transformation information, as well as encoder-related information.

GoOutput

The *GoOutput* class represents output configuration and provides functions to get the specific types of output (Analog, Digital, Ethernet, and Serial). Classes corresponding to the specific types of output (*GoAnalog*, *GoDigital*, *GoEthernet*, and *GoSerial*) are available to configure these outputs.

Data Types

The following sections describe the types used by the SDK and the *kApi* library.

Value Types

GoSDK is built on a set of basic data structures, utilities, and functions, which are contained in the *kApi* library.

The following basic value types are used by the *kApi* library.

Value Data Types

Type	Description
k8u	8-bit unsigned integer
k16u	16-bit unsigned integer
k16s	16-bit signed integer
k32u	32-bit unsigned integer
k32s	32-bit signed integer
k64s	64-bit signed integer
k64u	64-bit unsigned integer
k64f	64-bit floating number
kBool	Boolean, value can be kTRUE or kFALSE
kStatus	Status, value can be kOK or kERROR
kIpAddress	IP address

Output Types

The following output types are available in the SDK.

Output Data Types

Data Type	Description
GoAlignMsg	Represents a message containing an alignment result.

Data Type	Description
GoBoundingBoxMatchMsg	Represents a message containing bounding box based part matching results.
GoDataMsg	Represents a base message sourced from the data channel. See <i>GoDataSet Type</i> below for more information.
GoEdgeMatchMsg	Represents a message containing edge based part matching results.
GoEllipseMatchMsg	Represents a message containing ellipse based part matching results.
GoExposureCalMsg	Represents a message containing exposure calibration results.
GoMeasurementMsg	Represents a message containing a set of GoMeasurementData objects.
GoProfileIntensityMsg	Represents a data message containing a set of profile intensity arrays.
GoProfileMsg	Represents a data message containing a set of profile arrays.
GoRangeIntensityMsg	Represents a data message containing a set of range intensity data.
GoRangeMsg	Represents a data message containing a set of range data.
GoResampledProfileMsg	Represents a data message containing a set of resampled profile arrays.
GoSectionMsg	Represents a data message containing a set of section arrays.
GoSectionIntensityMsg	Represents a data message containing a set of profile intensity arrays.
GoStampMsg	Represents a message containing a set of acquisition stamps.
GoSurfaceIntensityMsg	Represents a data message containing a surface intensity array.
GoSurfaceMsg	Represents a data message containing a surface array.
GoVideoMsg	Represents a data message containing a video image.

Refer to the *GoSdkSamples* sample code for examples of acquiring data using these data types.



See *Setup and Locations* on page 553 for more information on the code samples.

GoDataSet Type

Data are passed to the data handler in a *GoDataSet* object. The *GoDataSet* object is a container that can contain any type of data, including scan data (sections or surfaces), measurements, and results from various operations. Data inside the *GoDataSet* object are represented as messages.

The following illustrates the content of a *GoDataSet* object of a surface mode setup with two measurements.

GoDataSet Header
GoStampMsg
GoSurfaceMsg
GoMeasurementMsg (for measurement ID 0)
GoMeasurementMsg (for measurement ID 1)

After receiving the *GoDataSet* object, you should call *GoDestroy* to dispose the *GoDataSet* object. You do not need to dispose objects within the *GoDataSet* object individually.

 All objects that are explicitly created by the user or passed via callbacks should be destroyed by using the *GoDestroy* function.

Measurement Values and Decisions

Measurement values and decisions are 32-bit signed values (k32s). See *Value Types* on page 555 for more information on value types.

The following table lists the decisions that can be returned.

Measurement Decisions


Decision	Description
1	The measurement value is between the maximum and minimum decision values. This is a pass decision.
0	The measurement value is outside the maximum and minimum. This is a fail decision.
-1	The measurement is invalid (for example, the target is not within range). Provides the reason for the failure.
-2	The tool containing the measurement is anchored and has received invalid measurement data from one of its anchors. Provides the reason for the failure.

Refer to the *SetupMeasurement* example for details on how to add and configure tools and measurements. Refer to the *ReceiveMeasurement* example for details on how to receive measurement decisions and values.

 You should check a decision against ≤ 0 for failure or invalid measurement.

Operation Workflow

Applications created using the SDK typically use the following programming sequence

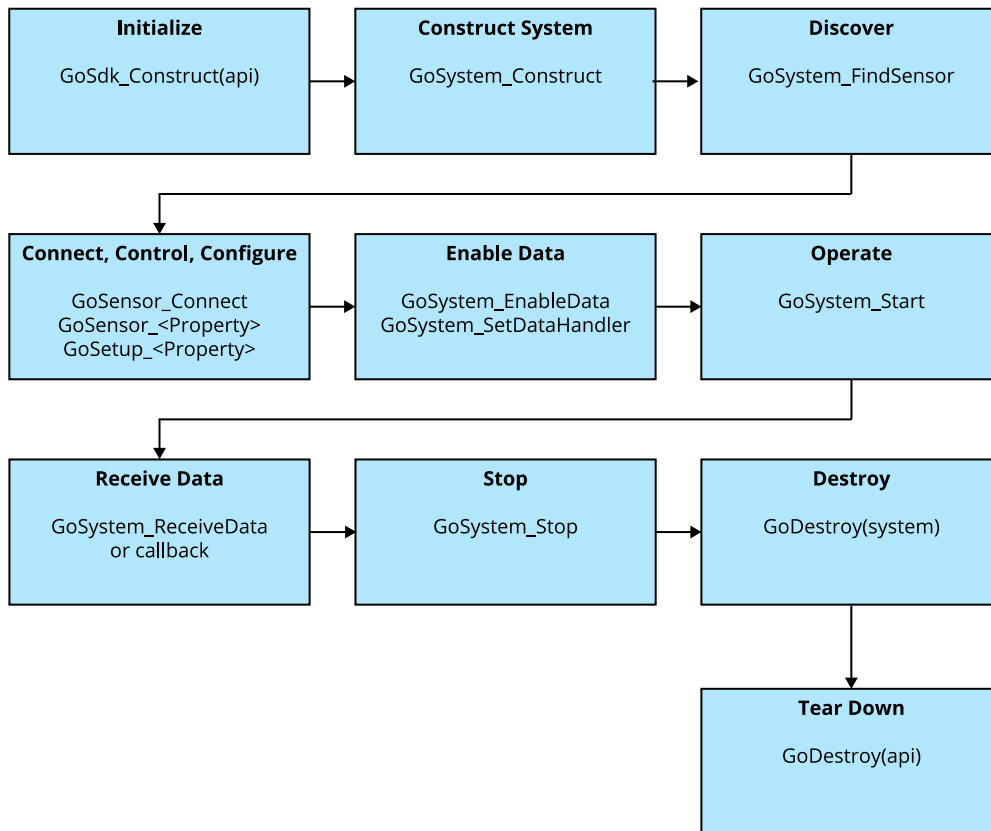

See *Setup and Locations* on page 553 for more information on the code samples referenced below.



Sensors must be connected before the system can enable the data channel.



All GoSDK data functions are named *Go<Object>_<Function>*, for example, *GoSensor_Connect*. For property access functions, the convention is *Go<Object>_<Property Name>* for reading the property and *Go<Object>_Set<Property Name>* for writing it, for example, *GoMeasurement_DecisionMax* and *GoMeasurement_SetDecisionMax*, respectively.

Initialize GoSdk API Object

Before the SDK can be used, the *GoSdk* API object must be initialized by calling *GoSdk_Construct(api)*:

```

kAssembly api = kNULL;
if ((status = GoSdk_Construct(&api)) != kOK)
{
    printf("Error: GoSdk_Construct:%d\n", status);
    return;
}
  
```

When the program finishes, call *GoDestroy(api)* to destroy the API object.

Discover Sensors

Sensors are discovered when *GoSystem* is created, using *GoSystem_Construct*. You can use *GoSystem_SensorCount* and *GoSystem_SensorAt* to iterate all the sensors that are on the network.

GoSystem_SensorCount returns the number of sensors physically in the network.

Alternatively, use *GoSystem_FindSensorById* or *GoSystem_FindSensorByIpAddress* to get the sensor by ID or by IP address.

Refer to the *Discover* example for details on iterating through all sensors. Refer to other examples for details on how to get a sensor handle directly from IP address.

Connect Sensors

Sensors are connected by calling *GoSensor_Connect*. You must first get the sensor object by using *GoSystem_SensorAt*, *GoSystem_FindSensorById*, or *GoSystem_FindSensorByIpAddress*.

Configure Sensors

Some configuration is performed using the *GoSensor* object, such as managing jobs, uploading and downloading files, scheduling outputs, setting alignment reference, etc. Most configuration is however performed through the *GoSetup* object, for example, setting scan mode, exposure, exposure mode, active area, speed, alignment, filtering, subsampling, etc. Surface generation is configured through the *GoSurfaceGeneration* object and part detection settings are configured through the *GoPartDetection* object.

See *Functional Hierarchy of Classes* on page 553 for information on the different objects used for configuring a sensor. Sensors must be connected before they can be configured.

Refer to the *Configure* example for details on how to change settings and to switch, save, or load jobs. Refer to the *BackupRestore* example for details on how to back up and restore settings.

Enable Data Channels

Use *GoSystem_EnableData* to enable the data channels of all connected sensors.

Perform Operations

Operations are started by calling *GoSystem_Start*, *GoSystem_StartAlignment*, and *GoSystem_StartExposureAutoSet*.

Refer to the *StationaryAlignment* and *MovingAlignment* examples for details on how to perform alignment operations. Refer to the *ReceiveRange*, *ReceiveProfile*, and *ReceiveWholePart* examples for details on how to acquire data.

Example: Configuring and starting a sensor with the Gocator API

```
#include <GoSdk/GoSdk.h>

void main()
{
    kIpAddress ipAddress;
```

```

GoSystem system = kNULL;
GoSensor sensor = kNULL;
GoSetup setup = kNULL;

//Construct the GoSdk library.
GoSdk_Construct(&api);

//Construct a Gocator system object.
GoSystem_Construct(&system, kNULL);

//Parse IP address into address data structure
kIpAddress_Parse(&ipAddress, SENSOR_IP);

//Obtain GoSensor object by sensor IP address
GoSystem_FindSensorByIpAddress(system, &ipAddress, &sensor)

//Connect sensor object and enable control channel
GoSensor_Connect(sensor);

//Enable data channel
GoSensor_EnableData(system, kTRUE)

//[Optional] Setup callback function to receive data asynchronously
//GoSystem_SetDataHandler(system, onData, &contextPointer)
//Retrieve setup handle
setup = GoSensor_Setup(sensor);

//Reconfigure system to use time-based triggering.
GoSetup_SetTriggerSource(setup, GO_TRIGGER_TIME);

//Send the system a "Start" command.
GoSystem_Start(system);

//Data will now be streaming into the application
//Data can be received and processed asynchronously if a callback function has been
//set (recommended)
//Data can also be received and processed synchronously with the blocking call
//GoSystem_ReceiveData(system, &dataset, RECEIVE_TIMEOUT)
//Send the system a "Stop" command.
GoSystem_Stop(system);

//Free the system object.
GoDestroy(system);

//Free the GoSdk library
GoDestroy(api);

```

}

Limiting Flash Memory Write Operations

Several operations and Gocator SDK functions write to the Gocator's flash memory. The lifetime of the flash memory is limited by the number of write cycles. Therefore it is important to avoid frequent write operation to the Gocator's flash memory when you design your system with the Gocator SDK.



Power loss during flash memory write operation will also cause Gocators to enter rescue mode.



This topic applies to all Gocator sensors.

Gocator SDK Write-Operation Functions

Name	Description
GoSensor_Restore	Restores a backup of sensor files.
GoSensor_RestoreDefaults	Restores factory default settings.
GoSensor_CopyFile	Copies a file within the connected sensor. The flash write operation does not occur if GoSensor_CopyFile function is used to load an existing job file. This is accomplished by specifying "_live" as the destination file name.
GoSensor_DeleteFile	Deletes a file in the connected sensor.
GoSensor_SetDefaultJob	Sets a default job file to be loaded on boot.
GoSensor_UploadFile	Uploads a file to the connected sensor.
GoSensor_Upgrade	Upgrades sensor firmware.
GoSystem_StartAlignment	When alignment is performed with alignment reference set to fixed, flash memory is written immediately after alignment. GoSensor_SetAlignmentReference() is used to configure alignment reference.
GoSensor_SetAddress	Configures a sensor's network address settings.
GoSensor_ChangePassword	Changes the password associated with the specified user account.

System created using the SDK should be designed in a way that parameters are set up to be appropriate for various application scenarios. Parameter changes not listed above will not invoke flash memory write operations when the changes are not saved to a file using the GoSensor_CopyFile function. Fixed alignment should be used as a means to attach previously conducted alignment results to a job file, eliminating the need to perform a new alignment.

GDK

The Gocator Development Kit (GDK) is a framework for developing and testing custom Gocator tools containing your own algorithms, and then deploying them to Gocator sensors.

Custom tools created with the GDK act much like native Gocator data output tools (providing measurements, geometric features, data and generic outputs) with support for multiple input parameters), running at native speeds and taking advantage of features such as anchoring. The GDK supports all data types (profile and surface), and tools created with the GDK use the same data visualization as native tools.

Benefits

When you use the GDK to create custom measurement tools, you have complete control over how and where your custom measurement tools can be used, which protects your intellectual property.

You can also easily troubleshoot and modify your tools on-site, letting you respond quickly to your customers' urgent issues.

Supported Sensors

The GDK is available for free for the following Gocator sensors:

- Gocator 1300 series
- Gocator 2100 series
- Gocator 2300 series
- Gocator 2400 series
- Gocator 2880
- Gocator 3210 and 3506

Typical Workflow

The following is the typical workflow for creating and deploying custom measurement tools:

- Develop and build tools using the GDK project files and libraries in Microsoft Visual Studio, targeting Win32.
- Debug the tools using the emulator on a PC.
- Build the tools into a custom firmware binary.
- Upload the custom firmware to a sensor.

Installation and Class Reference

The GDK project and library files are in the *Gocator GDK* package (14524-x.x.x.xx_SOFTWARE_GDK.zip). To download the package, go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download it from the Download Center.

After downloading the package, extract the package to a directory.

You can access full installation and setup instructions, as well as the complete class reference documentation, by double-clicking the *Guide* shortcut under the root directory.

 bin	8/4/2016 2:08 AM	File folder
 doc	8/4/2016 2:10 AM	File folder
 Gocator	8/4/2016 2:14 AM	File folder
 lib	8/4/2016 2:15 AM	File folder
 pkg	8/4/2016 2:16 AM	File folder
 Platform	8/4/2016 2:16 AM	File folder
 res	8/4/2016 2:16 AM	File folder
 Guide	8/3/2016 1:39 PM	Shortcut

Required Tools

The GDK requires Microsoft Visual Studio 2017, as well as various other tools provided in the *Gocator GDK Prerequisites* package (14525_2.0.0.0_SOFTWARE_GDK_Prerequisites.zip), which is available in LMI's Downloads Center (see above for download location).


Getting Started with the Example Code

The best way to get started is with the GDK sample code. You can find the sample projects under `Gocator\GDKSampleApp`. This project is ready for you to build and use as a template for new projects.

Start by opening `GDK.sln` in Visual Studio 2017.

Building the Sample Code

You can build the sample code for working with either the emulator or a sensor. To do this, choose the target and then build the solution.

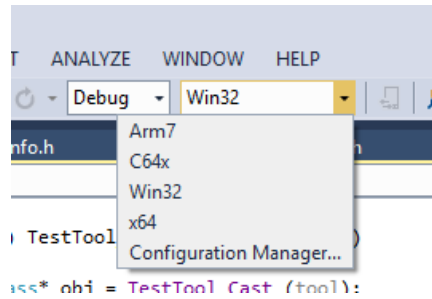

The following targets are available:

- Win32/x64 for debugging code and emulating a sensor to test tools (on a PC)
- Arm7 for building for Gocator 2300C and 2400 series sensors
- C64x for Gocator 1300, 2300A, 2300B, 3210, and 3506 series sensors

The Win32 target supports Debug and Release builds. The Arm7 and C64x targets (Gocator sensors) only support Release builds.

Tool Registration

For a tool to be available to a user in the Gocator web interface, you must add it to the project assembly in `Asm.c`.

```
#include <GdkSampleApp/Asm.h>
#include <GdkSampleApp/TestProfileSelect.h>
#include <GdkSampleApp/TestSurfaceSelect.h>
#include <GdkSampleApp/TestSurfaceConfiguration.h>
#include <GdkSampleApp/TestSurfaceGraphics.h>
#include <Gdk/GdkLib.h>
#include <GoSensor/Version.h>
#include <GoSensorAppLib/GsaDef.h>
#include <GoSensorAppLib/GsaAsm.h>

kBeginAssembly (Tool, ToolAsm, TOOL_VERSION, GOCATOR_VERSION)
    kAddDependency (GdkLib)
    kAddType (TestProfileSelect)
    kAddType (TestSurfaceSelect)
    kAddType (TestSurfaceConfiguration)
    kAddType (TestSurfaceGraphics)
kEndAssembly ()
```

You can add multiple tools in a GDK project. As seen above, `TestProfileSelect`, `TestSurfaceSelect`, `TestSurfaceConfiguration`, etc. will be available for users from the dropdown menu in the **Tools** panel in sensor's web interface.

Tool Definitions

You must add standard entry functions (methods) for each tool. The class table declares the entry functions:

```
kBeginClass (Tool, TestTool, GdkTool)
    kAddVMethod (TestTool, kObject, VRelease)
    kAddVMethod (TestTool, GdkTool, VInit)
    kAddVMethod (TestTool, GdkTool, VName)
    kAddVMethod (TestTool, GdkTool, VDescribe)
    kAddVMethod (TestTool, GdkTool, VNewToolConfigInstantced)
    kAddVMethod (TestTool, GdkTool, VNewMeasurementConfigInstantced)
    kAddVMethod (TestTool, GdkTool, VUpdateConfigInstantced)
    kAddVMethod (TestTool, GdkTool, VNewFeatureConfigInstantced)
    kAddVMethod (TestTool, GdkTool, VNewToolDataOutputConfigInstantced)
    kAddVMethod (TestTool, GdkTool, VIsVisible)
    kAddVMethod (TestTool, GdkTool, VCalcDataOutputRegionInstantced)
    kAddVMethod (TestTool, GdkTool, VStart)
    kAddVMethod (TestTool, GdkTool, VStop)
    kAddVMethod (TestTool, GdkTool, VProcess)
kEndClass ()

ToolFx (kStatus) TestTool_VDescribe (GdkToolInfo toolInfo)
{
    GdkMeasurementInfo mmt;
    GdkParamsInfo params;
    GdkParamInfo paramInfo;

    kCheck (GdkToolInfo_SetTypeName (toolInfo, TEST_PROFILE_SELECT_TOOL_NAME));
    kCheck (GdkToolInfo_SetLabel (toolInfo, TEST_PROFILE_SELECT_TOOL_LABEL));

    kCheck (GdkToolInfo_SetSourceType (toolInfo, GDK_DATA_TYPE_UNIFORM_PROFILE));

    ...
}
```

The function `<Tool Name>_VDescribe` describes the tool and its basic configuration. This function is called during sensor start-up. For more information on entry functions, see *Entry Functions* below.



Make sure the `VDescribe` function for each tool is properly formed. Significant issues with this function (for example, overwriting memory) could prevent the sensor from starting.



You should use the emulator to debug tools *before* deploying tools to sensors.

Entry Functions

The following table describes the main entry functions.


Function	Description
VDescribe	Defines the tool's name, data types, acceptable source options, configuration parameters, and at least one measurement.
VStart	Called when the sensor starts running (that is, the user clicks the Run button). The function gets parameters from <code>GtTool</code> . You typically allocate memory in this function.
VProcess	Called every time data is received while the sensor is running.
VStop	Called when the user clicks the Stop button.

The `TestSurfaceConfiguration` example shows how to create and modify parameters based on other user settings.

For full descriptions of these functions, see the GDK class reference documentation (see *Installation and Class Reference* on page 563 for information on installing the documentation).

Parameter Configurations

Each tool has two levels of parameters: tool parameters and measurement parameters.

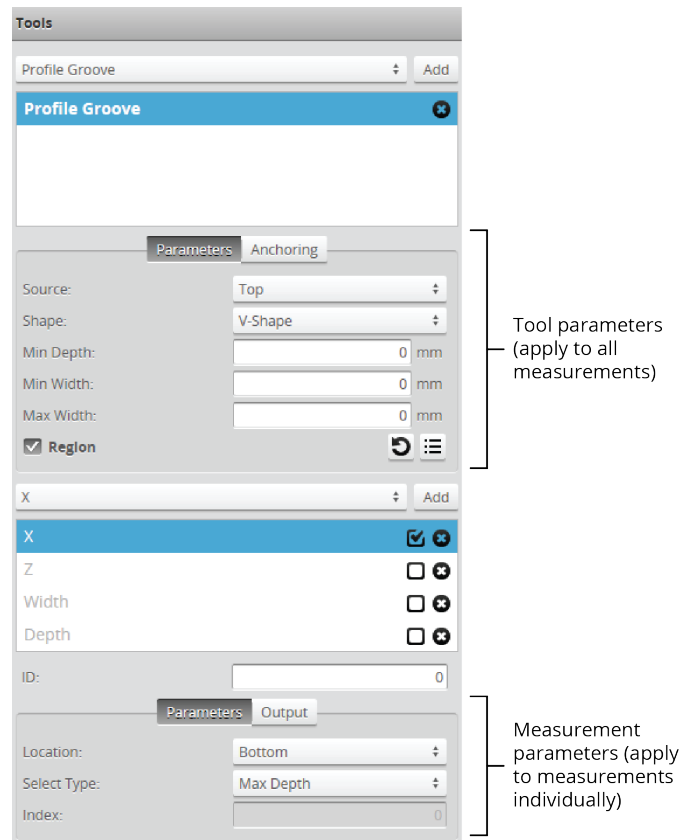

A tool can contain multiple measurements. In the image above, the Groove tool contains four measurements: X, Z, Width, and Depth. Each tool has one set of tool parameters and each measurement in a tool has one set of measurement parameters.


The following table lists the functions that provide advanced or interactive control for setting up tool and measurement parameters:

Function	Description
<code>VNewToolConfig</code>	Advanced method for setting default values of tool parameters based on the current sensor configuration (for example, active area). Called when a new tool is added in the interface.
<code>VNewMeasurementConfig</code>	Advanced method for setting default values of measurement parameters based on the current sensor configurations (for example, active area). Called when measurements in a tool are added in the interface.
<code>VUpdateConfig</code>	Advanced method for updating the configuration based on parameters set by users.


For full descriptions of these functions, see the GDK class reference documentation (see *Installation and Class Reference* on page 563 for information on installing the documentation).

Graphics Visualization

The `GdkGraphic` function supports points and lines.

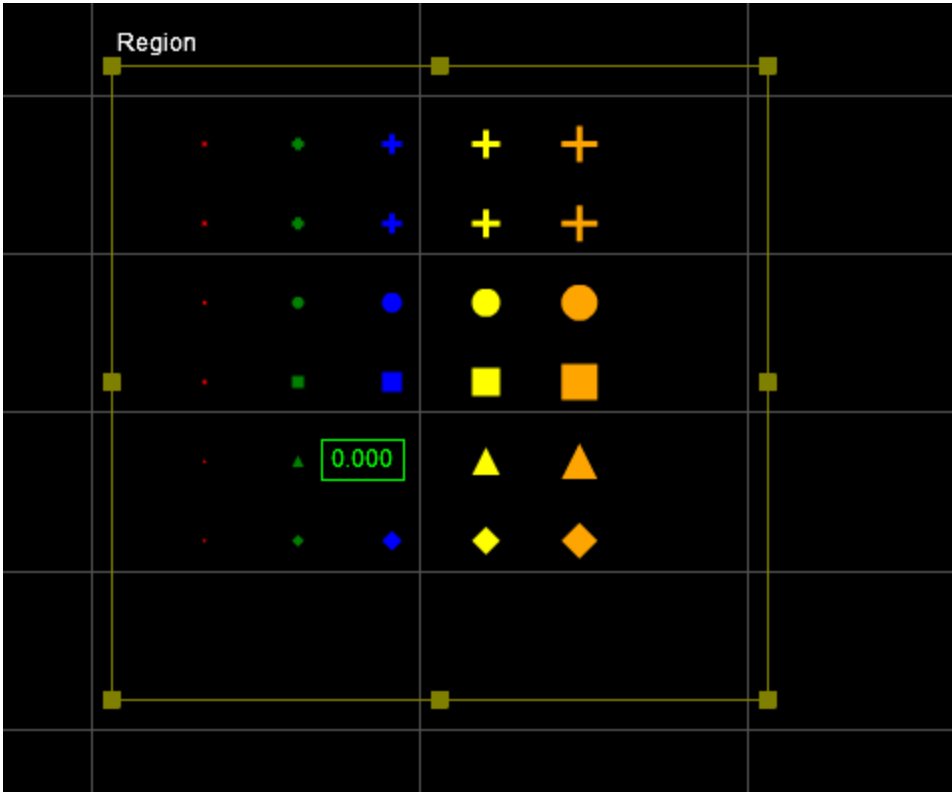

Point graphics

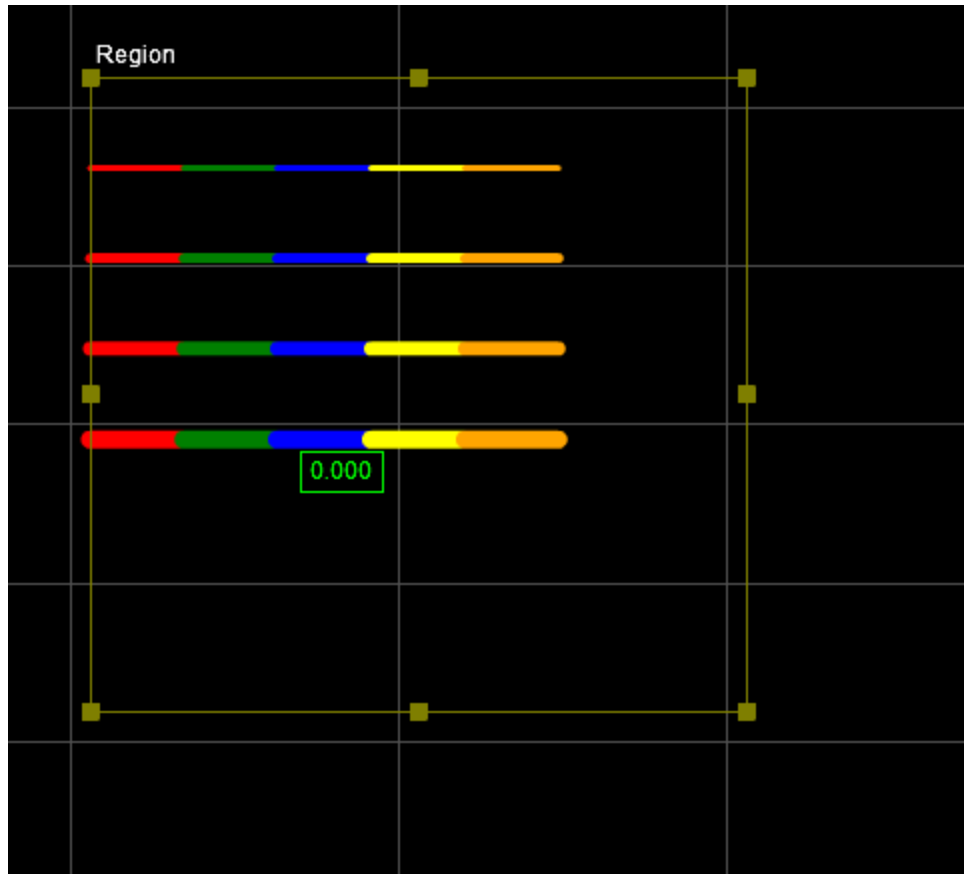

Line graphics

To create graphics:

1. Use `GdkGraphic_Construct` to create a graphic object.
2. Use `GdkGraphicPointSet_Construct` to create points or `GdkGraphicLineSet_Construct` to create lines.
3. Add the points and lines to the graphic object using `GdkGraphic_AddPointSet` and `GdkGraphic_AddLineSet`.
4. Output using `GdkToolOutput_SetRendering`.

The following illustrates the process:

```
kTest(GdkGraphic_Construct(&graphic, kObject_Alloc(tool)));
kTest(GdkGraphicPointSet_Construct(&pointSet, 4.0, kMARKER_SHAPE_CROSS, kCOLOR_LIME,
&point32f, 1, kObject_Alloc(tool)));
kTest(GdkGraphic_AddPointSet(graphic, pointSet));
kTest(GdkToolOutput_SetRendering(output, measurementIndex, graphic));
```

The GDK example `TestSurfaceGraphics` shows how to use the graphics functions.


 Graphic functions take an array of `kPoint3d32f`. It does NOT accept `kPoint3d64f`.


Debugging Your Tools

We highly recommend using the emulator to debug tools you create with the GDK. By using a Gocator support file and previously recorded scan data, downloaded from a physical sensor, you can completely simulate standalone and multi-sensor configurations on a PC to test your tools.

To debug your tools in the emulator:

1. Compile your code using the Win32 target (Debug or Release).
2. In the output directory, rename the DLL with the same name as your project to GdkApp.dll.
For example, if your project is called `MyGDKTools`, the resulting DLL should be called `MyGDKTools.dll`. You rename this DLL to `GdkApp.dll`.
The output directories are as follows:
Release: `win32`
Debug: `win32d`
3. Launch the emulator from same output directory as in step 2.
4. In the emulator, choose a scenario and start it.
5. In Visual Studio, attach the debugger to the `kFramework.exe` process.

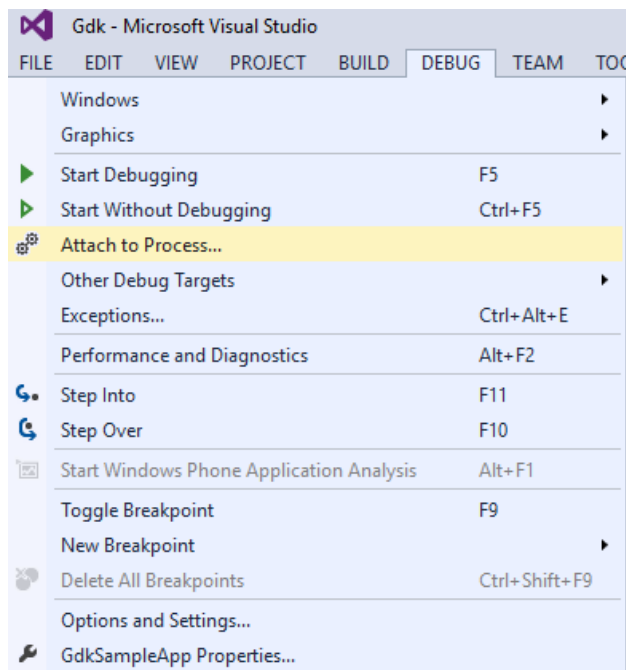

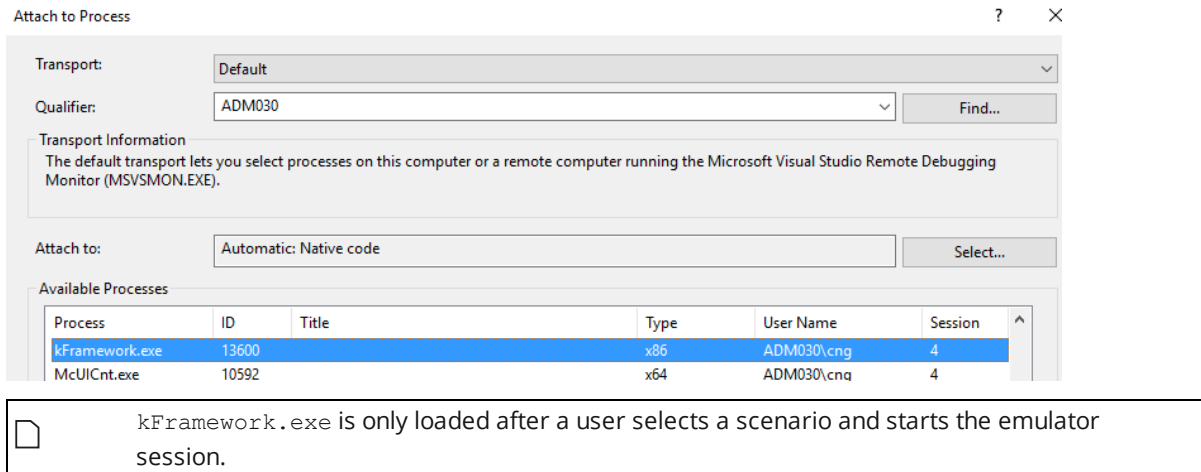

Debugging Entry Functions

VStart, *VProcess*, and *VStop* are called whenever a data record is played back in the emulator (that is, when a user clicks on the Next button or types the frame number in the frame field) with at least one tool instance. For more information on playback controls, see *Recording, Playback, and Measurement Simulation* in the Gocator user manual.

VDescribe however is called when the DLL loads, before the debugger can attach to the `kFramework.exe` process. To debug *VDescribe*, we recommend testing the function calls by putting them in *VInit*.

For information on building targets for testing in the emulator, see the GDK class reference documentation.

Tips

The following sections provide useful information for creating custom measurement tools.

Backward Compatibility with Older Versions of Tools

When loading a recording or job file that contains a custom measurement tool, the parameters in the loaded recording or job file must match those in the firmware.

By default, if declared parameters are missing from the configuration, a job file or a recording will fail to load.

There are two ways to provide backward compatibility with older parameter sets.

Define new parameters as optional

Mark a parameter as optional with the function `GdkParamInfo_SetIsOptional`. When a parameter is marked as optional, parameter parsing functions succeed even if the parameter is missing from the configuration. The missing parameter is initialized with default value.

Configuration Versioning

Over the lifetime of a tool, you may need to make changes to its interface (for example, changing or removing parameters). The user-defined aspects of a tool interface—its parameters and

measurements—are captured by `GDKToolVersionInfo` objects.

By default, a tool has just one version (`GdkToolInfo_FirstVersion`), but more versions may be added using `GdkToolInfo_AddVersion`. Whenever the interface of a tool has changed, a new version can be registered so that the new interface can be correctly parsed by the framework.

When the configuration of a tool instance is saved, the version used at the time is also saved. This saved version is used by the framework to parse the configuration. If a version is not defined by the firmware implementation, then that tool instance will not be active.

During run-time, you can query the version of the configuration of a tool instance by using `GdkToolCfg_Version`. You can then interpret the parameters depending on the version the configuration is saved in.

```
GdkFx(kStatus) GdkExampleTool_VDescribe(GdkToolInfo info)
{
    kCheck(GdkToolInfo_SetLabel(info, "Example"));

    kCheck(GdkToolInfo_SetSourceType(info, GDK_DATA_TYPE_UNIFORM_PROFILE));
    kCheck(GdkToolInfo_AddSourceOption(info, GDK_DATA_SOURCE_TOP));

    kCheck(GdkExampleTool_DescribeV0(info));
    kCheck(GdkExampleTool_DescribeV1(info));

    kCheck(GdkToolInfo_SetDefaultVersion(info, GdkToolInfo_VersionAt(info, 1)));

    return kOK;
}

GdkFx(kStatus) GdkExampleTool_DescribeV0(GdkToolInfo info)
{
    kCheck(GdkParamsInfo_Add(GdkToolInfo_Params(info), "RefRegion", GDK_PARAM_TYPE_PROFILE_
REGION, "Ref Region", kNULL));
    kCheck(GdkParamsInfo_Add(GdkToolInfo_Params(info), "Region", GDK_PARAM_TYPE_PROFILE_
REGION, "Region", kNULL));
    kCheck(GdkToolInfo_SetFirstVersionName(info, ""));

    return kOK;
}

GdkFx(kStatus) GdkExampleTool_DescribeV1(GdkToolInfo info)
{
    GdkToolVersionInfo versionInfo;

    // Auto-version

    kCheck(GdkToolInfo_AddVersion(info, kNULL, &versionInfo));
    kCheck(GdkToolVersionInfo_UseBase(versionInfo, GdkToolInfo_FirstVersion(info)));
    kCheck(GdkParamsInfo_AddFloat(GdkToolVersionInfo_Params(versionInfo), "BaseScale",
kNULL, 2.0, kNULL));

    return kOK;
}
```


Adding a new measurement does not require special handling. The new measurement is just not instantiated in a previous configuration.

Version

You can define the version number of your tools in `Asm.x.h`.

```
#define TOOL_VERSION    kVersion_Stringify_(1, 0, 0, 23)
```

The version is displayed on the **Manage** page, in the **Support** category.

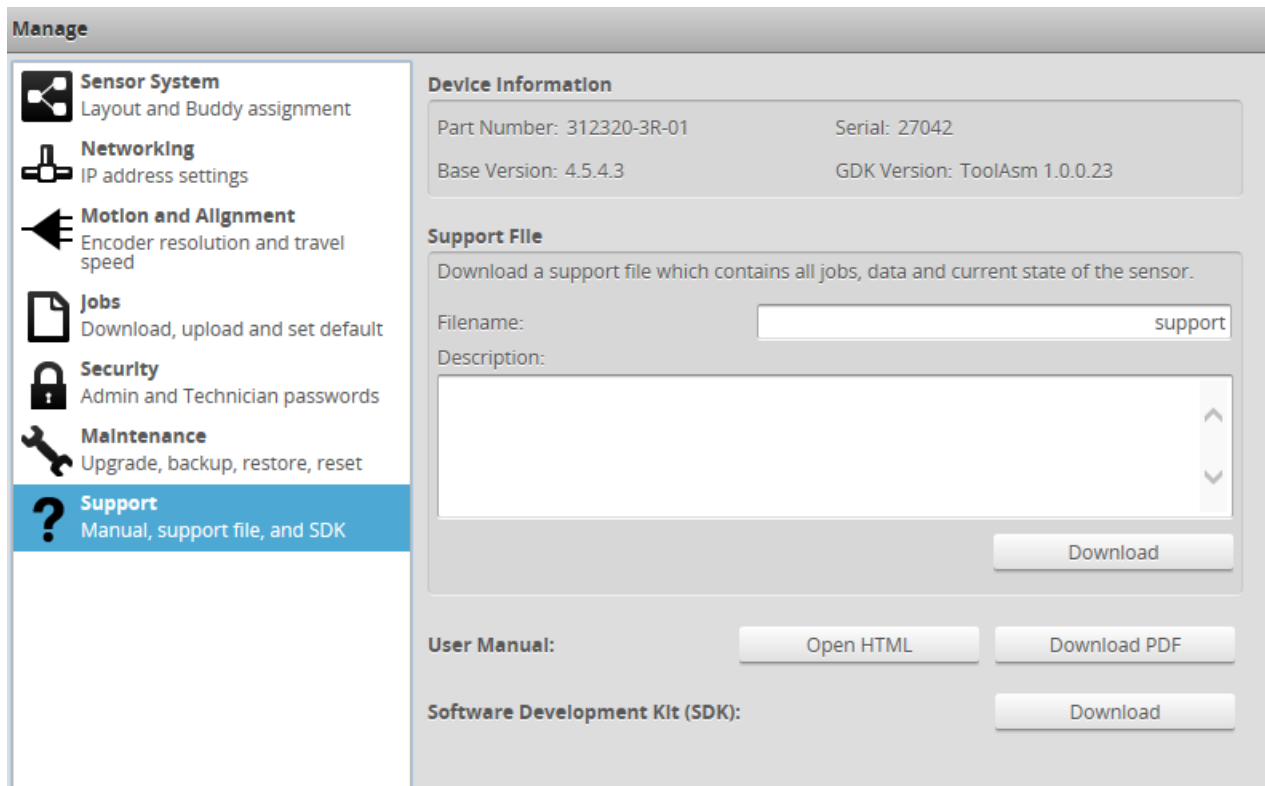

The screenshot shows the 'Manage' interface. On the left is a sidebar with icons and labels for different categories: Sensor System, Networking, Motion and Alignment, Jobs, Security, Maintenance, and Support (which is highlighted with a blue background and a question mark icon). The main area is titled 'Manage' and contains several sections. The 'Device Information' section shows 'Part Number: 312320-3R-01', 'Serial: 27042', 'Base Version: 4.5.4.3', and 'GDK Version: ToolAsm 1.0.0.23'. Below this is the 'Support File' section, which includes a description, a 'Filename:' input field with 'support' entered, a 'Description:' text area, and a 'Download' button. At the bottom, there are links for 'User Manual' (with 'Open HTML' and 'Download PDF' buttons) and 'Software Development Kit (SDK)' (with a 'Download' button).

Common Programming Operations

The following sections describe common programming operations.

Input Data Objects

The `VProcess` function receives a `GdkToolInput` object as input. This object is a container where the information and actual data of the received input is stored.

```
GdkInputItem item = GdkToolInput_Find(input, obj->dataSource);  
GdkDataInfo itemInfo = GdkInputItem_Info(item);
```

The `GdkToolInput_Find` and `GdkInputItem_Info` functions are used to extract the item and info objects. These objects can then be used to retrieve the input data and information (for example, offset and resolution) associated to the input. The following are some examples:

Computing actual height information using offset and scale


```
k64f height = rangeSrc[index] * scale->z + offset->z;
```

Extracting height information from profiles and surfaces.

The `TestProfileSelect` and `TestSurfaceSelect` examples show how to perform these operations.

Setup and Region Info during Tool Initialization

Memory allocation is often done in the `VInit` or `VStart` function. To retrieve sensor and data information such as active area settings and data scale outside of `VProcess`, you can use the following function:

```
GdkDataInfo info = GdkSensorInfo_DataSource(GdkTool_SensorInfo(tool), GDK_DATA_SOURCE_TOP);
```

Computing Region Based on the Offset from an Anchor Source

Just like built-in measurement tools, custom tools created with the GDK can be anchored to another tool (GDK-based tools or built-in tools).

To compute the offset region:

```
TestToolClass* obj = TestTool_Cast_(tool);
GdkParams params = GdkToolCfg_Parameters(config);
const kPoint3d64f* anchor = GdkToolInput_AnchorPosition(input);
GdkRegionXZ64f offsetRegion = { k64F_NULL, k64F_NULL, k64F_NULL, k64F_NULL };

param = GdkParams_Find(params, "Region");
obj->region = *GdkParam_AsProfileRegion(param);

offsetRegion = obj->region;
offsetRegion.x += anchor->x;
offsetRegion.z += anchor->z;
```

In the code above, we first retrieve the tool's region settings (before anchoring is applied), and then adjust the region based on the results from the anchored source in `VProcess`. If the anchored source fails, the tools will not be invoked.

The `TestProfileSelect` and `TestSurfaceSelect` examples show how to extract height information from anchored regions.

For more information on anchoring, see *Measurement Anchoring* in the Gocator user manual.

Part Matching

When part matching is enabled, the tool receives translated and corrected surface data. If part matching fails for the current scan (for example, the quality score is too low), the tools will not be invoked.

For more information on part matching, see *Part Matching* in the Gocator user manual.

Accessing Sensor Local Storage

You can access a sensor's local storage by using the `kFile` API.

For example, to read and write a file to a sensor's storage, you could use the following:

```
#include <kApi/Io/kFile.h>

...

ToolFx(kStatus) TestTool_VStart(TestTool tool)
{
    ...

    kFile_Save("test.txt", stringBuffer, (kSize) 1024);
    kFile_Load("test.txt", stringBuffer, &bufLen, kNULL);
}
```

Print Output

In the emulator, you can send output to Visual Studio or to programs such as DebugView by using the `OutputDebugString` function.

```
GtsFx(kStatus) TestTool_Trace(const kChar* format, ...)
{
    kStatus status = kOK;
    kChar debugLine[256];

    kVarArgList argList;
    kVarArgList_Start_(argList, format);
    {
        status = kStrPrintf(debugLine, 256, format, argList);
    }
    kVarArgList_End_(argList);
    OutputDebugStringA(debugLine);
    return status;
}
```



`OutputDebugString` is NOT supported on sensor targets. Use `#ifdef` to comment out the code when compiling against sensor targets.


Tools and Native Drivers

The following sections describe the tools and native drivers you can use with a Gocator, as well as the CSV format that Gocator can export.

Sensor Discovery Tool

If a sensor's network address or administrator password is forgotten, the sensor can be discovered on the network and/or restored to factory defaults by using the Sensor Discovery software tool. This tool can be obtained from the downloads area of the LMI Technologies website: <http://www.lmi3D.com>.

After downloading the tool package [14405-x.x.x.x_SOFTWARE_GO_Tools.zip], unzip the file and run the Sensor Discovery Tool [>Discovery>kDiscovery.exe].

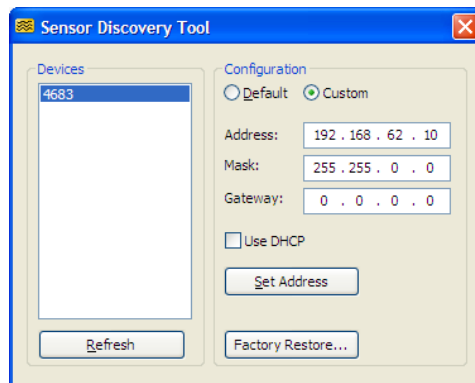

Any sensors that are discovered on the network will be displayed in the Devices list.

To change the network address of a sensor:

1. Select the **Custom** option.
2. Enter the new network address information.
3. Click **Set Address**.

To restore a sensor to factory defaults:

1. Select the sensor serial number in the **Devices** list.
2. Press the **Factory Restore...** button.
Confirm when prompted.



The Sensor Discovery tool uses UDP broadcast messages to reach sensors on different subnets. This enables the Sensor Discovery tool to locate and re-configure sensors even when the sensor IP address or subnet configuration is unknown.

GenTL Driver

GenTL is an industry standard method of controlling and acquiring data from an imaging device. The GenTL driver included with Gocator allows GenTL-compliant third-party software applications such as Halcon and Common Vision Blox to acquire and process 3D point clouds and intensity generated from the Gocator's Video, Surface mode in real-time.

 To use these third-party software applications, you *must* configure a system variable so the software can access the GenTL driver. For instructions, see *To configure system variables to use the driver in Windows 7*, below.

To get the toolset package containing the driver (14405-x.x.x.x_SOFTWARE_GO_Tools.zip), go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download it from the Download Center.


After downloading the package and unzipping the file to a location you will remember, you will find the driver in the GenTL\x86 or GenTL\x64 folder (you can move the GenTL folder to a more convenient location).

To configure system variables to use the driver in Windows 7:


1. From the Start menu, open the **Control** panel and then click **System and Security**.




2. Click **System**.

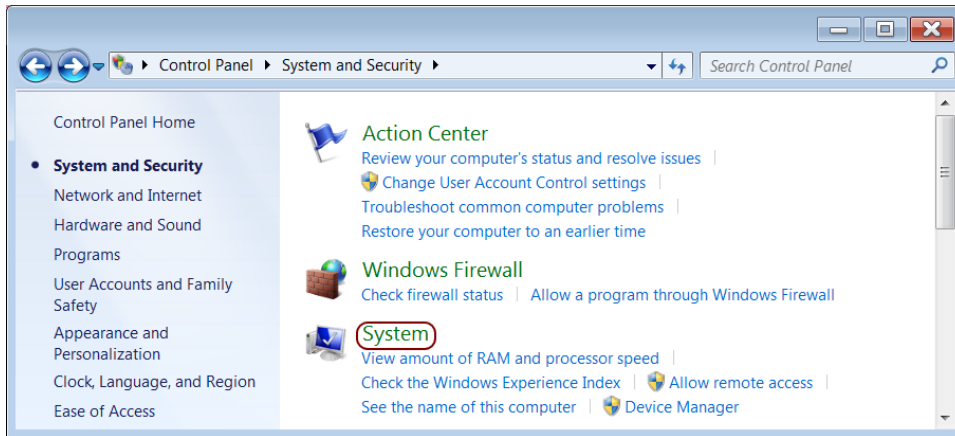


3. Click **Advanced System Settings**.

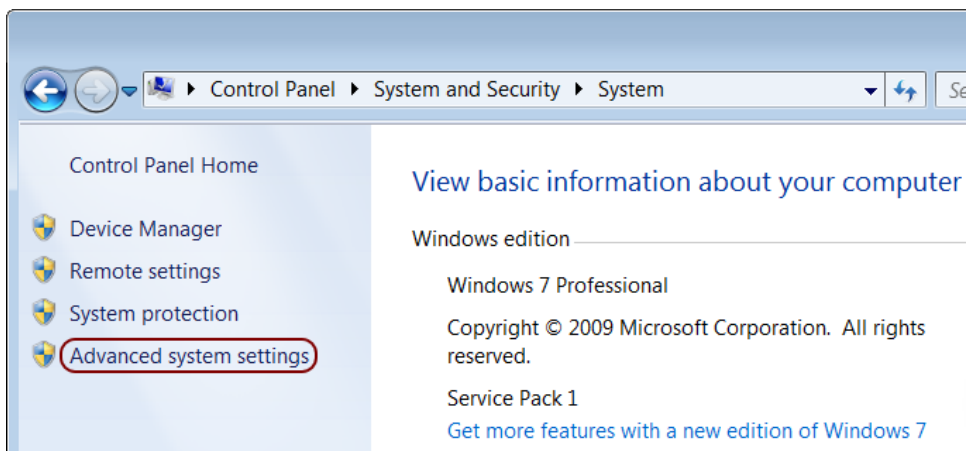

4. In the **System Properties** dialog, on the **Advanced** tab, click **Environment Variables...**

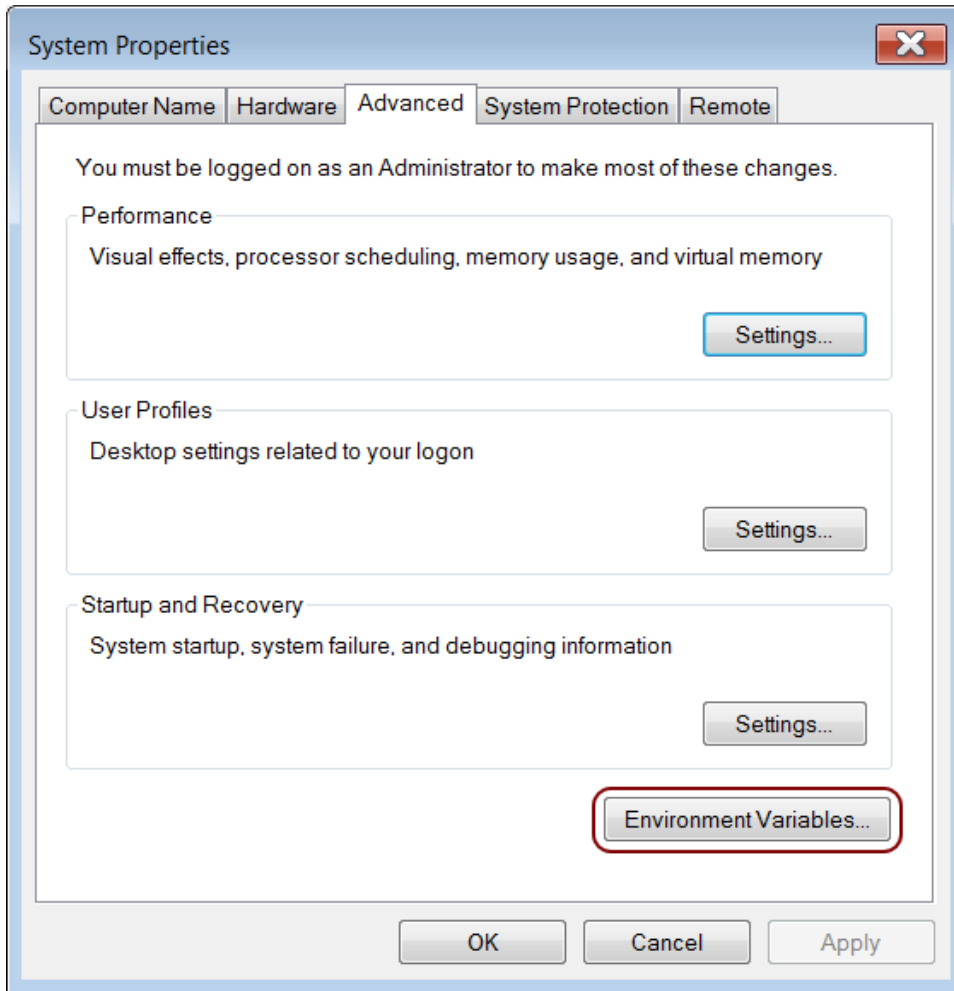


5. In the **Environment Variables** dialog, under the **System variables** list, click **New**.

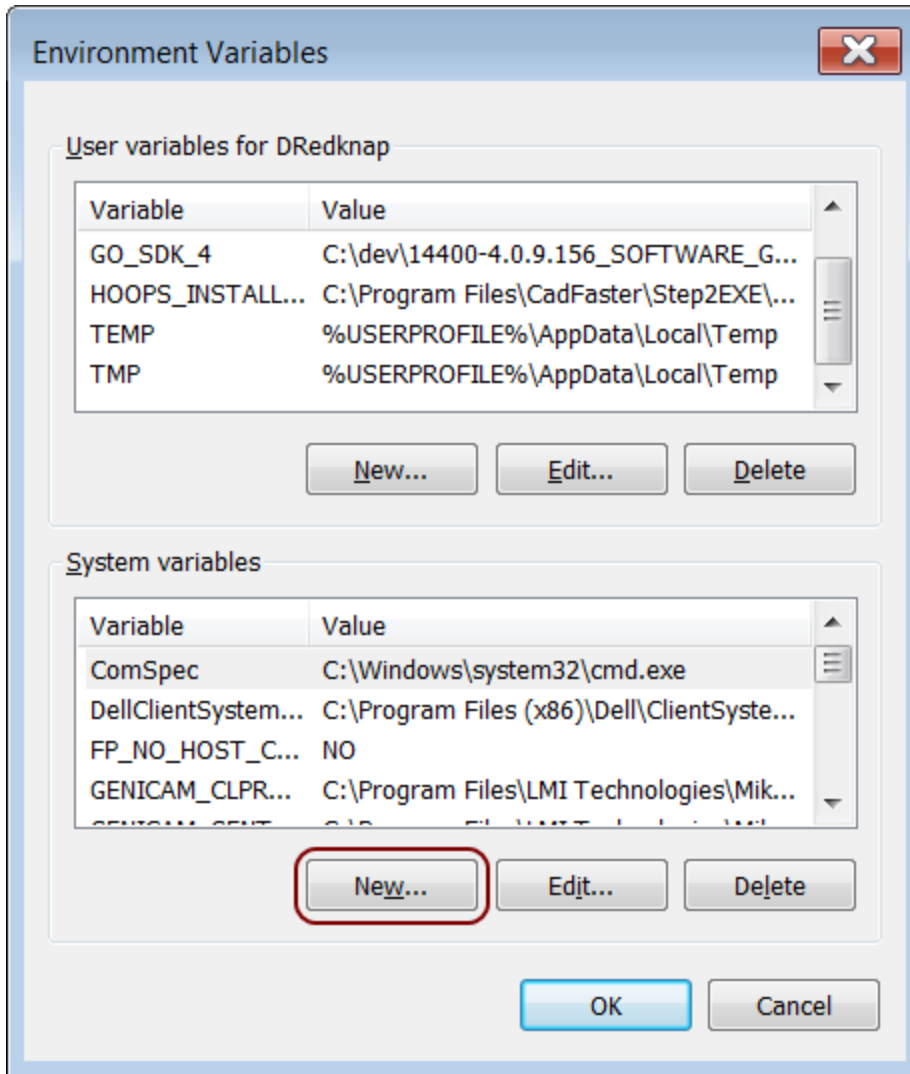

6. In the **New System Variable** dialog, enter the following information, depending on your system:

	Variable name	Variable value
32-bit system	GENICAM_GENTL32_PATH	The full path to the GenTLx86 folder.
64-bit system	GENICAM_GENTL64_PATH	The full path to the GenTLx64 folder.

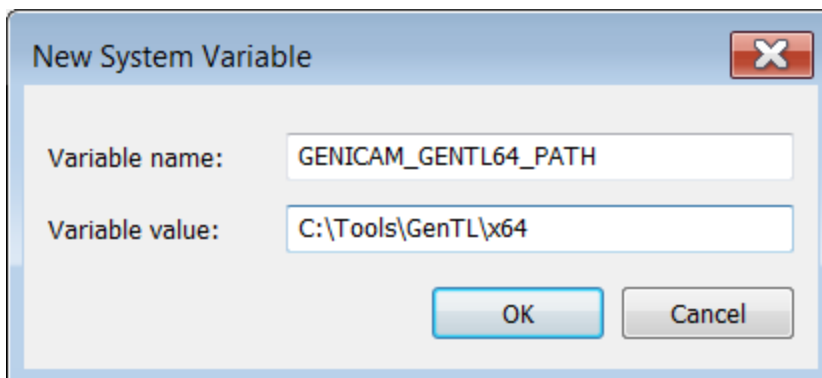

7. Click OK in the dialogs until they are all closed.

To work with the Gocator GenTL driver, the Gocator must operate in Surface or Video mode with its the appropriate output enabled in the **Ethernet** panel in the **Output** page. Check **Acquire Intensity** in the **Scan Mode** panel on the **Scan** page and enable intensity output in the **Ethernet** panel if intensity data is required.

The GenTL driver packs the part output, intensity, and stamps (e.g., time stamp, encoder index, etc.) into either a 16-bit RGB image or a 16-bit grey scale image. You can select the format in the Go2GenTL.xml setting file.

The width and height of the 16-bit RGB or grey scale image is calculated from the maximum number of columns and rows needed to accommodate the sensor's field of view and the maximum part length.

16-bit RGB Image

When the 16-bit RGB format is used, the height map, intensity, and stamps are stored in the red, green, and blue channel respectively.

Channel	Details
Red	Height map information. The width and height of the image represent the dimensions in the X and Y axis. Together with the pixel value, each red pixel presents a 3D point in the real-world coordinates. The following formula can be used to calculate the real-world coordinates (X, Y, Z) from pixel coordinates (Px, Py, Pz): $X = X \text{ offset} + Px * X \text{ resolution}$ $Y = Y \text{ offset} + Py * Y \text{ resolution}$ $Z = Z \text{ offset} + Pz * Z \text{ resolution}$ Refer to the blue channel on how to retrieve the offset and resolution values. If Pz is 0 if the data is invalid. The Z offset is fixed to $-32768 * Z \text{ resolution}$. Z is zero if Pz is 32768.
Green	Intensity information. Same as the red channel, the width and height of the image represent the dimension in the X and the Y axis. Together with the pixel value, each blue pixel represents an intensity value in the real-world coordinates. The following formula can be used to calculate the real-world coordinates (X, Y, Z) from pixel coordinates (Px, Py, Pz): $X = X \text{ offset} + Px * X \text{ resolution}$ $Y = Y \text{ offset} + Py * Y \text{ resolution}$ $Z = 16\text{-bit intensity value}$ The intensity value is 0 if the intensity image is not available. Gocator outputs 8-bit intensity values. The values stored in the 16-bit RGB image is multiplied by 256. To obtain the original values, divide the intensity values by 256. Refer to the blue channel on how to retrieve the offset and resolution values.
Blue	Stamp information. Stamps are 64-bit auxiliary information related to the height map and intensity content. The next table explains how the stamps are packed into the blue

Channel	Details
	pixel channel
	See <i>Data Results</i> on page 504 for an explanation of the stamp information.

The following table shows how the stamp information is packed into the blue channel. A stamp is a 64-bit value packed into four consecutive 16-bit blue pixels, with the first byte position storing the most significant byte.

Stamp Information from GenTL driver

Stamp Index	Blue Pixel Position	Details
0	0..3	Version
1	4..7	Frame Count
2	8..11	Timestamp (µs)
3	12..15	Encoder value (ticks)
4	16..19	Encoder index (ticks) This is the encoder value when the last index is triggered
5	20..23	Digital input states
6	24..27	X offset (nm)
7	28..31	X resolution(nm)
8	32..35	Y offset (nm)
9	36..39	Y resolution (nm)
10	40..43	Z offset (nm)
11	44..47	Z resolution (nm)
12	48..51	Height map Width (in pixels)
13	52..55	Height map length (in pixels)
14	56..59	Specify if the intensity is enabled

16-bit Grey Scale Image

When the 16-bit grey scale format is used, the height map, intensity, and stamps are stored sequentially in the grey scale image.

The last row of the image contains the stamp information.

Rows	Details
0 .. (max part height - 1)	Height map information. The width and height of the image represent the dimensions in the X and Y axis. Together with the pixel value, each pixel presents a 3D point in the real-world coordinates. The following formula can be used to calculate the real-world coordinates (X, Y, Z) from pixel coordinates (Px, Py, Pz): $X = X \text{ offset} + Px * X \text{ resolution}$

Rows	Details
	$Y = Y \text{ offset} + P_y * Y \text{ resolution}$ $Z = Z \text{ offset} + P_z * Z \text{ resolution}$ Refer to the blue channel on how to retrieve the offset and resolution values. If P_z is 0 if the data is invalid. The Z offset is fixed to $-32768 * Z \text{ Resolution}$. Z is zero if P_z is 32768.
(max part height) .. 2* (max part height) If intensity is enabled	Intensity information. The width and height of the image represent the dimension in the X and the Y axis. Together with the pixel value, each blue pixel represents an intensity value in the real-world coordinates. The following formula can be used to calculate the real-world coordinates (X, Y, Z) from pixel coordinates (Px, Py, Pz): The following formula assumes Py is relative to the first row of the intensity information, not the first row of the whole 16-bit grey scale image. $X = X \text{ offset} + P_x * X \text{ resolution}$ $Y = Y \text{ offset} + P_y * Y \text{ resolution}$ $Z = 16\text{-bit intensity value}$ This intensity value is 0 if the intensity image is not available. Gocator outputs 8-bit intensity values. The values stored in the 16-bit Grey scale image is multiplied by 256. To obtain the original values, divide the intensity values by 256. Refer to the stamps on how to retrieve the offset and resolution values.
The last row of the 16-bit grey scale image	Stamp information. Stamps are 64-bit auxiliary information related to the height map and intensity content. The next table explains how the stamps are packed into the blue pixel channel See <i>Data Results</i> on page 504 for an explanation of the stamp information.

The following table shows how the stamp information is packed into the last row. A stamp is a 64-bit value packed into four consecutive 16-bit pixels, with the first byte position storing the most significant byte.

Stamp Information from GenTL driver

Stamp Index	Column Position	Details
0	0..3	Version
1	4..7	Frame Count
2	8..11	Timestamp (μ s)
3	12..15	Encoder value (ticks)
4	16..19	Encoder index (ticks) This is the encoder value when the last index is triggered
5	20..23	Digital input states
6	24..27	X offset (nm)
7	28..31	X resolution(nm)
8	32..35	Y offset (nm)

Stamp Index	Column Position	Details
9	36..39	Y resolution (nm)
10	40..43	Z offset (nm)
11	44..47	Z resolution (nm)
12	48..51	Height map Width (in pixels)
13	52..55	Height map length (in pixels)
14	56..59	Specify if intensity is enabled or not

Registers

GenTL registers are multiples of 32 bits. The registers are used to control the operation of the GenTL driver, send commands to the sensors, or to report the current sensor information.

Register Map Overview

Register Address	Name	Read/Write	Length (bytes)	Description
260	WidthReg	RO	4	Specify the width of the returned images. The part height map is truncated if it is wider than the specified width.
264	HeightReg	RO	4	Specify the height of the returned images (i.e., length of the part). The part height map is truncated if it is longer than the specified length.
292	ResampleMode	RO	4	Enable the resampling logic in the GenTL driver 0 – Disable resampling 1 – Enable resampling When resampling is enabled, the GenTL driver will resample the height map so that the pixel spacing is the same in the X and Y axis.
296	EncoderValue0	RO	4	Report the current encoder value (least significant 32-bit). The current encoder value is latched from the sensor when this register is read.
300	EncoderValue1	RO	4	Report the current encoder value (most significant 32-bit). The encoder value is latched when EncoderValue0 register is read. User should read EncoderValue0 before reading EncoderValue1.
304	Configuration File	RW	16	Read the name of sensor live configuration file or switch (write) the sensor configuration file. The configuration name is NULL terminated and includes the extension ".job". Writing to this register causes the sensor to switch to the specified configuration.

Register Address	Name	Read/Write	Length (bytes)	Description
320	Transformation X offset	RO	4	Return the sensor transformation X offset
324	Transformation Z offset	RO	4	Return the sensor transformation Z offset
328	Transformation Angle	RO	4	Return the sensor transformation angle
332	Transformation Orientation	RO	4	Return the sensor transformation orientation
336	Clearance distance	RO	4	Return the sensor clearance distance

XML Settings File

The settings file, Go2GenTL.xml, resides in the same directory as the Gocator GenTL driver. Users can set the resample mode and output format by changing the setting in this file.

Element	Type	Description
ResampleMode	32u	Settings to disable or enable resampling mode: 0 – Disable 1 – Enable When resampling mode is enabled, the GenTL driver will resample the height map so that the pixel spacing is the same in the X and Y axis. The default value is 1.
DataFormat	32u	Settings to choose 16-bit RGB or 16-bit grey scale image output: 0 – 16-bit RGB Image 1 – 16-bit grey scale Image The default value is 0.

Interfacing with Halcon

Halcon is a comprehensive software package for machine vision applications with an integrated development environment. Gocator can use the included GenTL driver to stream 3D point clouds and intensity data into Halcon in real-time.



The Gocator 4.x GenTL driver does not currently support scanning in profile mode.

For information on setting up the GenTL driver, see *GenTL Driver* on page 576.

This section describes how to configure Halcon to acquire data from the Gocator 4.x firmware. You should be familiar with Gocator's Surface mode. Before continuing, make sure Halcon is installed.

Requirements

Firmware	Firmware 4.0.9.136 or later
Halcon	Version 10.0 or later

Setting Up Halcon


Before using Halcon with Gocator, you must set up Halcon.

To set up Halcon:


1. Connect a Gocator sensor to the PC running Halcon.

You will need a Master hub to connect the sensor to the PC. For more information, see *Installation* on page 24 and *Network Setup* on page 32.

2. Click the **Scan** page icon.

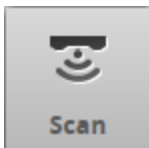

3. On the **Scan** page, click the **Surface** icon to switch to Surface mode.

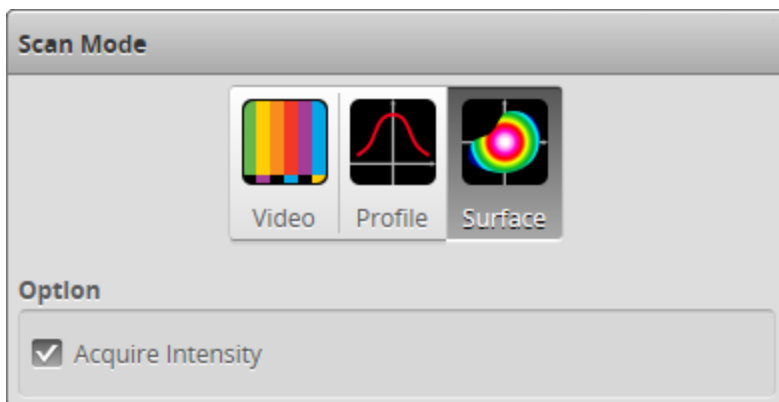

4. (Optional) If you need intensity data, check the **Acquire Intensity** option.


5. Configure the sensor to produce the desired surface data.

For more information on configuring Gocator sensors, see *Scan Setup and Alignment* on page 83 and *Models* on page 120.

6. Click the **Output** page icon.




7. On the **Output** page, enable the required surface under **Data** and choose Gocator in **Protocol**.

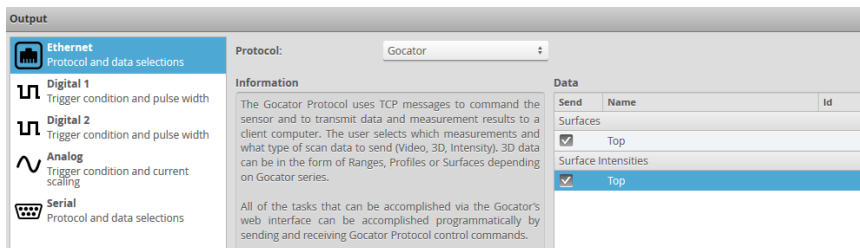


For more information on configuring Ethernet output, see *Ethernet Output* on page 331.

8. Make sure the Gocator is running.
9. On the PC, launch Halcon.
10. In Halcon, in the **Assistants** menu, click **Open New Image Acquisition**.
11. In the dialog that opens, in the **Source** tab, check the **Image Acquisition Interface** option and choose GenICamTL in the drop-down.

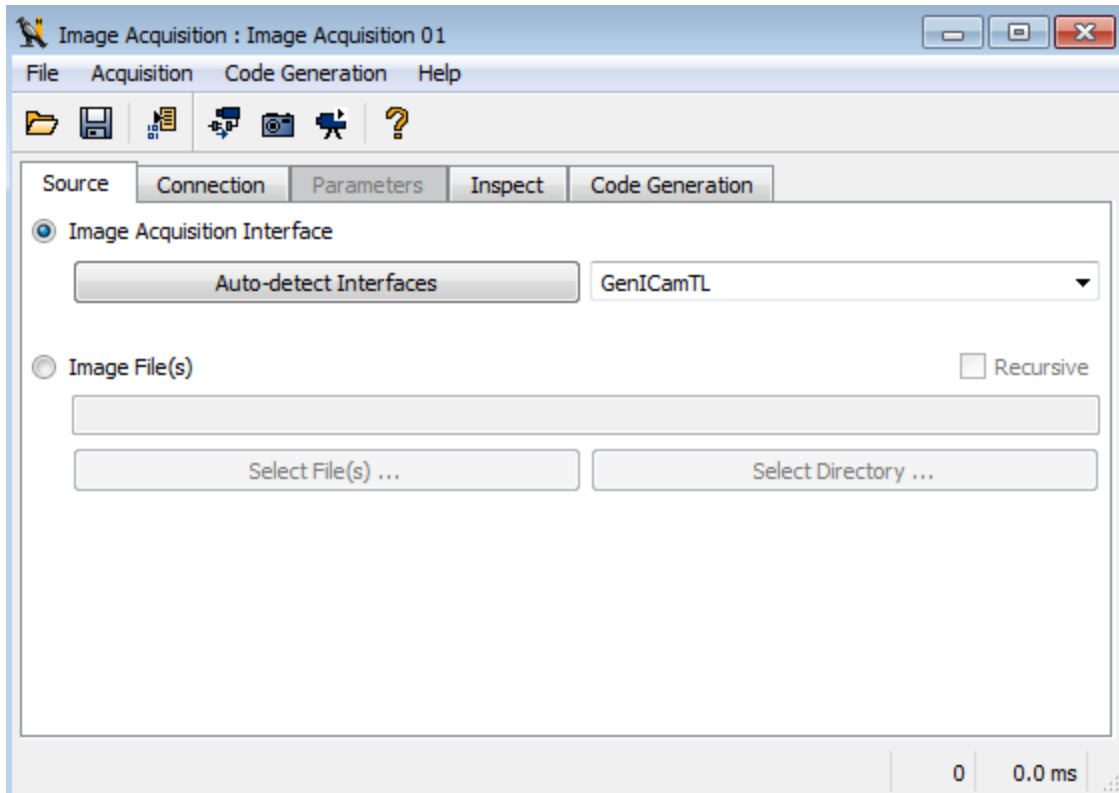

The driver uses the Gocator protocol discovery messages to search for available Gocator sensors. Discovery messages can be blocked by a PC's firewall. You should therefore turn off the firewall and try again if the Gocator sensor can't be detected.


12. Switch to the **Connection** tab.
If Halcon detects a Gocator sensor, the sensor's IP will be listed next to **Device**.

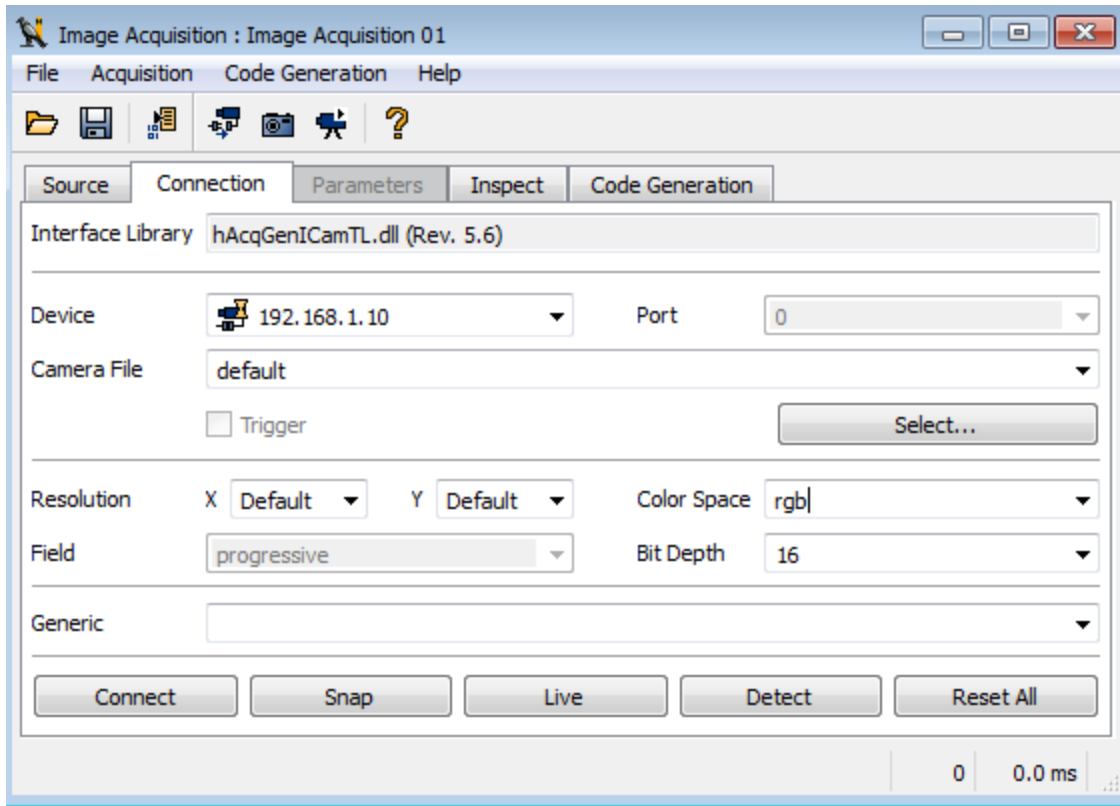

13. In the **Connection** tab, set **Color Space** to **RGB** and **Bit Depth** to 16.
14. In the Gocator web interface, click the Snapshot button to trigger the output of a surface.



The output displays in the Halcon **Graphics Window**.

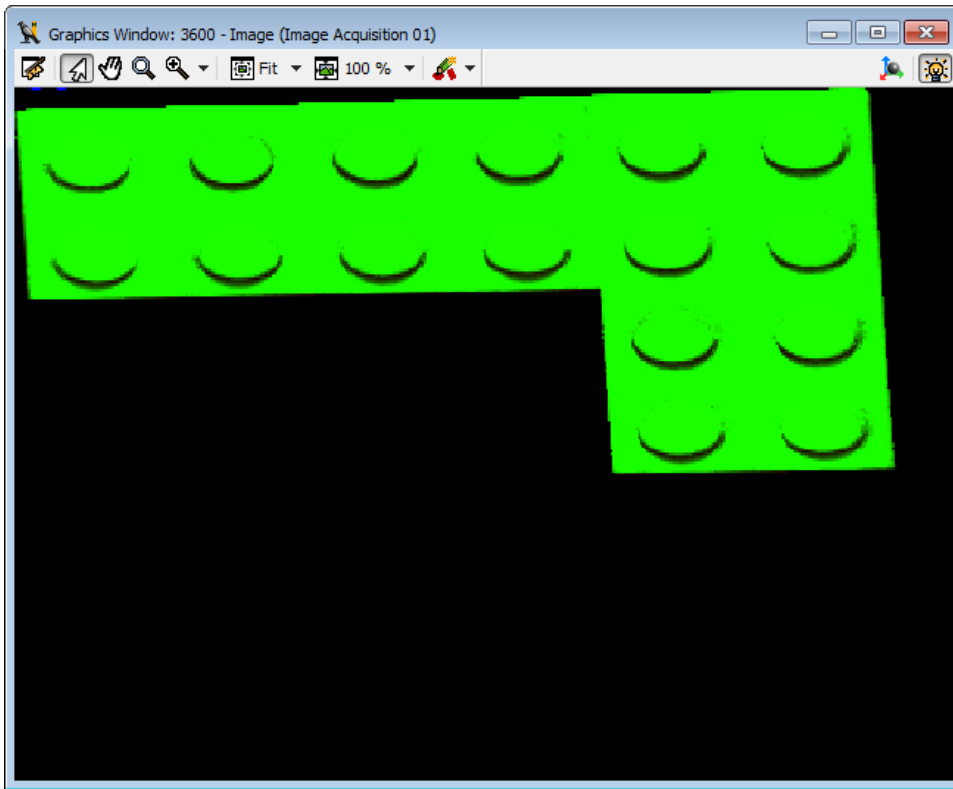

Halcon is now configured for use with Gocator.

Halcon Procedures

The Halcon example code contains internal procedures that you can use to decompose the RGB image and to control registers that the GenTL driver opens.

You can import the procedures into your own code by selecting **File > Insert Program > Insert Procedures** and then choosing the example code `Continuous_Acq.hdev` under the **Examples/Halcon** directory.

 The Go2GenTL.xml file for Gocator 4.x has more fields than the Gocator 3.x version. Make sure you are using the correct version.

The following section describes each of these procedures.

Halcon Procedures

Procedures	Description
Go2GenTL_ ParseData	The GenTL driver packs the height map, intensity and stamp information into a 16-bit RGB image. The function is used to extract data from the RGB image. For details on how the information is packed in the data, see the sections under <i>GenTL Driver</i> on page 576. The function accepts the image acquired from <code>grab_image_async</code>, and returns the height map, intensity and stamps. <i>Parameters (Input)</i> Image: RGB Image acquired by using <code>grab_image_async</code>.

Procedures	Description
	<i>Parameters (Output)</i> HeightMap: The height map image. Intensity: The intensity image. FrameCount: The number of frames. Timestamp: The timestamp. Encoder: The encoder position. EncoderIndex: The last index of the encoder. Inputs: The digital input states. xOffset: The X offset in millimeters. xResolution: The X resolution in millimeters. yOffset: The Y offset in millimeters. yResolution: The Y resolution in millimeters. zOffset: The Z offset in millimeters. zResolution: The Z resolution in millimeters. Width: The width (number of columns) of the image that contains the part. The part width can be less than the image width requested by the user. Height: The height or length (number of rows) of the image that contains the part. The part length can be less than the image height requested by the user. HasIntensity: Specifies if the intensity image is available. The intensity image is available if Acquire Intensity is enabled in the Gocator web interface. Each output is returned as decimal value. <i>Example</i> <pre>Go2GenTL_ParseData(Image, HeightMap, Intensity, frameCount, timestamp, encoderPosition, encoderIndex, inputs, xOffset, xResolution, yOffset, yResolution, zOffset, zResolution, width, height, hasIntensity)</pre>
Go2GenTL_ResampleMode	Returns the resample mode. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. <i>Parameters (Output)</i> ResampleMode: No - Resample is disabled. Yes - Resample is enabled. When resampling is enabled, the GenTL driver resamples the height map so that the pixel spacing is the same on the X and Y axis. <i>Example</i> <pre>Go2GenTL_ResampleMode (AcqHandle, ResampleMode)</pre>  To set the resample mode, you must directly modify Go2GenTL.xml, which is in the same directory as the Gocator GenTL driver (Go2GenTL.cti).
Go2GenTL_ConfigFileName	Returns the current live sensor job file name. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber.

Procedures	Description
	<i>Parameters (Output)</i> ConfigFile: The name of the job file. The file name includes the extension .job. <i>Example</i> <pre>Go2GenTL_ConfigFileName (AcqHandle, ConfigFile)</pre>
Go2GenTL_SetConfigFileName	Sets the sensor live configuration. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. ConfigFile: The name of the job file. The file name should include the extension .job. <i>Example</i> <pre>Go2GenTL_SetConfigFileName (AcqHandle, 'test2.cfg')</pre>
Go2GenTL_Encoder	Returns the current encoder value. When this function is called, the GenTL driver retrieves the latest encoder value from the sensor. The value is returned as a two-element tuple. The first element is the least significant 32-bit value, and the second element is the most significant 32-bit value. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. <i>Parameters (Output)</i> EncoderValue: The current encoder value. <i>Example</i> <pre>Go2GenTL_Encoder (AcqHandle, EncoderValue)</pre>
Go2GenTL_ImageSize	Returns the size of the image returned by the GenTL driver. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. <i>Parameters (Output)</i> Width: The width of the image. Height: The height of the image. <i>Example</i> <pre>Go2GenTL_ImageSize (AcqHandle, Width, Height)</pre>  To set the image size, you must directly modify Go2GenTL.xml, which is in the same directory as the Gocator GenTL driver (Go2GenTL.cti).
Go2GenTL_CoordinateXYZ	Returns the real-world coordinates (X, Y, Z) of the part given the row and column position in the height map. The values of the offset and resolution input parameters can be retrieved using Go2GenTL_ParseData. <i>Parameters (Input)</i> HeightMap: The height map image. Row: The row in the height map. Column: The column in the height map. xOffset: The X offset in millimeters.

Procedures	Description
	xResolution: The X resolution in millimeters. yOffset: The Y offset in millimeters. yResoluion: The Y resolution in millimeters. zOffset: The Z offset in millimeters. zResolution: The Z resolution in millimeters. <i>Parameters (Output)</i> coordinateXYZ: The real-world coordinates.
Go2GenTL_ Exposure	Returns the current exposure. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. <i>Parameters (Output)</i> Exposure: The current exposure value (in μs). The value is returned as an integer. Decimals are truncated. <i>Example</i> <pre>Go2GenTL_Exposure(AcqHandle, exposure)</pre>
Go2GenTL_ SetExposure	Sets the current exposure. <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. Exposure: The current exposure value (in μs), as an integer. <i>Example</i> <pre>Go2GenTL_SetExposure(AcqHandle, exposure)</pre>
set_ framegrabber_ param	Generic Halcon function to set parameters on the scanner. Can be used to set scanner specific settings. For a complete list of settings that can be changed, see the SDK interface files. In the generic form: <pre>set_framegrabber_param(AcqHandle, 'Name', 'Value')</pre> <i>Parameters (Input)</i> AcqHandle: Acquisition handle created by open_framegrabber. Name: The name of the parameter to set on the scanner. Value: The parameter value to set on the scanner. <i>Examples</i> To set the format of the image buffer to 16-bit packed: <pre>set_framegrabber_param(AcqHandle, 'PixelFormat', 'RGB16Packed')</pre> To set the Scan mode to HDR (1 = no HDR, 2 = HDR, 3 = Super HDR): <pre>set_framegrabber_param(AcqHandle, 'Dynamic', '2')</pre> To set the brightness to '3': <pre>set_framegrabber_param(AcqHandle, 'Exposure', '3')</pre> To schedule a system to start in 1000000 ticks or microseconds (depends on current domain unit):


Procedures	Description
	<pre> set_framegrabber_param(AcqHandle, 'XMLSetting', 'GenTL/System') set_framegrabber_param(AcqHandle, 'XMLSetting', 'ScheduledStart=1') set_framegrabber_param(AcqHandle, 'XMLSetting', '000000') set_framegrabber_param(AcqHandle, 'XMLSetting', '') </pre> To schedule a <i>sensor</i> to start after a delay (ticks or microseconds), pass GenTL/Sensor in the first call to <code>set_framegrabber_param</code>, followed by the remaining calls to the function as described in the previous example: <pre> set_framegrabber_param(AcqHandle, 'XMLSetting', 'GenTL/Sensor') </pre> To clear data buffers:: <pre> set_framegrabber_param(AcqHandle, 'XmlCommand', 'GenTL/ClearData\n') </pre>

Generating Halcon Acquisition Code

Halcon lets you insert acquisition code into your code in the IDE.

To generate acquisition code:

1. In Halcon, in the **Assistants** menu, click **Open New Image Acquisition**.
2. In the dialog that opens, in the **Code Generation** tab, set **Acquisition Mode** to **Asynchronous Acquisition**.

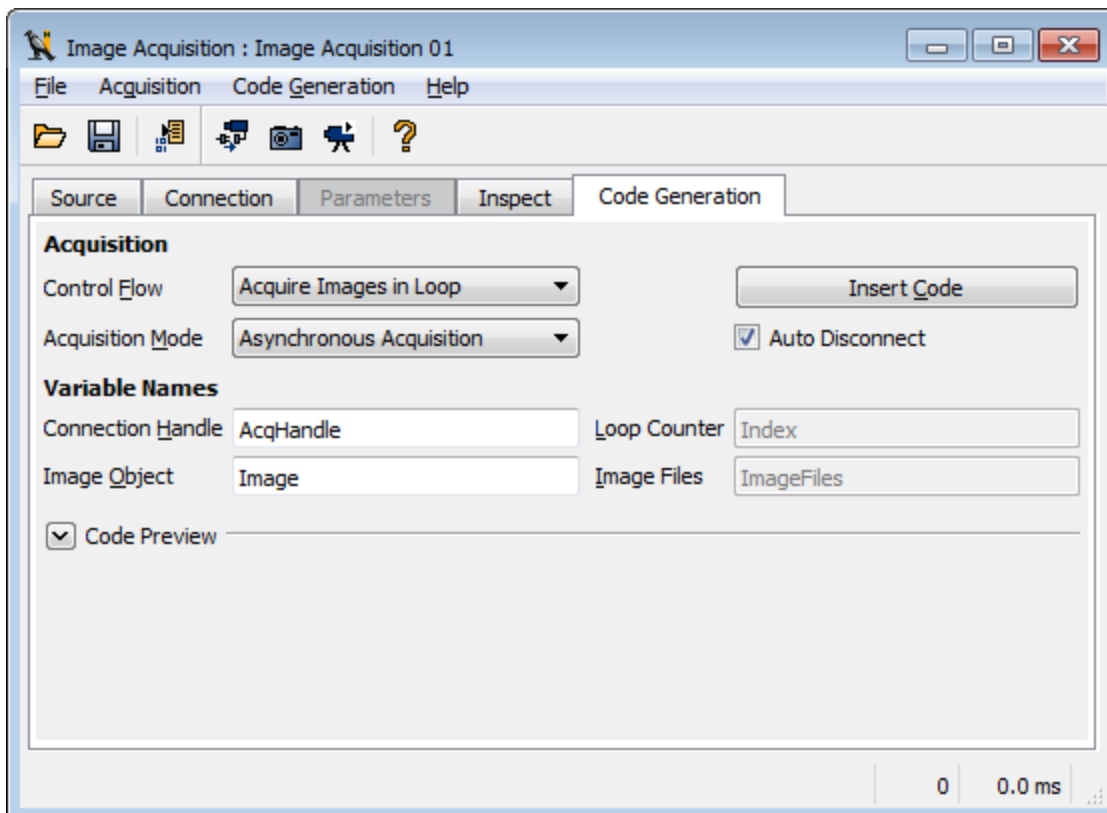

3. Under **Acquisition**, click **Insert Code** to generate the code that will open the acquisition device.

To handle cases when the `grab_image` function times out while waiting for data, add a try-catch statement around the `grab_image` function code.

After the example code is generated, you should add a `catch` instruction to bypass the acquisition timeout event, and use the [Go2GenTL_ParseData](#) function to extract information from the returned image.

An example, `Continuous_Acq.hdev`, is included in the `Examples/Halcon` directory and is shown below:

```
* This example illustrates how to do the following:
* 1. Acquire data from the Gocator (16-bit RGB or gray image)
* 2. Decompose the returned image into three separate image for height map, intensity and
stamps.
* 3. Extract some stamp values from the stamp image.
* Connect to the Gocator device. This code is auto generated by the Image Acquisition
dialog box. User can manually override the directory path by editing the line below.
* Set image type to 'rgb' if the format is 16-bit RGB. 'gray' if the format is 16-bit
mono
open_framegrabber ('GenICamTL', 0, 0, 0, 0, 0, 0, 'progressive', 16, 'rgb', -1, 'false',
'default', '192.168.1.10', 0, -1, AcqHandle)
grab_image_start (AcqHandle, -1)
while (true)
    try
        grab_image_async (Image, AcqHandle, -1)
    catch(Exception)
        continue
    endtry

    Go2GenTL_ParseData (Image, HeightMap, Intensity, frameCount, timestamp, encoderPosition,
encoderIndex, inputs, xOffset, xResolution, yOffset, yResolution, zOffset, zResolution,
width, height, hasIntensity)

    * Image Processing Routines Start ****


    * Add your own routines here!

    * Image Processing Routines End ****
endwhile
close_framegrabber (AcqHandle)
```

CSV Converter Tool

The CSV Converter tool lets you convert data exported from Gocator in the CSV format to several formats (see table below). For more information on exporting recorded data, see *Downloading, Uploading, and Exporting Replay Data* on page 65.

For information on the CSV file format that Gocator exports, see the next section.

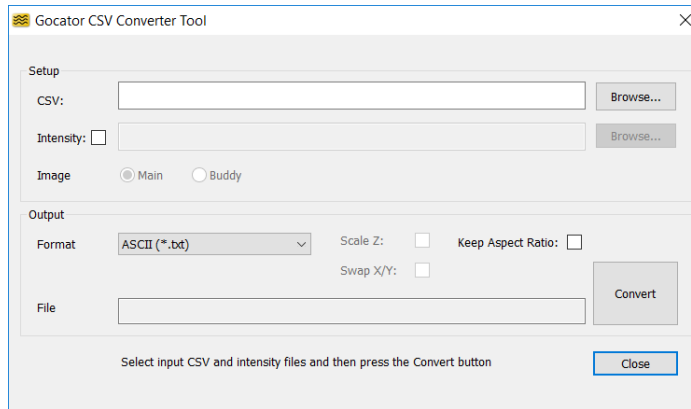

The tool supports data exported from Profile or Surface mode.

To get the tool package (14405-x.x.x.x_SOFTWARE_GO_Tools.zip), go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download it from the Download Center.

After downloading the tool package, unzip the file and run the Gocator CSV Converter tool [CsvConverter>kCsvConverter.exe].

The tool supports the following output formats:

Output formats

Format	Description
ASCII (XYZI)	Comma-separated points in X, Y, Z, Intensity (if available) format.
16-bit BMP	Heightmap with 16bit height values in a 5-5-5 RGB image. Not intended for visualization.
16-bit TIFF	Heightmap as grayscale image.
16-bit PNG	Heightmap as grayscale image.
GenTL RGB	For more information, see <i>16-bit RGB Image</i> on page 580
GenTL Mono	For more information, see <i>16-bit Grey Scale Image</i> on page 581.
Raw CSV	LMI Gocator CSV format for a single frame.
HexSight HIG	LMI HexSight heightmap.
STL ASCII	Mesh in standard STL text format (can become very large).
STL Binary	Mesh in binary STL format.
Wavefront OBJ	Mesh with comma-separated vertices and facets in text format.
ODSCAD OMC	GFM ODSCAD heightmap.
MountainsMap SUR	DigitalSurf MountainsMap heightmap.
24-bit Spectrum	Color spectrum bitmap for visualization of heightmap. Does not contain height values.

With some formats, one or more of the following options are available:

Output options

Option	Description
Scale Z	Resamples the Z values to use the full value range.
Swap X/Y	Swaps the X and Y axes to obtain a right-handed coordinate system.
Keep Aspect Ratio	Resamples the X and Y axes to obtain the proper aspect ratio.

 The GenTL format is a 48-bit RGB or grey scale PNG. Height map, intensity and stamp information are stored as defined in the GenTL Driver section (*GenTL Driver* on page 576). You can load the exported data into image processing software to provide simulation data for developing applications using the GenTL driver.

To convert exported CSV into different formats:

1. Select the CSV file to convert in the **CSV** field.
2. (Optional) If intensity information is required, check the **Intensity** box and select the intensity bitmap. Intensity information is only used when converting to ASCII or GenTL format. If intensity is not selected, the ASCII format will only contain the point coordinates (XYZ).
3. If a dual-sensor system was used, choose the source sensor next to **Image**.
4. Select the output format.
For more information on output formats, see *Output formats* on the previous page.
5. (Optional) Set the **Scale Z**, **Swap X/Y**, and **Keep Aspect Ratio** options.
Availability of these options depends on the output format you have chosen. For more information, see *Output options* above.
6. Click **Convert**.
The converter converts the input files.
The converted file will be in the same directory as the input file. It will also have the same name as the input file but with a different file extension. The converted file name is displayed in the **Output File** field.

CSV File Format

The CSV Converter tool can convert from the CSV format that Gocator can export to several other formats. If you want to work with the exported file directly, use the following information.

An exported CSV file contains a series of "sections." Each section begins with a row containing the name of the section, and ends with a row containing the string "End." An empty line separates each section.

Each section usually contains one or more subsections. Each subsection has a header row containing a list of field names, followed by one or more rows of data. There is usually no empty line between the subsections.

Other structures within sections are possible.

Example:

```
Info
CSV Version,Sensor Count,Trigger Mode,...
2,1,0,32000.00000,...
End
```

```
DeviceInfo
ID,Model,Version,...
13434,311320-2M-01,4.8.2.29,...
End
```

Ranges

...

End

Usually all available data in the recording buffer is exported. The exceptions are Surface and SurfacePointCloud. For these sections, only the currently selected frame is exported.

Info

This section contains basic system information. It has one header row and one value row. The fields are described below:

Info Fields

Field	Description
CSV Version	Version of the CSV file format.
Sensor Count	Number of sensors in the system.
Trigger Mode	Trigger source: 0 – Time 1 – Encoder 2 – Digital input 3 – Software
Trigger Rate	Frame rate for time trigger (Hz).
Trigger Delay Domain	Output delay domain: 0 – Time (µs) 1 – Encoder (mm)
Trigger Delay	Output delay (µs or mm, depending on delay domain defined above).
Operation Mode	The scan mode.
XResolution	System X resolution (mm).
YResolution	System Y resolution (mm).
ZResolution	System Z resolution (mm).
Yspeed	Y Speed (mm/s).
Layout	Sensor orientation:

Field	Description
	0 – Normal (single-sensor system) / Wide (dual-sensor system)
	1 – Opposite
	2 – Reverse
	3 – Grid

DeviceInfo

This section contains information about each device in the system. There is one header row, and one value row per device.

DeviceInfo Fields

Field	Description
ID	Device serial number
Model	Device part number
Version	Firmware version
Exposure Mode	Exposure mode: 0 – Single exposure 1 – Multiple exposures 2 – Dynamic exposure
Exposure 0 through Exposure 4	Multiple exposures
Exposure Min	Dynamic exposure min
Exposure Max	Dynamic exposure max
FOV X	Active area X
FOV Y	Active area Y
FOV Z	Active area Z
FOV Width	Active area width
FOV Height	Active area length (Y). (Note difference in terminology.)
FOV Depth	Active area height (Z). (Note difference in terminology.)
Transform X	Transform X offset (mm)
Transform Y	Transform Y offset (mm)
Transform Z	Transform Z offset (mm)
Transform X Angle	Transform X Angle (degrees)
Transform Y Angle	Transform Y angle (degrees)
Transform Z Angle	Transform Z angle (degrees)

RecordingFilter

This section lists the filters used during recording. Unlike the other sections, it contains multiple subsections within, separated by spaces (but not the “End” keyword).

Example:

```

RecordingFilter
Section1 Param 1, Section1 Param2
value, value
Section2 Param 1
value
Section3 Param1, Section3 Param2
value
End

```

Each section will be described by a separate table below. They appear in the same order as documented.

RecordingFilter Fields

Field	Description
Condition Combination Type	Any or All

"Any Measurement" Filter Fields

Field	Description
Type	Any Measurement
Enabled	Whether or not is enabled. Yes/No
Result	Accepted result type: Pass/Fail/Invalid/Valid

"Any Data" Filter Fields

Field	Description
Type	Any Data
Enabled	Whether or not is enabled: Yes/No
Threshold Case	How to threshold: At or Above, or Below
Range Count Threshold	Threshold value (point count)

"Measurement" Filter Fields

Field	Description
Type	Measurement
Enabled	Whether or not is enabled: Yes/No
Result	Accepted result type: Pass/Fail/Invalid/Valid
Selection ID	First measurement ID

Ranges

This section describes single-point range data. It has two sub-sections: attributes and data.

The attribute section has only one row of data

Attribute Section Fields

Field	Description
Frame Count	Total number of frames
X Offset	X offset (mm)
Y Offset	Y offset (mm)
Z Offset	Z offset (mm)

The data section has one or more rows of data per frame (for example, range and intensity).

Data Section Fields

Field	Description
Frame	Frame index
Source	Source (for example, 0 for Top)
Time	Stamp time
Encoder	Stamp encoder
Z Encoder	Stamp encoder Z
Inputs	Stamp inputs
Exposure	Stamp exposure (us)
Y	Y value (mm)
Axis	Axis: Z (range) or I (Intensity)
Value	Range value (mm) or intensity (count)

Profile

This section describes uniform (or resampled) profile data, which is produced when the sensor is in Profile mode and uniform spacing is enabled. It has two sub-sections: attributes and data.

The attribute section has only one row of data.

Attribute Section Fields

Field	Description
Frame Count	Total number of frames
Column Count	Number of columns
X Offset	X offset (mm)
Y Offset	Y offset (mm)
Z Offset	Z offset (mm)

The data section has one or more rows of data per frame (for example, range and intensity).

Data Section Fields

Field	Description
Frame	Frame index
Source	Source (for example, 0 for Top)
Time	Stamp time
Encoder	Stamp encoder
Z Encoder	Stamp encoder Z
Inputs	Stamp inputs
Exposure	Stamp exposure (μs)
Y	Y value (mm)
Axis	Axis: Z (range) or I (Intensity)

Field	Description
(x values)	Each column in header is a resampled X position Each column in data is the range (mm) or intensity (count)

RawProfile

This section describes point cloud profile data (or unresampled / raw data), which is produced when the sensor is in Profile mode and uniform spacing is disabled. It has two sub-sections: attributes and data.

The attribute section has only one row of data.

Attribute Section Fields

Field	Description
Frame Count	Total number of frames
Column Count	Number of columns
X Offset	X offset (mm)
Y Offset	Y offset (mm)
Z Offset	Z offset (mm)

The data section has one or more rows of data per frame (for example, range and intensity).

Data Section Fields

Field	Description
Frame	Frame index
Source	Source (for example, 0 for Top)
Time	Stamp time
Encoder	Stamp encoder
Z Encoder	Stamp encoder Z
Inputs	Stamp inputs
Exposure	Stamp exposure (µs)
Y	Y value (mm)
Axis	Axis: X, Z, or I (Intensity)
(x values)	Each column in header is an index. Each column in data is the X/Z value (mm) or intensity (count)

Part

This section describes uniform (or resampled) surface data, which is produced when the sensor is in Surface mode and uniform spacing is enabled.



Only the data for the frame currently selected in the UI is exported when you export part data to a CSV file.

The section has two sub-sections: attributes and data.

The attribute section has only one row of data.

Attribute Section Fields

Field	Description
Frame	Frame index
Source	Source (for example, 0 for Top)
Time	Stamp time
Encoder	Stamp encoder
Z Encoder	Stamp encoder Z
Inputs	Stamp inputs
Row Count	Number of rows
Column Count	Number of columns
X Offset	X offset (mm)
Y Offset	Y offset (mm)
Z Offset	Z offset (mm)

The data section contains the data of a single surface scan. Each data row corresponds to one Y position. The first row contains the X values, and the first column contains the Y values. The region inside contains the range values (mm) for the corresponding row and column.

SurfacePointCloud

This section describes point cloud data (unresampled surface data), which is produced when the sensor is in Surface mode and uniform spacing is disabled. It has two sub-sections: attributes and data.

The attribute section has only one row of data.

Attribute Section Fields

Field	Description
Frame	Total number of frames
Source	Source (for example, 0 for Top)
Time	Stamp time
Encoder	Stamp encoder
Z Encoder	Stamp encoder Z
Inputs	Stamp inputs
Row Count	Number of rows
Column Count	Number of columns
X Offset	X offset (mm)
Y Offset	Y offset (mm)
Z Offset	Z offset (mm)

The data section contains the data of a single surface scan. The first row (header) can be ignored.

The data are (x,y,z) tuples expanded into a flat list of values, for example:

```
p0x, p0y, p0z, p1x, p1y, p1z, ..., pnx, pny, pnz  
p(n+1)x, p(n+1)y, p(n+1)z, ...
```

...

Because the data has multiple rows and columns, it forms a rectangular grid of (x,y,z) tuples. The rows and columns do not correspond exactly to X and Y values, but suggest adjacency. i.e. positions with consecutive row indices or column indices are generally adjacent to each other in (x,y,z) coordinates.

The values are provided in mm, with the resolution and offset already calculated in the values.

Surface Section

This section describes surface section data, which is produced when a section is added to uniform surface data. A surface section is similar to a uniform profile.

The data section contains the following fields.

Data Section Fields

Field	Description
Frame	Frame Index
Source	Source (e.g. 0 for Top)
Time	Stamp time
Encoder	Stamp encoder
Z Encoder	Stamp encoder Z
Inputs	Stamp inputs
Exposure	Exposure
Column Count	Number of columns
Start X	X Start
Start Y	Y Start
End X	X End
End Y	Y End
Pose Angle	Pose Angle
Pose X	Pose X Offset
Pose Y	Pose Y Offset
X Offset	X Offset
Y Offset	Y Offset
Z Offset	Z Offset
XResolution	X Resolution
ZResolution	Y Resolution
Axis	Axis: Z (range) or I (Intensity)
(x values)	Each column in header is a resampled X position Each column in data is the range (mm) or intensity (count)

MountainsMap Transfer Tool

The MountainsMap transfer tool (MMTransfer.exe) lets you trigger scans on a connected sensor. The scan data is then automatically transferred to the MountainsMap component of the transfer tool. You can then work on the scan data within the tool. For more information on the tool, see *Using the Mountains Map Transfer Tool* below.

 MountainsMap must be installed and properly licensed on the PC.

The MountainsMap transfer tool is available in the GO Tools package (14405-x.x.x.x_SOFTWARE_GO_Tools.zip). To get the package, go to <http://lmi3d.com/support>, choose your product from the Product Downloads section, and download it from the Download Center.


Configuring Gocator to Work with the Transfer Tool

In order for scan data to be available for transfer, you must first configure the Gocator sensor.

To configure a sensor:

1. In the Gocator web interface, go to the **Output** tab.
2. In the **Ethernet** category, set **Protocol** to **Gocator**.
3. In the **Data** area of the panel, make sure a source for Surface data is checked under **Surfaces**.

By default, a source for Surface data is already selected.

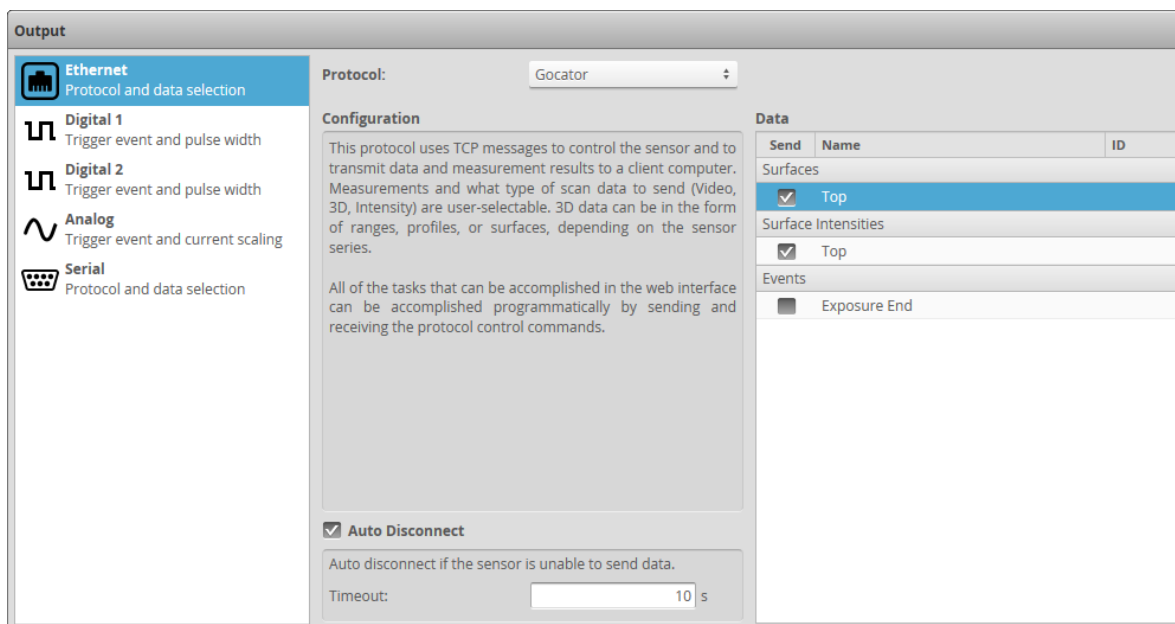


The screenshot shows the 'Output' tab of the Gocator web interface. On the left, the 'Ethernet' category is selected, showing options for 'Digital 1', 'Digital 2', 'Analog', and 'Serial'. The 'Protocol' dropdown is set to 'Gocator'. The 'Configuration' section contains text about TCP messages and a checkbox for 'Auto Disconnect' which is checked, with a timeout of 10 seconds. The 'Data' section on the right shows a table with columns 'Send', 'Name', and 'ID'. Under 'Surfaces', 'Top' is checked. Under 'Surface Intensities', 'Top' is checked. Under 'Events', 'Exposure End' is checked.

Send	Name	ID
☒	Top	
☒	Top	
☒	Exposure End	

4. (Optional) If you want to transfer intensity data, check a source for intensity data under **Surface Intensities**. For intensity to be available, you must also check **Acquire Intensity** on the [Scan page](#).

Using the Mountains Map Transfer Tool

The following graphic and table show the functionalities available in the tool:

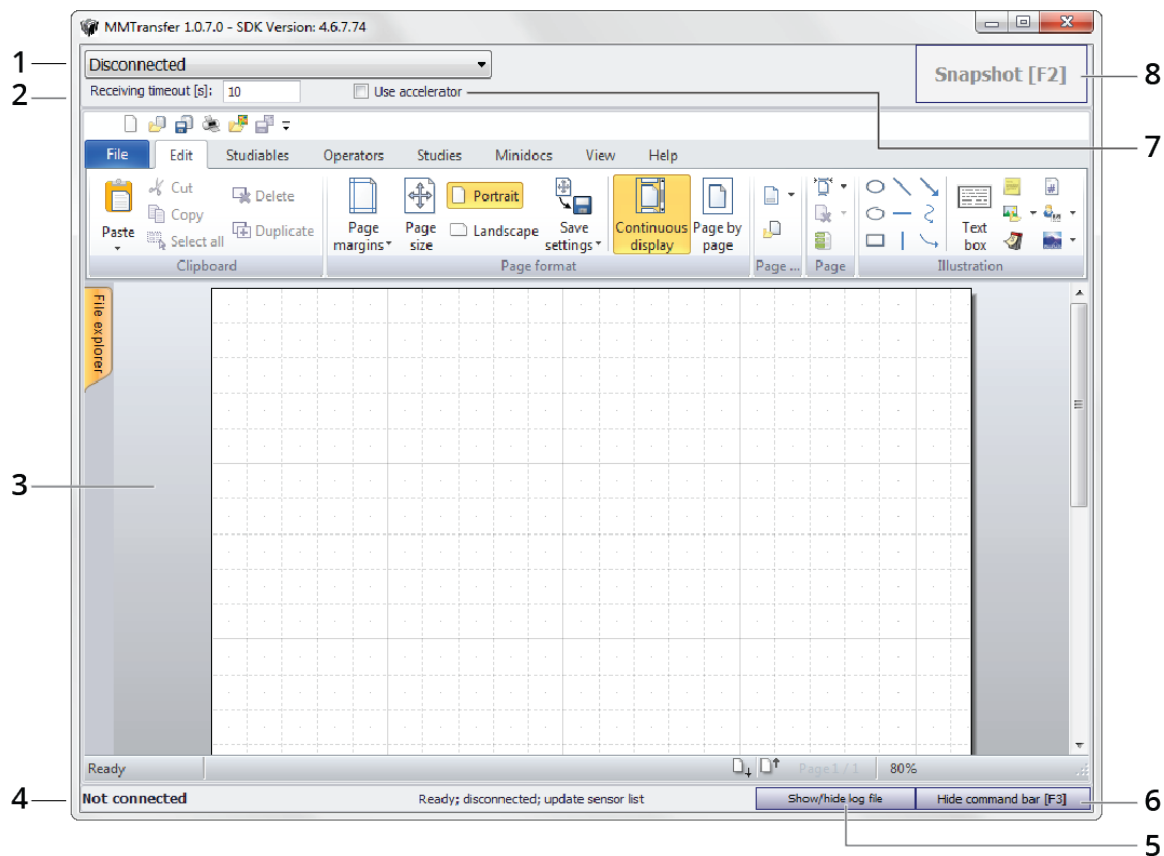


Element	Description
1 Sensor selector	Lets you choose among connected sensors.
2 Receiving timeout	The number of seconds the transfer tool will wait to receive data from the sensor before timing out.
3 MountainsMap component	After the data transfers from the sensor to the tool, you can edit it directly in the transfer tool.
4 Status bar	Indicates whether the tool is connected to a sensor, and so on.
5 Show/hide log file	Toggles display of the log file. Useful for diagnosing connection and scan issues.
6 Hide command bar	Toggles display of the command bar at the top of the tool.
7 Use accelerator	Attempts to accelerate the sensor chosen in the sensor selector drop-down. In order for the tool to accelerate the sensor, the sensor's firmware must match the Gocator SDK version indicated on the tool's title bar. If these versions do not match, the tool will not be able to accelerate the sensor. In this case, you can accelerate the sensor using the standalone accelerator application or an SDK-based application.
8 Snapshot button	Causes the connected sensor to take a snapshot. The data is then transferred to the tool. If the tool does not receive the data before the delay specified in Receiving timeout , the transfer fails.

To use the transfer tool:

1. Make sure the sensor you wish to work with is configured properly.
See *Configuring Gocator to Work with the Transfer Tool* on page 603.
2. (Optional) Modify the timeout or check the **Use accelerator** option.
See the table above for more information.
3. Click the Snapshot button or press F2.
The sensor takes a snapshot, and the scan data transfers to the tool.

Universal Robots Integration

This section describes using the Gocator URCap with a Gocator 3210 sensor mounted on a UR3 Universal Robots robot arm to perform hand-eye calibration. The Gocator URCap is available in the Gocator Tools package (14405-x.x.x.xx_SOFTWARE_GO_Tools.zip), available on LMI's website at <https://downloads.lmi3d.com/?brand=11&product=9241>, under the *Software* category.

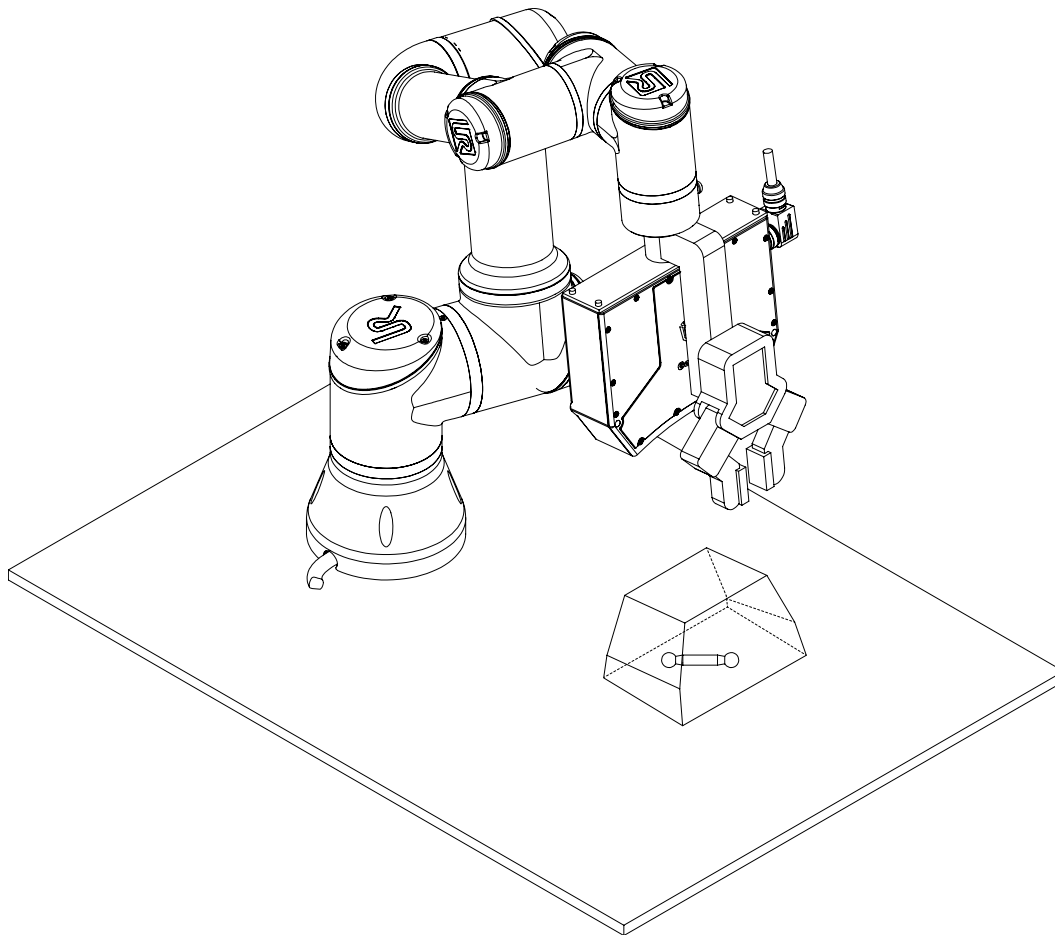

The Gocator URCap is an application that you install on the robot that triggers scans on the sensor and retrieves the information that describes the pose of the calibration target in the sensor's field of view. After a sufficient number of scans, the calibration is saved to the robot, and hand-eye calibration (between the sensor and the robot flange) is complete.

The calibration described in the following sections is performed using a 50 mm ball-bar (not provided). The same method can be used with different snapshot sensor models, different UR robot models, and different size ball-bar artifacts. You must either configure the sensor's built-in measurement tools and a script tool to return the target's pose, or develop an appropriate GDK tool to return the part's pose; for more information on GDK tools, see *GDK* on page 562 and the class reference provided with the GDK itself. For guidelines on what information is required, see *Measurement Tool Settings* on the next page.

Note that this procedure only supports an end-of-arm mounting. That is, the sensor is mounted to the end of the robot arm, rather than being mounted in a fixed position above the target.

Mounting the Sensor

Typically, you will mount the sensor to the robot flange using a metal plate. The design of the plate depends on how you will mount the sensor to the robot, and whether and how you need to mount a manipulator. For the sensor's mounting hole locations and specifications, see *Gocator 3210* on page 625.

At a minimum, you will need to connect the Power & Ethernet cordset to the sensor's Power/LAN connector, connect the Ethernet end of the cordset to a switch, and wire the pigtailed leads to a power source; for pinout and lead information, see *Gocator Power/LAN Connector* on page 635.

If you intend to use the sensor to control an external device such as a PLC based on the sensor's measurement decisions, you will also need to connect an I/O cordset to the sensor's I/O connector and configure I/O. For pinout and lead information, see *Gocator I/O Connector* on page 637. For information on configuring I/O on the sensor, see *Digital Output* on page 335.

Make sure that cordsets:

- do not interfere with robot movement;
- do not block the sensor's view of targets;
- do not interfere with the robot's manipulator;
- do not touch targets.

Connecting to the Sensor

You configure the sensor (measurements and general settings) by connecting to the sensor's web interface from a client PC over an Ethernet connection. By default, the sensor's IP is 192.168.1.10. The client PC Ethernet card you use to connect to the sensor must share the same network ID as the sensor: we typically suggest setting the client PC's Ethernet card to 192.168.1.5. However, you may need to change the sensor and client PC IPs to work with your system. For more information on client PC setup, see *Client Setup* on page 32. For more information on setting the sensor's IP, see *Networking and Power* on page 72.



You can also use the Discovery tool (kDiscovery.exe) to set the sensor's IP without needing to change the client PC's network ID. The tool is available in the tools package (14405-x.x.x.xx_SOFTWARE_GO_Tools.zip) on LMI's website (<https://downloads.lmi3d.com/>), under the *Software* category.

To connect to the sensor:

1. If you have not already done so, apply power to the sensor.

Sensors typically take less than 30 seconds to start

2. From a web browser connected to the switch to which the sensor is connected, type in the IP address of the sensor.
3. If an Administrator password has been set, make sure the Administrator account type is selected in the first drop-down and type the password in the field that appears.

Only Administrator account types can add tools.

4. Click Login to log in to the sensor.


Configuring the Gocator Sensor

To configure the sensor, you must add and then configure measurement tools that return the required information, and then configure other Gocator settings.


Measurement Tool Settings

The Gocator URCap requires 12 values corresponding to the values of a 3x3 rotation matrix and a 3x1 translation vector. Each value is retrieved by the URCap from the sensor via either a measurement tool (such as a Surface Sphere tool) or a script tool that uses values from two or more measurement tools to calculate the other values.

The measurement tools you choose partially depends on your calibration target. For example, to perform hand-eye calibration using a ball-bar target, you would use two Surface Sphere tools (see *Sphere* on page 283), one per ball. You would decide which of the balls is the origin, and the positional (X, Y, and Z) measurements from the Surface Sphere tool positioned over this ball in the Gocator web interface comprise the translation vector.

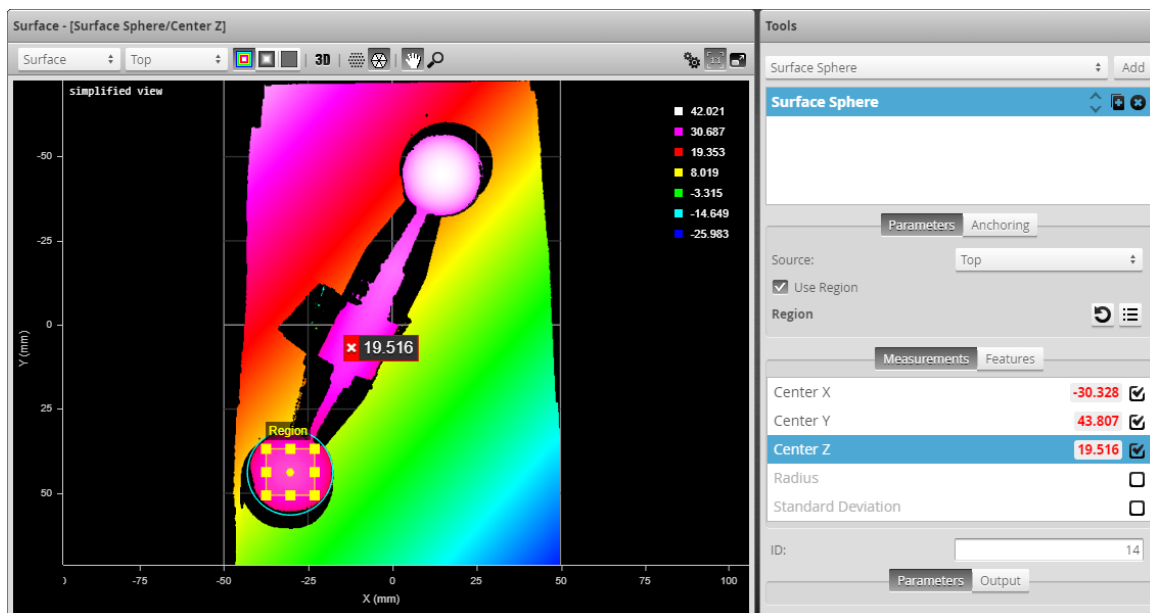

Typically, you use a Surface Plane (see *Plane* on page 272) tool on the surface surrounding the calibration target to retrieve X angle and Y angle information.

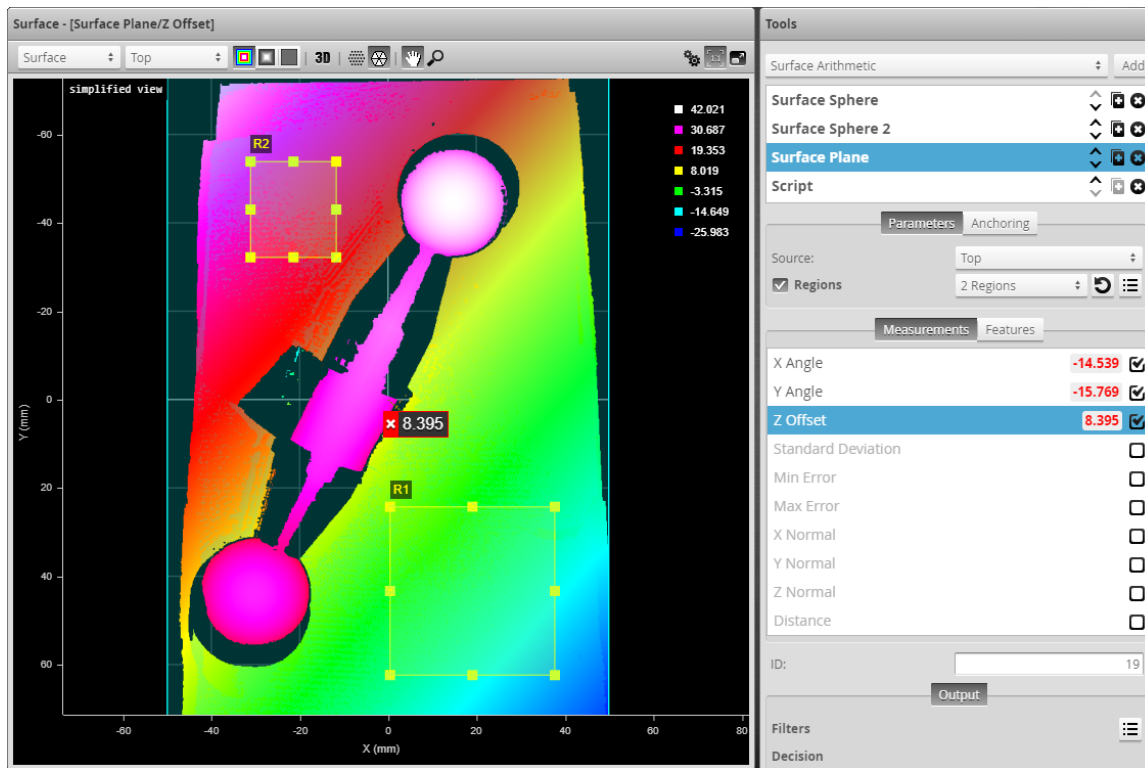

Finally, you would use a script tool to use the positional information of the two Sphere tools and the X angle and Y angle information of the Plane tool to calculate the Z angle rotation and the values of the rotation matrix (X, Y, and Z vectors). Script tools use a C-like language; for more information on script tools, see page 314.

The Gocator URCap expects the measurements to be in a specific order and to use ID numbers 0 to 11. Otherwise, the hand-eye calibration will not be correct.

Information required by the Gocator URCap

Type of Information	ID	Description
Xx	0	
Xy	1	
Xz	2	
Yx	3	
Yy	4	Rotation matrix values (X, Y, and Z vectors) calculated in a script tool using values from other measurement tools.
Yz	5	
Zx	6	
Zy	7	
Zz	8	
XT	9	
YT	10	Translation vector values returned by one of the measurement tools.
ZT	11	


The first time you add a measurement tool in the Gocator interface, its first measurement is automatically enabled, and its ID is set to 0. Each time you enable another measurement or add a new tool (which automatically enables another measurement), the ID is set to the next available number. Because the Gocator URCap expects the measurements in a specific order and with specific IDs, you will have to set the IDs accordingly. For more information, see *Changing a Measurement ID* on page 160.

You should use separate jobs for calibration and for scanning. For more information, see *Creating, Saving and Loading Jobs (Settings)* on page 60. For information on managing jobs, see *Jobs* on page 74


General Sensor Settings

The following settings on the Gocator sensor are required or recommended:

- The Gocator sensor should not be aligned; that is, you should not perform the alignment procedure available in the **Sensor** panel on the **Scan** page. In an unaligned sensor, the origin is in the middle of the sensor's scan volume. Note that if the alignment of the sensor is set or changed at any time, you will have to perform hand-eye calibration again.
- On the **Scan** page, in the **Trigger** panel, set **Source** to **Software**.

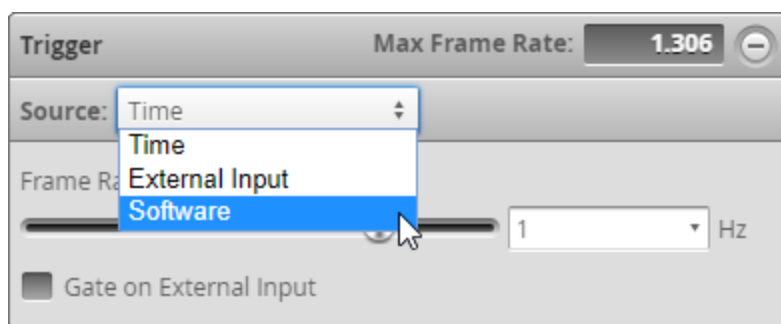

 - On the **Output** page, set **Protocol** to **Gocator** and enable the surface data (normally labeled "Top") as well as all 12 of the required measurements.



Make sure that the measurements are in the correct order and that their IDs are 0 to 11. For more information, see the table entitled *Information required by the Gocator URCap* on the previous page.

- You should use different jobs for calibration and for scanning.


Installing the Gocator URCap on the Robot

To perform the hand-eye calibration between the Gocator sensor and the Universal Robots robot, you must install the Gocator URCap on the robot.


To install the URCap:

1. Unzip the contents of the zip file and copy the URCaps file (a file ending with a .urcap extension) to a USB drive.
2. Insert the USB drive into the USB port on the robot controller.


3. In the Universal Robots interface, click **Setup Robot**.

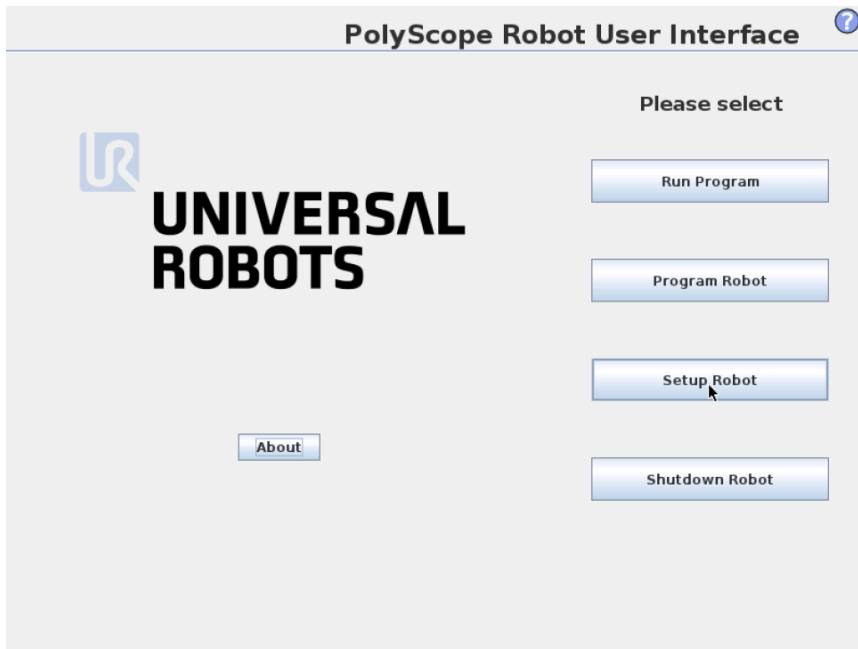


4. In the **Setup Robot** screen, click **URCaps**.

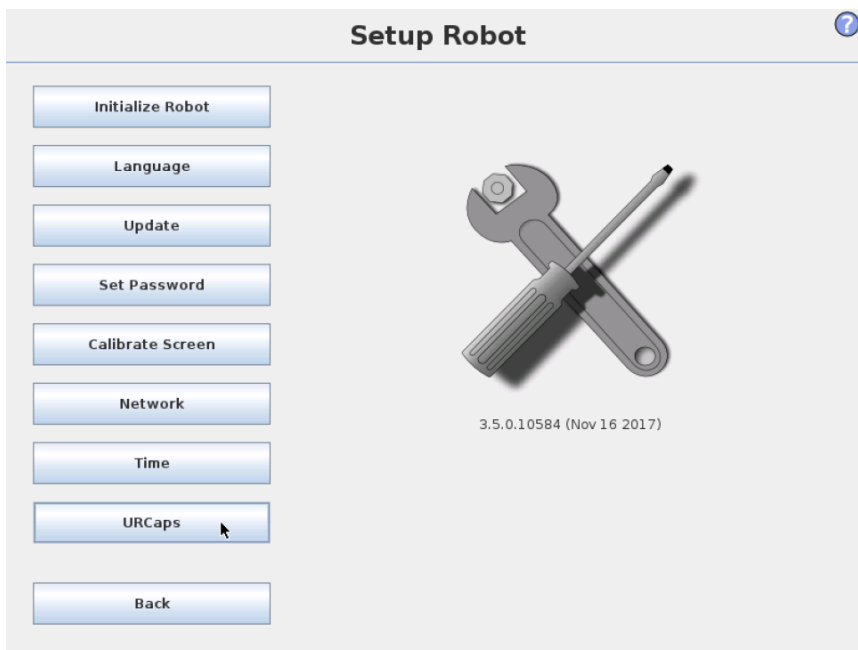


5. Click the Plus button.

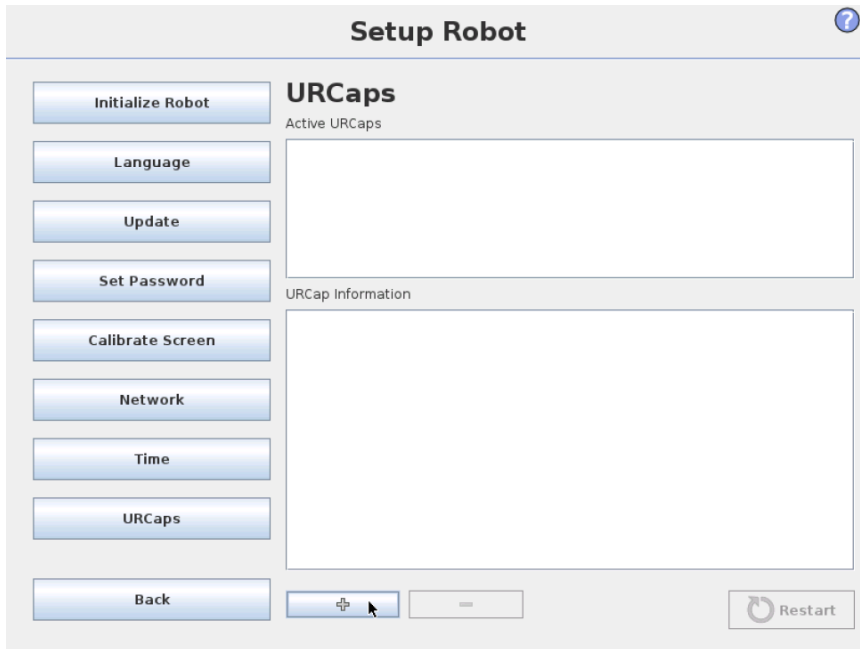


6. In the next screen, double-click the USB drive in the list that appears.

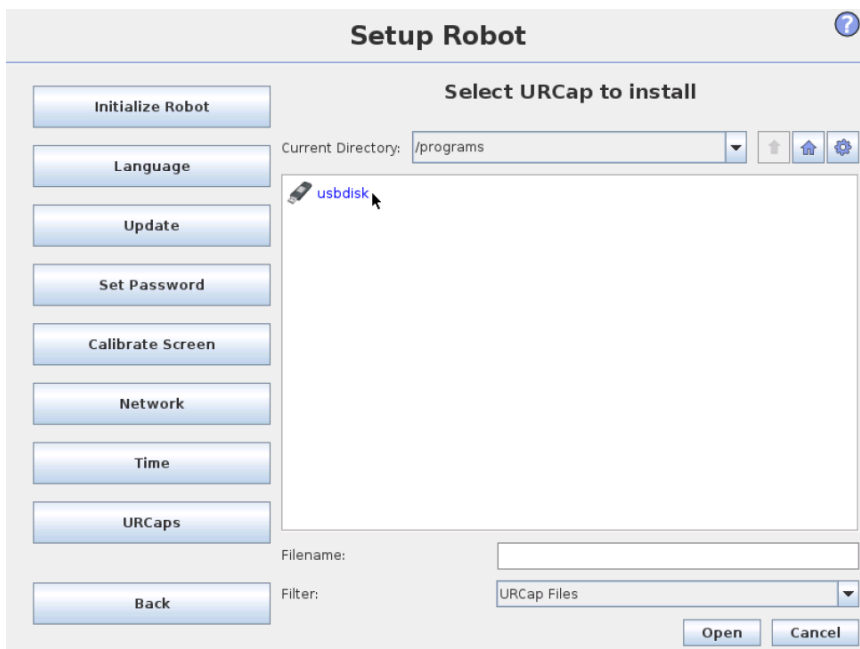

7. Click the `gocator-x.x.x.x.urcap` file to select it and then click **Open**.

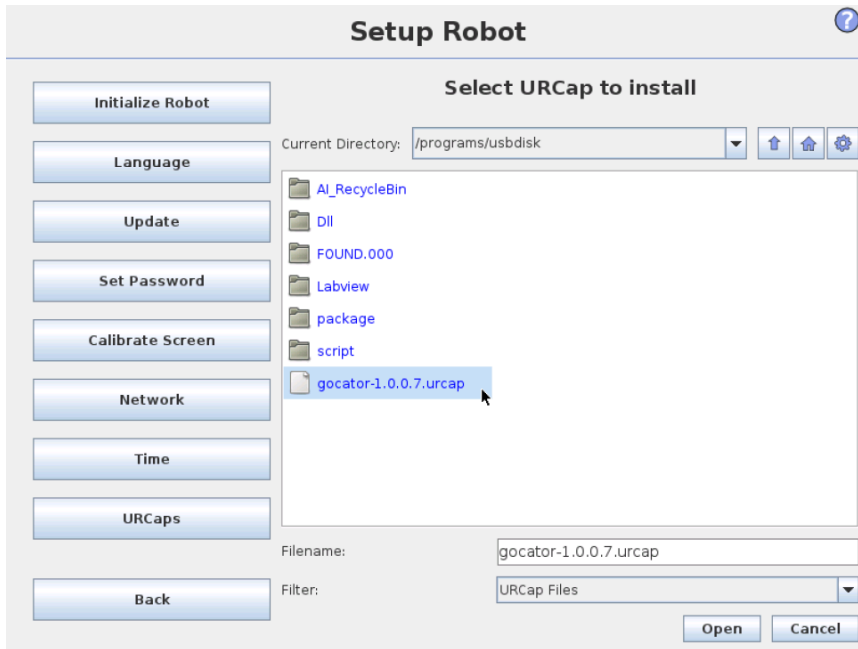

8. In the next screen, click **Restart** to finish the installation and restart the robot.

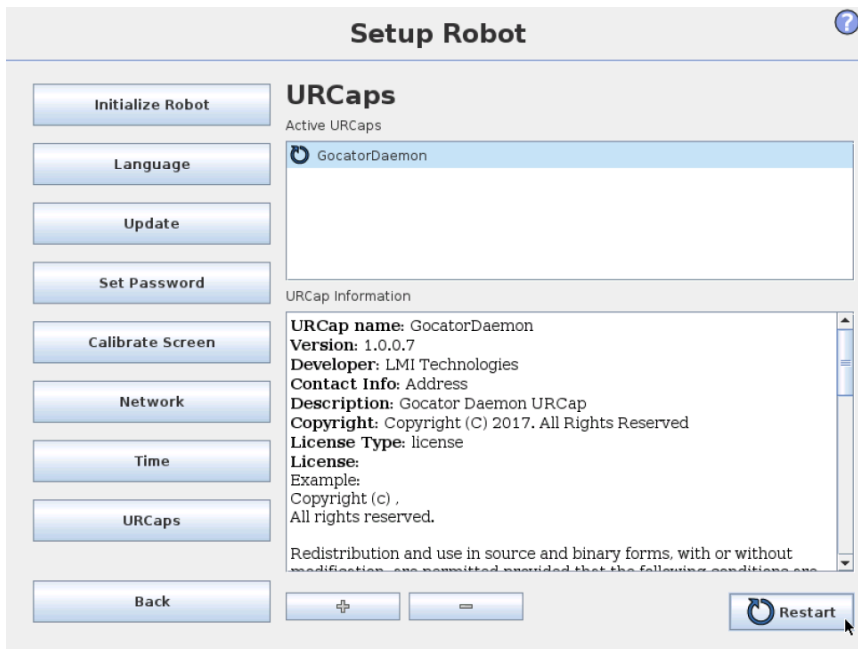

The Gocator URCap is installed


Performing the Hand-Eye Calibration

For the calibration process, you will scan a calibration target from different poses. Then a calibration matrix will be calculated on the robot by the URCap.


 If any external manipulator is required for your application (such as a gripper), you must mount it and perform the built-in TCP configuration to calculate the manipulator's tool center point before you perform the hand-eye calibration. For more information, see the user manuals of your robot and of the manipulator.

To perform the hand-eye calibration:

1. In the Installation tab, click **Gocator Calibration**.

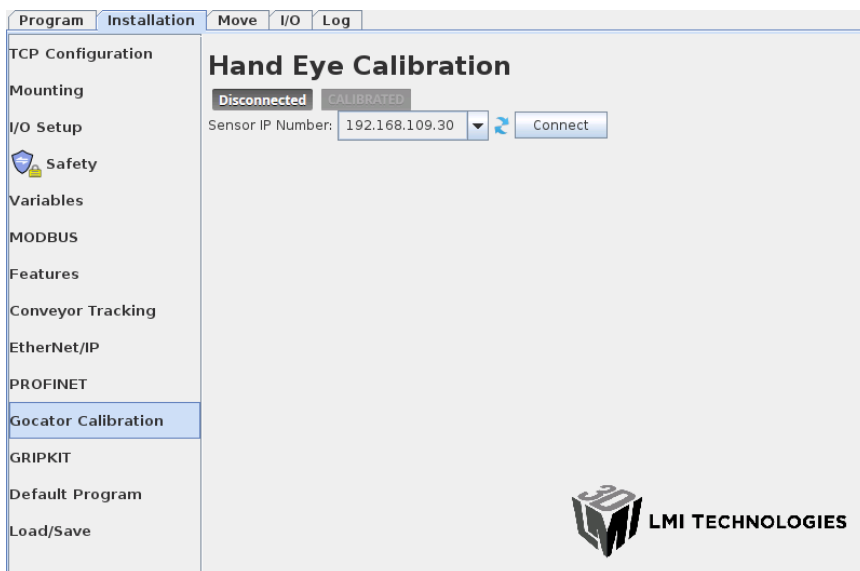

2. In the pane to the right, select the sensor's IP address in the drop-down and click **Connect**.
The robot connects to the sensor and the interface for obtaining the target's pose displays in the pane.

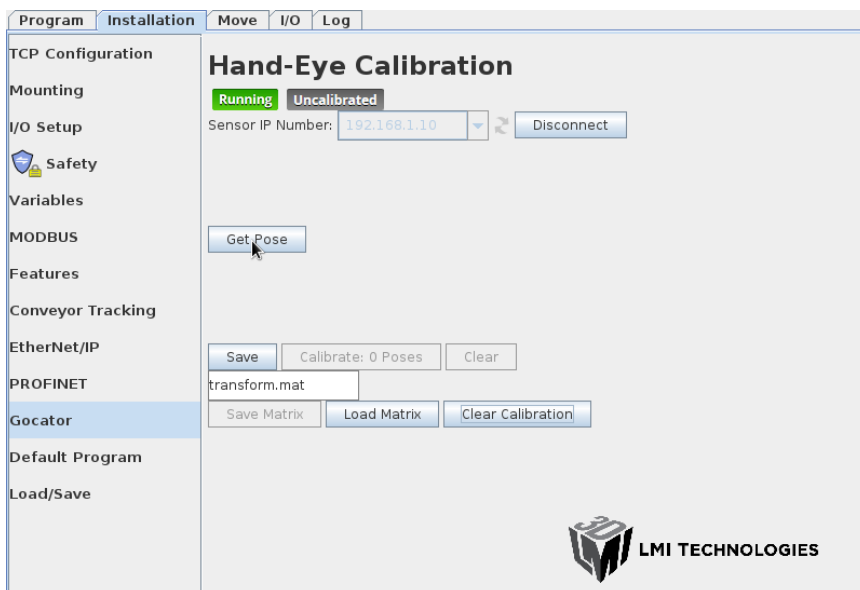

If only 1 sensor is found in the system, it will be connected automatically.


3. Manually position the robot arm over the calibration target.
4. In the Gocator web interface, switch to the **Measure** page.



- Click the Snapshot button to scan the target.




- Examine the scan data in the data viewer to confirm that the calibration target is in the sensor's field of view (FOV), and adjust the position of the robot if required.

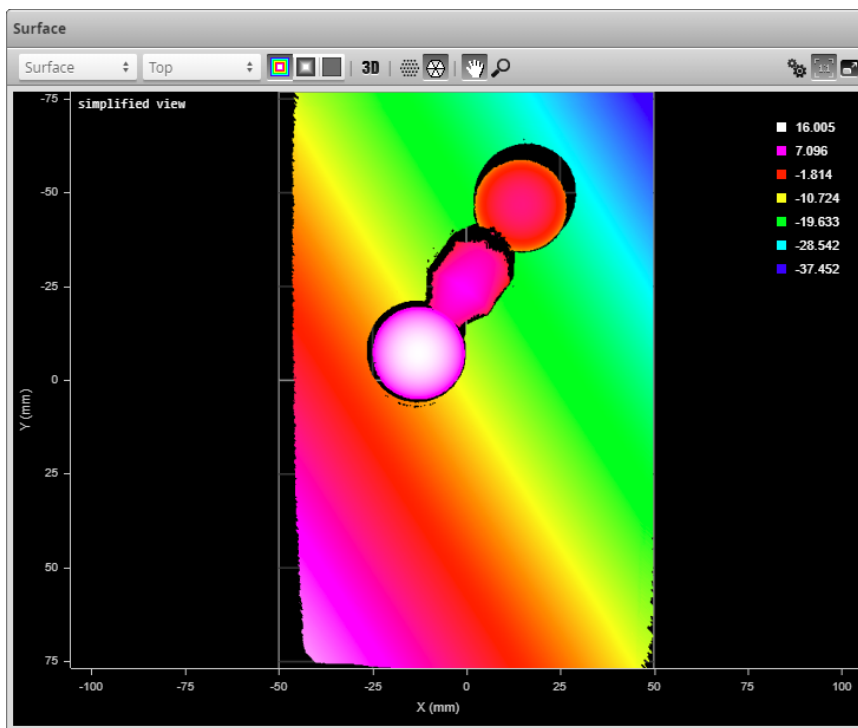


Typically, the entire calibration target must be in the sensor's field of view, and it should fill most of the field. There should be no other edges in the FOV.

- If required, in the **Tools** panel, adjust the regions of interest of the measurement tools and make sure that the measurement tools return the required information (that is, no "Invalid" measurements).
- In the Gocator URCap, click **Get Pose** and wait for an image of the calibration target to display in the URCap.

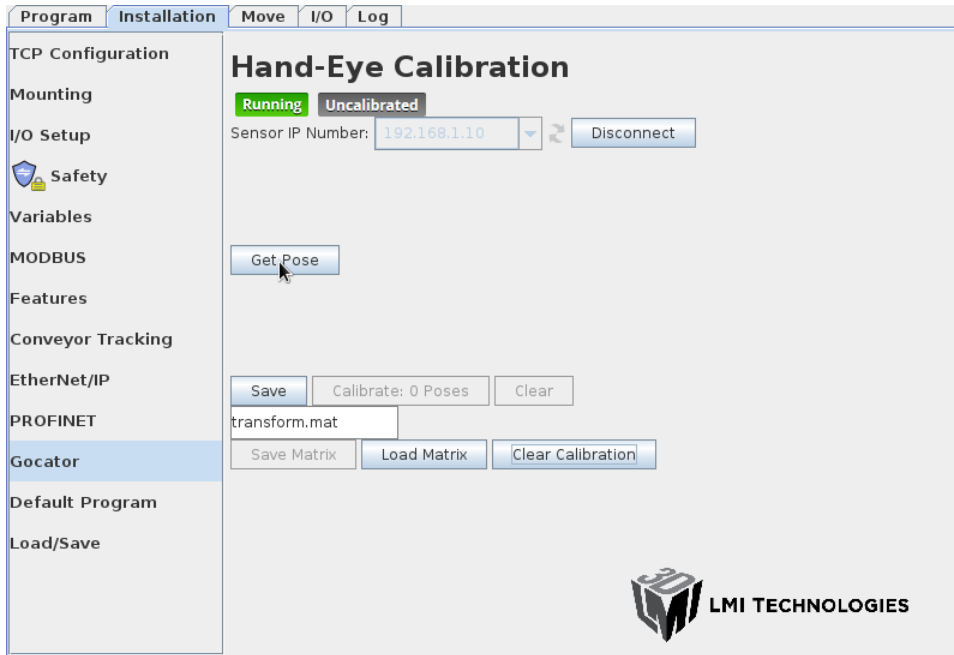


9. If the scan is successful, click **Save**.

The scan is successful if "Pose received" displays next to the scan data of the calibration target.

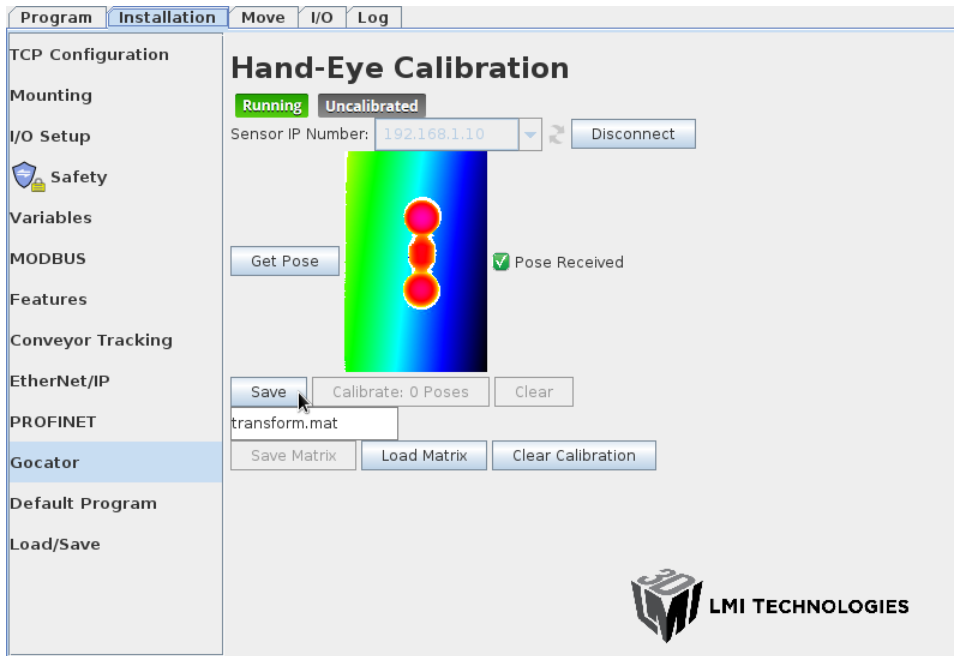

If the scan is not successful, go to the next step without clicking **Save**.


10. Reposition the robot slightly on all axes to change the position of the calibration target in the sensor's FOV, and repeat steps 5 to 9 to get another pose.

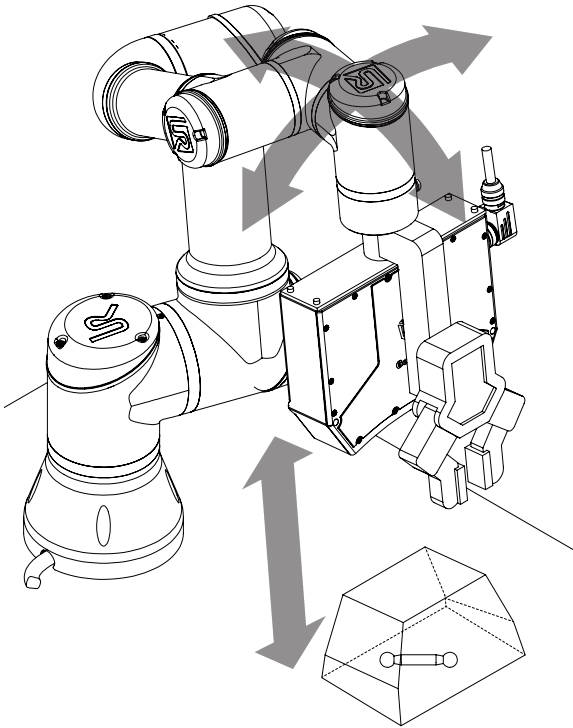

Note the following:

- The URCap requires at least 4 scans to calculate the calibration matrix and will not let you proceed to the next step otherwise. We recommend 8 scans or more.
- Do not rotate the sensor around the Z axis by more than 90 degrees: in the case of a ball-bar calibration target, the “upper” ball must remain the “upper” ball.

11. Once you have acquired a sufficient number of poses, click **Calibrate**.

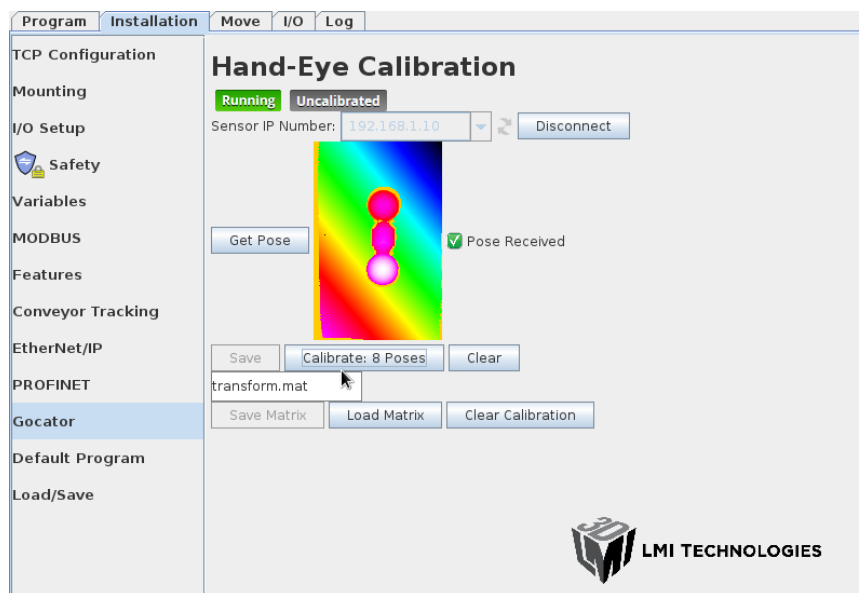

The Gocator URCap calculates the calibration matrix and saves it to the specified file.

Using the Gocator URCap Program Nodes

After you have performed the hand-eye calibration, you must add program nodes to the program tree to tell the robot to connect to the sensor, to load a job on the sensor, and to trigger a scan.

The program nodes are:

- [Gocator Connect](#)
- [Gocator Load Job](#)
- [Gocator Scan](#)


You must add all of these nodes to the program tree. The following sections describe the program nodes.

Gocator Connect

This node connects the robot to the sensor and must appear before any of the other program nodes. We recommend that you place the *Gocator Connect* node in the *BeforeStart* sequence of the program tree.

To configure the Gocator Connect node:

1. In the drop-down, choose the Gocator's IP address and click **Set**.

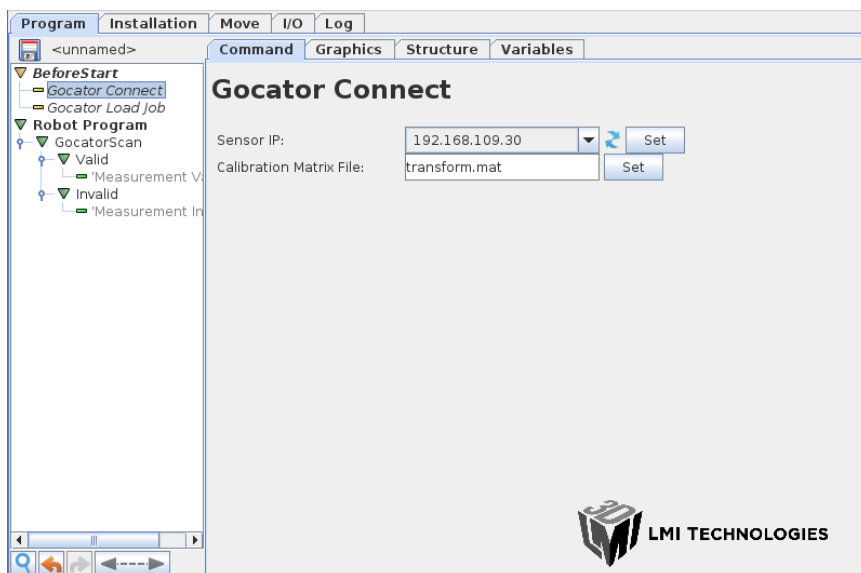

2. In the **Calibration Matrix File** field, type the name of the file used in *Performing the Hand-Eye Calibration* on page 612.


If you do not select a calibration matrix file, measurements from the Gocator will be in the sensor's coordinate system.

Gocator Load Job

This node loads a job file on the Gocator.

To configure the Gocator Load Job node:


- Type the job name in the field.

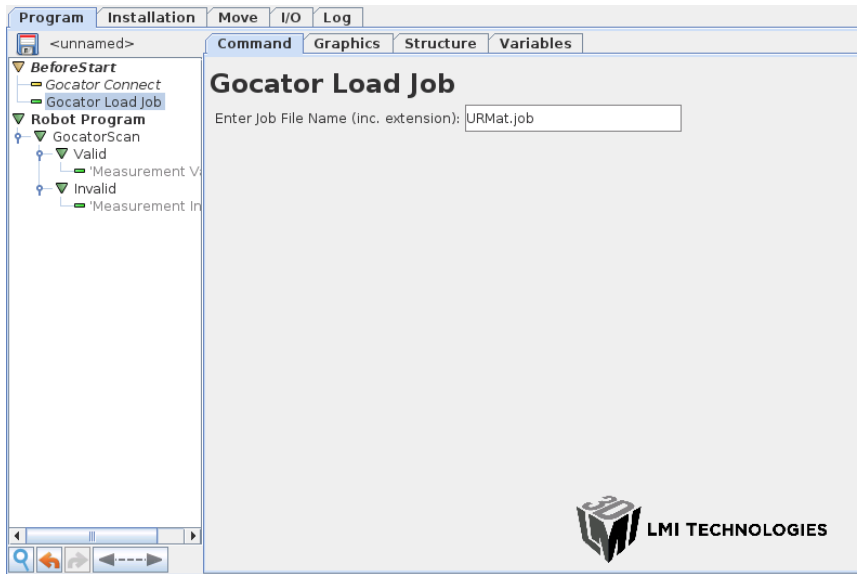

The file name must end with the extension .job.

Gocator Scan

This node causes the Gocator sensor to trigger a scan. Depending on how you configure the node, the sensor returns different information; for more information, see *Measurement Types* on page 620.

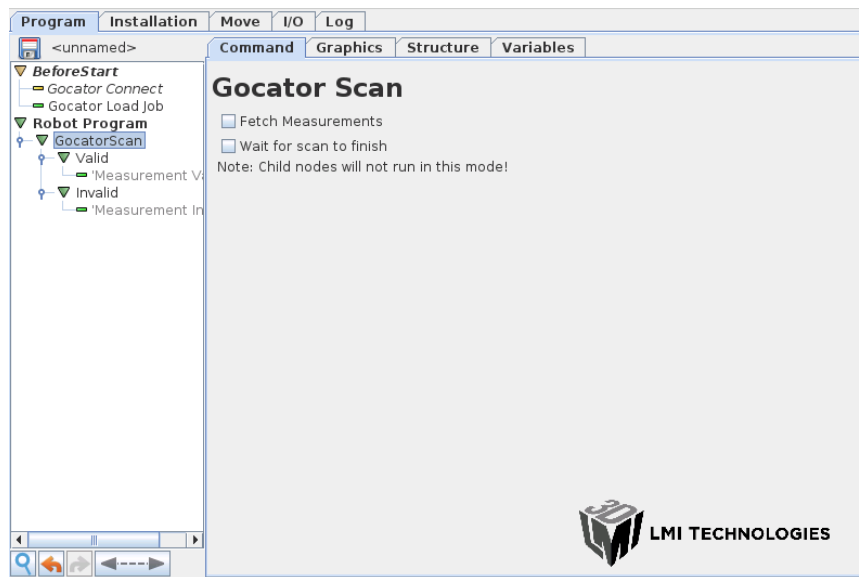

Fetch Measurements

If you do not need the sensor to return measurements, uncheck the **Fetch Measurements** checkbox. When this setting is disabled, the child nodes “Valid” and “Invalid” are skipped.

Wait for Scan to Finish


Available only when **Fetch Measurements** is disabled.

If **Fetch Measurements** is enabled, the node would wait until the Gocator is done scanning and processing the results.

If **Fetch Measurements** is unchecked, the program will continue immediately after triggering the sensor.

Note: The user is responsible to make sure the sensor is static for the duration of the exposure.

Setting Variables

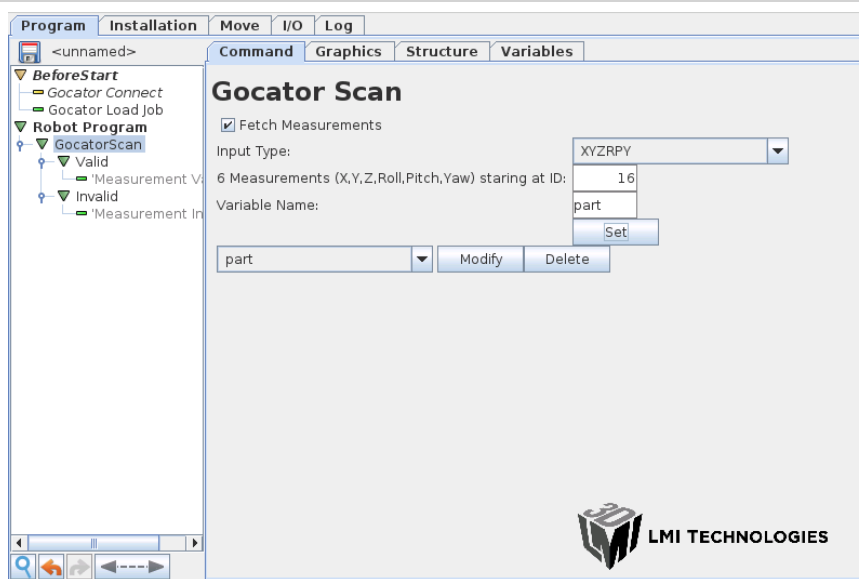

When **Fetch Measurements** is enabled, use the form to set up variables.

To set up a variable:

1. In the first text box field, enter the measurement ID.
You can find the measurement ID in the ID field in the Gocator web interface when a tool is selected in the list of added tools.
2. In the **Variable Name** field, enter the name of the variable to create.
3. In the Input Type drop-down, choose the measurement type .
4. Click **Set**.

To view or modify an existing variable:

1. Select the variable from the drop-down below **Variable Name**.
2. Click **Modify**.
The current settings for the variable display.
3. Change the settings as required.
4. Click **Set** to save the changes.

To delete an existing variable:

1. Select the variable from the drop-down below **Variable Name**.

2. Click **Delete**.

The selected variable is deleted.

Measurement Types

Single Measurement

Retrieves a single float measurement according to the provided ID into the defined variable.

The measurement will be provided as is, in the sensor's coordinate system (if relevant), and the calibration data will not be used.

XYZRPY

Retrieves a pose in spaces, provided by 6 measurements for X, Y, Z, Roll, Pitch, and Yaw.

The measurement IDs must be consecutive and begin with the provided ID.

The pose will be given in the robot base's coordinate system (assuming [hand-eye calibration](#) has been performed).



The Gocator's web UI will still display the results in the sensor's coordinate system.

Pose Matrix

Same as XYZRPY, except that the pose will be provided by a 3x3 rotational matrix, and a 3x1 translation vector. These would be 12 measurements with consecutive IDs, beginning with the provided ID.

The result will still be a pose in the XYZRPY format.

XYZ

Retrieves a point in spaces, provided by 3 measurements for X, Y, and Z.

The measurement IDs must be consecutive and begin with the provided ID.

The point will be given in the robot base's coordinate system (assuming [hand-eye calibration](#) has been performed).



The Gocator's web UI will still display the results in the sensor's coordinate system.

Acting on Retrieved Measurements

Place command sequences in the "Valid" and "Invalid" sub-trees of the Gocator Scan node in order to control the program's behaviour based on the measurement's results.

Troubleshooting

Review the guidance in this chapter if you are experiencing difficulty with a Gocator sensor system. If the problem that you are experiencing is not described in this section, see *Return Policy* on page 660.

Mechanical/Environmental

The sensor is warm.

- It is normal for a sensor to be warm when powered on. A Gocator sensor is typically 15° C warmer than the ambient temperature.

Connection

When attempting to connect to the sensor with a web browser, the sensor is not found (page does not load).

- Verify that the sensor is powered on and connected to the client computer network. The Power Indicator LED should illuminate when the sensor is powered.
- Check that the client computer's network settings are properly configured.
- Use the LMI Sensor Recovery tool to verify that the sensor has the correct network settings. See *Sensor Discovery Tool* on page 575 for more information.

When attempting to log in, the password is not accepted.

- Use the LMI Sensor Recovery tool. See *Sensor Discovery Tool* on page 575 for steps to reset the password.

Performance

The sensor CPU level is near 100%.

- Consider reducing the speed. If you are using a time trigger source, see *Triggers* on page 86 for information on reducing the speed. If you are using an external input or software trigger, consider reducing the rate at which you apply triggers.
- Consider reducing the resolution.
See *Spacing* on page 99 for more information on configuring resolution.
- Review the measurements that you have programmed and eliminate any unnecessary measurements.

Specifications

The following sections describe the specifications of Gocator sensors and connectors, as well as Master hubs.

Sensors

The following sections provide the specifications of Gocator sensors.

Gocator 3210 Sensor

The Gocator 3210 is defined below:

MODEL	3210
Scan Rate (Hz)	6
Imagers (megapixels)	2
Clearance Distance (CD) (mm)	164.0
Measurement Range (MR) (mm)	110.0
Field of View (mm)	71.0 x 98.0 - 100.0 x 154.0
Repeatability Z (µm)	4.7
Resolution XY (mm)	0.060 - 0.090
VDI/VDE Accuracy (mm)*	0.035
Dimensions (mm)	49 x 146 x 190
Weight (kg)	1.7
Light Source	Blue LED (465 nm)
Interface	Gigabit Ethernet
Inputs	Differential Encoder, Trigger
Outputs	2x Digital output, RS-485 Serial (115 kBaud) Analog Output (4 – 20 mA)
Input Voltage (Power)	+24 to +48 VDC (50 Watts); Ripple +/- 10%
Housing	Gasketed aluminum enclosure, IP67
Operating Temp.	0 to 45° C
Storage Temp.	-30 to 70° C
Vibration Resistance	10 to 55 Hz, 1.5 mm double amplitude in X, Y and Z directions, 2 hours per direction
Shock Resistance	15 g, half sine wave, 11 ms, positive and negative for X, Y and Z directions

* Based on 2634, Part 2.


Linearity Z values and Resolution Z are typical values.

Field of View and Resolution XY are specified as [X] x [Y], near to far.

Differential encoder requires the use of Master 400/800/810/1200/2400/2410.

For details on scan rates, see *Estimated Scan Rates* on page 633.







The following diagram illustrates some of the terms used in the table above.

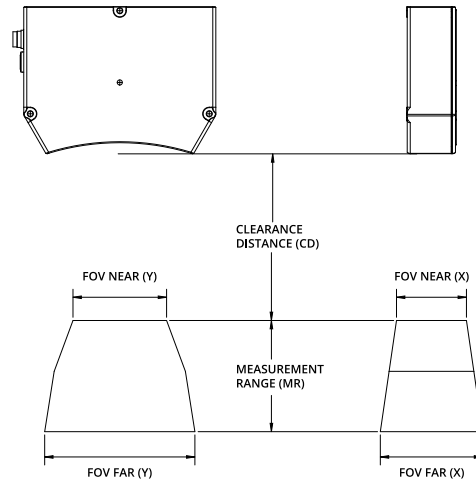

Mechanical dimensions, CD/FOV/MR, and the envelope for each sensor model are illustrated on the following pages.

Gocator 3210

 
Field of View / Measurement Range / Coordinate System Orientation

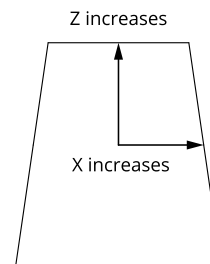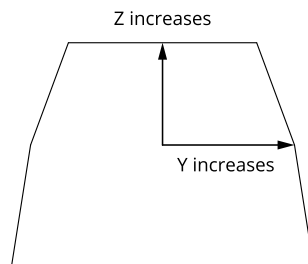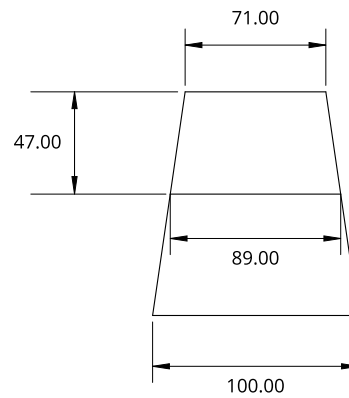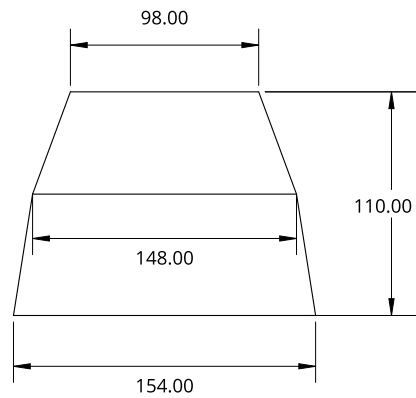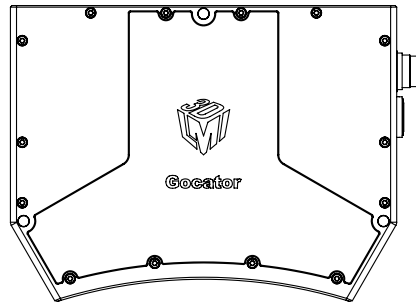


Dimensions



The following drawings include the optional shop air heat sink. For more information, see [APPNOTE_Gocator_3210_Heatsink.pdf](#), available on LMI's website.

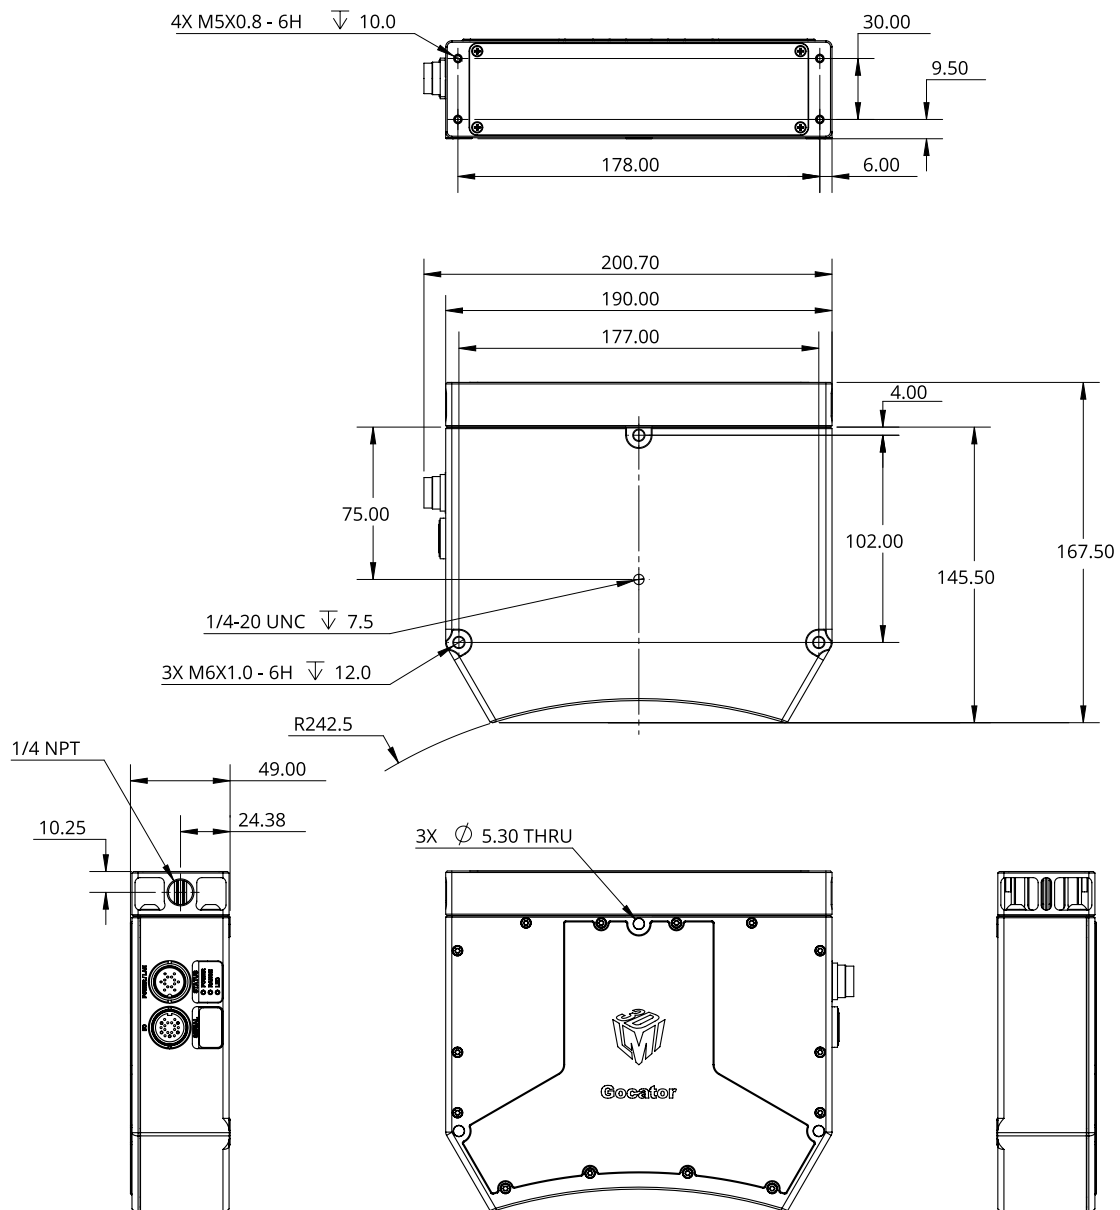

Envelope

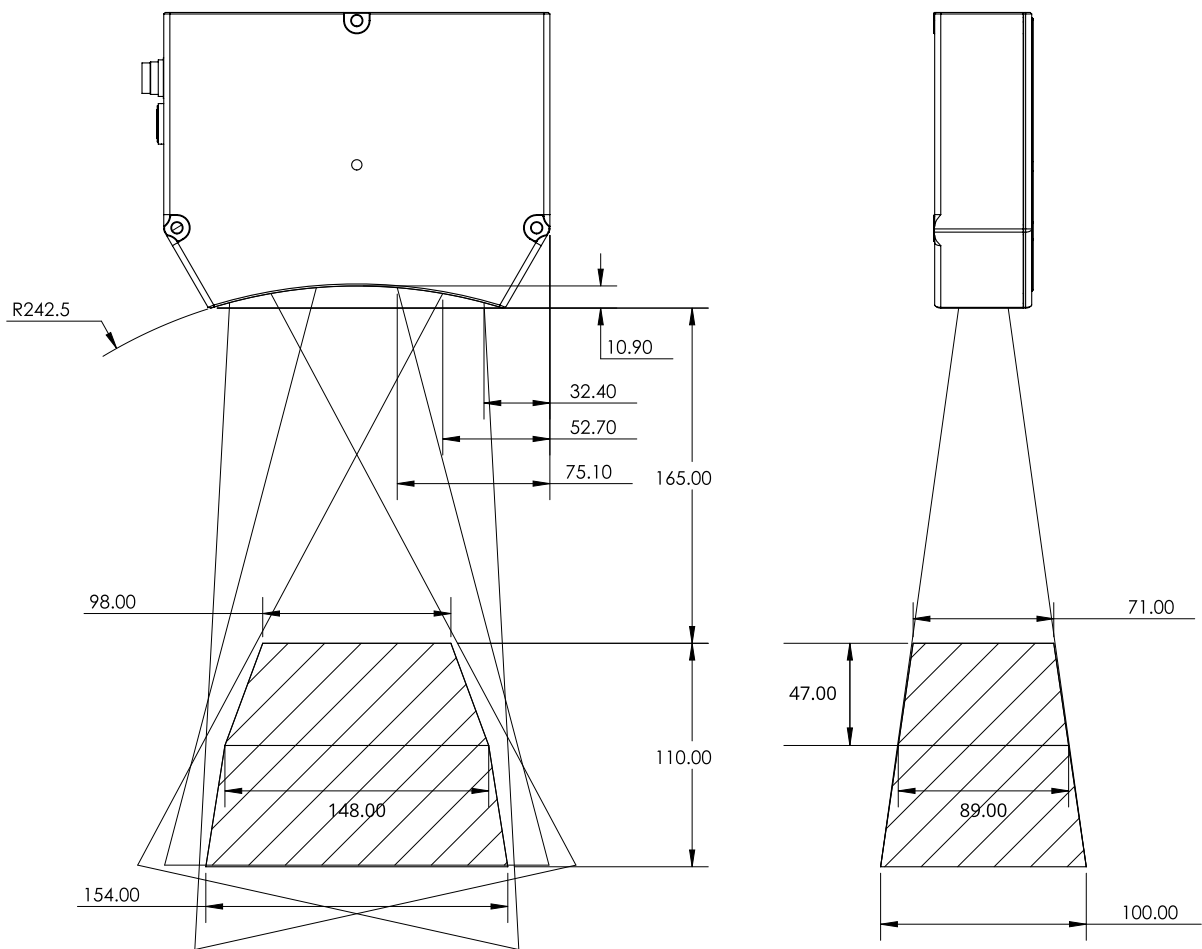

Gocator 3500 Series

The Gocator 3500 series consists of the following models:


MODEL	3504	3506
Scan Rate (Hz)	6	6
Imagers (megapixels)	5	5
Clearance Distance (CD) (mm)	51.5	87.0
Measurement Range (MR) (mm)	7	25.0
Field of View (mm)	12.4 x 13.2 (near) - 12.5 x 16.0 (maxY) - 13.1 x 14.6 (far)	27.0 x 45.0 (near) - 30.0 x 45.0 (far)
Repeatability Z (μm)	0.2	2.0
Resolution XY (μm)	6.7 - 7.1	20 - 25
VDI/VDE Accuracy (mm)*	TBD	0.012
Dimensions (mm)	49x152x177.5	49 x 136 x 170
Weight (kg)	1.77	1.52

* Based on 2634, Part 2.

Field of View and Resolution XY are specified as [X] x [Y], near to far.

For details on scan rates, see *Estimated Scan Rates* on page 633.

The following diagram illustrates some of the terms used in the table above.

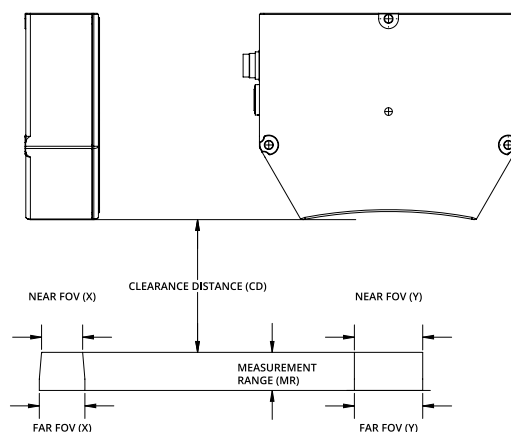

ALL 3500 SERIES MODELS

Light Source	Blue LED (465 nm)
Interface	Gigabit Ethernet
Inputs	Differential Encoder, Trigger


ALL 3500 SERIES MODELS

Outputs	2x Digital output, RS-485 Serial (115 kBaud) Analog Output (4 – 20 mA)
Input Voltage (Power)	+24 to +48 VDC (25 Watts); Ripple +/- 10%
Housing	Gasketed aluminum enclosure, IP67
Operating Temp.	0 to 50° C
Storage Temp.	-30 to 70° C
Vibration Resistance	10 to 55 Hz, 1.5 mm double amplitude in X, Y and Z directions, 2 hours per direction
Shock Resistance	15 g, half sine wave, 11 ms, positive and negative for X, Y and Z directions


Mechanical dimensions, CD/FOV/MR, and the envelope for each sensor model are illustrated on the following pages.

Gocator 3504

Field of View / Measurement Range / Coordinate System Orientation

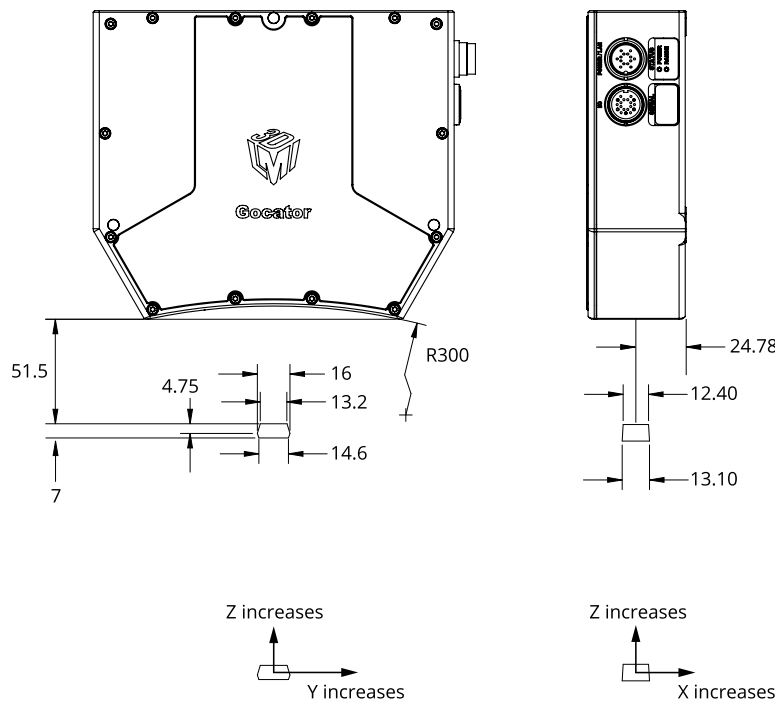


Dimensions

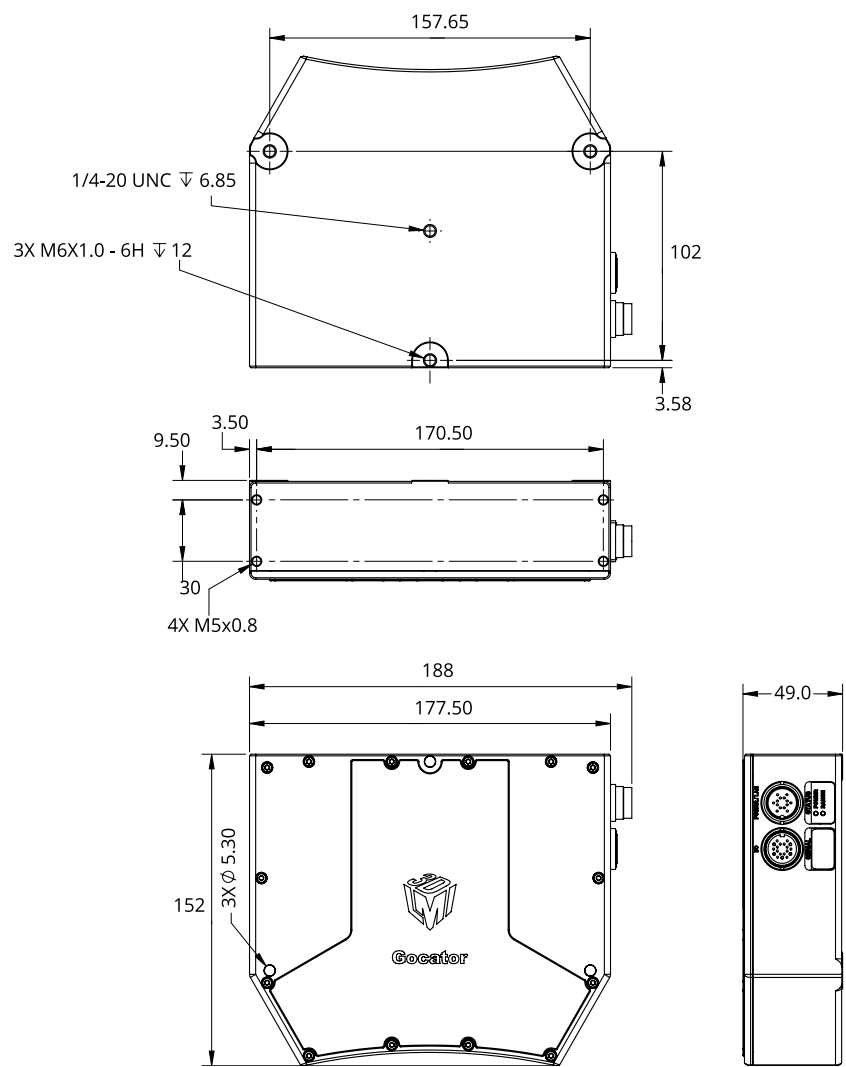


Gocator 3506


Field of View / Measurement Range / Coordinate System Orientation

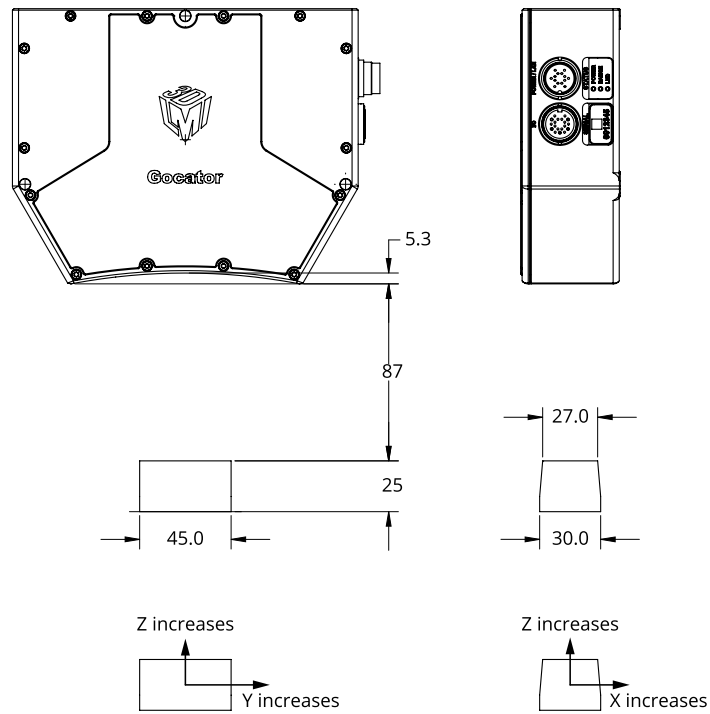

Dimensions

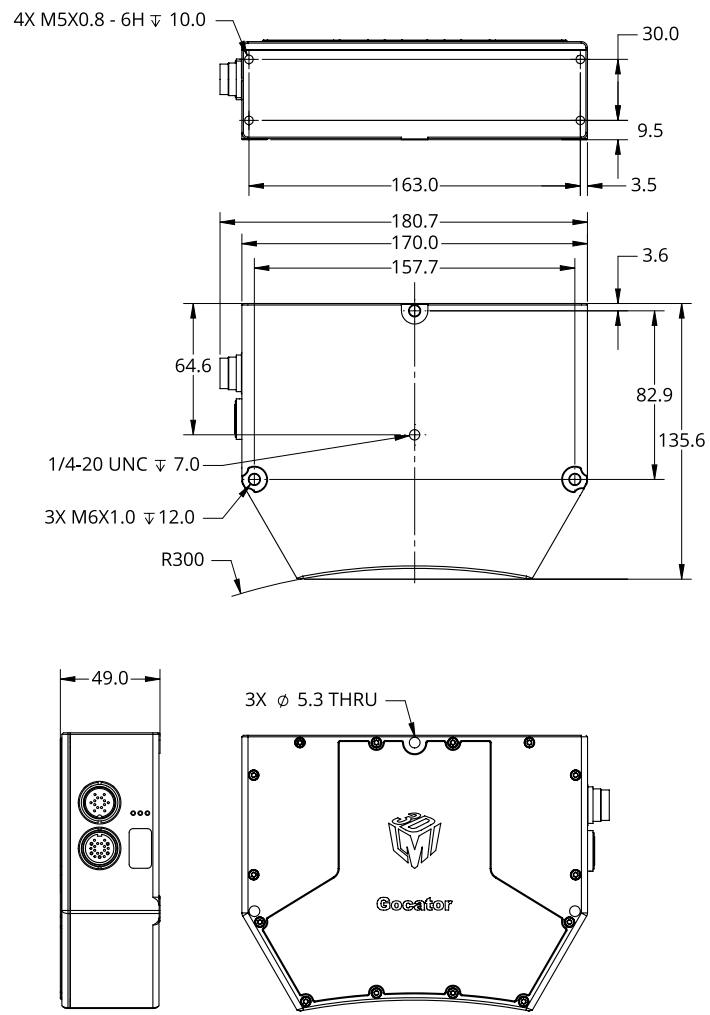

Envelope

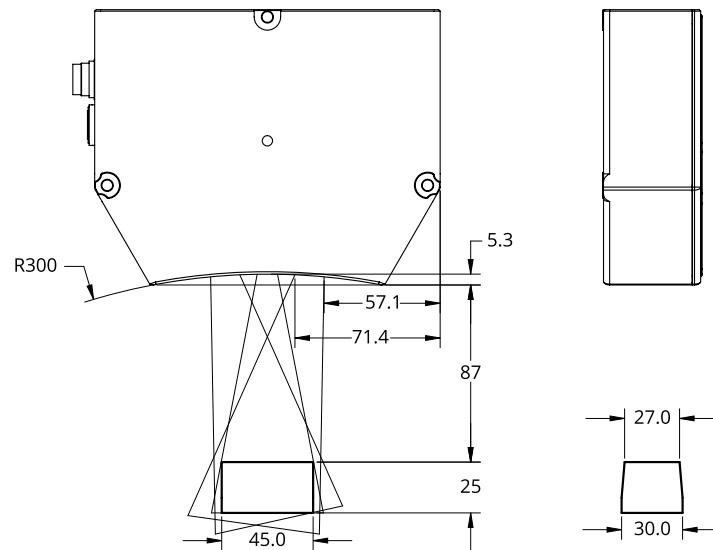

Estimated Scan Rates

The following tables provide estimates of the scan rates (Hz) of Gocator 3210 and 3506 under different field-of-view and resolution settings.

The exposure was set to 4 milliseconds with no measurement tools added. **Acquire Intensity** and **Reduce Occlusion** were both disabled.

Gocator 3210 Estimated Scan Rates

Field of View (X x Y x MR)	Resolution (mm)	Scan Rate without Accelerator (Hz)	Scan Rate with Accelerator (Hz)
100x154x110	0.5	6	7.5
100x154x110	0.2	1.8	7.5
100x154x110	0.1	0.5	6
100x154x110	0.08	0.3	4
35x35x100	0.5	7.5	7.5
35x35x100	0.2	7.5	7.5
35x35x100	0.1	4.2	7.5
35x35x100	0.08	3	7.5
35x35x35	0.5	7.5	7.5
35x35x35	0.2	7.5	7.5
35x35x35	0.1	6.4	7.5
35x35x35	0.08	4.8	7.5

Gocator 3506 Estimated Scan Rates

Field of View (X x Y x MR)	Resolution (mm)	Scan Rate without Accelerator (Hz)	Scan Rate with Accelerator (Hz)
30x45x25	0.2	4.3	4.3
30x45x25	0.1	3.3	4.3
30x45x25	0.02	0.2	3

Sensor Connectors

The following sections provide the specifications of the connectors on Gocator sensors.

Gocator Power/LAN Connector


The Gocator Power/LAN connector is a 14 pin, M16 style connector that provides power input and Ethernet.

 This connector is rated IP67 only when a cable is connected or when a protective cap is used.

This section defines the electrical specifications for Gocator Power/LAN Connector pins, organized by function.

Gocator Power/LAN Connector Pins

Function	Pin	Lead Color on Cordset
GND_24-48V	L	White/ Orange & Black
GND_24-48V	L	Orange/ Black
DC_24-48V	A	White/ Green & Black
DC_24-48V	A	Green/ Black
Reserved	G	White/ Blue & Black
Reserved	J	Blue/ Black
Sync+	E	White/ Brown & Black
Sync-	C	Brown/ Black
Ethernet MX1+	M	White/ Orange
Ethernet MX1-	N	Orange
Ethernet MX2+	O	White/ Green
Ethernet MX2-	P	Green
Ethernet MX3-	S	White/ Blue
Ethernet MX3+	R	Blue
Ethernet MX4+	T	White/ Brown
Ethernet MX4-	U	Brown

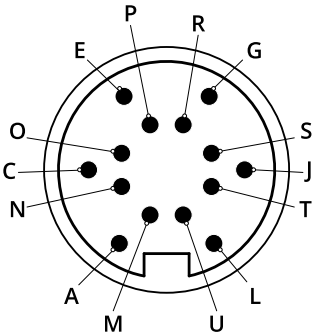

View: Looking into the connector **on** the sensor

Two wires are connected to the ground and power pins.

Grounding Shield

The grounding shield should be mounted to the earth ground.

Power

Apply positive voltage to DC_24-48V. See *Sensors* on page 622

Power requirements

Function	Pins	Min	Max
DC_24-48V	A	24 V	48 V
GND_24-48VDC	L	0 V	0 V

Safety Input

With snapshot sensors, the Safety_in+ and Safety_in- signals do not need to be connected (to a voltage source) in order to scan with these models.

Gocator I/O Connector


The Gocator I/O connector is a 19 pin, M16 style connector that provides encoder, digital input, digital outputs, serial output, and analog output signals.

 This connector is rated IP67 only when a cable is connected or when a protective cap is used.

This section defines the electrical specifications for Gocator I/O connector pins, organized by function.

Gocator I/O Connector Pins

Function	Pin	Lead Color on Cordset
Trigger_in+	D	Grey
Trigger_in-	H	Pink
Out_1+ (Digital Output 0)	N	Red
Out_1- (Digital Output 0)	O	Blue
Out_2+ (Digital Output 1)	S	Tan
Out_2- (Digital Output 1)	T	Orange
Encoder_A+	M	White / Brown & Black
Encoder_A-	U	Brown / Black
Encoder_B+	I	Black
Encoder_B-	K	Violet
Encoder_Z+	A	White / Green & Black
Encoder_Z-	L	Green / Black
Serial_out+	B	White
Serial_out-	C	Brown
Reserved	E	Blue / Black
Reserved	G	White / Blue & Black
Analog_out+	P	Green
(Reserved on Gocator 2500 series sensors)		
Analog_out-	F	Yellow & Maroon / White
(Reserved on Gocator 2500 series sensors)		
Reserved	R	Maroon

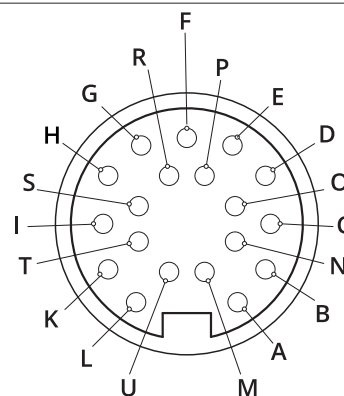

View: Looking into the connector **on** the sensor

Grounding Shield

The grounding shield should be mounted to the earth ground.

Digital Outputs


Each Gocator sensor has two optically isolated outputs. Both outputs are open collector and open emitter, which allows a variety of power sources to be connected and a variety of signal configurations.



Digital outputs cannot be used when taking scans using the Snapshot button, which takes a single scan and is typically used to test measurement tool settings. Digital outputs can only be used when a sensor is running, taking a continuous series of scans.

Out_1 (Collector – Pin N and Emitter – Pin O) and Out_2 (Collector – Pin S and Emitter – Pin T) are independent and therefore V+ and GND are not required to be the same.

Function	Pins	Max Collector Current	Max Collector-Emitter Voltage	Min Pulse Width
Out_1	N, O	40 mA	70 V	20 μ s
Out_2	S, T	40 mA	70 V	20 μ s

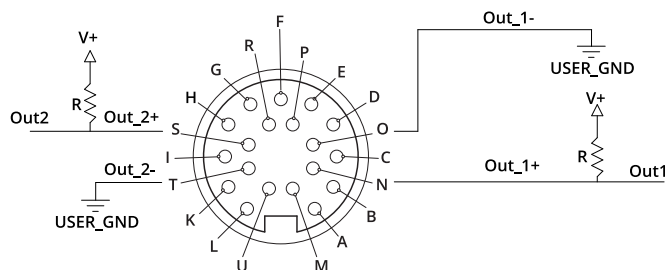


The resistors shown above are calculated by $R = (V+) / 2.5 \text{ mA}$.

The size of the resistors is determined by power $= (V+)^2 / R$.


Inverting Outputs

To invert an output, connect a resistor between ground and Out_1- or Out_2- and connect Out_1+ or Out_2+ to the supply voltage. Take the output at Out_1- or Out_2-. For resistor selection, see above.

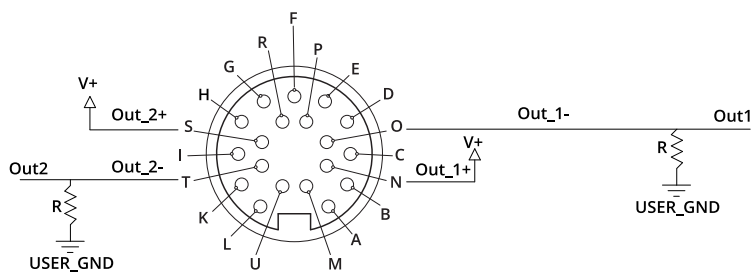


Digital Input

Every Gocator sensor has a single optically isolated input. To use this input without an external resistor, supply 3.3 - 24 V to the positive pin and GND to the negative.

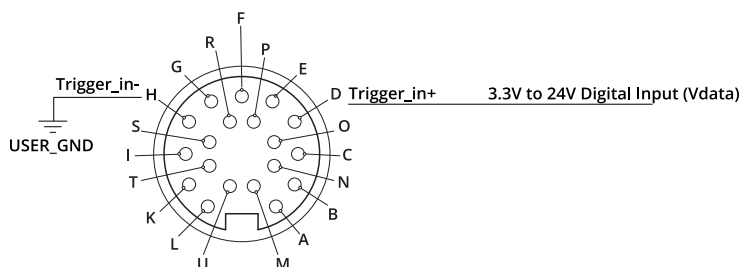

Active High

If the supplied voltage is greater than 24 V, connect an external resistor in series to the positive. The resistor value should be $R = [(V_{in} - 1.2V) / 10mA] - 680$.

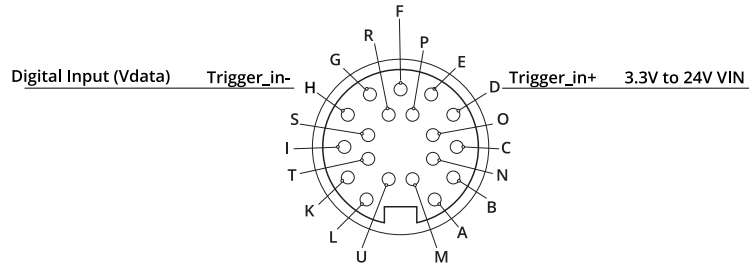


Active Low

To assert the signal, the digital input voltage should be set to draw a current of 3 mA to 40 mA from the positive pin. The current that passes through the positive pin is $I = (V_{in} - 1.2 - V_{data}) / 680$. To reduce noise sensitivity, we recommend leaving a 20% margin for current variation (i.e., uses a digital input voltage that draws 4mA to 25mA).

Function	Pins	Min Voltage	Max Voltage	Min Current	Max Current	Min Pulse Width
Trigger_in	D, H	3.3 V	24 V	3 mA	40 mA	20 μ s

Encoder Input

Encoder input is provided by an external encoder and consists of three RS-485 signals. These signals are connected to Encoder_A, Encoder_B, and Encoder_Z.

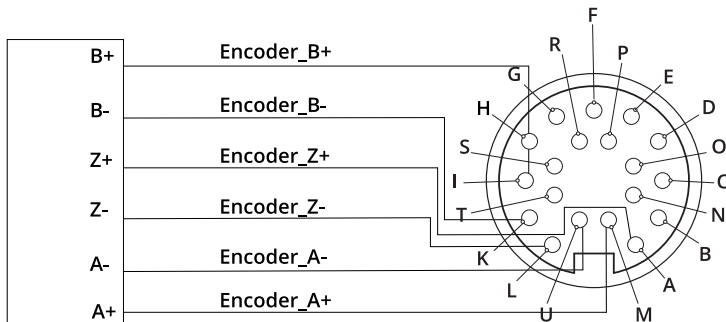

Function	Pins	Common Mode Voltage		Differential Threshold Voltage			Max Data Rate
		Min	Max	Min	Typ	Max	
Encoder_A	M, U	-7 V	12 V	-200 mV	-125 mV	-50 mV	1 MHz
Encoder_B	I, K	-7 V	12 V	-200 mV	-125 mV	-50 mV	1 MHz
Encoder_Z	A, L	-7 V	12 V	-200 mV	-125 mV	-50 mV	1 MHz

 Gocator only supports differential RS485 signalling. Both + and - signals must be connected.


 Encoders are normally specified in *pulses* per revolution, where each pulse is made up of the

four quadrature *signals* (A+ / A- / B+ / B-). Because Gocator reads each of the four quadrature signals, you should choose an encoder accordingly, given the resolution required for your application.

Serial Output

Serial RS-485 output is connected to Serial_out as shown below.


Function	Pins
Serial_out	B, C

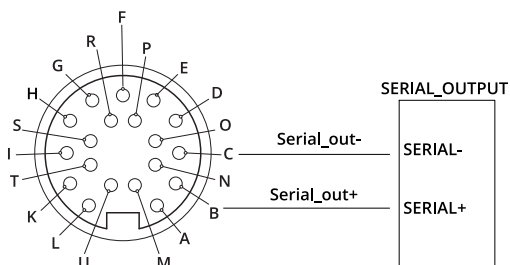


Analog Output

The Sensor I/O Connector defines one analog output interface: Analog_out.

Function	Pins	Current Range
Analog_out	P, F	4 – 20 mA

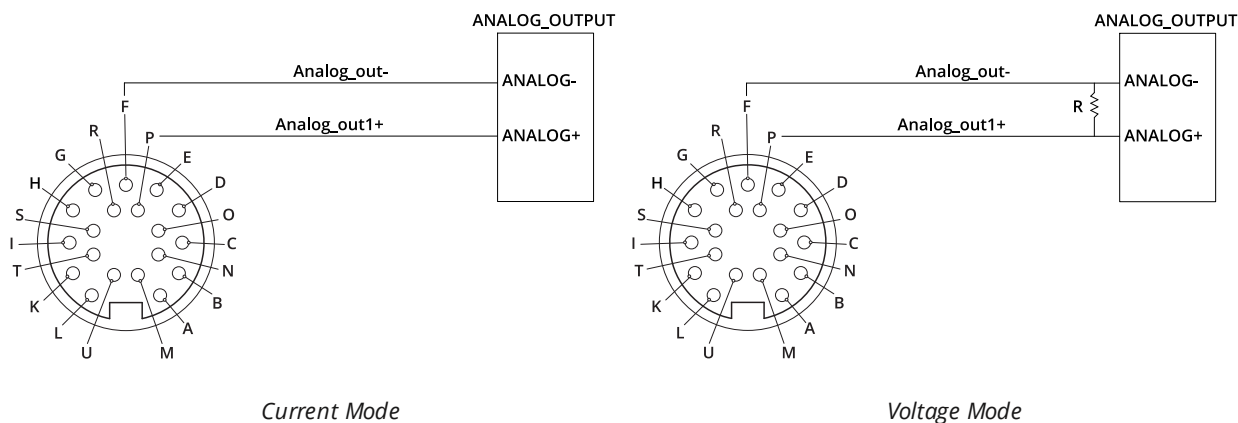

To configure for voltage output, connect a 500 Ohm ¼ Watt resistor between Analog_out+ and Analog_out- and measure the voltage across the resistor. To reduce the noise in the output, we recommend using an RC filter as shown below.

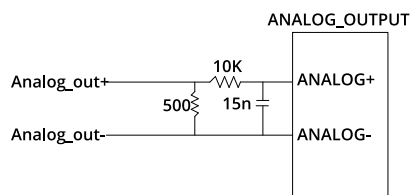


Master Network Controllers

The following sections provide the specifications of Master network controllers.

For information on maximum external input trigger rates, see *Maximum Input Trigger Rate* on page 88.

Master 100

The Master 100 accepts connections for power, safety (not supported by Gocator snapshot sensors), and encoder, and provides digital output.

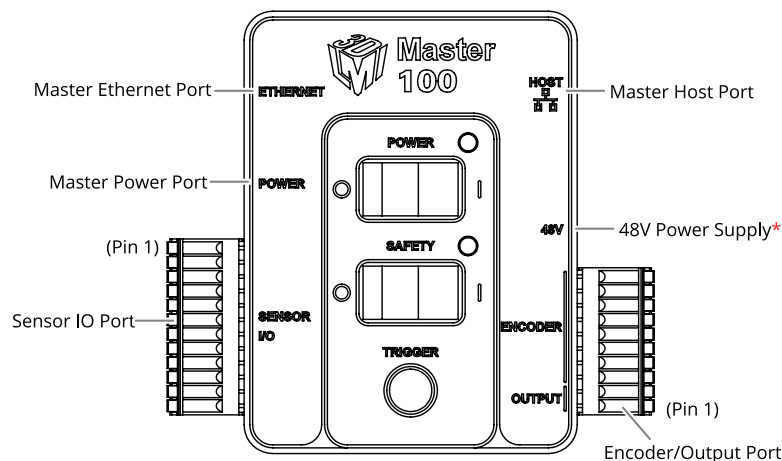

*Contact LMI for information regarding this type of power supply.

Connect the Master Power port to the Gocator's Power/LAN connector using the Gocator Power/LAN to Master cordset. Connect power RJ45 end of the cordset to the Master Power port. The Ethernet RJ45 end of the cordset can be connected directly to the Ethernet switch, or connect to the Master Ethernet port. If the Master Ethernet port is used, connect the Master Host port to the Ethernet switch with a CAT5e Ethernet cable.

To use encoder and digital output, wire the Master's Gocator Sensor I/O port to the Gocator IO connector using the Gocator I/O cordset.

Sensor I/O Port Pins

Gocator I/O Pin	Master Pin	Conductor Color
Encoder_A+	1	White/Brown & Black
Encoder_A-	2	Brown/Black
Encoder_Z+	3	White/Green & Black
Encoder_Z-	4	Green/Black
Trigger_in+	5	Grey
Trigger_in-	6	Pink
Out_1-	7	Blue
Out_1+	8	Red


Gocator I/O Pin	Master Pin	Conductor Color
Encoder_B+	11	Black
Encoder_B-	12	Violet

The rest of the wires in the Gocator I/O cordset are not used.

Encoder/Output Port Pins

Function	Pin
Output_1+ (Digital Output 0)	1
Output_1- (Digital Output 0)	2
Encoder_Z+	3
Encoder_Z-	4
Encoder_A+	5
Encoder_A-	6
Encoder_B+	7
Encoder_B-	8
Encoder_GND	9
Encoder_5V	10


Master 100 Dimensions

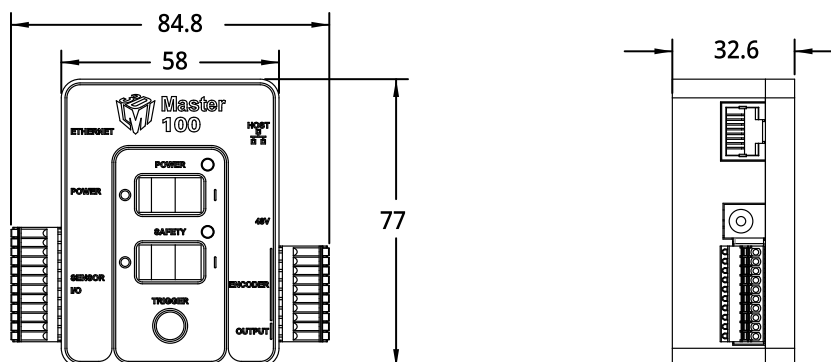

Master 400/800

Master network controllers provide sensor power and safety interlock, and broadcast system-wide synchronization information (i.e., time, encoder count, encoder index, and digital I/O states) to all devices on a sensor network.

- Safety interlock is not supported by Gocator snapshot sensors.
- The Phoenix connectors on Master 400/800/1200/2400 are not compatible with the connectors on Master 810/2410. For this reason, if you are switching models in your network, you must rewire the connections to the Master.

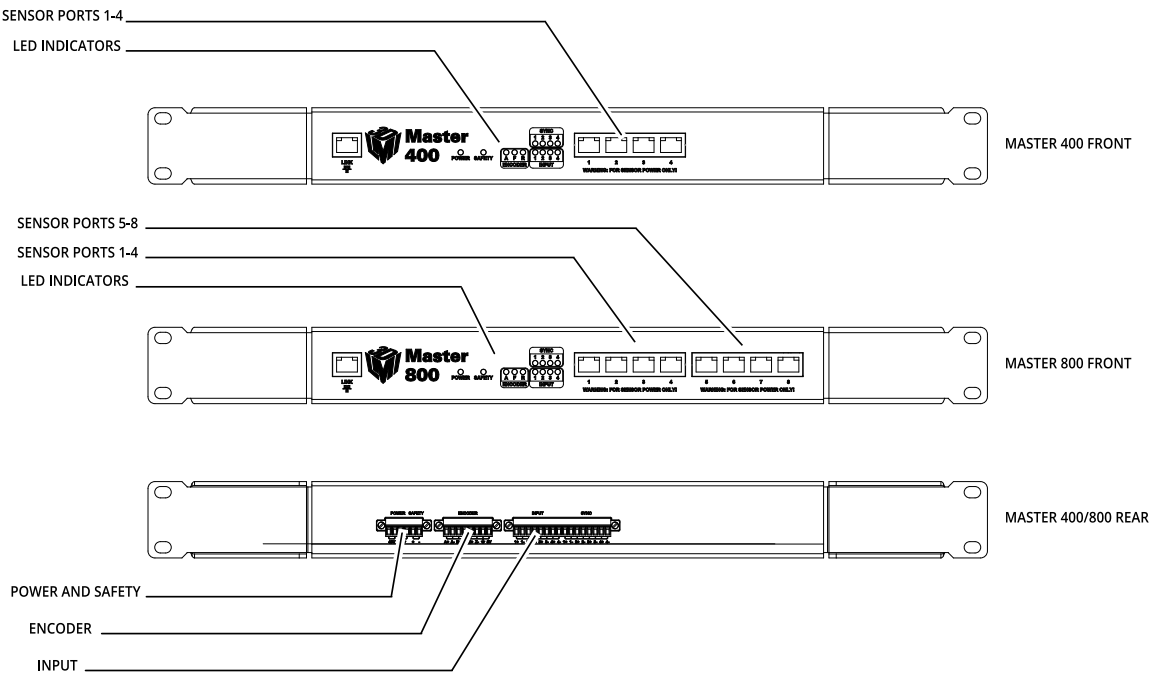

Power and Safety (6 pin connector)

Function	Pin
+48VDC	1
+48VDC	2
GND (24-48VDC)	3
GND (24-48VDC)	4
Reserved	5
Reserved	6

- The power supply must be isolated from AC ground. This means that AC ground and DC ground are not connected.

Input (16 pin connector)

Function	Pin
Input 1	1
Input 1 GND	2
Reserved	3
Reserved	4
Reserved	5
Reserved	6
Reserved	7
Reserved	8
Reserved	9
Reserved	10
Reserved	11
Reserved	12
Reserved	13
Reserved	14
Reserved	15
Reserved	16



The Input connector does not need to be wired up for proper operation.

Encoder (8 pin connector)

Function	Pin
Encoder_A+	1
Encoder_A-	2
Encoder_B+	3
Encoder_B-	4
Encoder_Z+	5
Encoder_Z-	6
GND	7
+5VDC	8

Master 400/800 Electrical Specifications

Electrical Specifications

Specification	Value
Power Supply Voltage	+48 VDC
Power Supply Current (Max.)	10 A

Specification	Value
Power Draw (Min.)	5.76 W
Encoder Signal Voltage	Differential (5 VDC)
Digital Input Voltage Range	Logical LOW: 0 to +0.1 VDC Logical HIGH: +3.3 to +24 VDC




 When using a Master hub, the chassis must be well grounded.

 The power supply must be isolated from AC ground. This means that AC ground and DC ground are not connected.

 The Power Draw specification is based on a Master with no sensors attached. Every sensor has its own power requirements that need to be considered when calculating total system power requirements..

Master 400/800 Dimensions

The dimensions of Master 400 and Master 800 are the same.

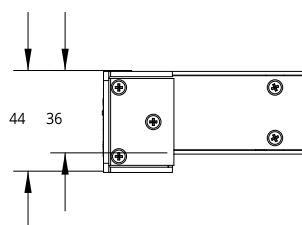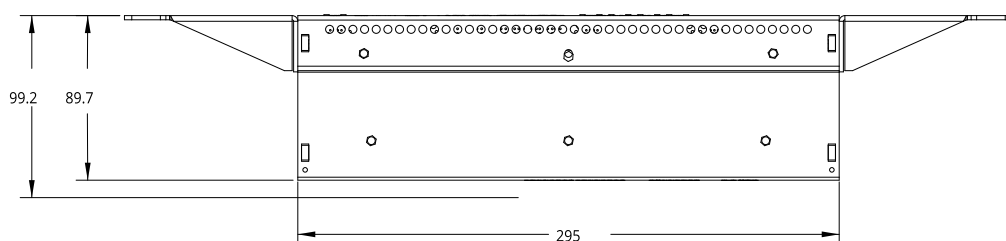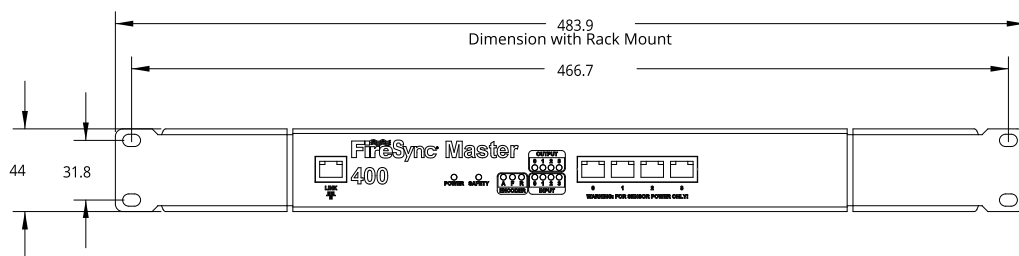

Master 810/2410

Master network controllers provide sensor power and safety interlock, and broadcast system-wide synchronization information (i.e., time, encoder count, encoder index, and digital I/O states) to all devices on a sensor network.


 Safety interlock is not supported by Gocator snapshot sensors.


Master 810 and 2410 can be mounted to DIN rails using the provided adapters (for more information, see *Installing DIN Rail Clips: Master 810 or 2410* on page 27). The units are also provided with removable adapters for 1U rack mounting; the mounting holes for this option are compatible with older Master models (400/800/1200/2400).

 The Phoenix connectors on Master 400/800/1200/2400 are not compatible with the connectors on Master 810/2410. For this reason, if you are switching models in your network, you must rewire the connections to the Master.

Master 2410 can currently be used with encoders with a maximum quadrature frequency of 300 kHz.

Master 810 can be configured to work with a maximum encoder quadrature frequency of 6.5 MHz. For more information, see *Configuring Master 810* on page 29.

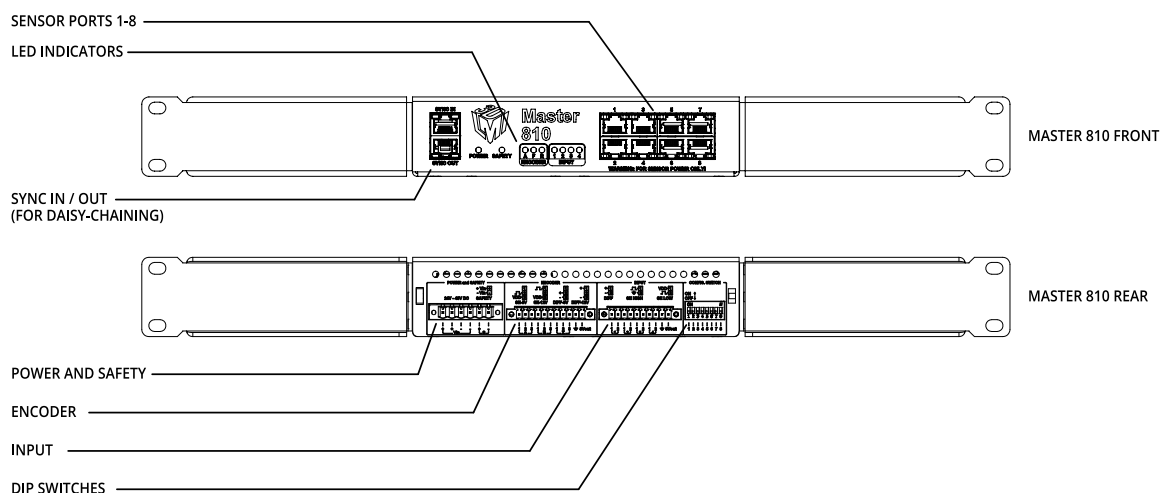

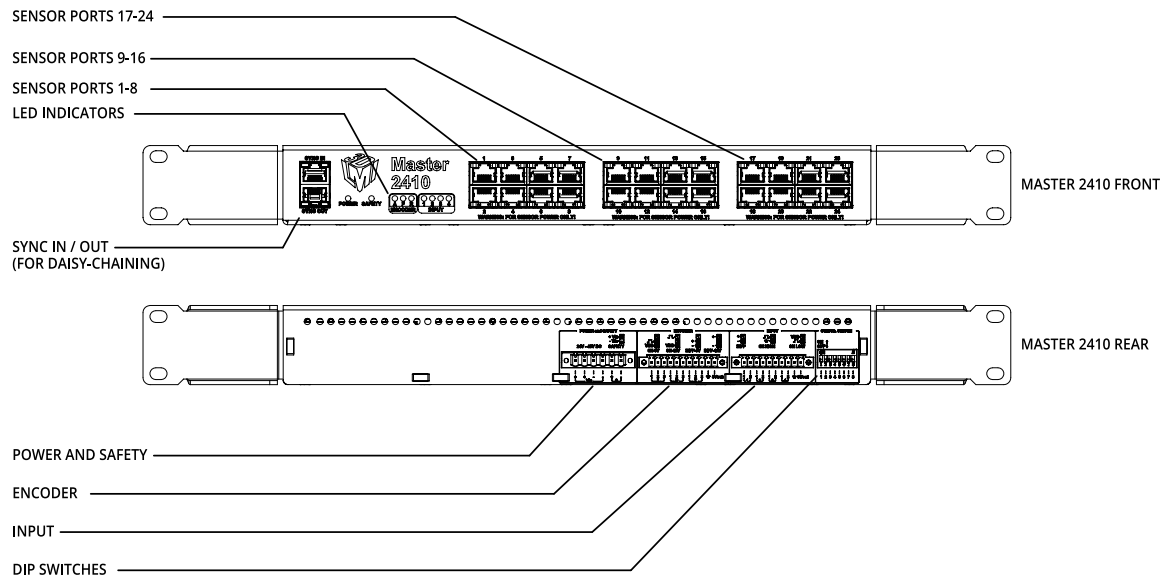

For information on configuring the DIP switches, see *Configuring Master 810* on page 29.

Power and Safety (6 pin connector)

Function	Pin
Power In+	1
Power In+	2
Power In-	3
Power In-	4
Reserved	5
Reserved	6



The power supply must be isolated from AC ground. This means that AC ground and DC ground are not connected.



On earlier revisions of Master 810 and Master 2410, the inputs are labeled 0-3.

Input (10 pin connector)

Function	Pin
Input 1 Pin 1	1
Input 1 Pin 2	2
Reserved	3
Reserved	4
Reserved	5
Reserved	6
Reserved	7

Function	Pin
Reserved	8
GND (output for powering other devices)	9
+5VDC (output for powering other devices)	10

 The Input connector does not need to be wired up for proper operation.

 For Input connection wiring options, see *Input* on page 651.

Encoder (11 pin connector)

Function	Pin
Encoder_A_Pin_1	1
Encoder_A_Pin_2	2
Encoder_A_Pin_3	3
Encoder_B_Pin_1	4
Encoder_B_Pin_2	5
Encoder_B_Pin_3	6
Encoder_Z_Pin_1	7
Encoder_Z_Pin_2	8
Encoder_Z_Pin_3	9
GND (output for powering external devices)	10
+5VDC (output for powering external devices)	11

 For Encoder connection wiring options, see *Encoder* on the next page.

Electrical Specifications

Electrical Specifications

Specification	Value
Power Supply Voltage	+24 VDC to +48 VDC
Power Supply Current (Max.)*	Master 810: 9 A Master 2410: 25 A * Fully loaded with 1 A per sensor port.
Power Draw (Min.)	Master 810: 1.7 W Master 2410: 4.8 W
Encoder Signal Voltage	Differential (5 VDC, 12 VDC) Single-Ended (5 VDC, 12 VDC) For more information, see <i>Encoder</i> on the next page.
Digital Input Voltage Range	Single-Ended Active LOW: 0 to +0.8 VDC

Specification	Value
	Single-Ended Active HIGH: +3.3 to +24 VDC
	Differential LOW: 0.8 to -24 VDC
	Differential HIGH: +3.3 to +24 VDC
	For more information, see <i>Input</i> on page 651.
	If the input voltage is above 24 V, use an external resistor, using the following formula: $R = [(V_{in} - 1.2V) / 10mA] - 680$

 When using a Master hub, the chassis must be well grounded.

 The power supply must be isolated from AC ground. This means that AC ground and DC ground are not connected.

 24 VDC power supply is only supported if all connected sensors support an input voltage of 24 VDC.

 The Power Draw specification is based on a Master with no sensors attached. Every sensor has its own power requirements that need to be considered when calculating total system power requirements..

Encoder



Master 810 and 2410 support the following types of encoder signals: Single-Ended (5 VDC, 12 VDC) and Differential (5 VDC, 12 VDC).



For 5 VDC operation, pins 2 and 3 of each channel are used.

For 12 VDC operation, pins 1 and 3 of each channel are used.

 The 5-volt encoder input supports up to 12 volts for compatibility with earlier Master network controllers. However, we strongly recommend connecting 12-volt output encoders to the appropriate 12-volt input to attain maximum tolerance.

To determine how to wire a Master to an encoder, see the illustrations below.

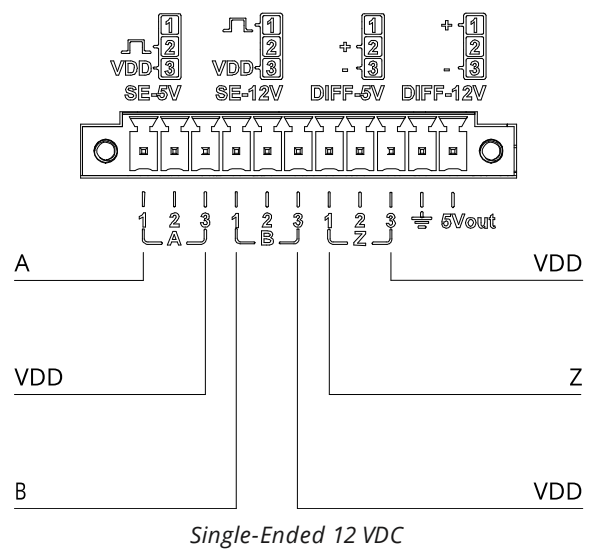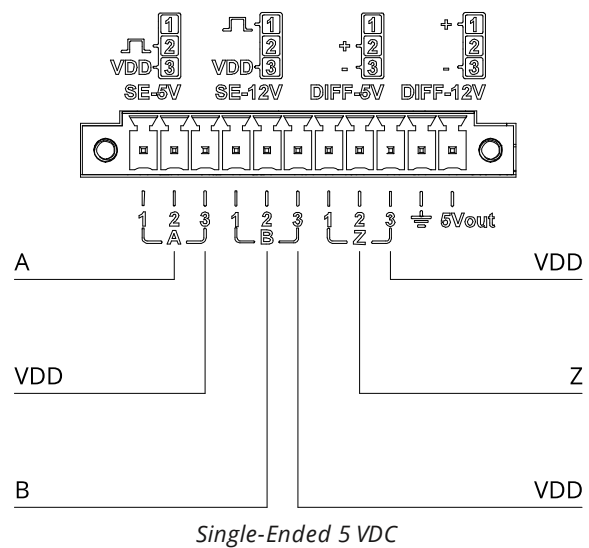

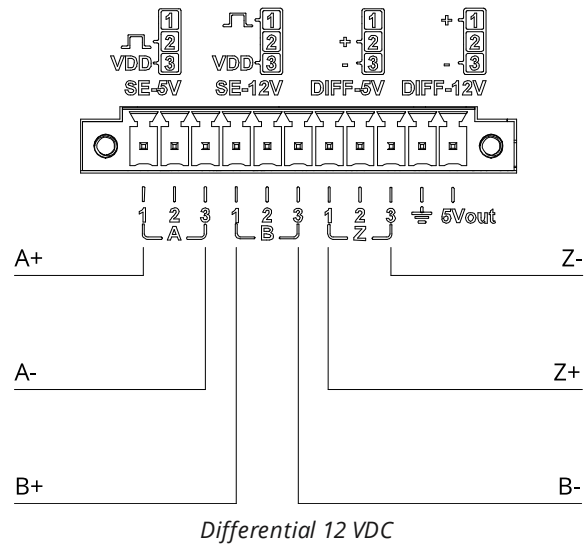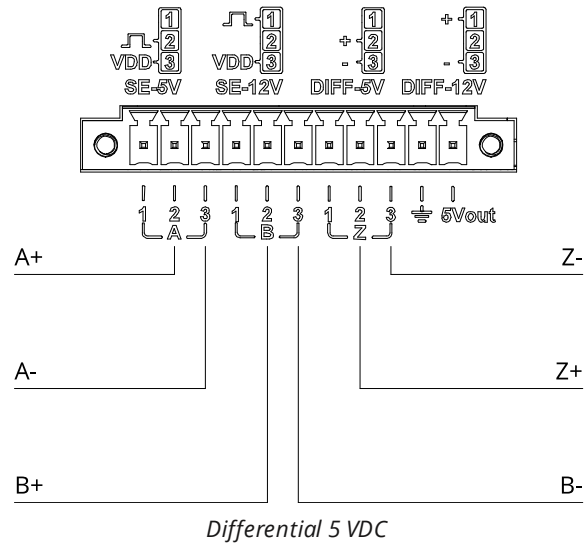




Input

Master 810 and 2410 support the following types of input: Differential, Single-Ended High, and Single-Ended Low.



Currently, Gocator only supports Input 0.

For digital input voltage ranges, see the table below.

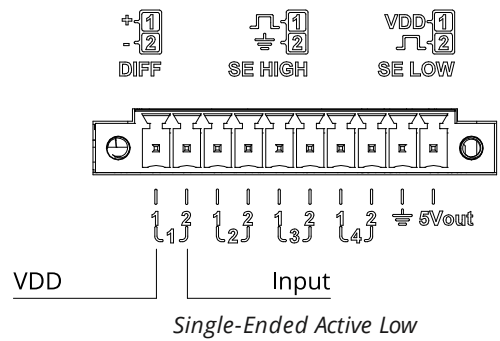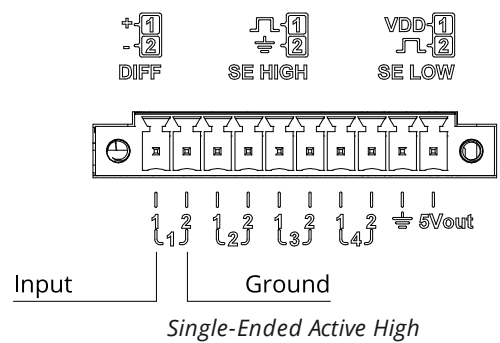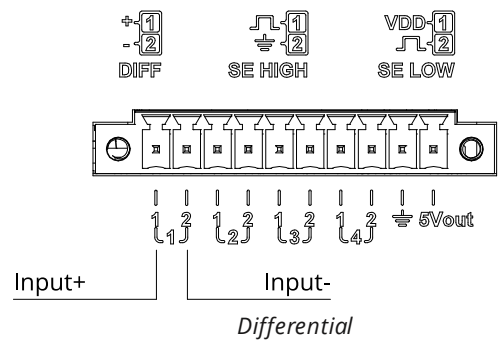


Digital Input Voltage Ranges


	Input Status	Min (VDC)	Max (VDC)
Single-ended Active High	Off	0	+0.8
	On	+3.3	+24
Single-ended Active Low	Off	(V _{DD} - 0.8)	V _{DD}
	On	0	(V _{DD} - 3.3)
Differential	Off	-24	+0.8
	On	+3.3	+24

Master 810 Dimensions

With 1U rack mount brackets:

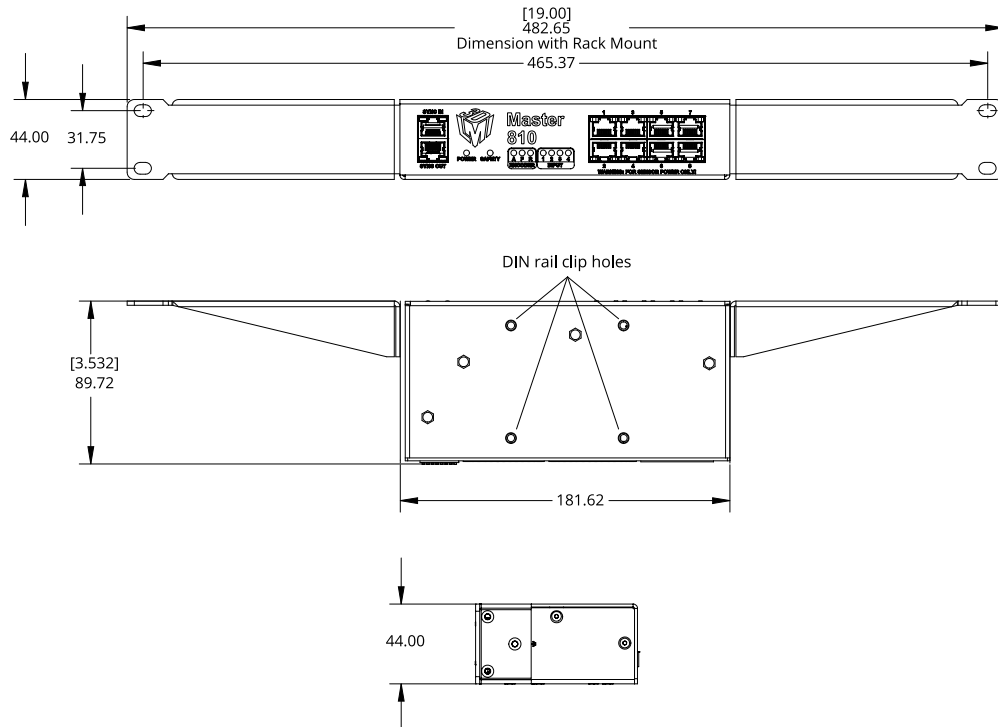

With DIN rail mount clips:

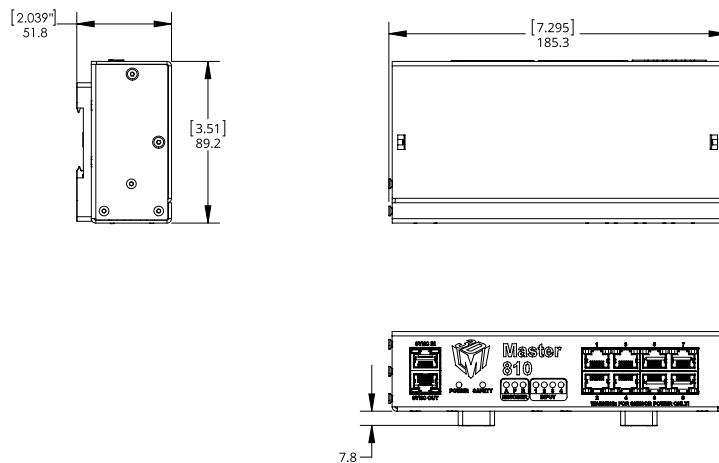


Older revisions of Master 810 and 2410 network controllers use a different configuration for the DIN rail clip holes.

For information on installing DIN rail clips, see *Installing DIN Rail Clips: Master 810 or 2410* on page 27.


The CAD model of the DIN rail clip is available at <https://www.winford.com/products/cad/dinm12-rc.igs>.

Master 2410 Dimensions

With 1U rack mount brackets:

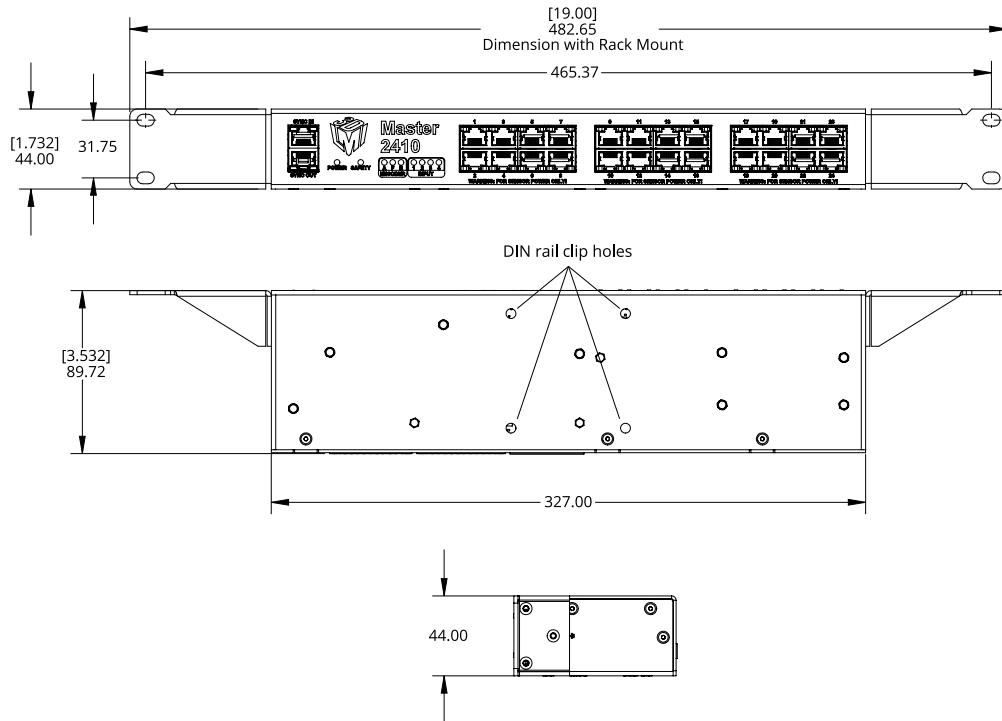

With DIN rail mount clips:

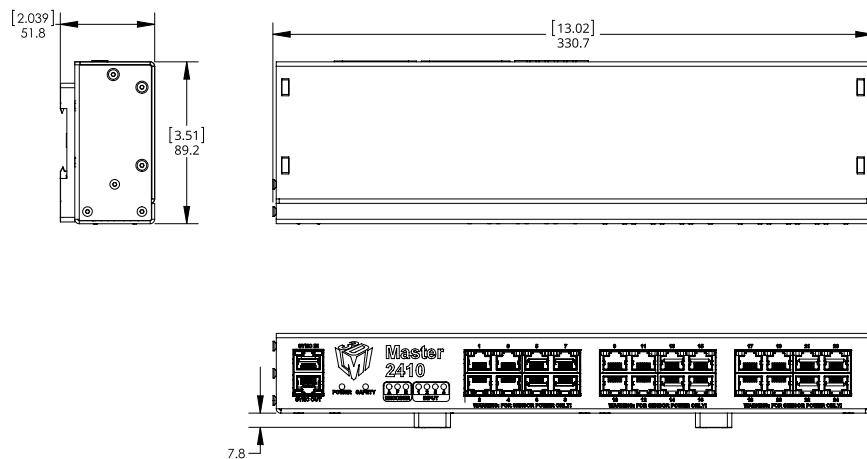

Older revisions of Master 810 and 2410 network controllers use a different configuration for the DIN rail clip holes.

For information on installing DIN rail clips, see *Installing DIN Rail Clips: Master 810 or 2410* on page 27.


The CAD model of the DIN rail clip is available at <https://www.winford.com/products/cad/dinm12-rc.igs>.

Master 1200/2400

Master network controllers provide sensor power and safety interlock, and broadcast system-wide synchronization information (i.e., time, encoder count, encoder index, and digital I/O states) to all devices on a sensor network.

 Safety interlock is not supported by Gocator snapshot sensors.

 The Phoenix connectors on Master 400/800/1200/2400 are not compatible with the connectors on Master 810/2410. For this reason, if you are switching models in your network, you must rewire the connections to the Master.

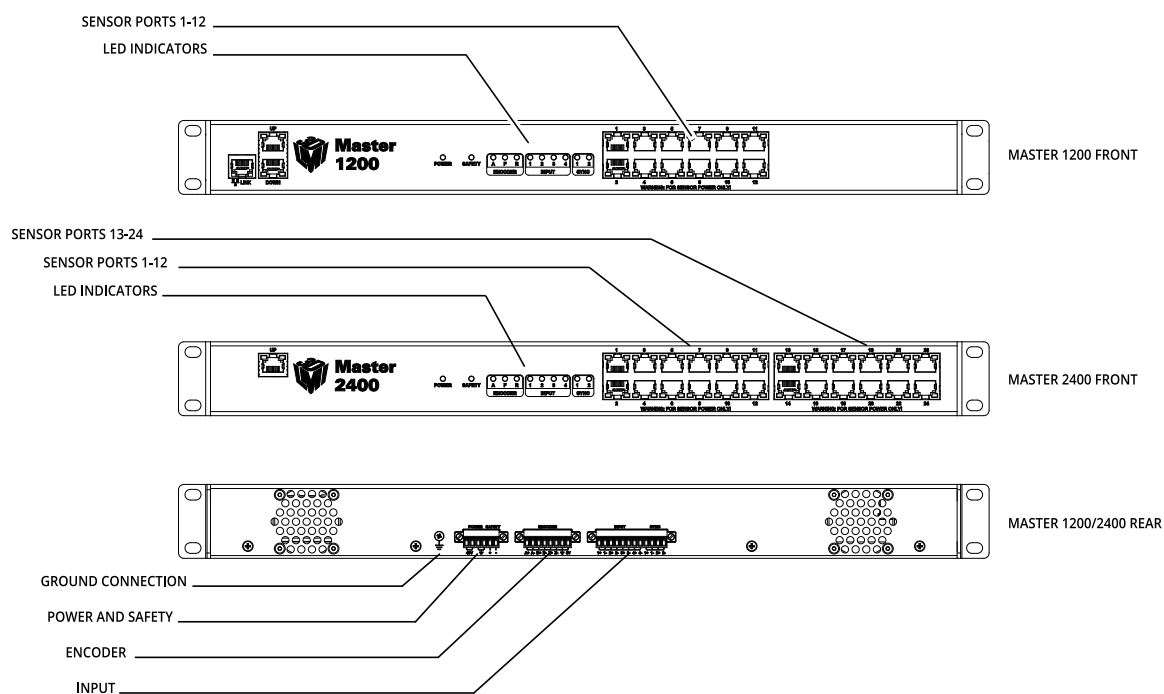

Power and Safety (6 pin connector)

Function	Pin
+48VDC	1
+48VDC	2
GND (24-48VDC)	3
GND (24-48VDC)	4
Reserved	5
Reserved	6

 The power supply must be isolated from AC ground. This means that AC ground and DC ground are not connected.

Input (12 pin connector)

Function	Pin
Input 1	1
Input 1 GND	2
Reserved	3
Reserved	4
Reserved	5
Reserved	6
Reserved	7
Reserved	8
Reserved	9
Reserved	10
Reserved	11
Reserved	12



The Input connector does not need to be wired up for proper operation.

Encoder (8 pin connector)

Function	Pin
Encoder_A+	1
Encoder_A-	2
Encoder_B+	3
Encoder_B-	4
Encoder_Z+	5
Encoder_Z-	6
GND	7
+5VDC	8

Master 1200/2400 Electrical Specifications

Electrical Specifications

Specification	Value
Power Supply Voltage	+48 VDC
Power Supply Current (Max.)	10 A
Power Draw (Min.)	5.76 W
Encoder Signal Voltage	Differential (5 VDC)
Digital Input Voltage Range	Logical LOW: 0 to +0.1 VDC Logical HIGH: +3.5 to +6.5 VDC




When using a Master hub, the chassis must be well grounded.

The power supply must be isolated from AC ground. This means that AC ground and DC ground are not connected.

The Power Draw specification is based on a Master with no sensors attached. Every sensor has its own power requirements that need to be considered when calculating total system power requirements..

Master 1200/2400 Dimensions

The dimensions of Master 1200 and Master 2400 are the same.

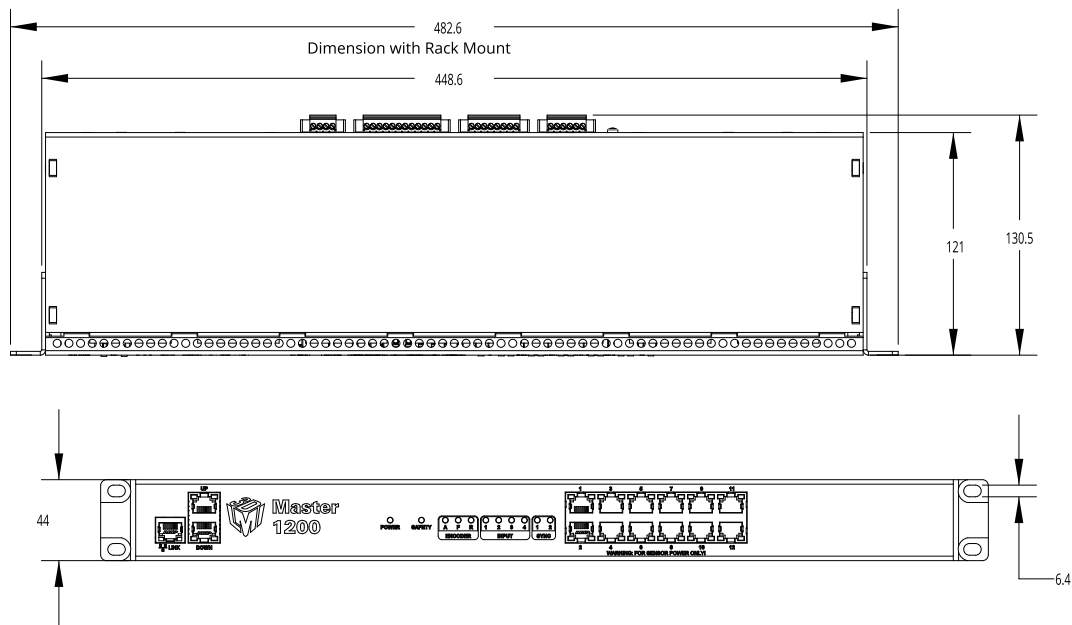

Accessories

Masters

Description	Part Number
Master 100 - for single sensor (development only)	30705
Master 810 - for networking up to 8 sensors	301114
Master 2410 - for networking up to 24 sensors	301115

Cordsets

Description	Part Number
1.2m I/O cordset, open wire end	30864-1.2m
2m I/O cordset, open wire end	30864-2m
5m I/O cordset, open wire end	30864-5m
10m I/O cordset, open wire end	30864-10m
15m I/O cordset, open wire end	30864-15m
20m I/O cordset, open wire end	30864-20m
25m I/O cordset, open wire end	30864-25m
2m Power and Ethernet cordset, 1x open wire end, 1x RJ45 end	30861-2m
5m Power and Ethernet cordset, 1x open wire end, 1x RJ45 end	30861-5m
10m Power and Ethernet cordset, 1x open wire end, 1x RJ45 end	30861-10m
15m Power and Ethernet cordset, 1x open wire end, 1x RJ45 end	30861-15m
20m Power and Ethernet cordset, 1x open wire end, 1x RJ45 end	30861-20m
25m Power and Ethernet cordset, 1x open wire end, 1x RJ45 end	30861-25m
1.2m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-1.2m
2m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-2m
5m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-5m
10m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-10m
15m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-15m
20m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-20m
25m Power and Ethernet to Master cordset, 2x RJ45 ends	30858-25m

Cordsets - 90-degree

Description	Part Number
2m I/O cordset, 90-deg, open wire end	30883-2m
5m I/O cordset, 90-deg, open wire end	30883-5m

Description	Part Number
10m I/O cordset, 90-deg, open wire end	30883-10m
15m I/O cordset, 90-deg, open wire end	30883-15m
20m I/O cordset, 90-deg, open wire end	30883-20m
25m I/O cordset, 90-deg, open wire end	30883-25m
2m Power and Ethernet cordset, 90-deg, 1x open wire end, 1x RJ45 end	30880-2m
5m Power and Ethernet cordset, 90-deg, 1x open wire end, 1x RJ45 end	30880-5m
10m Power and Ethernet cordset, 90-deg, 1x open wire end, 1x RJ45 end	30880-10m
15m Power and Ethernet cordset, 90-deg, 1x open wire end, 1x RJ45 end	30880-15m
20m Power and Ethernet cordset, 90-deg, 1x open wire end, 1x RJ45 end	30880-20m
25m Power and Ethernet cordset, 90-deg, 1x open wire end, 1x RJ45 end	30880-25m
2m Power and Ethernet to Master cordset, 90-deg, 2x RJ45 ends	30877-2m
5m Power and Ethernet to Master cordset, 90-deg, 2x RJ45 ends	30877-5m
10m Power and Ethernet to Master cordset, 90-deg, 2x RJ45 ends	30877-10m
15m Power and Ethernet to Master cordset, 90-deg, 2x RJ45 ends	30877-15m
20m Power and Ethernet to Master cordset, 90-deg, 2x RJ45 ends	30877-20m
25m Power and Ethernet to Master cordset, 90-deg, 2x RJ45 ends	30877-25m

Contact LMI for information on creating cordsets with custom length or connector orientation. The maximum cordset length is 60 m.

Return Policy

Return Policy

Before returning the product for repair (warranty or non-warranty) a Return Material Authorization (RMA) number must be obtained from LMI. Please call LMI to obtain this RMA number.

Carefully package the sensor in its original shipping materials (or equivalent) and ship the sensor prepaid to your designated LMI location. Please ensure that the RMA number is clearly written on the outside of the package. Inside the return shipment, include the address you wish the shipment returned to, the name, email and telephone number of a technical contact (should we need to discuss this repair), and details of the nature of the malfunction. For non-warranty repairs, a purchase order for the repair charges must accompany the returning sensor.

LMI Technologies Inc. is not responsible for damages to a sensor that are the result of improper packaging or damage during transit by the courier.

Software Licenses

Pico-C

Website:

<http://code.google.com/p/picoc/>

License:

picoc is published under the "New BSD License".

<http://www.opensource.org/licenses/bsd-license.php>

Copyright (c) 2009-2011, Zik Saleeba

All rights reserved.

Redistribution and use in source and binary forms, with or without modification, are permitted provided that the following conditions are met:

- * Redistributions of source code must retain the above copyright notice, this list of conditions and the following disclaimer.
- * Redistributions in binary form must reproduce the above copyright notice, this list of conditions and the following disclaimer in the documentation and/or other materials provided with the distribution.
- * Neither the name of the Zik Saleeba nor the names of its contributors may be used to endorse or promote products derived from this software without specific prior written permission.

THIS SOFTWARE IS PROVIDED BY THE COPYRIGHT HOLDERS AND CONTRIBUTORS "AS IS" AND ANY EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE DISCLAIMED. IN NO EVENT SHALL THE COPYRIGHT OWNER OR CONTRIBUTORS BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL, SPECIAL, EXEMPLARY, OR CONSEQUENTIAL DAMAGES (INCLUDING, BUT NOT LIMITED TO, PROCUREMENT OF SUBSTITUTE GOODS OR SERVICES; LOSS OF USE, DATA, OR PROFITS; OR BUSINESS INTERRUPTION) HOWEVER CAUSED AND ON ANY THEORY OF LIABILITY, WHETHER IN CONTRACT, STRICT LIABILITY, OR TORT (INCLUDING NEGLIGENCE OR OTHERWISE) ARISING IN ANY WAY OUT OF THE USE OF THIS SOFTWARE, EVEN IF ADVISED OF THE POSSIBILITY OF SUCH DAMAGE.

BlowFish

Website:

<http://www.chiark.greenend.org.uk/~sgtatham/putty/licence.html>

License:

PuTTY is copyright 1997-2011 Simon Tatham.

Portions copyright Robert de Bath, Joris van Rantwijk, Delian Delchev, Andreas Schultz, Jeroen Massar, Wez Furlong, Nicolas Barry, Justin Bradford, Ben Harris, Malcolm Smith, Ahmad Khalifa, Markus Kuhn, Colin Watson, and CORE SDI S.A.

Permission is hereby granted, free of charge, to any person obtaining a copy of this software and associated documentation files (the "Software"), to deal in the Software without restriction, including without limitation the rights to use, copy, modify, merge, publish, distribute, sublicense, and/or sell copies of the Software, and to permit persons to whom the Software is furnished to do so, subject to the following conditions:

The above copyright notice and this permission notice shall be included in all copies or substantial portions of the Software.

THE SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT. IN NO EVENT SHALL SIMON TATHAM BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF OR IN CONNECTION WITH THE SOFTWARE OR THE USE OR OTHER DEALINGS IN THE SOFTWARE.

CodeMirror

Website:

<http://codemirror.net>

License:

Copyright (C) 2011 by Marijn Haverbeke <marijnh@gmail.com>

Permission is hereby granted, free of charge, to any person obtaining a copy of this software and associated documentation files (the "Software"), to deal in the Software without restriction, including without limitation the rights to use, copy, modify, merge, publish, distribute, sublicense, and/or sell copies of the Software, and to permit persons to whom the Software is furnished to do so, subject to the following conditions:

The above copyright notice and this permission notice shall be included in all copies or substantial portions of the Software.

THE SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT. IN NO EVENT SHALL THE AUTHORS OR COPYRIGHT HOLDERS BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF OR IN CONNECTION WITH THE SOFTWARE OR THE USE OR OTHER DEALINGS IN THE SOFTWARE.

jQuery

Website:

<http://jquery.com/>

License:

Copyright (c) 2011 John Resig, <http://jquery.com/>

Permission is hereby granted, free of charge, to any person obtaining a copy of this software and associated documentation files (the "Software"), to deal in the Software without restriction, including without limitation the rights to use, copy, modify, merge, publish, distribute, sublicense, and/or sell copies of the Software, and to permit persons to whom the Software is furnished to do so, subject to the following conditions:

The above copyright notice and this permission notice shall be included in all copies or substantial portions of the Software.

THE SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT. IN NO EVENT SHALL THE AUTHORS OR COPYRIGHT HOLDERS BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF OR IN CONNECTION WITH THE SOFTWARE OR THE USE OR OTHER DEALINGS IN THE SOFTWARE.

Three.js

The MIT License

Copyright (c) 2010-2013 three.js authors

Permission is hereby granted, free of charge, to any person obtaining a copy of this software and associated documentation files (the "Software"), to deal in the Software without restriction, including without limitation the rights to use, copy, modify, merge, publish, distribute, sublicense, and/or sell

copies of the Software, and to permit persons to whom the Software is furnished to do so, subject to the following conditions:

The above copyright notice and this permission notice shall be included in all copies or substantial portions of the Software.

THE SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT. IN NO EVENT SHALL THE AUTHORS OR COPYRIGHT HOLDERS BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF OR IN CONNECTION WITH THE SOFTWARE OR THE USE OR OTHER DEALINGS IN THE SOFTWARE.

jQuery.CopyEvents

Website:

<http://brandonaaron.net>

License:

Copyright (c) 2006 Brandon Aaron

Licensed under the MIT License (<http://www.opensource.org/licenses/mit-license.php>)

jQuery.history

License:

jQuery history plugin

Copyright (c) 2006 Taku Sano (Mikage Sawatari)

Licensed under the MIT License (<http://www.opensource.org/licenses/mit-license.php>)

Modified by Lincoln Cooper to add Safari support and only call the callback once during initialization for msie when no initial hash supplied. API rewrite by Lauris Bukis-Haberkorns

jQuery.mouseWheel

Website:

<http://brandonaaron.net>

License:

Copyright (c) 2010 Brandon Aaron

Licensed under the MIT License (<http://www.opensource.org/licenses/mit-license.php>)

jQuery.scaling

Website:

<http://eric.garside.name>

License:

Scaling 1.0 - Scale any page element

Copyright (c) 2009 Eric Garside

Licensed under the MIT License (<http://www.opensource.org/licenses/mit-license.php>)

jQuery.scrollFollow

Website:

<http://kitchen.net-perspective.com/>

License:

Copyright (c) 2008 Net Perspective

Licensed under the MIT License (<http://www.opensource.org/licenses/mit-license.php>)

EtherNet/IP Communication Stack

Website:

sourceforge.net/projects/opener

License:

SOFTWARE DISTRIBUTION LICENSE FOR THE
ETHERNET/IP(TM) COMMUNICATION STACK (ADAPTED BSD STYLE LICENSE)

Copyright (c) 2009, Rockwell Automation, Inc. ALL RIGHTS RESERVED.

EtherNet/IP is a trademark of ODVA, Inc.

Support

For help with a component or product, please submit an online support ticket using LMI's [Help Desk](http://support.lmi3d.com/newticket.php) at <http://support.lmi3d.com/newticket.php>.

If you are unable to use the Help Desk or prefer to contact LMI by phone or email, use the contact information below.



Response times for phone or email support requests are longer than requests submitted through the Help Desk.

North America

Phone	+1 604 636 1011
Fax	+1 604 516 8368
Email	support@lmi3d.com

Europe

Phone	+31 45 850 7000
Fax	+31 45 574 2500
Email	support@lmi3d.com

Contact

Americas	EMEAR	ASIA PACIFIC
LMI Technologies (Head Office) Burnaby, Canada +1 604 636 1011	LMI Technologies GmbH Berlin, Germany +49 (0)3328 9360 0	LMI (Shanghai) Trading Co., Ltd. Shanghai, China +86 21 5441 0711

LMI Technologies has sales offices and distributors worldwide. All contact information is listed at lmi3d.com/contact/locations.