


Quick Start Guide



15223-1.0_MANUAL_Quickstart_HDI-109-Heat-Sink.pdf

Attach Heat Sink to HDI 109

- Recommended: Apply thermal paste (not supplied) to the back of the **HDI 109 Scanner**.
- Position the **Heat Sink** on the back of the scanner and tighten the four screws using the Allen key.

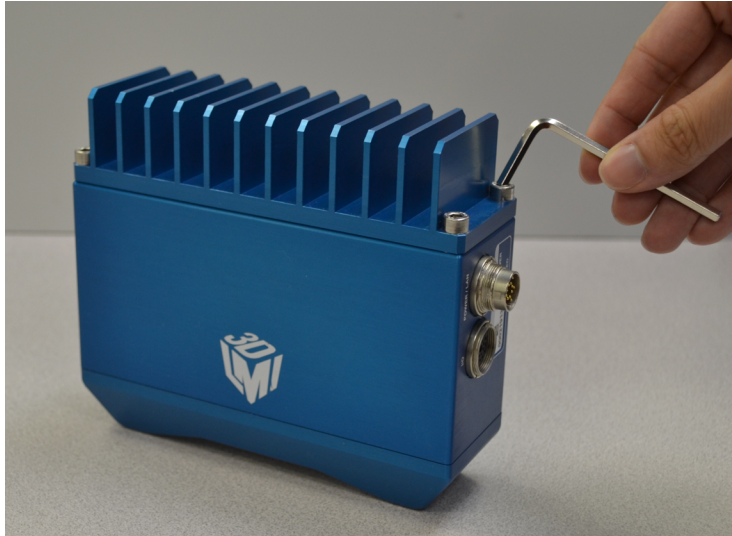

Customer Support

If you have any installation issues, please contact:

Worldwide

Email:

support@lmi3d.com

Web:

www.lmi3d.com

North America (Vancouver)

Phone:

+1 604 636 1011

China (Shanghai)

Phone:

+86 21 5441 0711

Germany (Berlin)

Phone:

+49 (0)3328 9360 0

Netherlands (Kerkrade)

Phone:

+31 45 850 7000

LMI Technologies, their partners, and resellers accept no liability for any damages (personal or to property) incurred as a result of improper use, incorrect assembly, failure to adhere to safety precautions, and/or mistreatment of this product (including its components).

